


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blackalls Park Public School (3966)
Region : Hunter/Central Coast
State Electorate : Lake Macquarie
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 14 - Jan - 2010
Reviewed By : Parsons Brinckerhoff : 13 - Jun - 2015

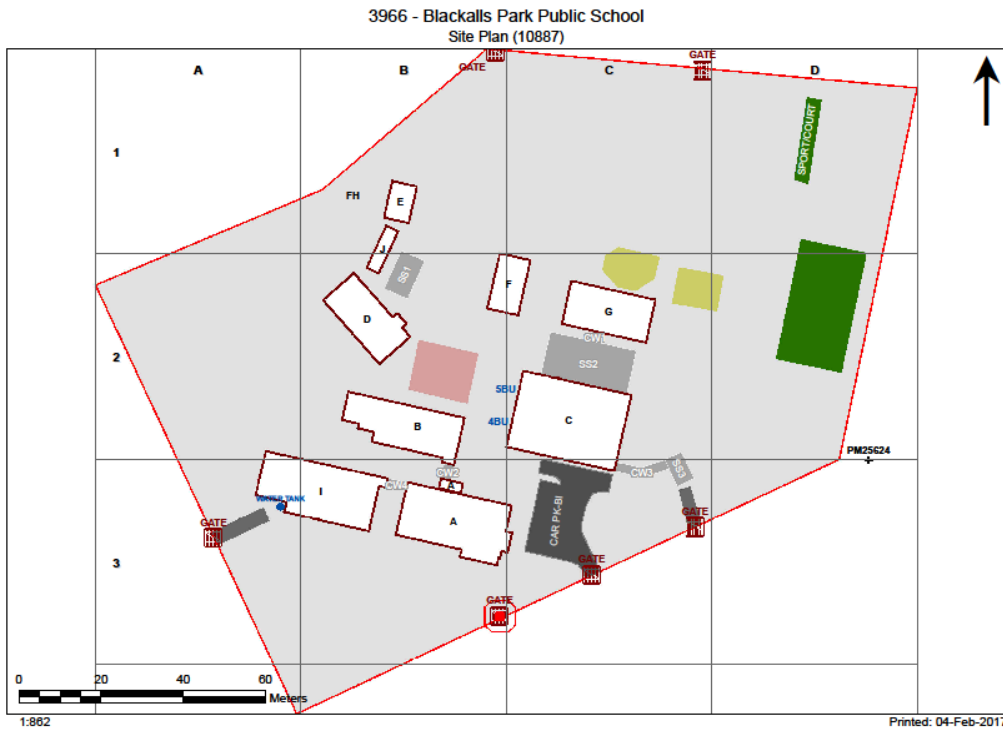

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Eaves Linings/S13					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/In-fill-panel/S17					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Gable Verge Lining/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Staff Room Annexe (12.37 m2)

Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Main Switch Board (3.13 m2)

No Asbestos

B00A - R0003 - External Movement (7.49 m2)

No Asbestos

B00A - R0004 - Staff Room Annexe (12.39 m2)

Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - External Movement (18.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00A - R0006 - Entry Vestibule (12.83 m2)

Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Movement (18.68 m2)

Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Clerical Office (12.37 m2)

Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Principal (18.52 m2)

Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Movement (12.18 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0011 - Sick Bay (8.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Cleaning Distributed Store (1.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0013 - Security Store (11.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Staff Room (64.62 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Staff Toilet (8.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)
B00A - R0016 - Staff Toilet (6.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)
B00A - R0017 - Movement (7.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0018 - External Movement (31.09 m2)						
No Asbestos						
B00A - R0019 - Interview (14.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - External Movement (15.59 m2)						
No Asbestos						
B00A - R0021 - Clerical Office (12.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0022 - Deputy Principal (12.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	3966/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0023 - Stairs (9.97 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1001 - External Movement (14.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)
B00A - R1002 - Reading Area (97.31 m2)						
No Asbestos						
B00A - R1003 - Reading Area (81.07 m2)						
No Asbestos						
B00A - R1004 - Library Office/Workroom (8.09 m2)						
No Asbestos						
B00A - R1005 - Seminar/Study (8.63 m2)						
No Asbestos						
B00A - R1006 - Library Office/Workroom (19.47 m2)						
No Asbestos						
B00A - R1007 - Communications Room (13.66 m2)						
No Asbestos						
B00A - R1008 - Library Office/Workroom (11.11 m2)						
No Asbestos						
B00A - R1009 - Toilets - Girls (3.54 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)
B00A - R1010 - Distribution Board (2.2 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R1011 - Movement (11.08 m2)						
No Asbestos						
B00A - R1012 - Toilets - Boys (3.15 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)
B00A - R1013 - Cleaning Distributed Store (1.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R1014 - External Movement (13.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)
B00A - R1015 - Stairs (9.95 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	35m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Eaves Linings/S13					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/In-fill-panel/S17					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Gable Verge Lining/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	AC Fragments/Debris	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3966/B00B/Ceiling Voids/S16					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Movement (71.74 m2)

No Asbestos

B00B - R0002 - Practical Activities - 1hb (18.69 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3966/B00B/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00B - R0003 - Home Base (51.16 m2)

No Asbestos

B00B - R0004 - Home Base (50.68 m2)

No Asbestos

B00B - R0005 - Practical Activities - 1hb (18.72 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3966/B00B/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00B - R0006 - Toilets - Boys (9.71 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)

B00B - R0007 - Toilets - Girls (9.68 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)

B00B - R0008 - Craft Store (4.7 m2)

No Asbestos

B00B - R0009 - Distribution Board (0.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0010 - Stairs (11.38 m2)

Recently Modified Space Requires Inspection

B00B - R1001 - Movement (71.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00B - R1002 - Practical Activities - 1hb (18.69 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3966/B00B/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00B - R1003 - Home Base (51.31 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R1004 - Home Base (51.46 m2)

No Asbestos

B00B - R1005 - Practical Activities - 1hb (18.79 m2)

Floor Coverings Res/Textile Vinyl Sheet

3966/B00B/R0005/Floor Coverings Res/Textile/S27

No Asbestos Detected

B00B - R1006 - Toilets - Boys (9.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

3966/B00B/R1006/Ceiling Structures/Linings/S19

Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	-------	--------------------	---------	--------------------

3966/B00A/R0016/Partition Walls (Cubicles)/S26

Chrysotile (white asbestos)

B00B - R1007 - Toilets - Girls (9.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

3966/B00B/R1007/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	-------	--------------------	---------	--------------------

3966/B00A/R0016/Partition Walls (Cubicles)/S26

Chrysotile (white asbestos)

B00B - R1008 - Stairs (16.92 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities/Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	10m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00C/Gable Verge Lining/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Movement (10.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)	

B00C - R0002 - Movement (126.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting	127m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00C/R0002/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00C - R0003 - Communal Space (164.29 m2)

No Asbestos

B00C - R0004 - Sports Store (12.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00C/R0006/Ceiling Structures/Linings/S22				Chrysotile (white asbestos)	

B00C - R0005 - Raised Platform (37.01 m2)

No Asbestos

B00C - R0006 - Music Store (8.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00C/R0006/Ceiling Structures/Linings/S22				Chrysotile (white asbestos)	

B00C - R0007 - Toilets - Girls (8.92 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26				Chrysotile (white asbestos)	

B00C - R0008 - Distribution Board (0.45 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3966/B00C/R0008/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00C/R0008/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	

B00C - R0009 - Movement (29.91 m2)

No Asbestos

B00C - R0010 - General Storeroom (6.49 m2)

No Asbestos

B00C - R0012 - Canteen Office/Store (4.87 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2				No Asbestos Detected	

B00C - R0013 - Canteen Office/Store (5.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2				No Asbestos Detected	

B00C - R0014 - Canteen (27.39 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00C - R0015 - Toilets - Boys (9.16 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0016/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)
B00C - R0016 - Cleaning Supplies (9.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00C - R0017 - Cleaning Distributed Store (3.48 m2)						
No Asbestos						
B00C - R0018 - Toilets-Unisex (1.71 m2)						
Recently Modified Space	Requires Inspection					
B00C - R0019 - Toilet - Lobby (1.61 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1953 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00D/Eaves Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Movement (4.49 m2)

No Asbestos

B00D - R0002 - Practical Activities - 1hb (43.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)	

B00D - R0003 - Home Base (66.85 m2)

No Asbestos

B00D - R0004 - Home Base Store (4.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2				No Asbestos Detected	

B00D - R0005 - Practical Activities - 1hb (17.82 m2)

No Asbestos

B00D - R0006 - Home Base Store (4.39 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2				No Asbestos Detected	

B00D - R0007 - Home Base (53.33 m2)

No Asbestos

B00D - R0008 - Toilets - Boys/Girls (2.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					
	3966/B00D/R0008/Wall Linings Internal/S3				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities/Administration - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00E - R0001 - P.E. Store (24.17 m2)

No Asbestos

B00E - R0002 - General Assistant/Bulk Store (24.05 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Eaves Linings/S13					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Gable Verge Lining/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Movement (23.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00F - R0002 - Cleaning Distributed Store (2.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00F - R0003 - Toilets - Girls (32.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00F - R0004 - Garden Store (2.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

Incinerette	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	High Priority (6-8)
	Assumed Asbestos - Sealed Unit - Unable to access					

B00F - R0005 - Toilets - Boys (27.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00F - R0006 - Toilets - Boys (1.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/R0005/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Eaves Linings/S13					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00A/In-fill-panel/S17					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/Gable Verge Lining/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00G - R0001 - Home Base Store (6.59 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00G - R0002 - General Storeroom (7.23 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00G - R0003 - Distribution Board (0.92 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard - Metal cased unit -
Infill panel above door	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/R0003/Infill panel above door/S25					Chrysotile (white asbestos)

B00G - R0004 - Movement (12.69 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00G - R0005 - Movement (37.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/R0005/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)

B00G - R0006 - Home Base (57.22 m2)

No Asbestos

B00G - R0007 - Home Base (57.23 m2)

No Asbestos

B00G - R0008 - Home Base Store (6.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3966/B00G/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - R0009 - Movement (8.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3966/B00A/R0009/Floor Coverings Res/Textile/S2					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00I - General Learning/Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00I - R0001 - External Movement (81.27 m2)**

No Asbestos

B00I - R0002 - Home Base (66.56 m2)

No Asbestos

B00I - R0003 - Home Base Store (6.91 m2)

No Asbestos

B00I - R0004 - Practical Activities - 2hb (38.05 m2)

No Asbestos

B00I - R0005 - Access Shower/Toilet/Change (17.35 m2)

No Asbestos

B00I - R0006 - Other (0.61 m2)

No Asbestos

B00I - R0007 - Laundry - S (5.32 m2)

No Asbestos

B00I - R0008 - Access Shower/Toilet (5.86 m2)

No Asbestos

B00I - R0009 - Home Base (65.81 m2)

No Asbestos

B00I - R0010 - Home Base Store (6.03 m2)

No Asbestos

B00I - R0011 - No Access (0.51 m2)

No Asbestos

B00I - R0012 - Cleaning Distributed Store (8.35 m2)

No Asbestos

B00I - R0013 - Special Programs Room (32.21 m2)

No Asbestos

B00I - R0014 - Special Programs Store (6.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Sports Store (9.5 m2)

No Asbestos

B00J - R0002 - General Assistant/Bulk Store (11.78 m2)

No Asbestos

B00J - R0003 - Garden Store (9.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017