


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Beacon Hill Public School (3971)
Region : Northern Sydney
State Electorate : Wakehurst
Local Government Area : Warringah

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 10 - Apr - 2015

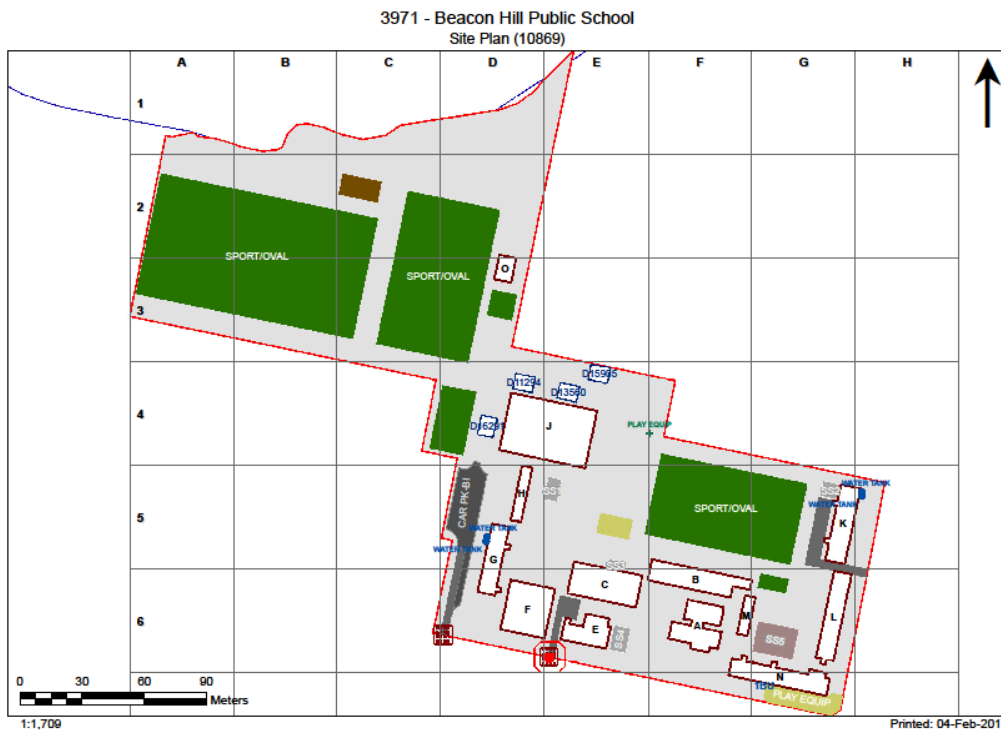

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1958 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3971/B00A/Gable Verge Lining/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Principal (16.02 m2)

No Asbestos

B00A - R0002 - Security Store (10.38 m2)

No Asbestos

B00A - R0003 - Main Switch Board (2.58 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00A/R0003/Floor Coverings Res/Textile/S14			Chrysotile (white asbestos)		

B00A - R0006 - Disabled Toilet (4.72 m2)

No Asbestos

B00A - R0007 - Staff Toilet (4.72 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					
	3971/B00A/R0007/Partition Walls (Cubicles)/S13			No Asbestos Detected		

B00A - R0011 - Duplicating Workroom (16.77 m2)

No Asbestos

B00A - R0013 - Movement (20.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0014 - Interview (17.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00A/R0014/Floor Coverings Res/Textile/S26			Chrysotile (white asbestos)		

B00A - R0015 - Movement (45.07 m2)

No Asbestos

B00A - R0016 - Sick Bay (10.65 m2)

No Asbestos

B00A - R0017 - Interview (12.04 m2)

No Asbestos

B00A - R0018 - Interview (12.35 m2)

No Asbestos

B00A - R0019 - Interview (7.13 m2)

No Asbestos

B00A - R0020 - Movement (17.85 m2)

No Asbestos

B00A - R0021 - Clerical Office (42.45 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3971/B00A/R0003/Floor Coverings Res/Textile/S14	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0022 - Staff Room (61.16 m2)

No Asbestos

B00A - R0023 - General Storeroom (13.68 m2)

No Asbestos

B00A - R0024 - Duplicating Workroom (24.8 m2)

No Asbestos

B00A - R0025 - Movement (16.4 m2)

No Asbestos

B00A - R0026 - Access Shower/Toilet (5.01 m2)

No Asbestos

B00A - R0027 - Toilet - Lobby (2.62 m2)

No Asbestos

B00A - R0028 - Staff Toilet (1.9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3971/B00N/Eaves Linings/S1	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - General Storeroom (5.98 m2)**

No Asbestos

B00B - R0006 - General Storeroom (11.2 m2)

Decorative Coating	Vermiculite 3971/B00B/R0021/Decorative Coating/S25					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0007 - Home Base (57.02 m2)

Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0008 - Home Base Store (5.81 m2)

Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0009 - Personal Effects Storage (15.83 m2)

Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0010 - Home Base Store (5.81 m2)

Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0011 - Home Base (57.57 m2)

Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0012 - Garden Store (8.51 m2)

No Asbestos

B00B - R0013 - Garden Store (9.9 m2)

No Asbestos

B00B - R0014 - Movement (138.23 m2)

Wall Linings Internal	Flat AC Sheeting 3971/B00B/R1013/Wall Linings Internal/S6	10m2	South facing, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0015 - Stairs (12.39 m2)

Ceiling Structures/Linings	Vermiculite 3971/B00B/R0014/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0016 - General Storeroom (13.13 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0017 - Canteen Office/Store (4.74 m2)						
No Asbestos						
B00B - R0018 - Canteen (37.82 m2)						
No Asbestos						
B00B - R0019 - Staff Toilet (2.17 m2)						
No Asbestos						
B00B - R0020 - Canteen Office/Store (6.27 m2)						
No Asbestos						
B00B - R0021 - General Storeroom (5.92 m2)						
Decorative Coating	Vermiculite					
	3971/B00B/R0021/Decorative Coating/S25					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0022 - Stairs (10.15 m2)						
No Asbestos						
B00B - R1001 - Cleaning Distributed Store (7.83 m2)						
No Asbestos						
B00B - R1002 - Home Base (57.32 m2)						
No Asbestos						
B00B - R1003 - Home Base Store (5.71 m2)						
No Asbestos						
B00B - R1004 - Personal Effects Storage (15.92 m2)						
No Asbestos						
B00B - R1005 - Home Base Store (5.91 m2)						
No Asbestos						
B00B - R1006 - Home Base (57.24 m2)						
No Asbestos						
B00B - R1007 - Home Base (57.24 m2)						
No Asbestos						
B00B - R1008 - Home Base Store (5.81 m2)						
No Asbestos						
B00B - R1009 - Distribution Board (0.8 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1010 - Personal Effects Storage (14.81 m2)						
No Asbestos						
B00B - R1011 - Home Base Store (5.78 m2)						
No Asbestos						
B00B - R1012 - Home Base (57.24 m2)						
No Asbestos						
B00B - R1013 - Movement (89.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00B/R1013/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	South facing, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00B/R1013/Wall Linings Internal/S6					Chrysotile (white asbestos)
B00B - R1014 - Stairs (16.61 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00B/R1013/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1015 - Stairs (22.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00B/R1013/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Reading Area (225.09 m2)

No Asbestos

B00C - R0002 - K.L.A. Store (12.9 m2)

No Asbestos

B00C - R0003 - Library Office/Workroom (24.51 m2)

No Asbestos

B00C - R0004 - Distribution Board (1.73 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00C/R0004/Wall Linings Internal/S10					Chrysotile (white asbestos)	

B00C - R0005 - Movement (2.63 m2)

No Asbestos

B00C - R0006 - Toilets - Boys/Girls (6.93 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00C/R0007/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

B00C - R0007 - Toilets - Boys/Girls (6.43 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00C/R0007/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

B00C - R0008 - Special Programs Room (43.85 m2)

No Asbestos

B00C - R0009 - Special Programs Store (5.1 m2)

No Asbestos

B00C - R0010 - Plant (1.77 m2)

No Asbestos

B00C - R0011 - Movement (161.56 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1969 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3971/B00E/Gable Verge Lining/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Movement (5.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0002 - Movement (8.03 m2)

No Asbestos

B00E - R0003 - General Storeroom (10.75 m2)

No Asbestos

B00E - R0005 - Toilets - Boys/Girls (1.44 m2)

No Asbestos

B00E - R0008 - Movement (5.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0009 - Movement (3.17 m2)

No Asbestos

B00E - R0010 - Movement (67.8 m2)

No Asbestos

B00E - R0011 - Home Base (79.32 m2)

No Asbestos

B00E - R0012 - Home Base (56.79 m2)

No Asbestos

B00E - R0013 - Personal Effects Storage (4.95 m2)

No Asbestos

B00E - R0014 - Home Base Store (5.64 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1980 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00F - R0001 - Home Base (92.31 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0002 - Home Base Store (6.71 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00F/R0002/Floor Coverings Res/Textile/S27					Chrysotile (white asbestos)
Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0003 - Movement (9.56 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0004 - Cleaning Distributed Store (3.81 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00F/R0002/Floor Coverings Res/Textile/S27					Chrysotile (white asbestos)

B00F - R0005 - Toilets - Boys/Girls (2.95 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0006 - Toilets - Girls (15.78 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0007 - Toilets - Boys (17.91 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0008 - Personal Effects Storage (8.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00F/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Decorative Coating	Vermiculite					Limited Samples Taken
	3971/B00F/R0007/Decorative Coating/S24					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0009 - Distribution Board (0.7 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00F/R0009/Wall Linings Internal/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00F/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00F/R0009/Ceiling Structures/Linings/S28				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0010 - Home Base Store (6.6 m2)

Decorative Coating	Vermiculite	3971/B00F/R0007/Decorative Coating/S24		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00F/R0002/Floor Coverings Res/Textile/S27				Chrysotile (white asbestos)		

B00F - R0011 - Home Base (94.85 m2)

Decorative Coating	Vermiculite	3971/B00F/R0007/Decorative Coating/S24		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00F - R0012 - Toilets - Boys/Girls (3.48 m2)

No Asbestos

B00F - R0013 - Toilets - Boys/Girls (3.5 m2)

No Asbestos

B00F - R0014 - Home Base Store (5.66 m2)

Decorative Coating	Vermiculite	3971/B00F/R0007/Decorative Coating/S24		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00F - R0015 - Personal Effects Storage (7.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00F/R0009/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		

Decorative Coating	Vermiculite	3971/B00F/R0007/Decorative Coating/S24		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00F - R0016 - Home Base (92.83 m2)

Decorative Coating	Vermiculite	3971/B00F/R0007/Decorative Coating/S24		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00F - R0017 - Movement (98.31 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3971/B00G/Gable Verge Lining/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - General Storeroom (10.38 m2)

No Asbestos

B00G - R0002 - Toilets - Boys/Girls (3.41 m2)

Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00L/R0004/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0003 - Personal Effects Storage (10.52 m2)

No Asbestos

B00G - R0004 - Movement (3.06 m2)

No Asbestos

B00G - R0005 - Movement (4.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0006 - Home Base (85.64 m2)

No Asbestos

B00G - R0007 - Home Base (56.88 m2)

No Asbestos

B00G - R0008 - Home Base Store (3.83 m2)

No Asbestos

B00G - R0009 - Personal Effects Storage (6.19 m2)

No Asbestos

B00G - R0010 - Personal Effects Storage (6.23 m2)

No Asbestos

B00G - R0011 - Movement (6.28 m2)

No Asbestos

B00G - R0012 - Movement (4.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0013 - Home Base Store (3.85 m2)

No Asbestos

B00G - R0014 - Home Base (57.35 m2)

No Asbestos

B00G - R9001 - Staff Room Annexe (11.5 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00L/R9005/Ceiling Structures/Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00G - R9002 - Withdrawal Space - 2hb (30.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00L/R9005/Ceiling Structures/Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00G - R9003 - Staff Room Annexe (13.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00L/R9005/Ceiling Structures/Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00G - R9004 - P.E. Store (53.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00G/R9004/Ceiling Structures/Linings/S29				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00G - R9005 - Movement (4.03 m2)						
No Asbestos						
B00G - R9006 - General Storeroom (62.44 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Toilets - Boys (37.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00H/R0005/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00H - R0002 - Drinking Facilities (17.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00H/R0005/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00H - R0003 - General Storeroom (6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00H/R0005/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00H - R0004 - General Storeroom (5.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00H/R0005/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00H - R0005 - Drinking Facilities (16.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00H/R0005/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00H - R0006 - Toilets - Girls (33.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00H/R0005/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Communal Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - M0001 - Movement (5.52 m2)**

No Asbestos

B00J - M0002 - Movement (5.48 m2)

No Asbestos

B00J - R0001 - P.E. Store (50.59 m2)

No Asbestos

B00J - R0002 - Disabled Toilet (4.39 m2)

No Asbestos

B00J - R0003 - Distribution Board (3.13 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0004 - Toilets - Boys (52.04 m2)

No Asbestos

B00J - R0005 - Movement (15.39 m2)

No Asbestos

B00J - R0006 - Movement (44.94 m2)

No Asbestos

B00J - R0007 - Raised Platform (66.22 m2)

No Asbestos

B00J - R0008 - Movement (5.76 m2)

No Asbestos

B00J - R0009 - Movement (16.5 m2)

No Asbestos

B00J - R0010 - Toilets - Girls (52.3 m2)

No Asbestos

B00J - R0011 - Cleaning Distributed Store (3.49 m2)

No Asbestos

B00J - R0012 - Movement (15.39 m2)

No Asbestos

B00J - R0013 - Staff Kitchen (15.89 m2)

No Asbestos

B00J - R0014 - Staff Shower/Change (5.88 m2)

No Asbestos

B00J - R0015 - Staff Room Annexe (14.6 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00J - R0016 - Sports Store (16.66 m2)**

No Asbestos

B00J - R0017 - Communal Space (485.04 m2)

No Asbestos

B00J - R0018 - Movement (254.49 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3971/B00K/Gable Verge Lining/S20			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Home Base (65.08 m2)

No Asbestos

B00K - R0002 - Home Base Store (4.81 m2)

No Asbestos

B00K - R0003 - Personal Effects Storage (14.35 m2)

Electrical Backing Board	Resinous Board	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard - Unable to sample						

B00K - R0004 - Movement (6.76 m2)

No Asbestos

B00K - R0005 - Movement (4.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0006 - Home Base Store (4.81 m2)

No Asbestos

B00K - R0007 - Home Base (64.64 m2)

No Asbestos

B00K - R0008 - Home Base (64.55 m2)

No Asbestos

B00K - R0009 - Home Base Store (4.78 m2)

No Asbestos

B00K - R0010 - Personal Effects Storage (14.35 m2)

No Asbestos

B00K - R0011 - Movement (6.76 m2)

No Asbestos

B00K - R0012 - Movement (4.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0013 - Home Base Store (4.77 m2)

No Asbestos

B00K - R0014 - Home Base (64.82 m2)

No Asbestos

B00K - R9001 - Craft Store (77.44 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R9002 - Special Programs Room (57.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00K/R9002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00K - R9003 - Kiln Room (4.1 m2)						
No Asbestos						
B00K - R9004 - Special Programs Room (61.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3971/B00K/R9002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00L - General Learning - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3971/B00L/Gable Verge Lining/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00L - R0001 - Movement (4.56 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0002 - Out Of School Hours Care Centre (4.44 m2)

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00L/R0004/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0003 - Out Of School Hours Care Centre (4.55 m2)

No Asbestos

B00L - R0004 - Out Of School Hours Care Centre (4.33 m2)

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00L/R0004/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0005 - Out Of School Hours Care Centre (0.39 m2)

No Asbestos

B00L - R0006 - Out Of School Hours Care Centre (28.09 m2)

No Asbestos

B00L - R0007 - Out Of School Hours Care Centre (56.66 m2)

No Asbestos

B00L - R0008 - Out Of School Hours Care Centre (4.55 m2)

No Asbestos

B00L - R0009 - Out Of School Hours Care Centre (9.61 m2)

Splashback	Compressed AC Sheet	1Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00L/R0016/Splashback/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Backing Board	Resinous Board	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard - Unable to sample					

B00L - R0010 - Movement (4.84 m2)

No Asbestos

B00L - R0011 - Movement (1.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0012 - Home Base Store (4.55 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00L - R0013 - Special Programs Room (57.14 m2)

No Asbestos

B00L - R0014 - Home Base (56.66 m2)

No Asbestos

B00L - R0015 - Home Base Store (4.55 m2)

No Asbestos

B00L - R0016 - Personal Effects Storage (9.72 m2)

Splashback Compressed AC Sheet 1Unit(s) West facing Good Condition (1) Low (1) Low Priority (2-3)

3971/B00L/R0016/Splashback/S3 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00L - R0017 - Movement (4.88 m2)

No Asbestos

B00L - R0018 - Movement (1.49 m2)

Ceiling Structures/Linings Flat AC Sheeting 2m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

3971/B00N/R0013/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00L - R0019 - Home Base Store (4.55 m2)

No Asbestos

B00L - R0020 - Home Base (57.06 m2)

No Asbestos

B00L - R9001 - General Assistant/Bulk Store (54.69 m2)

No Asbestos

B00L - R9002 - Canteen Office/Store (2.78 m2)

Ceiling Structures/Linings Flat AC Sheeting 3m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

3971/B00L/R9005/Ceiling Structures/Linings/S15 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00L - R9003 - Canteen Office/Store (2.96 m2)

Ceiling Structures/Linings Flat AC Sheeting 3m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

3971/B00L/R9005/Ceiling Structures/Linings/S15 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00L - R9004 - Canteen (19.85 m2)

Ceiling Structures/Linings Flat AC Sheeting 20m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

3971/B00L/R9005/Ceiling Structures/Linings/S15 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00L - R9005 - Movement (26.04 m2)

Ceiling Structures/Linings Flat AC Sheeting 27m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

3971/B00L/R9005/Ceiling Structures/Linings/S15 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00M/Eaves Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00M - R0001 - Drinking Facilities (7.77 m2)

No Asbestos

B00M - R0002 - Toilets - Boys (32.41 m2)

No Asbestos

B00M - R0003 - Toilets - Girls (29.37 m2)

No Asbestos

B00M - R0004 - No Access (2.59 m2)

No Asbestos

B00M - R0005 - Drinking Facilities (7.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	35m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00N - R0001 - General Storeroom (6.56 m2)

No Asbestos

B00N - R0008 - Movement (5.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0009 - Home Base (56.75 m2)

No Asbestos

B00N - R0010 - Home Base Store (6.67 m2)

No Asbestos

B00N - R0011 - Personal Effects Storage (7.58 m2)

No Asbestos

B00N - R0012 - Movement (5.91 m2)

No Asbestos

B00N - R0013 - Movement (5.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0020 - Movement (4.83 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3971/B00N/R0013/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0022 - Child Care Centre (57.21 m2)

No Asbestos

B00N - R0023 - Child Care Centre (13.94 m2)

No Asbestos

B00N - R0024 - Child Care Centre (11.28 m2)

No Asbestos

B00N - R0025 - Child Care Centre (1.17 m2)

No Asbestos

B00N - R0026 - Child Care Centre (2.24 m2)

No Asbestos

B00N - R0027 - Child Care Centre (12.99 m2)

No Asbestos

B00N - R0028 - Child Care Centre (87.82 m2)

No Asbestos

B00N - R0029 - Child Care Centre (12.32 m2)

No Asbestos

B00N - R0030 - Child Care Centre (1.94 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00N - R0031 - Child Care Centre (3.39 m2)

No Asbestos

B00N - R0032 - Child Care Centre (3.09 m2)

No Asbestos

B00N - R0033 - Child Care Centre (10.02 m2)

No Asbestos

B00N - R0034 - Home Base (69.59 m2)

No Asbestos

B00N - R0035 - Movement (8.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities/Other - 2010 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B000 - R0001 - Toilets - Boys (29.92 m2)

No Asbestos

B000 - R0002 - Toilets - Girls (29.89 m2)

No Asbestos

B000 - R0003 - Canteen (12.15 m2)

No Asbestos

B000 - R0004 - External Movement (17.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11294 - Learning Unit - Standard With P.A.A. : Placement Date - 8/11/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D13560 - Learning Unit - Standard/Withdrawal : Placement Date - 10/05/2010

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D15905 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 25/02/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D16291 - Learning Unit - Standard With P.A.A. : Placement Date - 21/01/2013

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3971_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017