


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bellambi Public School (3979)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : AECOM : 18 - Jun - 2015

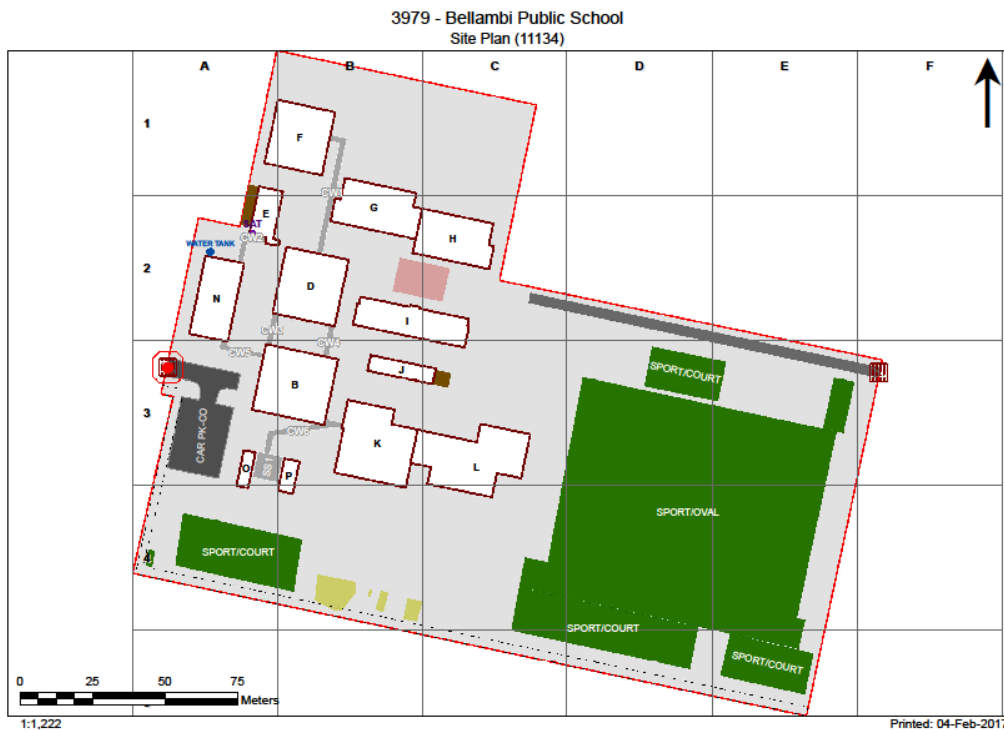

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1981 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible - due to raked ceiling.					

Interior

B00B - R0001 - Reading Area (268.41 m2)

No Asbestos

B00B - R0002 - K.L.A. Store (14.21 m2)

No Asbestos

B00B - R0003 - K.L.A. Store (14.29 m2)

No Asbestos

B00B - R0004 - General Assistant/Bulk Store (12.67 m2)

No Asbestos

B00B - R0005 - Library Office/Workroom (8.4 m2)

No Asbestos

B00B - R0006 - Library Office/Workroom (25.32 m2)

No Asbestos

B00B - R0007 - Distribution Board (1.73 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	West, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	----------------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00B - R0008 - Toilets - Girls (3.99 m2)

No Asbestos

B00B - R0009 - Movement (11.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00B - R0010 - Toilets - Boys (3.57 m2)

No Asbestos

B00B - R0011 - Cleaning Distributed Store (2.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00B - R0012 - Movement (150.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	151m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00B/R0012/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

In-fill-panel	Flat AC Sheeting	80m	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00B/R0012/In-fill-panel/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0013 - General Assistant/Bulk Store (25.32 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/Staff Facilities - 1981 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00D - R0001 - Principal (21.77 m2)**

No Asbestos

B00D - R0002 - Interview (13.04 m2)

No Asbestos

B00D - R0003 - Movement (10.83 m2)

No Asbestos

B00D - R0004 - Security Store (16.23 m2)

Floor Coverings Res/Textile Vinyl Tiles
3979/B00B/R0009/Floor Coverings Res/Textile/S6

No Asbestos Detected

B00D - R0005 - Clerical Office (13.07 m2)

No Asbestos

B00D - R0006 - Entry Vestibule (22.72 m2)

No Asbestos

B00D - R0007 - Interview (13.03 m2)

No Asbestos

B00D - R0008 - Other-Vacant (13.07 m2)

No Asbestos

B00D - R0009 - Interview (13.04 m2)

No Asbestos

B00D - R0010 - Movement (9.83 m2)

No Asbestos

B00D - R0011 - Cleaning Distributed Store (3.08 m2)

No Asbestos

B00D - R0012 - Staff Toilet (3.19 m2)

No Asbestos

B00D - R0013 - Staff Toilet (1.98 m2)

No Asbestos

B00D - R0014 - Staff Room (93.41 m2)

Floor Coverings Res/Textile Vinyl Tiles
3979/B00B/R0009/Floor Coverings Res/Textile/S6

No Asbestos Detected

B00D - R0015 - Clerical Office/Workroom (36.67 m2)

Floor Coverings Res/Textile Vinyl Tiles
3979/B00B/R0009/Floor Coverings Res/Textile/S6

No Asbestos Detected

B00D - R0016 - Sick Bay (20.06 m2)

No Asbestos

B00D - R0017 - Sick Bay - Shower/Toilet (3.17 m2)

No Asbestos

B00D - R0018 - Uniform Shop (7.15 m2)

No Asbestos

B00D - R0019 - Movement (139.01 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	140m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00D/R0019/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0020 - Main Switch Board (8.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Communal Facilities - 1981 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Flat AC Sheeting	22m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Underfloor Voids	Non Accessible Area - Area inaccessible - due to debris and low clearance.					
Ceiling Voids	No Asbestos Found					

Interior

B00E - R0001 - Communal Space (86 m2)

No Asbestos

B00E - R0002 - Toilets - Boys/Girls (3.29 m2)

No Asbestos

B00E - R0003 - General Storeroom (9.59 m2)

No Asbestos

B00E - R0004 - Movement (6.1 m2)

No Asbestos

B00E - R0005 - Practical Activities - 1hb (21.46 m2)

No Asbestos

B00E - R0023 - Movement (3.17 m2)

No Asbestos

B00E - R0024 - External Movement (4.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

3979/B00E/R0024/Ceiling Structures/Linings/S37

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1981 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00F/Eaves Linings/S14					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - Practical Activities - 1hb (48.27 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00F - R0002 - Withdrawal Space - 1hb (9.91 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0003 - General Storeroom (12.56 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00F - R0004 - Movement (26.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00F - R0005 - Distribution Board (0.78 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00F/R0015/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00F - R0006 - Cleaning Distributed Store (0.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00F - R0007 - General Storeroom (0.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00F - R0008 - Home Base (75.83 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0009 - Toilets - Boys/Girls (2.93 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0010 - Home Base (75.9 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0011 - Toilets - Boys/Girls (3.24 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0012 - Home Base (75.9 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0013 - Toilets - Boys/Girls (2.82 m2)

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0014 - Withdrawal Space - 1hb (13.04 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00F - R0015 - Movement (46.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
	3979/B00F/R0015/Ceiling Structures/Linings/S15					
In-fill-panel	Flat AC Sheeting	40m	North, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
	3979/B00F/R0015/In-fill-panel/S16					
B00F - R0016 - Movement (10.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
	3979/B00F/R0015/Ceiling Structures/Linings/S15					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1981 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	70m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

Interior**B00G - R0001 - Movement (2.82 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0002 - Drinking Facilities (4.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0003 - Movement (15.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0004 - Distribution Board (0.39 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting					
	3979/B00B/R0009/Floor Coverings Res/Textile/S6				No Asbestos Detected	

B00G - R0005 - Toilets - Girls (8.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0006 - Toilets - Boys (8.94 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0007 - Home Base (58.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0008 - Home Base (58.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0009 - Cleaning Distributed Store (1.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0010 - Toilets - Boys (17.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00G/R0006/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0011 - Movement (9.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00G - R0012 - Movement (32.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00G - R0013 - Home Base (57.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00G - R0014 - Practical Activities - 1hb (58.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0014/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00G - R0015 - Home Base (57.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1981 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	70m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

Interior**B00H - R0001 - Home Base (58.47 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00H - R0002 - Movement (19.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0010/Wall Linings Internal/S19				Chrysotile (white asbestos)	

B00H - R0003 - Distribution Board (0.27 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00H - R0004 - Toilets - Girls (8.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00H - R0005 - Toilets - Boys (8.7 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00H - R0006 - Home Base (58.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00H - R0007 - Home Base (58.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0012/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00H - R0008 - Cleaning Distributed Store (2.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0010/Wall Linings Internal/S19				Chrysotile (white asbestos)	

B00H - R0009 - Toilets - Girls (17.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00H/R0010/Wall Linings Internal/S19				Chrysotile (white asbestos)	

B00H - R0010 - Movement (9.93 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00H/R0010/Wall Linings Internal/S19					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00H/R0010/Wall Linings Internal/S19					Chrysotile (white asbestos)	
B00H - R0011 - Home Base (57.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00H/R0012/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	
B00H - R0012 - Practical Activities - 1hb (58.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00G/R0014/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00H/R0012/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	
B00H - R0013 - Movement (2.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00H/R0012/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - General Learning - 1957 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos						
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B001 - R0001 - Toilets - Boys/Girls (3.05 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0002/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0002/Wall Linings Internal/S22				Chrysotile (white asbestos)		

B001 - R0002 - Movement (18.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0002/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0002/Wall Linings Internal/S22				Chrysotile (white asbestos)		

B001 - R0003 - Movement (3.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0005/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		

B001 - R0004 - General Storeroom (5.73 m2)

Hatch	Flat AC Sheeting	1Unit(s)	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos						

B001 - R0005 - Staff Room Annexe (12.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0005/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		

B001 - R0006 - Home Base (53.51 m2)

In-fill-panel	Compressed AC Sheet	5m	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0006/In-fill-panel/S24				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0006/Floor Coverings Res/Textile/S25				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite	3979/B001/R0006/Ceiling Structures/Linings/S26			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B001 - R0007 - Movement (17.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B001/R0002/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0008 - Home Base (53.44 m2)

Ceiling Structures/Linings	Vermiculite	3979/B001/R0006/Ceiling Structures/Linings/S26			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00I - R0009 - Movement (8.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00I/R0002/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00I - R0010 - Movement (32.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3979/B00I/R0002/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00I - R0011 - Home Base Store (9.27 m2)						
Ceiling Structures/Linings	Vermiculite					
3979/B00I/R0006/Ceiling Structures/Linings/S26				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00I - R0012 - Deputy Principal (12.8 m2)						
Ceiling Structures/Linings	Vermiculite					
3979/B00I/R0006/Ceiling Structures/Linings/S26				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00I - R0013 - Home Base (53.58 m2)						
Ceiling Structures/Linings	Vermiculite					
3979/B00I/R0006/Ceiling Structures/Linings/S26				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00I - R0014 - Home Base (53.58 m2)						
Ceiling Structures/Linings	Vermiculite					
3979/B00I/R0006/Ceiling Structures/Linings/S26				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00I - R0015 - Home Base Store (30.02 m2)						
Ceiling Structures/Linings	Vermiculite					
3979/B00I/R0006/Ceiling Structures/Linings/S26				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00J - Pupil Facilities/Building Services - 1981 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00J - R0001 - Toilets - Boys (48.67 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Partition Walls (Cubicles)/S28			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0002 - Staff Toilet (1.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0003 - General Storeroom (6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0004 - Toilets - Girls (44.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Partition Walls (Cubicles)/S28			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0005 - Staff Toilet (1.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0006 - Garden Store (6.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00J/R0001/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities/Pupil Facilities - 1981 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00K - R0001 - Cleaning Supplies (9.09 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00K/R0001/Floor Coverings Res/Textile/S29				No Asbestos Detected	

B00K - R0002 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	

B00K - R0003 - Movement (70.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	20m	North, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00B/R0012/In-fill-panel/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00K - R0004 - Movement (38.21 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00K/R0001/Floor Coverings Res/Textile/S29				No Asbestos Detected	

B00K - R0005 - Hall Chair Store (8.97 m2)

No Asbestos

B00K - R0006 - Communal Space (234.28 m2)

No Asbestos

B00K - R0007 - Raised Platform (53.2 m2)

No Asbestos

B00K - R0008 - P.E. Store (26.07 m2)

No Asbestos

B00K - R0009 - Cleaning Distributed Store (3.6 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00K/R0001/Floor Coverings Res/Textile/S29				No Asbestos Detected	

B00K - R0010 - Movement (6.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	

B00K - R0011 - Movement (6.83 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	

B00K - R0012 - Garden Store (12.63 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R0013 - General Assistant/Bulk Store (7.29 m2)						
No Asbestos						
B00K - R0014 - Toilets - Boys (8.88 m2)						
No Asbestos						
B00K - R0015 - Toilets - Girls (8.61 m2)						
No Asbestos						
B00K - R0016 - Staff Toilet (3.65 m2)						
No Asbestos						
B00K - R0017 - Canteen Office/Store (6.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3979/B00K/R0001/Floor Coverings Res/Textile/S29					No Asbestos Detected	
B00K - R0018 - Canteen (43.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3979/B00K/R0001/Floor Coverings Res/Textile/S29					No Asbestos Detected	
B00K - R0019 - Canteen Office/Store (3.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3979/B00K/R0001/Floor Coverings Res/Textile/S29					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1981 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00L - R0001 - General Storeroom (11.45 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00K/R0001/Floor Coverings Res/Textile/S29					No Asbestos Detected

B00L - R0002 - Withdrawal Space - 1hb (11.59 m2)

No Asbestos

B00L - R0003 - Home Base (60.31 m2)

No Asbestos

B00L - R0004 - Home Base (60.48 m2)

No Asbestos

B00L - R0005 - Practical Activities - 1hb (118.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00K/R0001/Floor Coverings Res/Textile/S29					No Asbestos Detected

B00L - R0006 - Kiln Room (1.83 m2)

No Asbestos

B00L - R0007 - Home Base (60.53 m2)

No Asbestos

B00L - R0008 - Distribution Board (0.89 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	----------------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00L - R0009 - Home Base (60.53 m2)**

No Asbestos

B00L - R0010 - Home Base (60.62 m2)

No Asbestos

B00L - R0011 - Movement (6.12 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3979/B00K/R0001/Floor Coverings Res/Textile/S29					No Asbestos Detected

B00L - R0012 - Staff Room Annexe (17.34 m2)

No Asbestos

B00L - R0013 - General Storeroom (30.65 m2)

No Asbestos

B00L - R0014 - Movement (73.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3979/B00K/R0003/Ceiling Structures/Linings/S30					Chrysotile (white asbestos)

B00L - R0015 - Toilets - Boys (16.8 m2)

No Asbestos

B00L - R0016 - Toilets - Girls (16.68 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Home Base (61.06 m2)	No Asbestos
B00N - R0002 - Home Base Store (6.28 m2)	No Asbestos
B00N - R0003 - Practical Activities - 1hb (19.27 m2)	No Asbestos
B00N - R0004 - Withdrawal Space - 2hb (11.74 m2)	No Asbestos
B00N - R0005 - Home Base (61.05 m2)	No Asbestos
B00N - R0006 - Home Base Store (6.28 m2)	No Asbestos
B00N - R0007 - Practical Activities - 1hb (19.18 m2)	No Asbestos
B00N - R0008 - Home Base (59.61 m2)	No Asbestos
B00N - R0009 - Home Base Store (5.76 m2)	No Asbestos
B00N - R0010 - Withdrawal Space - 1hb (8.7 m2)	No Asbestos
B00N - R0011 - Practical Activities - 1hb (19.19 m2)	No Asbestos
B00N - R0012 - External Movement (68.74 m2)	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Storage - 2010 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B000 - R0001 - Sports Store (13.21 m2)

No Asbestos

B000 - R0002 - General Assistant/Bulk Store (16.07 m2)

No Asbestos

B000 - R0003 - Garden Store (13.17 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Storage - 2010 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - Movement (5.68 m2)

No Asbestos

B00P - R0002 - General Storeroom (6.11 m2)

No Asbestos

B00P - R0003 - General Storeroom (6.11 m2)

No Asbestos

B00P - R0004 - Special Programs Room (32.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017