


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Balgowlah North Public School (3984)  
**Region :** Northern Sydney  
**State Electorate :** Manly  
**Local Government Area :** Warringah

**Initial Survey :** Noel Arnold & Associates : 21 - Jan - 2008  
**Register Issue Date :** 23 - Mar - 2017

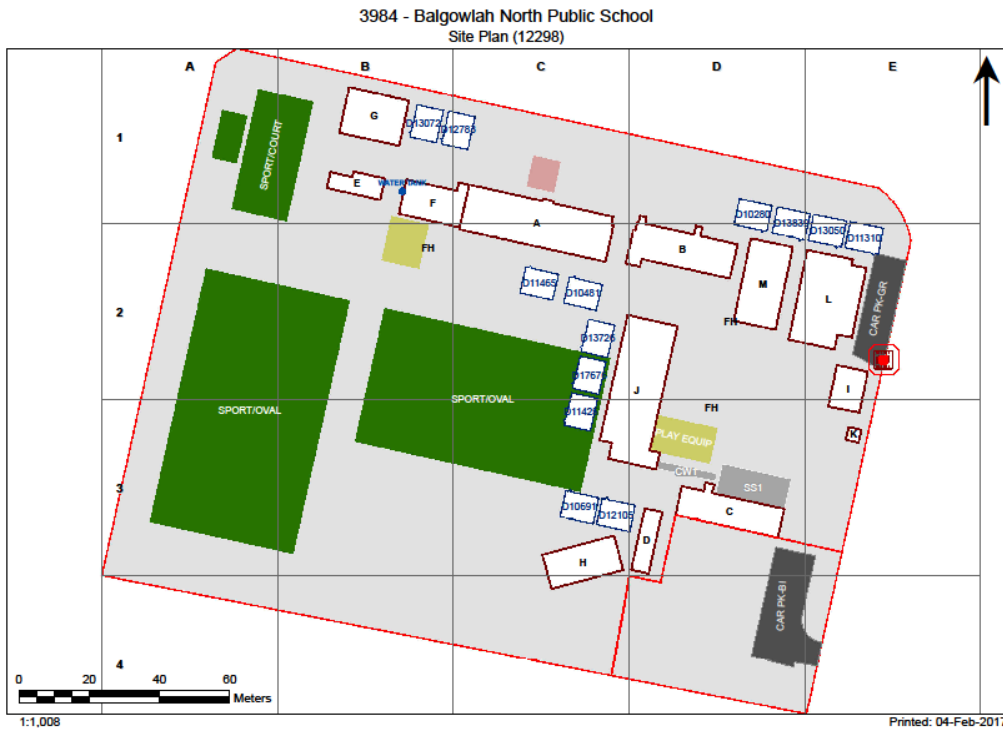

# 2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - General Learning/Administration - 1955 - Timber (Timber)****Exterior**

|                  |  |  |  |  |  |                             |
|------------------|--|--|--|--|--|-----------------------------|
| Eaves Linings    | Flat AC Sheeting<br>3984/B00A/Eaves Linings/S2 |  |  |  |  | <b>No Asbestos Detected</b> |
| Ceiling Voids    | Requires Inspection                            |  |  |  |  |                             |
| Underfloor Voids | Requires Inspection                            |  |  |  |  |                             |

**Interior****B00A - M0001 - Stairs**

No Asbestos

**B00A - R0001 - Security Store**

No Asbestos

**B00A - R0004 - Staff Toilet**

|                            |   |     |              |                    |         |   |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 3m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 3984/B00A/R0017/Ceiling Structures/Linings/S8 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00A - R0015 - Staff Toilet**

|                            |   |     |              |                    |         |   |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 3m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 3984/B00A/R0017/Ceiling Structures/Linings/S8 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

|                             |  |     |              |                    |         |                                    |
|-----------------------------|--|-----|--------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                    | 3m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                             | 3984/B00A/R0017/Floor Coverings Res/Textile/S4 |     |              |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00A - R0016 - External Movement**

No Asbestos

**B00A - R0017 - Home Base Store**

|                            |   |     |              |                    |         |   |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 3984/B00A/R0017/Ceiling Structures/Linings/S8 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

|                             |  |     |              |                    |         |                                    |
|-----------------------------|--|-----|--------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                    | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                             | 3984/B00A/R0017/Floor Coverings Res/Textile/S9 |     |              |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00A - R0018 - Stairs**

No Asbestos

**B00A - R0019 - Special Programs Room**

No Asbestos

**B00A - R0020 - Home Base Store**

No Asbestos

**B00A - R0021 - Home Base Store**

No Asbestos

**B00A - R0022 - Home Base**

No Asbestos

**B00A - R0023 - Home Base Store**

No Asbestos

**B00A - R0024 - Home Base Store**

No Asbestos

**B00A - R0025 - Special Programs Room**

No Asbestos

**B00A - R0026 - Home Base**

No Asbestos

**B00A - R0027 - Home Base Store**

No Asbestos

| Product  | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No  |                      |        |                    |                    | Test Result |                  |
| <b>B00A - R0028 - Home Base Store</b>              |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00A - R0029 - General Storeroom</b>            |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00A - R0030 - External Movement</b>            |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00A - R9001 - General Assistant/Bulk Store</b> |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00A - R9002 - General Assistant/Bulk Store</b> |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00A - R9003 - General Assistant/Bulk Store</b> |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00A - R9004 - General Assistant/Bulk Store</b> |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Administration - 1955 - Timber (Timber)****Exterior**

|                  |  |      |                               |                    |         |                             |
|------------------|--|------|-------------------------------|--------------------|---------|-----------------------------|
| Awnings          | Flat AC Sheeting<br>3984/B00B/Awnings/S5 |      |                               |                    |         | <b>No Asbestos Detected</b> |
| Eaves Linings    | Flat AC Sheeting                         | 60m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)          |
|                  | <b>Assumed Asbestos</b>                  |      |                               |                    |         |                             |
| Ceiling Voids    | Requires Inspection                      |      |                               |                    |         |                             |
| Underfloor Voids | Requires Inspection                      |      |                               |                    |         |                             |

**Interior****B00B - R0004 - External Movement**

No Asbestos

**B00B - R0005 - External Movement**

No Asbestos

**B00B - R0009 - Access Shower/Toilet**

|                       |  |  |  |  |  |                             |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting<br>3984/B00B/R0009/Wall Linings Internal/S6 |  |  |  |  | <b>No Asbestos Detected</b> |
|-----------------------|--|--|--|--|--|-----------------------------|

**B00B - R0010 - Staff Room**

No Asbestos

**B00B - R0011 - Interview**

No Asbestos

**B00B - R0012 - Principal**

No Asbestos

**B00B - R0013 - Deputy Principal**

No Asbestos

**B00B - R0014 - Staff Toilet**

No Asbestos

**B00B - R0015 - Duplicating Workroom**

No Asbestos

**B00B - R0016 - Sick Bay**

No Asbestos

**B00B - R0017 - Clerical Office**

No Asbestos

**B00B - R0018 - General Storeroom**

No Asbestos

**B00B - R0019 - Movement**

No Asbestos

**B00B - R0020 - Movement**

No Asbestos

**B00B - R0021 - Toilet - Lobby**

No Asbestos

**B00B - R0022 - Staff Toilet**

No Asbestos

**B00B - R0023 - Staff Toilet**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - General Learning - 1955 - Brick/Veneer (Brick/Veneer)****Exterior**

|                  |                         |      |                               |                    |         |                    |
|------------------|-------------------------|------|-------------------------------|--------------------|---------|--------------------|
| Eaves Linings    | Flat AC Sheeting        | 75m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|                  | <b>Assumed Asbestos</b> |      |                               |                    |         |                    |
| Ceiling Voids    | Requires Inspection     |      |                               |                    |         |                    |
| Underfloor Voids | Requires Inspection     |      |                               |                    |         |                    |

**Interior****B00C - R0001 - External Movement**

No Asbestos

**B00C - R0003 - Craft Store**

No Asbestos

**B00C - R0004 - Movement**

No Asbestos

**B00C - R0005 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0006 - Staff Room Annexe**

No Asbestos

**B00C - R0007 - Personal Effects Storage**

No Asbestos

**B00C - R0008 - Home Base**

No Asbestos

**B00C - R0009 - Home Base**

No Asbestos

**B00C - R0010 - Home Base Store**

No Asbestos

**B00C - R0011 - Toilets - Boys/Girls**

No Asbestos

**B00C - R0013 - Personal Effects Storage**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**

**Exterior**

|               |                  |      |             |                    |         |                    |
|---------------|------------------|------|-------------|--------------------|---------|--------------------|
| Eaves Linings | Flat AC Sheeting | 10m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------|------------------|------|-------------|--------------------|---------|--------------------|

**Assumed Asbestos**

|               |                     |
|---------------|---------------------|
| Ceiling Voids | Requires Inspection |
|---------------|---------------------|

|                  |                     |
|------------------|---------------------|
| Underfloor Voids | Requires Inspection |
|------------------|---------------------|

**Interior**

**B00D - R0001 - Drinking Facilities**

No Asbestos

**B00D - R0002 - Toilets - Girls**

|   |                     |                             |  |  |  |
|---|---------------------|-----------------------------|--|--|--|
| Partition Walls (Cubicles)                    | Compressed AC Sheet |                             |  |  |  |
| 3984/B00D/R0004/Partition Walls (Cubicles)/S1 |                     | <b>No Asbestos Detected</b> |  |  |  |

**B00D - R0003 - Cleaning Distributed Store**

No Asbestos

**B00D - R0004 - General Storeroom**

|   |                     |                             |  |  |  |
|---|---------------------|-----------------------------|--|--|--|
| Partition Walls (Cubicles)                    | Compressed AC Sheet |                             |  |  |  |
| 3984/B00D/R0004/Partition Walls (Cubicles)/S1 |                     | <b>No Asbestos Detected</b> |  |  |  |

**B00D - R0005 - Drinking Facilities**

No Asbestos

**B00D - R0006 - General Storeroom**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Pupil Facilities - 1988 - Brick/Block (Brick/Block)**

**Exterior**

|            |                  |     |             |                    |         |                    |
|------------|------------------|-----|-------------|--------------------|---------|--------------------|
| Gable Ends | Flat AC Sheeting | 6m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|------------|------------------|-----|-------------|--------------------|---------|--------------------|

**Assumed Asbestos**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior**

**B00E - R0001 - Toilets - Boys**

No Asbestos

**B00E - R0002 - Toilets - Girls**

No Asbestos

**B00E - R0003 - External Movement**

No Asbestos

**B00E - R0004 - Sports Store**

No Asbestos

**B00E - R0005 - General Assistant/Bulk Store**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - General Learning/Pupil Facilities - 1960 - Timber (Timber)**

**Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | Requires Inspection |
| Underfloor Voids | Requires Inspection |

**Interior**

**B00F - M0001 - Home Base Store**

No Asbestos

**B00F - R0002 - Canteen**

No Asbestos

**B00F - R0003 - Sports Store**

No Asbestos

**B00F - R0005 - Home Base**

|                            |  |      |              |   |         |                    |
|----------------------------|--|------|--------------|---|---------|--------------------|
| Wall Linings Internal      | Flat AC Sheeting                         | 80m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 3984/B00F/R0006/Wall Linings Internal/S7 |      |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |
| Ceiling Structures/Linings | Flat AC Sheeting                         | 51m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 3984/B00F/R0006/Wall Linings Internal/S7 |      |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00F - R0006 - Home Base**

|                            |  |      |              |   |         |                    |
|----------------------------|--|------|--------------|---|---------|--------------------|
| Wall Linings Internal      | Flat AC Sheeting                         | 80m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 3984/B00F/R0006/Wall Linings Internal/S7 |      |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |
| Ceiling Structures/Linings | Flat AC Sheeting                         | 52m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 3984/B00F/R0006/Wall Linings Internal/S7 |      |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00F - R0007 - External Movement**

No Asbestos

**B00F - R0008 - External Movement**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00G - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior**

**B00G - R0001 - Movement**

No Asbestos

**B00G - R0002 - Practical Activities - 1hb**

No Asbestos

**B00G - R0003 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00G - R0004 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00G - R0005 - Withdrawal Space - 2hb**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00G - R0006 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00G - R0007 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00G - R0008 - Practical Activities - 1hb**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00H - Other-After School Care - 2006 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior**

**B00H - R0001 - Out Of School Hours Care Centre**

No Asbestos

**B00H - R0002 - Out Of School Hours Care Centre**

No Asbestos

**B00H - R0003 - Out Of School Hours Care Centre**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B001 - Admin/General Learning - 2006 - Steel (Steel)**

**Exterior**

|                  |                         |      |                             |                    |         |                    |
|------------------|-------------------------|------|-----------------------------|--------------------|---------|--------------------|
| Eaves Linings    | Flat AC Sheeting        | 25m2 | East facing,<br>West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|                  | <b>Assumed Asbestos</b> |      |                             |                    |         |                    |
| Ceiling Voids    | No Asbestos Found       |      |                             |                    |         |                    |
| Underfloor Voids | Requires Inspection     |      |                             |                    |         |                    |

**Interior**

**B001 - R0002 - General Storeroom**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B001 - R0003 - Staff Kitchen**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B001 - R0006 - Interview**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B001 - R0007 - Clerical Office**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B001 - R0008 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
|         | Sample No            |        |                    |                    |             | Test Result      |

**B00J - General Learning - 2007 - Brick/Veneer (Brick/Veneer)****Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior****B00J - R0001 - Home Base Store**

No Asbestos

**B00J - R0002 - Practical Activities - 1hb**

No Asbestos

**B00J - R0003 - Home Base**

No Asbestos

**B00J - R0004 - Withdrawal Space - 2hb**

No Asbestos

**B00J - R0005 - Home Base**

No Asbestos

**B00J - R0006 - Practical Activities - 1hb**

No Asbestos

**B00J - R0007 - Home Base Store**

No Asbestos

**B00J - R0008 - Home Base Store**

No Asbestos

**B00J - R0009 - Practical Activities - 1hb**

No Asbestos

**B00J - R0010 - Home Base**

No Asbestos

**B00J - R0011 - Withdrawal Space - 2hb**

No Asbestos

**B00J - R0012 - Home Base**

No Asbestos

**B00J - R0013 - Practical Activities**

No Asbestos

**B00J - R0014 - Home Base Store**

No Asbestos

**B00J - R0015 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00J - R0016 - External Movement**

No Asbestos

**B00J - R0017 - External Movement**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00K - Mechanical Services - 2007 - Concrete (Concrete)**

**Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior**

**B00K - R0001 - Plant**

No Asbestos

**B00K - R0002 - Plant**

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
|         | Sample No            |        |                    |                    |             | Test Result      |

**B00L - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior****B00L - R0001 - Communal Space**

No Asbestos

**B00L - R0002 - Main Switch Board**

No Asbestos

**B00L - R0003 - Access Shower/Toilet/Change**

No Asbestos

**B00L - R0004 - Cleaning Distributed Store**

No Asbestos

**B00L - R0005 - Other**

No Asbestos

**B00L - R0006 - Toilet - Lobby**

No Asbestos

**B00L - R0007 - Sound Cupboard**

No Asbestos

**B00L - R0008 - Toilets - Boys**

No Asbestos

**B00L - R0009 - Toilet - Lobby**

No Asbestos

**B00L - R0010 - Toilets - Girls**

No Asbestos

**B00L - R0011 - P.E. Store**

No Asbestos

**B00L - R0012 - Communal/Performance Store**

No Asbestos

**B00L - R0013 - Chair Storeroom**

No Asbestos

**B00L - R0014 - Raised Platform**

No Asbestos

**B00L - R0015 - Movement**

No Asbestos

**B00L - R0016 - Movement**

No Asbestos

**B00L - R0017 - External Movement**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00M - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                  |                     |
|------------------|---------------------|
| Ceiling Voids    | No Asbestos Found   |
| Underfloor Voids | Requires Inspection |

**Interior**

**B00M - R0001 - Reading Area**

No Asbestos

**B00M - R0002 - Library Office/Workroom**

No Asbestos

**B00M - R0003 - Communications Room**

No Asbestos

**B00M - R0004 - K.L.A. Store**

No Asbestos

**B00M - R0005 - Cleaning Distributed Store**

No Asbestos

**B00M - R0006 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00M - R0007 - Toilet - Lobby**

No Asbestos

**B00M - R0008 - Staff Toilet**

No Asbestos

**B00M - R0009 - External Movement**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10280 - Learning Unit - Standard With P.A.A. : Placement Date - 14/11/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D10481 - Learning Unit - Standard With P.A.A. : Placement Date - 15/12/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 601 - D10691 - Learning Unit - Standard/Withdrawal : Placement Date - 3/02/2000**

### Exterior

|             |                     |                  |          |
|-------------|---------------------|------------------|----------|
| Eave Lining | Flat AC Sheet       | Assumed Asbestos | 11.52 m2 |
| Landing     | Compressed AC Sheet | Assumed Asbestos | 1.2 m2   |
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2  |

### Interior

#### R1 - Entry

|                |               |                  |       |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos | 8 m2  |

#### R2 - General Learning Space

|                |               |                  |       |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos | 55 m2 |

#### R3 - Store

|         |               |                  |       |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

**OS 602 - D11310 - Learning Unit - Standard With P.A.A. : Placement Date - 22/02/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 601 - D11425 - Learning Unit - Standard/Withdrawal : Placement Date - 5/04/2002**

### Exterior

|             |               |                  |          |
|-------------|---------------|------------------|----------|
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |
|-------------|---------------|------------------|----------|



| Product  | Material Description | Extent           | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|------------------|--------------------|--------------------|-------------|------------------|
| Sample No  |                      |                  |                    |                    | Test Result |                  |
| Landing  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.2 m2           |
| Step Treads  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.08 m2          |
| <b>Interior</b>  |                      |                  |                    |                    |             |                  |
| <b>R1 - Entry</b>  |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 8 m2             |
| <b>R2 - General Learning Space</b>   |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 55 m2            |
| <b>R3 - Store</b>  |                      |                  |                    |                    |             |                  |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 10 m2            |
| <b>OS 601 - D11465 - Learning Unit - Standard/Withdrawal : Placement Date - 2/02/1999</b>  |                      |                  |                    |                    |             |                  |
| <b>Exterior</b>  |                      |                  |                    |                    |             |                  |
| Step Treads  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.08 m2          |
| Eave Lining  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 11.52 m2         |
| Landing  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.2 m2           |
| <b>Interior</b>  |                      |                  |                    |                    |             |                  |
| <b>R1 - Entry</b>  |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 8 m2             |
| <b>R2 - General Learning Space</b>   |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 55 m2            |
| <b>R3 - Store</b>  |                      |                  |                    |                    |             |                  |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 10 m2            |
| <b>OS 601 - D12105 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b> |                      |                  |                    |                    |             |                  |
| <b>Exterior</b>  |                      |                  |                    |                    |             |                  |
| Landing  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.2 m2           |
| Step Treads  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.08 m2          |
| Eave Lining  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 11.52 m2         |
| <b>Interior</b>  |                      |                  |                    |                    |             |                  |
| <b>R1 - Entry</b>  |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 8 m2             |
| <b>R2 - General Learning Space</b>   |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 55 m2            |
| <b>R3 - Store</b>  |                      |                  |                    |                    |             |                  |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 10 m2            |
| <b>OS 602 - D12783 - Learning Unit - Standard With P.A.A. : Placement Date - 7/12/2010</b> |                      |                  |                    |                    |             |                  |
| <b>Exterior</b>  |                      |                  |                    |                    |             |                  |
| Eave Lining  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 11.52 m2         |
| Landing  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.2 m2           |
| Step Treads  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.08 m2          |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Interior**

**R1 - Learning space/withdrawal/entry**

|         |               |                  |  |  |  |       |
|---------|---------------|------------------|--|--|--|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos |  |  |  | 70 m2 |
|---------|---------------|------------------|--|--|--|-------|

**R2 - Home Base Store**

|                |               |                  |  |  |  |       |
|----------------|---------------|------------------|--|--|--|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos |  |  |  | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos |  |  |  | 3 m2  |

**OS 602 - D13050 - Learning Unit - Standard With P.A.A. : Placement Date - 4/05/2012**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D13072 - Learning Unit - Standard With P.A.A. : Placement Date - 15/01/2010**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D13726 - Learning Unit - Standard With P.A.A. : Placement Date - 15/12/2008**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D13839 - Learning Unit - Standard With P.A.A. : Placement Date - 8/11/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D17676 - Learning Unit - Standard With P.A.A. : Placement Date - 12/02/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3984\_ASB\_010313\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017