


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Biraban Public School (3988)  
**Region :** Hunter/Central Coast  
**State Electorate :** Lake Macquarie  
**Local Government Area :** Lake Macquarie

**Initial Survey :** Noel Arnold & Associates : 14 - Jan - 2010  
**Reviewed By :** Grencap-NAA : 26 - Mar - 2015

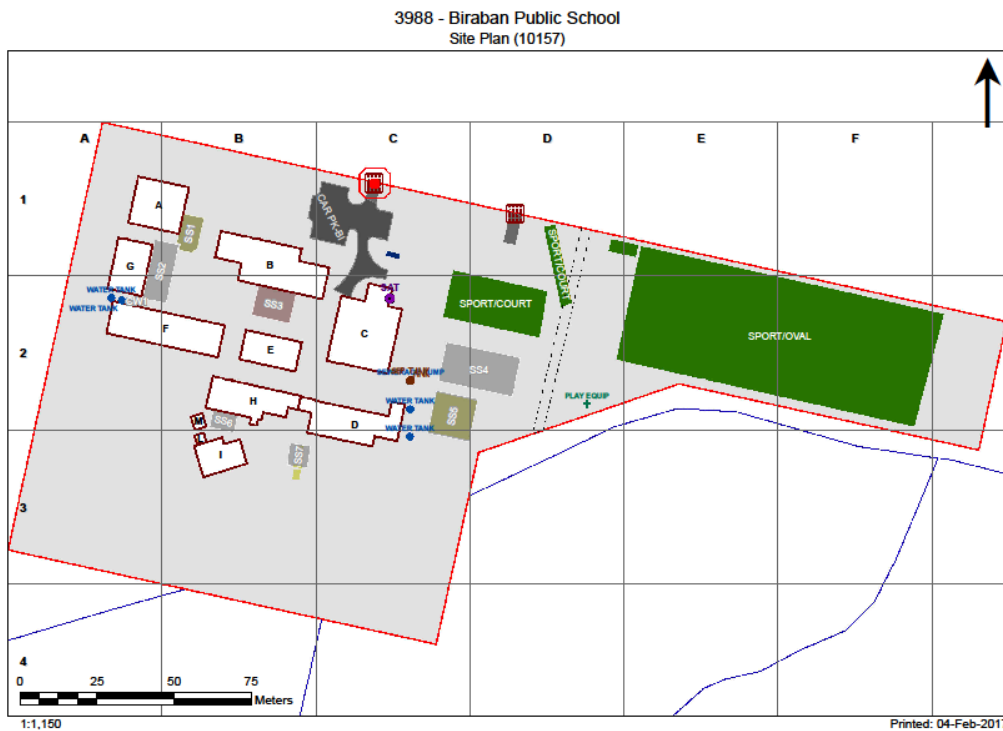

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Pupil Facilities - 1975 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/Eaves Linings/S5					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3988/B00A/Gable Verge Lining/S10					
In-fill-panel	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/In-fill-panel/S6					<b>Chrysotile (white asbestos)</b>
Wall Cladding	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/Wall Cladding/S11					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00A - R0001 - Movement (3.96 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0002 - Practical Activities - 1hb (12.92 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0002/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00A/R0002/Floor Coverings Res/Textile/S14					

**B00A - R0003 - Toilets - Boys/Girls (3.19 m2)**

No Asbestos

**B00A - R0004 - Home Base (81.99 m2)**

Wall infil panels	Flat AC Sheeting	3m2	South and East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0004/Wall infil panels/S15					<b>Chrysotile (white asbestos)</b>

**B00A - R0005 - Movement (28.21 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0006 - Home Base (82.12 m2)**

Wall infil panels	Flat AC Sheeting	3m2	South and West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0004/Wall infil panels/S15					<b>Chrysotile (white asbestos)</b>

**B00A - R0007 - Movement (3.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0008 - Practical Activities - 1hb (12.87 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0002/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00A/R0002/Floor Coverings Res/Textile/S14					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0009 - Toilets - Boys/Girls (3.21 m2)						

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/Staff Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 3988/B00A/Eaves Linings/S5	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting 3988/B00A/Gable Verge Lining/S10					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting 3988/B00A/In-fill-panel/S6	50m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 3988/B00A/Wall Cladding/S11	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior****B00B - R0001 - Staff Room (59.96 m2)**

No Asbestos

**B00B - R0002 - Movement (51.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00A/R0001/Ceiling Structures/Linings/S12	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	---

**B00B - R0003 - Staff Room Annexe (11.81 m2)**

No Asbestos

**B00B - R0004 - Movement (32.46 m2)**

No Asbestos

**B00B - R0005 - Security Store (11.81 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00A/R0001/Ceiling Structures/Linings/S12	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles 3988/B00A/R0002/Floor Coverings Res/Textile/S13	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 3988/B00A/R0002/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>

**B00B - R0006 - Staff Toilet (6.33 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 3988/B00B/R0007/Partition Walls (Cubicles)/S7	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	------------	--------------------	---------	--

**B00B - R0007 - Staff Toilet (9.75 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 3988/B00B/R0007/Partition Walls (Cubicles)/S7	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	------------	--------------------	---------	--

**B00B - R0008 - Sick Bay (9.39 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3988/B00A/R0002/Floor Coverings Res/Textile/S13	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 3988/B00A/R0002/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>

**B00B - R0009 - Deputy Principal (11.85 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00B - R0010 - Duplicating Workroom (14.81 m2)**

No Asbestos

**B00B - R0014 - Movement (39.11 m2)**

Ceiling Structures/Linings Flat AC Sheeting 40m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

3988/B00A/R0001/Ceiling Structures/Linings/S12

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00B - R0017 - Principal (19.62 m2)**

No Asbestos

**B00B - R0018 - Main Switch Board (2.74 m2)**

No Asbestos

**B00B - R0023 - Security Store (7.01 m2)**

No Asbestos

**B00B - R0024 - Plant (1.4 m2)**

No Asbestos

**B00B - R0025 - Staff Toilet (2.76 m2)**

No Asbestos

**B00B - R0028 - Staff Toilet (2.72 m2)**

No Asbestos

**B00B - R0030 - Clerical Office/Workroom (24.7 m2)**

No Asbestos

**B00B - R0031 - Entry Vestibule (16.26 m2)**

No Asbestos

**B00B - R0032 - General Storeroom (4.92 m2)**

No Asbestos

**B00B - R0033 - Interview (7.76 m2)**

No Asbestos

**B00B - R0034 - Access Shower/Toilet (8.63 m2)**

No Asbestos

**B00B - R0035 - Clerical Office (8.49 m2)**

No Asbestos

**B00B - R0036 - Movement (19.35 m2)**

No Asbestos

**B00B - R0037 - Cleaning Supplies (4.03 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Library/Communal Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/Eaves Linings/S5					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00C - R0001 - General Assistant/Bulk Store (16.11 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0002 - Movement (82.38 m2)**

No Asbestos

**B00C - R0003 - Toilets - Girls (10.46 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00C/R1009/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>

**B00C - R0004 - Toilets - Boys (10.09 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00C/R1009/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Sports Store (12.95 m2)**

No Asbestos

**B00C - R0007 - Movement (6.87 m2)**

No Asbestos

**B00C - R0008 - Raised Platform (40.55 m2)**

No Asbestos

**B00C - R0009 - Hall Chair Store (8.48 m2)**

No Asbestos

**B00C - R0010 - Communal Space (169.79 m2)**

No Asbestos

**B00C - R0011 - Canteen (26.73 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0002/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>

Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00A/R0002/Floor Coverings Res/Textile/S14					

**B00C - R0012 - Canteen Office/Store (4.81 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/R0002/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>

Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00A/R0002/Floor Coverings Res/Textile/S14					

**B00C - R0013 - Staff Toilet (3.26 m2)**

No Asbestos

Insulation to Supports

**B00C - R0014 - Canteen Office/Store (2.91 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00A/R0002/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
3988/B00A/R0002/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>	
<b>B00C - R0015 - Stairs (20.07 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Stairs (7.53 m2)</b>						
No Asbestos						
<b>B00C - R0020 - Hall Chair Store (8.98 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Movement (74.39 m2)</b>						
No Asbestos						
<b>B00C - R1002 - Reading Area (187.94 m2)</b>						
No Asbestos						
<b>B00C - R1003 - Library Office/Workroom (31.22 m2)</b>						
No Asbestos						
<b>B00C - R1004 - Seminar/Study (18.85 m2)</b>						
No Asbestos						
<b>B00C - R1005 - Communications Room (12.36 m2)</b>						
No Asbestos						
<b>B00C - R1006 - Library Office/Workroom (23.4 m2)</b>						
No Asbestos						
<b>B00C - R1007 - Library Office/Workroom (9.21 m2)</b>						
No Asbestos						
<b>B00C - R1008 - Cleaning Distributed Store (1.98 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00C - R1009 - Toilets - Girls (2.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00C/R1009/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1010 - Movement (10.14 m2)</b>						
No Asbestos						
<b>B00C - R1011 - Toilets - Boys (2.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00A/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00C/R1009/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1012 - Distribution Board (2.01 m2)</b>						
Note: No inspection of live electrical installation.						
No Asbestos						
<b>B00C - R1013 - Stairs (18.19 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R1014 - Stairs (21.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00A/R0001/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 3988/B00A/Eaves Linings/S5	30m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting 3988/B00A/Gable Verge Lining/S10					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting 3988/B00A/In-fill-panel/S6	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00D - R0001 - Movement (84.23 m2)**

No Asbestos

**B00D - R0002 - Toilets - Boys (10.31 m2)**

Ceiling Structures/Linings	Vermiculite 3988/B00D/R0002/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Partition Walls (Cubicles)	Compressed AC Sheet 3988/B00C/R1009/Partition Walls (Cubicles)/S16	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00D - R0003 - Toilets - Girls (10.63 m2)**

Ceiling Structures/Linings	Vermiculite 3988/B00D/R0002/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Partition Walls (Cubicles)	Compressed AC Sheet 3988/B00C/R1009/Partition Walls (Cubicles)/S16	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00D - R0004 - Practical Activities - 1hb (18.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3988/B00A/R0002/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite 3988/B00D/R0002/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00D - R0005 - Home Base (60.27 m2)**

Ceiling Structures/Linings	Vermiculite 3988/B00D/R0002/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00D - R0006 - Home Base (60.28 m2)**

Ceiling Structures/Linings	Vermiculite 3988/B00D/R0002/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00D - R0007 - Practical Activities - 1hb (18.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3988/B00A/R0002/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite 3988/B00D/R0002/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00D - R0008 - Stairs (8.37 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00D/R0009/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R0009 - Stairs (14.59 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00D/R0009/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R1001 - Movement (79.01 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00D/R0009/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R1002 - Toilets - Boys (10.42 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00C/R1009/Partition Walls (Cubicles)/S16				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R1003 - Toilets - Girls (10.8 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00C/R1009/Partition Walls (Cubicles)/S16				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R1004 - Practical Activities - 1hb (18.94 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3988/B00A/R0002/Floor Coverings Res/Textile/S1				<b>No Asbestos Detected</b>		
<b>B00D - R1005 - Home Base (60.51 m2)</b>						
No Asbestos						
<b>B00D - R1006 - Home Base (60.2 m2)</b>						
No Asbestos						
<b>B00D - R1007 - Practical Activities - 1hb (18.78 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3988/B00A/R0002/Floor Coverings Res/Textile/S1				<b>No Asbestos Detected</b>		
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00D - R1008 - Stairs (13.22 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00D/R0009/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R1009 - Stairs (15.31 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00D/R0009/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1956 - Brick/Veneer (Brick/Veneer)****Exterior**

Gable Verge Lining	Flat AC Sheeting 3988/B00E/Gable Verge Lining/S9					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting 3988/B00E/In-fill-panel/S19	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00E - R0001 - Movement (31.99 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00D/R0009/Ceiling Structures/Linings/S18	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	---

**B00E - R0002 - Practical Activities - 1hb (23.02 m2)**

No Asbestos

**B00E - R0003 - Home Base (53.51 m2)**

Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
--------------------------	----------------	-------	------	--------------------	---------	---

**B00E - R0004 - Home Base (53.59 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1975 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/Eaves Linings/S5					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3988/B00A/Gable Verge Lining/S10					
In-fill-panel	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/In-fill-panel/S6					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00F - R0001 - Movement (31.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Electrical Hazard</b>

**B00F - R0002 - Practical Activities - 1hb (23.32 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00F/R0002/Floor Coverings Res/Textile/S21					

**B00F - R0003 - Home Base (50.74 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00F/R0002/Floor Coverings Res/Textile/S21					

**B00F - R0004 - Home Base (50.77 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00F/R0002/Floor Coverings Res/Textile/S21					

**B00F - R0005 - Practical Activities - 1hb (23.04 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3988/B00F/R0002/Floor Coverings Res/Textile/S21					

**B00F - R0006 - Movement (32.19 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0007 - Practical Activities - 1hb (23.05 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
3988/B00F/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>	
<b>B00F - R0008 - Home Base (50.51 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
3988/B00F/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>	
<b>B00F - R0009 - Home Base (50.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
3988/B00F/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>	
<b>B00F - R0010 - Practical Activities - 1hb (23.3 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3988/B00F/R0002/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
3988/B00F/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities/Administration - 1975 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting 3988/B00A/Gable Verge Lining/S10					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Infil panel	Flat AC Sheeting 3988/B00A/In-fill-panel/S6	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior****B00G - R0001 - Movement (56.64 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00G/R0001/Ceiling Structures/Linings/S22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	--

**B00G - R0002 - Interview (11.55 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00G/R0001/Ceiling Structures/Linings/S22	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	--

**B00G - R0003 - Cleaning Supplies (9.12 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00G/R0001/Ceiling Structures/Linings/S22	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles 3988/B00A/R0002/Floor Coverings Res/Textile/S13	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 3988/B00A/R0002/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>

**B00G - R0004 - Craft Store (11.29 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3988/B00A/R0002/Floor Coverings Res/Textile/S13	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 3988/B00G/R0001/Ceiling Structures/Linings/S22	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00G - R0005 - Toilets - Girls (24.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00G/R0001/Ceiling Structures/Linings/S22	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet 3988/B00C/R1009/Partition Walls (Cubicles)/S16	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00G - R0006 - Toilets - Boys (24.74 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3988/B00G/R0001/Ceiling Structures/Linings/S22	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet 3988/B00C/R1009/Partition Walls (Cubicles)/S16	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00G - R0007 - General Storeroom (16.57 m2)**

No Asbestos

**B00G - R0008 - General Storeroom (16.08 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Other-Commercial - 1975 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	North and South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3988/B00A/Eaves Linings/S5				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3988/B00A/Gable Verge Lining/S10					
Infil panels	Flat AC Sheeting	16m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00A/In-fill-panel/S6				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00H - R0001 - Other-Commercial (89.36 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	90m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00H - R0002 - Other-Commercial (10.32 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00C/R1009/Partition Walls (Cubicles)/S16				<b>Chrysotile (white asbestos)</b>	

**B00H - R0003 - Other-Commercial (10.7 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00C/R1009/Partition Walls (Cubicles)/S16				<b>Chrysotile (white asbestos)</b>	

**B00H - R0004 - Home Base (55.57 m2)**

No Asbestos

**B00H - R0005 - Home Base (52.2 m2)**

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00H - R0006 - Other-Commercial (22.98 m2)**

No Asbestos

**B00H - R0007 - Movement (4.3 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Other-Non-Govt Pre-School - 1956 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3988/B00A/Eaves Linings/S5					<b>Chrysotile (white asbestos)</b>

**Interior****B00I - R0001 - Other-Non Government Pre-Sch (21.47 m2)**

No Asbestos

**B00I - R0002 - Other-Non Government Pre-Sch (5.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00I - R0003 - Other-Non Government Pre-Sch (46.86 m2)**

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Electrical Hazard</b>

**B00I - R0004 - Other-Non Government Pre-Sch (2.95 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00I - R0005 - Other-Non Government Pre-Sch (1.46 m2)**

No Asbestos

**B00I - R0006 - Other-Non Government Pre-Sch (3.82 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3988/B00I/R0006/Wall Linings Internal/S3					

**B00I - R0007 - Other-Non Government Pre-Sch (1.37 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3988/B00I/R0006/Wall Linings Internal/S3					

**B00I - R0008 - Other-Non Government Pre-Sch (46.74 m2)**

No Asbestos

**B00I - R0009 - Other-Non Government Pre-Sch (4.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00I - R0010 - Other-Non Government Pre-Sch (2.66 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3988/B00D/R0009/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Other-Non-Govt Pre-School - 1975 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00L - R0001 - Other-Non Government Pre-Sch (9.36 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Other - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00M - R0001 - No Access (16.15 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017