


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Booragul Public School (4017)
Region : Hunter/Central Coast
State Electorate : Lake Macquarie
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 30 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Jun - 2015

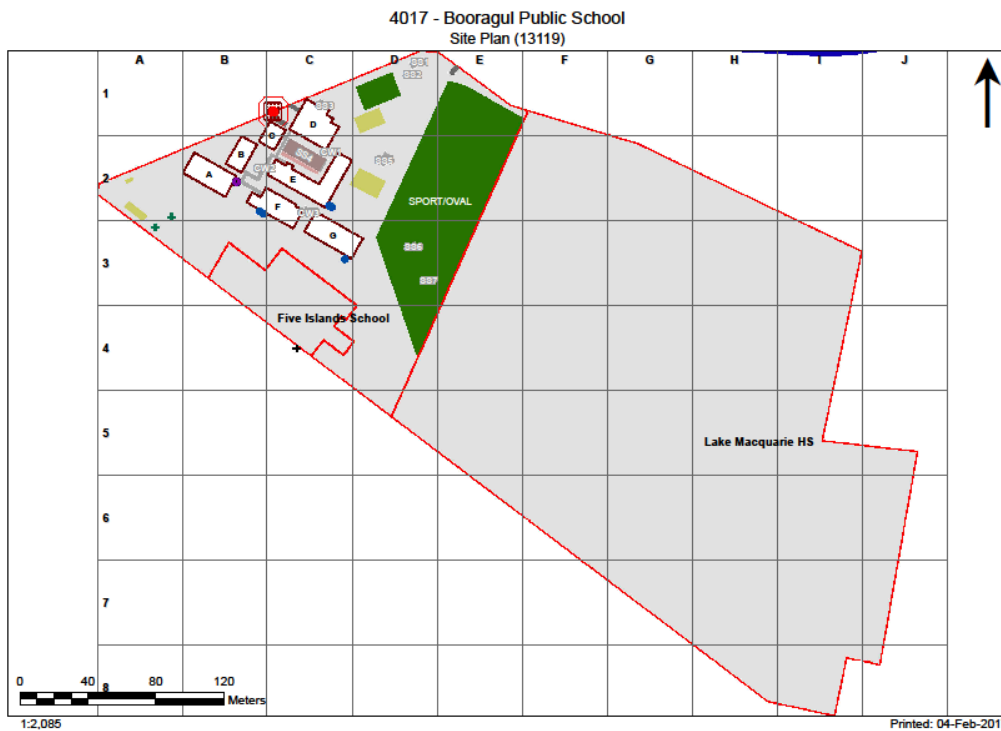

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00A - Administration - 1995 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00A - R0001 - Staff Room Annexe**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0002 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0003 - Main Switch Board

No Asbestos

B00A - R0004 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0005 - Cleaning Distributed Store

No Asbestos

B00A - R0006 - Interview

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0007 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0008 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0009 - Sick Bay - Shower/Toilet

No Asbestos

B00A - R0010 - Sick Bay

No Asbestos

B00A - R0011 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0012 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0013 - External Movement

No Asbestos

B00A - R0014 - Duplicating Workroom

No Asbestos

B00A - R0015 - Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0016 - Security Store

No Asbestos

B00A - R0017 - Staff Toilet

No Asbestos

B00A - R0018 - Staff Toilet

No Asbestos

B00A - R0019 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/Eaves Linings/S5					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/Gable Verge Lining/S7					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/In-fill-panel/S9					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill panel above windows	Flat AC Sheeting	4m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

Interior

B00B - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0006 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/Eaves Linings/S5					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/Gable Verge Lining/S7					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/In-fill-panel/S9					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill panels above windows	Flat AC Sheeting	4m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

Interior

B00C - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00C - R0002 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00C - R0003 - Music Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0006/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00C - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard - Unable to access

B00C - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00C - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00C/R0006/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00C - R0007 - Home Base

No Asbestos

B00C - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities - 1985 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Shower/Change

No Asbestos

B00D - R0003 - Shower/Change

No Asbestos

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Plant

No Asbestos

B00D - R0006 - Raised Platform

No Asbestos

B00D - R0007 - Hall Chair Store

No Asbestos

B00D - R0008 - Communal Space

No Asbestos

B00D - R0009 - Hall Chair Store

No Asbestos

B00D - R0010 - Canteen

No Asbestos

B00D - R0011 - Canteen Office/Store

No Asbestos

B00D - R0012 - Canteen Office/Store

No Asbestos

B00D - R0013 - Disabled Toilet

No Asbestos

B00D - R0014 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0015 - Cleaning Supplies

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning/Other-Community Use - 1955 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/Eaves Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4017/B00E/Underfloor Voids - Packing to Floor Joists/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00E - R0005 - Staff Kitchen**

Wall Linings Internal	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0015/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0006 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0015/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0007 - Craft Store

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0015/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00B/R0003/Floor Coverings Res/Textile/S1			Chrysotile (white asbestos)		

B00E - R0008 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0015/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0009 - Toilets - Boys/Girls

No Asbestos

B00E - R0010 - Home Base

No Asbestos

B00E - R0013 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4017/B00E/R0014/Wall Linings Internal/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4017/B00E/R0015/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0014 - Withdrawal Space - 1hb						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4017/B00E/R0014/Wall Linings Internal/S15				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4017/B00E/R0015/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0015 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	131m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4017/B00E/R0015/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0016 - External Movement						
No Asbestos						
B00E - R0020 - General Storeroom						
No Asbestos						
B00E - R0021 - Home Base						
No Asbestos						
B00E - R0022 - Home Base Store						
No Asbestos						
B00E - R0023 - Home Base						
No Asbestos						
B00E - R0024 - Home Base Store						
No Asbestos						
B00E - R0025 - Home Base Store						
No Asbestos						
B00E - R0026 - Home Base						
No Asbestos						
B00E - R9001 - Other-Community Use						
Wall Linings Internal	Flat AC Sheeting					
4017/B00E/R9001/Wall Linings Internal/S2				No Asbestos Detected		
B00E - R9002 - Other-Community Use						
Wall Linings Internal	Flat AC Sheeting					
4017/B00E/R9001/Wall Linings Internal/S2				No Asbestos Detected		
B00E - R9003 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet					
4017/B00E/R9004/Partition Walls (Cubicles)/S10				No Asbestos Detected		
Wall Linings Internal	Flat AC Sheeting					
4017/B00E/R9004/Wall Linings Internal/S11				No Asbestos Detected		
B00E - R9004 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet					
4017/B00E/R9004/Partition Walls (Cubicles)/S10				No Asbestos Detected		
Wall Linings Internal	Flat AC Sheeting					
4017/B00E/R9004/Wall Linings Internal/S11				No Asbestos Detected		
B00E - R9005 - Cleaning Distributed Store						
No Asbestos						
B00E - R9006 - External Movement						
No Asbestos						
B00E - R9007 - P.E. Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R9008 - General Assistant/Bulk Store

No Asbestos

B00E - R9009 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library/Special Purpose - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00F - R0002 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00F - R0003 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00F - R0004 - K.L.A. Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00F - R0005 - Staff Toilet

No Asbestos

B00F - R0006 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0007 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00F - R0008 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00F - R0009 - External Movement

No Asbestos

B00F - R0010 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - External Movement

No Asbestos

B00G - R0002 - Garden Store

No Asbestos

B00G - R0003 - General Assistant/Bulk Store

No Asbestos

B00G - R0004 - Sports Store

No Asbestos

B00G - R0005 - Home Base Store

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0007 - Personal Effects Storage

No Asbestos

B00G - R0008 - Practical Activities - 1hb

No Asbestos

B00G - R0009 - Withdrawal Space - 2hb

No Asbestos

B00G - R0010 - Home Base

No Asbestos

B00G - R0011 - Home Base Store

No Asbestos

B00G - R0012 - Practical Activities - 1hb

No Asbestos

B00G - R0013 - Personal Effects Storage

No Asbestos

B00G - R0014 - Withdrawal Space - 1hb

No Asbestos

B00G - R0015 - Home Base Store

No Asbestos

B00G - R0016 - Home Base

No Asbestos

B00G - R0017 - Practical Activities - 1hb

No Asbestos

B00G - R0018 - Personal Effects Storage

No Asbestos

B00G - R0019 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4017_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017