


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blacktown North Public School (4061)
Region : Western Sydney
State Electorate : Blacktown
Local Government Area : Blacktown

Initial Survey : Noel Arnold & Associates : 15 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

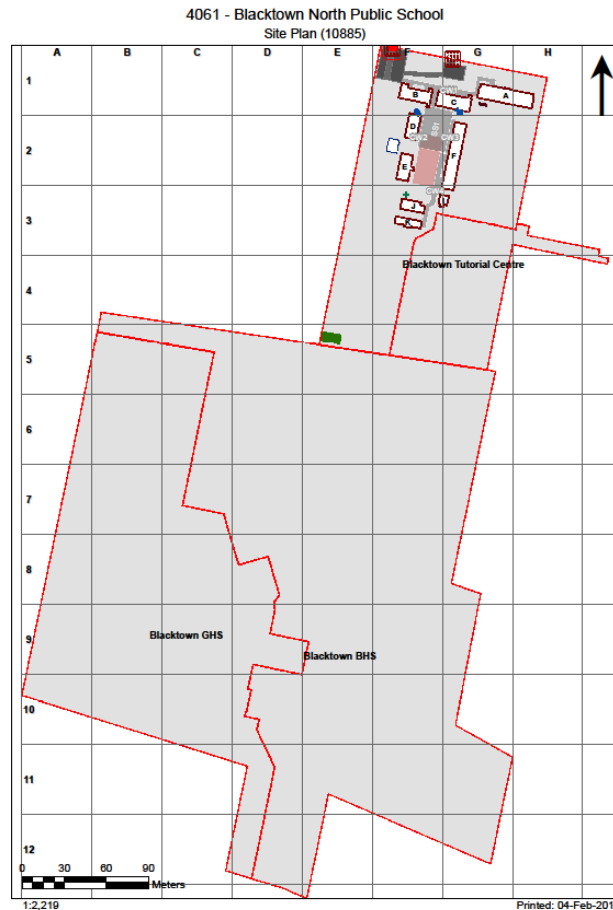

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00A/Eaves Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00A/R0001/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting					
	4061/B00A/R0002/Wall Linings Internal/S14					No Asbestos Detected

B00A - R0003 - Toilets - Boys/Girls

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Personal Effects Storage

No Asbestos

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Duplicating Workroom

No Asbestos

B00A - R0008 - Security Store

No Asbestos

B00A - R0009 - Withdrawal Space - 1hb

No Asbestos

B00A - R0010 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	2m2	South facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00A/R0011/Wall Linings Internal/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0011 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	South facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00A/R0011/Wall Linings Internal/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0012 - General Storeroom

No Asbestos

B00A - R0013 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4061/B00C/Eaves Linings/S16					No Asbestos Detected
Window In-fill Panel	Flat AC Sheeting 4061/B00B/Window In-fill Panel/S21					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4061/B00B/Underfloor Voids/S20	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00B - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 4061/B00B/R0001/Ceiling Structures/Linings/S3	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill Panel, Upper Portion	Flat AC Sheeting 4061/B00B/R0009/Door Infill Panel/S7	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0002 - Movement

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0007 - Staff Toilet

Door Insert	Flat AC Sheeting 4061/B00B/R0007/Door Insert/S6					No Asbestos Detected
-------------	--	--	--	--	--	-----------------------------

B00B - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 4061/B00B/R0001/Ceiling Structures/Linings/S3	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill Panel, Upper Portion	Flat AC Sheeting 4061/B00B/R0009/Door Infill Panel/S7	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 4061/B00B/R0001/Ceiling Structures/Linings/S3	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill Panel, Upper Portion	Flat AC Sheeting 4061/B00B/R0009/Door Infill Panel/S7	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Home Base Store

No Asbestos

B00B - R0012 - Clerical Office

No Asbestos

B00B - R0013 - Clerical/Printing

No Asbestos

B00B - R0014 - Sick Bay

No Asbestos

B00B - R0015 - Toilets - Boys/Girls

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R0016 - Principal

No Asbestos

B00B - R0017 - Entry Vestibule

No Asbestos

B00B - R0018 - Clerical Office/Workroom

No Asbestos

B00B - R0019 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4061/B00C/Eaves Linings/S16					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - No manhole in building					

Interior

B00C - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00C/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00C/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0005 - Communal Space

No Asbestos

B00C - R0008 - General Storeroom

No Asbestos

B00C - R0009 - Movement

No Asbestos

B00C - R0010 - External Movement

No Asbestos

B00C - R0011 - Communal Space

No Asbestos

B00C - R0012 - Raised Platform

No Asbestos

B00C - R0013 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4061/B00F/Eaves Linings/S17	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area - No Access - No manhole found in building					
Ceiling Void	No Asbestos Found					

Interior

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - Personal Effects Storage

No Asbestos

B00D - R0004 - Home Base

No Asbestos

B00D - R0005 - Home Base Store

No Asbestos

B00D - R0006 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00F/Eaves Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00E/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0002 - Movement

No Asbestos

B00E - R0003 - Personal Effects Storage

No Asbestos

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Home Base Store

No Asbestos

B00E - R0006 - Home Base Store

No Asbestos

B00E - R0007 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Library - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	120m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00F/Eaves Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - No manhole located					

Interior

B00F - R0001 - Other-Community Use

No Asbestos

B00F - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00F/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Door Infill panel	Flat AC Sheeting	1m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00F/R0002/Door Infill panel/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0004 - Library Office/Workroom

No Asbestos

B00F - R0005 - K.L.A. Store

No Asbestos

B00F - R0006 - Reading Area

No Asbestos

B00F - R0007 - K.L.A. Store

No Asbestos

B00F - R0008 - Staff Toilet

No Asbestos

B00F - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00F/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Door Infill panel	Flat AC Sheeting	1m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B00F/R0002/Door Infill panel/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0011 - General Storeroom

No Asbestos

B00F - R0012 - Staff Toilet

No Asbestos

B00F - R0013 - General Assistant/Bulk Store

No Asbestos

B00F - R0014 - Staff Room

No Asbestos

B00F - R0015 - Home Base

No Asbestos

B00F - R0016 - Home Base Store

No Asbestos

B00F - R0017 - Personal Effects Storage

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0018 - Cleaning Supplies						
No Asbestos						
B00F - R0019 - General Storeroom						
No Asbestos						
B00F - R0020 - Interview						
No Asbestos						
B00F - R0021 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B001/Eaves Linings/S18					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					

Interior

B001 - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4061/B001/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B001 - R0002 - Canteen

No Asbestos

B001 - R0003 - Canteen Office/Store

Non Accessible

B001 - R0004 - Canteen Office/Store

No Asbestos

B001 - R0005 - Staff Toilet

No Asbestos

B001 - R0006 - Shelter

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4061/B00J/Eaves Linings/S19					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00J - R0001 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 4061/B00J/R0001/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00J - R0002 - General Storeroom

No Asbestos

B00J - R0003 - Movement

No Asbestos

B00J - R0004 - Sports Store

No Asbestos

B00J - R0005 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4061/B00J/Eaves Linings/S19					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					

Interior

B00K - R0001 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 4061/B00K/R0001/Wall Linings Internal/S4					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00K - R0002 - Cleaning Distributed Store

No Asbestos

B00K - R0003 - Drinking Facilities

No Asbestos

B00K - R0004 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13057 - Learning Unit - Standard With P.A.A. : Placement Date - 5/10/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13774 - Learning Unit - Standard With P.A.A. : Placement Date - 6/05/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017