


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Black Springs Public School (4190)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Oberon

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Nov - 2016

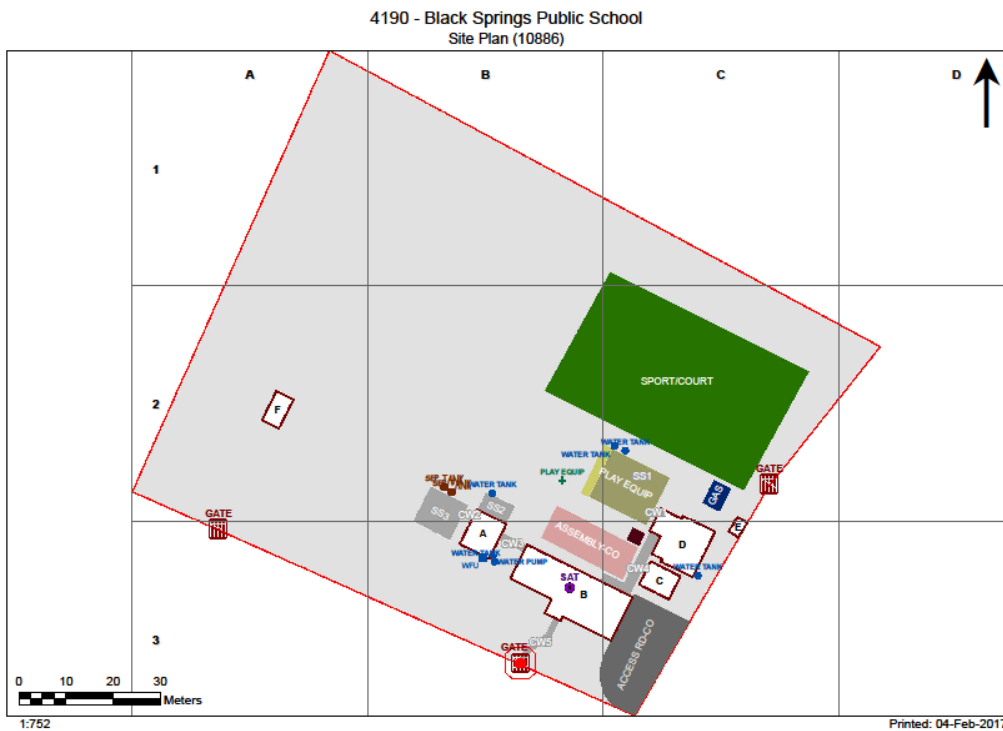

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4190/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4190/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4190/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4190/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0005 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4190/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities/General Learning - 1968 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4190/B00B/Eaves Linings/S2	16m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting 4190/B00B/Gable Verge Lining/S4	14m2	East, West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
In-fill-panel	Flat AC Sheeting 4190/B00B/In-fill-panel/S8	36m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting 4190/B00B/Wall Cladding/S7					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00B - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4190/B00B/R0001/Ceiling Structures/Linings/S10	25m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Wall Linings Internal	Flat AC Sheeting 4190/B00B/R0001/Wall Linings Internal/S13	8m2	South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
In-fill-panel	Flat AC Sheeting 4190/B00B/R0001/In-fill-panel/S16	15m	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Principal

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - General Storeroom

No Asbestos

B00B - R0011 - Staff Room

No Asbestos

B00B - R0012 - Movement

No Asbestos

B00B - R0013 - Clerical Office

No Asbestos

B00B - R0014 - Entry Vestibule

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00C - Special Purpose - 1893 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00C - R0001 - Special Programs Room

No Asbestos

B00C - R0002 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4190/B00D/Eaves Linings/S3					No Asbestos Detected
Electrical Backing Board	Resinous Board 4190/B00D/Electrical Backing Board/S17	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Underfloor Voids	Flat AC Sheeting 4190/B00D/Underfloor Voids/S6	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00D - R0001 - Reading Area

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4190/B00D/R0004/Ceiling Structures/Linings/S11					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4190/B00D/R0004/Wall Linings Internal/S12					No Asbestos Detected

B00D - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 2009 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00E - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Garage

Exterior

Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Eaves Linings/S1					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	1m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/Gable Ends/S5					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel above door	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)

Interior

B00F - R0001 - Garage

Infill panel	Flat AC Sheeting	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4190/B00F/R0001/Infill panel/S14					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S14	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S14	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S14	1m2	West, above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Infill panel	Flat AC Sheeting 4190/B00F/R0001/Infill panel/S15	4m2	North wall	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017