


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Blacktown South Public School (4193)  
**Region :** Western Sydney  
**State Electorate :** Blacktown  
**Local Government Area :** Blacktown

**Initial Survey :** Noel Arnold & Associates : 05 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 07 - Feb - 2017

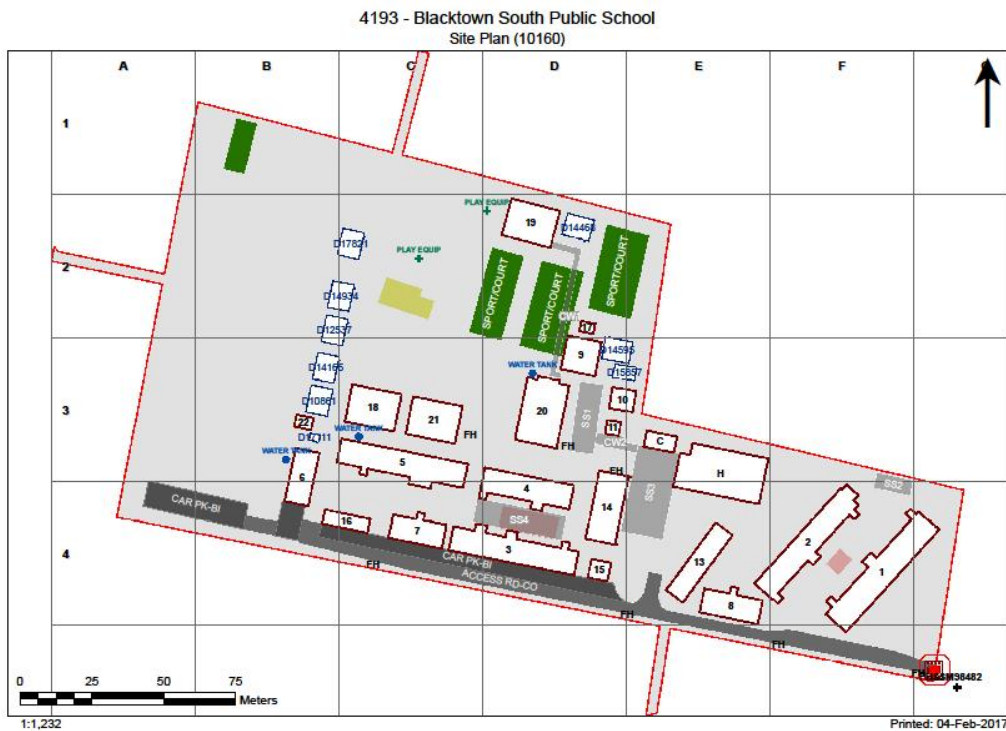

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - General Learning - 1959 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4193/B001/Eaves Linings/S26	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
Gable verge lining	Flat AC Sheeting 4193/B001/Gable verge lining/S27					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B001 - R0001 - Personal Effects Storage**

No Asbestos

**B001 - R0002 - Movement**

No Asbestos

**B001 - R0003 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B001/R0023/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>
Panel above door	Flat AC Sheeting 4193/B001/R0023/Panel above door/S19	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0004 - Staff Toilet**

No Asbestos

**B001 - R0005 - Home Base**

No Asbestos

**B001 - R0006 - Home Base**

No Asbestos

**B001 - R0007 - General Storeroom**

No Asbestos

**B001 - R0008 - Personal Effects Storage**

No Asbestos

**B001 - R0009 - Deputy Principal**

No Asbestos

**B001 - R0010 - General Storeroom**

No Asbestos

**B001 - R0011 - General Storeroom**

No Asbestos

**B001 - R0012 - Movement**

No Asbestos

**B001 - R0013 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B001/R0023/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>
Panel above door	Flat AC Sheeting 4193/B001/R0023/Panel above door/S19	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0014 - General Storeroom**

No Asbestos

**B001 - R0015 - Personal Effects Storage**

No Asbestos

**B001 - R0016 - Home Base**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0017 - Home Base</b>						
No Asbestos						
<b>B001 - R0018 - General Storeroom</b>						
No Asbestos						
<b>B001 - R0019 - Personal Effects Storage</b>						
No Asbestos						
<b>B001 - R0020 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0021 - Staff Toilet</b>						
No Asbestos						
<b>B001 - R0022 - Movement</b>						
No Asbestos						
<b>B001 - R0023 - External Movement</b>						
Panel above door	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B001/R0023/Panel above door/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4193/B001/R0023/Ceiling Structures/Linings/S20					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - General Learning - 1959 - Brick/Veneer (Brick/Veneer)****Exterior**

Gable verge lining	Flat AC Sheeting 4193/B002/Gable verge lining/S29					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 4193/B002/Eaves Linings/S28					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Unable to access at time of survey					

**Interior****B002 - R0001 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B002/R0003/Ceiling Structures/Linings/S16	11m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B002 - R0002 - General Storeroom**

No Asbestos

**B002 - R0003 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B002/R0003/Ceiling Structures/Linings/S16	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Panel above door	Flat AC Sheeting 4193/B006/R0003/Panel above door/S4	NA	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B002 - R0004 - Movement**

No Asbestos

**B002 - R0005 - Special Programs Room**

Floor Coverings Res/Textile	Vinyl Tiles 4193/B002/R0005/Floor Coverings Res/Textile/S17	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>No Asbestos Detected Note 1</b>

**B002 - R0006 - Personal Effects Storage**

No Asbestos

**B002 - R0007 - Home Base**

No Asbestos

**B002 - R0008 - Home Base**

No Asbestos

**B002 - R0009 - Personal Effects Storage**

No Asbestos

**B002 - R0010 - Movement**

No Asbestos

**B002 - R0011 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B002/R0003/Ceiling Structures/Linings/S16	9m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B002 - R0012 - Cleaning Distributed Store**

No Asbestos

**B002 - R0013 - General Storeroom**

No Asbestos

**B002 - R0014 - Personal Effects Storage**

No Asbestos

**B002 - R0015 - Home Base**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B002 - R0016 - Home Base</b>						
No Asbestos						
<b>B002 - R0017 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4193/B002/R0003/Ceiling Structures/Linings/S16				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B002 - R0018 - Movement</b>						
No Asbestos						
<b>B002 - R0019 - Personal Effects Storage</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B003 - Administration/General Learning - 1959 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4193/B003/Eaves Linings/S30	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Gable verge Lining	Flat AC Sheeting 4193/B003/Gable verge Lining/S31					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B003 - R0001 - Main Switch Board**

No Asbestos

**B003 - R0002 - Plant**

No Asbestos

**B003 - R0003 - General Storeroom**

No Asbestos

**B003 - R0004 - Principal**

No Asbestos

**B003 - R0005 - General Storeroom**

No Asbestos

**B003 - R0006 - Movement**

No Asbestos

**B003 - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B003/R0008/Ceiling Structures/Linings/S7	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	---	-----	--------------	--------------------	---------	---

**B003 - R0011 - Staff Toilet**

No Asbestos

**B003 - R0014 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B003/R0008/Ceiling Structures/Linings/S7	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	---	-----	--------------	--------------------	---------	---

**B003 - R0015 - Kiln Room**

No Asbestos

**B003 - R0016 - Deputy Principal**

No Asbestos

**B003 - R0018 - Home Base Store**

No Asbestos

**B003 - R0020 - Movement**

No Asbestos

**B003 - R0021 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B003/R0008/Ceiling Structures/Linings/S7	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	---	-----	--------------	--------------------	---------	---

**B003 - R0023 - Home Base Store**

No Asbestos

**B003 - R0024 - Home Base**

No Asbestos

**B003 - R0025 - Entry Vestibule**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B003 - R0026 - Clerical Office</b>						
No Asbestos						
<b>B003 - R0027 - General Storeroom</b>						
No Asbestos						
<b>B003 - R0028 - Staff Room</b>						
No Asbestos						
<b>B003 - R0029 - Movement</b>						
No Asbestos						
<b>B003 - R0030 - Staff Room</b>						
No Asbestos						
<b>B003 - R0031 - Deputy Principal</b>						
No Asbestos						
<b>B003 - R0032 - Staff Kitchen</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B004 - General Learning - 1959 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4193/B004/Eaves Linings/S32	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Gable verge lining	Flat AC Sheeting 4193/B004/Gable verge lining/S33					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Packing 4193/B004/Underfloor Voids/S34	1m2	Between floor joists and piles	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior**

**B004 - R0001 - Home Base**

No Asbestos

**B004 - R0002 - Home Base Store**

No Asbestos

**B004 - R0003 - Personal Effects Storage**

No Asbestos

**B004 - R0004 - Movement**

No Asbestos

**B004 - R0005 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B004/R0005/Ceiling Structures/Linings/S12	9m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Panel above door	Flat AC Sheeting 4193/B004/R0005/Panel above door/S18	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B004 - R0006 - General Storeroom**

No Asbestos

**B004 - R0007 - Cleaning Distributed Store**

No Asbestos

**B004 - R0008 - Personal Effects Storage**

No Asbestos

**B004 - R0009 - Home Base Store**

No Asbestos

**B004 - R0010 - Home Base**

No Asbestos

**B004 - R0011 - Home Base**

No Asbestos

**B004 - R0012 - External Movement**

No Asbestos

**B004 - R0013 - Movement**

No Asbestos

**B004 - R0014 - Personal Effects Storage**

No Asbestos

**B004 - R0015 - Home Base Store**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B005 - General Learning - 1959 - Brick/Block (Brick/Block)**

**Exterior**

Gable verge lining	Flat AC Sheeting 4193/B005/Gable verge lining/S36					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 4193/B005/Eaves Linings/S35	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4193/B005/Underfloor Voids/S37					<b>No Asbestos Detected</b>

**Interior**

**B005 - R0001 - Interview**

No Asbestos

**B005 - R0002 - Staff Room Annexe**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B005/R0006/Ceiling Structures/Linings/S10	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

**B005 - R0003 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B005/R0006/Ceiling Structures/Linings/S10	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

**B005 - R0004 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B005/R0006/Ceiling Structures/Linings/S10	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

**B005 - R0005 - Movement**

No Asbestos

**B005 - R0006 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B005/R0006/Ceiling Structures/Linings/S10	17m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Panel above door	Flat AC Sheeting 4193/B005/R0006/Wall Linings Internal/S11	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B005 - R0007 - Home Base**

No Asbestos

**B005 - R0008 - Home Base**

Electrical Mounting Board	Flat AC Sheeting 4193/B005/R0008/Wall Linings Internal/S9	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
---------------------------	--	-------	-------------	--------------------	---------	--

**B005 - R0009 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B005/R0006/Ceiling Structures/Linings/S10	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Panel above door	Flat AC Sheeting 4193/B005/R0006/Wall Linings Internal/S11	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B005 - R0010 - Movement**

No Asbestos

**B005 - R0011 - Home Base**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>
						No Asbestos
	<b>B005 - R0012 - General Storeroom</b>					No Asbestos
	<b>B005 - R0013 - Home Base Store</b>					No Asbestos
	<b>B005 - R0014 - Practical Activities - 1hb</b>					No Asbestos
	<b>B005 - R0015 - General Storeroom</b>					No Asbestos
	<b>B005 - R0016 - General Storeroom</b>					No Asbestos
	<b>B005 - R0017 - Deputy Principal</b>					No Asbestos
	<b>B005 - R0018 - Special Programs Room</b>					No Asbestos
	<b>B005 - R0019 - Cleaning Distributed Store</b>					No Asbestos
	<b>B005 - R0020 - Cleaning Distributed Store</b>					No Asbestos
	<b>B005 - R0021 - Withdrawal Space - 1hb</b>					No Asbestos
	<b>B005 - R9001 - Sports Store</b>					No Asbestos
	<b>B005 - R9002 - General Assistant/Bulk Store</b>					No Asbestos
	<b>B005 - R9003 - Cleaning Supplies</b>					No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B006 - General Learning - 1965 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4193/B006/Eaves Linings/S38	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
Gable verge lining	Flat AC Sheeting 4193/B006/Gable verge lining/S39					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B006 - R0001 - Home Base**

No Asbestos

**B006 - R0002 - Cleaning Distributed Store**

No Asbestos

**B006 - R0003 - Movement**

Panel above door	Flat AC Sheeting 4193/B006/R0003/Panel above door/S4	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
------------------	---	-----	-------------	--------------------	---------	--

**B006 - R0004 - Cleaning Distributed Store**

No Asbestos

**B006 - R0005 - Movement**

No Asbestos

**B006 - R0006 - General Storeroom**

No Asbestos

**B006 - R0007 - Home Base Store**

No Asbestos

**B006 - R0008 - Home Base Store**

No Asbestos

**B006 - R0009 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B007 - General Learning - 1965 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable verge lining	Flat AC Sheeting 4193/B007/Gable verge lining/S41					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 4193/B007/Eaves Linings/S40	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

**Interior**

**B007 - R0001 - Home Base**

No Asbestos

**B007 - R0002 - Home Base Store**

No Asbestos

**B007 - R0003 - Home Base Store**

No Asbestos

**B007 - R0004 - General Storeroom**

No Asbestos

**B007 - R0005 - Movement**

No Asbestos

**B007 - R0006 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B007/R0006/Ceiling Structures/Linings/S8	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	---	-----	--------------	--------------------	---------	---

**B007 - R0007 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B008 - General Learning - 1965 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable verge lining	Flat AC Sheeting 4193/B008/Gable verge lining/S43					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 4193/B008/Eaves Linings/S42	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4193/B008/Underfloor Voids/S44					<b>No Asbestos Detected</b>

**Interior**

**B008 - R0001 - Home Base**

No Asbestos

**B008 - R0002 - Personal Effects Storage**

No Asbestos

**B008 - R0003 - General Storeroom**

No Asbestos

**B008 - R0004 - Personal Effects Storage**

Panel behind sink	Flat AC Sheeting 4193/B008/R0004/Panel behind sink/S25	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-------------------	---	-----	-------------	--------------------	---------	--

**B008 - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4193/B008/R0005/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>
Panel above door	Flat AC Sheeting 4193/B008/R0005/Panel above door/S14	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B008 - R0006 - External Movement**

No Asbestos

**B008 - R0007 - Home Base**

No Asbestos

**B008 - R9002 - General Storeroom**

No Asbestos

**B008 - R9003 - Main Switch Board**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B009 - Other-After School Care - 1965 - Steel (Steel)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4193/B009/Eaves Linings/S45	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)**

**Interior**

**B009 - R0001 - Toilets - Boys/Girls**

No Asbestos

**B009 - R0002 - Movement**

No Asbestos

**B009 - R0003 - Staff Toilet**

No Asbestos

**B009 - R0004 - Out Of School Hours Care Centre**

No Asbestos

**B009 - R0005 - Out Of School Hours Care Centre**

No Asbestos

**B009 - R0006 - Out Of School Hours Care Centre**

No Asbestos

**B009 - R0007 - Out Of School Hours Care Centre**

No Asbestos

**B009 - R0008 - Covered Outdoor Learning Area**

No Asbestos

**B009 - R0009 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 2005 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Canteen**

No Asbestos

**B00C - R0002 - Canteen Office/Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 2005 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Communal Space**

No Asbestos

**B00H - R0002 - Disabled Shower/Toilet**

No Asbestos

**B00H - R0003 - Toilets - Boys**

No Asbestos

**B00H - R0004 - Sound Cupboard**

No Asbestos

**B00H - R0005 - Toilets - Girls**

No Asbestos

**B00H - R0006 - P.E. Store**

No Asbestos

**B00H - R0007 - Cleaning Distributed Store**

No Asbestos

**B00H - R0008 - Hall Chair Store**

No Asbestos

**B00H - R0009 - Communal/Performance Store**

No Asbestos

**B00H - R0010 - Raised Platform**

No Asbestos

**B00H - R0011 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0012 - Movement**

No Asbestos

**B00H - R0013 - Covered Outdoor Learning Area**

No Asbestos

**B00H - R0014 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B010 - General Learning - 1965 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4193/B010/Eaves Linings/S46	8m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Wall Cladding	Flat AC Sheeting 4193/B010/Wall Cladding/S22					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B010 - R0001 - Home Base**

No Asbestos

**B010 - R0002 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B011 - Administration - 1965 - Steel (Steel)**

**Exterior**

Eaves Linings	Flat AC Sheeting	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B011/Eaves Linings/S47				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ramp to entrance	Compressed AC Sheet				<b>No Asbestos Detected</b>	
	4193/B011/Ramp to entrance/S21					
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B011 - R0001 - Community Clinic**

No Asbestos

**B011 - R0002 - Community Clinic**

No Asbestos

**B011 - R0003 - Staff Toilet**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B013 - Pupil Facilities - 1959 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B013 - R0001 - Drinking Facilities**

No Asbestos

**B013 - R0002 - Drinking Facilities**

No Asbestos

**B013 - R0003 - Drinking Facilities**

No Asbestos

**B013 - R0004 - Drinking Facilities**

No Asbestos

**B013 - R0005 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet 4193/B013/R0005/Partition Walls (Cubicles)/S1	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B013 - R0006 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet 4193/B013/R0005/Partition Walls (Cubicles)/S1	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B013 - R0007 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet 4193/B013/R0005/Partition Walls (Cubicles)/S1	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B014 - General Learning - 1959 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting 4193/B014/Gable Verge Lining/S48					<b>No Asbestos Detected</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B014 - R0001 - Home Base**

No Asbestos

**B014 - R0002 - Library Office/Workroom**

No Asbestos

**B014 - R0003 - Movement**

No Asbestos

**B014 - R0004 - Special Programs Room**

No Asbestos

**B014 - R0005 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	44m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B014/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B015 - Building Services - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B015/Eaves Linings/S49					<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B015 - R0001 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B015/R0001/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B015 - R0002 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B015/R0001/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B015 - R0003 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B015/R0001/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B015 - R0004 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B015/R0001/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B015 - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B015/R0001/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B016 - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B016/Eaves Linings/S50				<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B016 - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B016/R0001/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B016 - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	4193/B016/R0002/Partition Walls (Cubicles)/S23					

**B016 - R0003 - Cleaning Distributed Store**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	4193/B016/R0002/Partition Walls (Cubicles)/S23					

**B016 - R0004 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4193/B016/R0001/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B017 - Building Services - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B017 - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B018 - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Wall Cladding	Compressed AC Sheet 4193/B018/R0001/Wall Linings Internal/S2					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B018 - R0001 - External Movement**

Wall Linings Internal	Compressed AC Sheet 4193/B018/R0001/Wall Linings Internal/S2					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Compressed AC Sheet 4193/B018/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B018 - R0002 - Practical Activities - 1hb**

No Asbestos

**B018 - R0003 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B018 - R0004 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B018 - R0005 - Withdrawal Space - 2hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B018 - R0006 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B018 - R0007 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B018 - R0008 - Practical Activities - 1hb**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B019 - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B019 - R0001 - External Movement**

No Asbestos

**B019 - R0002 - Practical Activities - 1hb**

No Asbestos

**B019 - R0003 - Home Base Store**

No Asbestos

**B019 - R0004 - Home Base**

No Asbestos

**B019 - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B019 - R0006 - Home Base**

No Asbestos

**B019 - R0007 - Home Base Store**

No Asbestos

**B019 - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B020 - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B020 - R0001 - Reading Area**

No Asbestos

**B020 - R0002 - Library Office/Workroom**

No Asbestos

**B020 - R0003 - Communications Room**

No Asbestos

**B020 - R0004 - Staff Toilet**

No Asbestos

**B020 - R0005 - Cleaning Distributed Store**

No Asbestos

**B020 - R0006 - Toilet - Lobby**

No Asbestos

**B020 - R0007 - K.L.A. Store**

No Asbestos

**B020 - R0008 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B020 - R0009 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B021 - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids No Asbestos Found

**Interior**

**B021 - R0001 - External Movement**

No Asbestos

**B021 - R0002 - Practical Activities - 1hb**

No Asbestos

**B021 - R0003 - Home Base Store**

No Asbestos

**B021 - R0004 - Home Base**

No Asbestos

**B021 - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B021 - R0006 - Home Base**

No Asbestos

**B021 - R0007 - Home Base Store**

No Asbestos

**B021 - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B022 - Storage - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids                      No Asbestos Found

**Interior**

**B022 - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D10861 - Learning Unit - Standard/Withdrawal : Placement Date - 23/01/2007**

### Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 602 - D12537 - Learning Unit - Standard With P.A.A. : Placement Date - 31/03/2015**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D13866 - Learning Unit - Standard With P.A.A. : Placement Date - 9/11/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D13965 - Learning Unit - Standard With P.A.A. : Placement Date - 20/03/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D14165 - Learning Unit - Standard With P.A.A. : Placement Date - 3/11/2014**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
<b>R2 - Home Base Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
<b>OS 602 - D14468 - Learning Unit - Standard With P.A.A. : Placement Date - 10/01/2012</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
<b>R2 - Home Base Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
<b>OS 601 - D14595 - Learning Unit - Standard/Withdrawal : Placement Date - 27/02/2001</b>						
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 602 - D14934 - Learning Unit - Standard With P.A.A. : Placement Date - 31/12/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 750 - D15857 - Learning Unit - ESL : Placement Date - 31/05/1999</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				5.76 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Interior**

**R1 - Es1**

End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

**OS 837 - D17111 - Hcap Shower/Change/Toilet : Placement Date - 7/05/2009**

**Exterior**

Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

**Interior**

**R1 - Disabled Shower/Toilet**

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				12 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2

**OS 602 - D17821 - Learning Unit - Standard With P.A.A. : Placement Date - 29/01/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017