


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Biddabah Public School (4206)  
**Region :** Hunter/Central Coast  
**State Electorate :** Lake Macquarie  
**Local Government Area :** Lake Macquarie

**Initial Survey :** Noel Arnold & Associates : 14 - Jan - 2010  
**Reviewed By :** AECOM : 25 - Jun - 2015

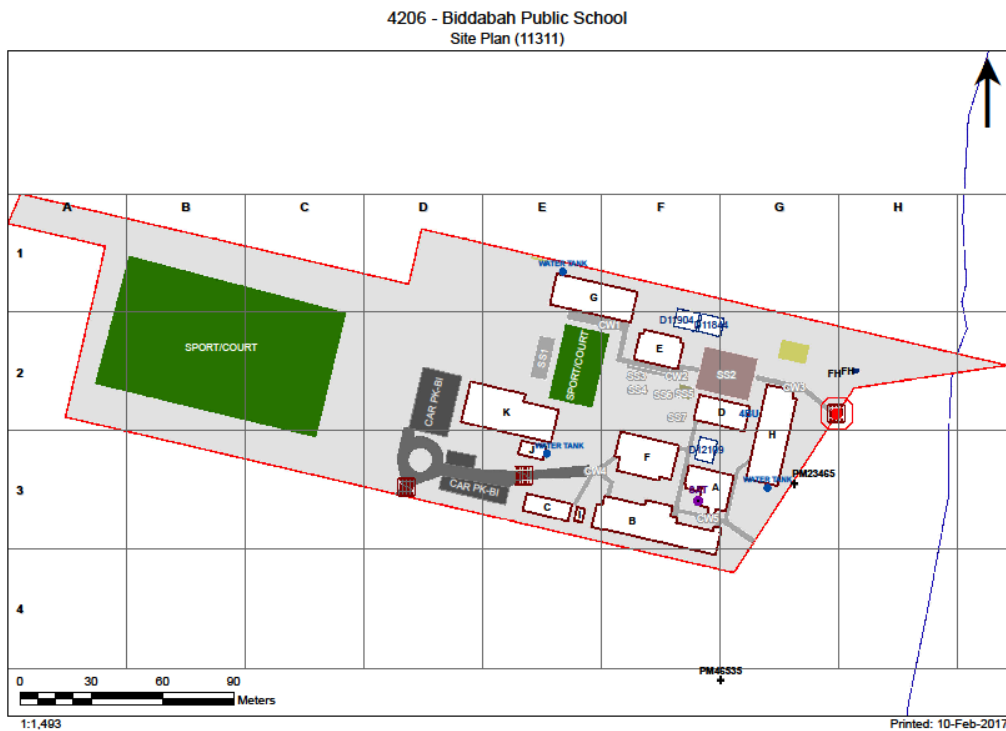

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1960 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/Eaves Linings/S7					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/In-fill-panel/S1					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	AC Fragments/Debris	4Unit	Ground, adjacent to floor space access hatch.	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)
	4206/B00A/Underfloor Voids/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Security Store**

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

**B00A - R0002 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/R0003/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0003 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/R0003/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0006 - Movement**

No Asbestos

**B00A - R0009 - Principal**

No Asbestos

**B00A - R0010 - Movement**

No Asbestos

**B00A - R0011 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00A/R0011/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>

**B00A - R0014 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/Eaves Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00A - R0018 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00A/R0011/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>

**B00A - R0019 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00A/R0011/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>

**B00A - R0020 - Toilets - Boys/Girls**

No Asbestos

**B00A - R0021 - Home Base**

No Asbestos

**B00A - R0022 - Special Programs Room**

No Asbestos

**B00A - R0023 - Special Programs Room**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00A - R0024 - Special Programs Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning/Pupil Facilities - 1960 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	Flat AC sheeting, wall lining. South west underfloor store.	8m2	South east store	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	4206/B00A/Underfloor Voids/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	AC Fragments/Debris	1Unit	South east corner below damaged wall lining.	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)
	4206/B00A/Underfloor Voids/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					

**Interior**

**B00B - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/Eaves Linings/S7				<b>Chrysotile (white asbestos)</b>	

**B00B - R0002 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					

**B00B - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	0.2m2	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
					<b>Assumed Asbestos - Electrical Hazard</b>	

Floor Coverings Res/Textile	Compressed AC Sheet					<b>No Asbestos Detected</b>
	4206/B00B/R0003/Floor Coverings Res/Textile/S16					

**B00B - R0004 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					

**B00B - R0005 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					

Ceiling Structures/Linings	Flat AC Sheeting	3.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0006 - Home Base**

No Asbestos

**B00B - R0007 - Home Base**

No Asbestos

**B00B - R0008 - Practical Activities - 1hb**

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					

**B00B - R0009 - Home Base Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0010 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0011 - Withdrawal Space - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0013 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/Eaves Linings/S7					Chrysotile (white asbestos)
<b>B00B - R0015 - Practical Activities - 1hb</b>						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0016 - Home Base</b>						
No Asbestos						
<b>B00B - R0017 - Home Base</b>						
No Asbestos						
<b>B00B - R0018 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0019 - Home Base Store</b>						
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00B - R0020 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0021 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0022 - Home Base</b>						
No Asbestos						
<b>B00B - R0023 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					No Asbestos Detected
<b>B00B - R0024 - External Movement</b>						
No Asbestos						
<b>B00B - R0025 - Canteen</b>						
Wall Linings Internal	Flat AC Sheeting	60m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Wall Linings Internal/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0025/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>
<b>B00B - R0026 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>
<b>B00B - R0027 - Toilets - Girls/Disabled Cubicle</b>						
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/Eaves Linings/S7					<b>Chrysotile (white asbestos)</b>
<b>B00B - R0028 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4206/B00B/R0002/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1960 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, no floor void access hatch.					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible. No ceiling space access hatch.					

**Interior****B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0002 - Toilets - Boys**

Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/R0003/Wall Linings Internal/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0003 - Toilets - Girls**

Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00A/R0003/Wall Linings Internal/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0004 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4206/B00B/R0025/Floor Coverings Res/Textile/S10					

**B00C - R0005 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0006 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	8.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0007 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	8.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00B/R0025/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Area inaccessible, no ceiling space access hatch.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible. No void, no access hatch.					

**Interior**

**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	33.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4206/B00D/R0001/Wall Linings Internal/S18					

**B00D - R0002 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>	

**B00D - R0003 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>	

**B00D - R0004 - Home Base**

No Asbestos

**B00D - R0005 - Home Base**

No Asbestos

**B00D - R0006 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>	

**B00D - R0007 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4206/B00D/R0001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>	

**B00D - R0008 - External Movement**

No Asbestos





Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1998 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - External Movement**

No Asbestos

**B00E - R0002 - Practical Activities - 1hb**

No Asbestos

**B00E - R0003 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00E - R0004 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00E - R0005 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00E - R0006 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00E - R0007 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00E - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 2003 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0002 - K.L.A. Store**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0003 - Staff Toilet**

No Asbestos

**B00F - R0004 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0005 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0006 - Library Office/Workroom**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0007 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0008 - Communications Room**

No Asbestos

**B00F - R0009 - Cleaning Distributed Store**

No Asbestos

**B00F - R0010 - K.L.A. Store**

No Asbestos

**B00F - R0011 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 2008 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - External Movement**

No Asbestos

**B00G - R0002 - Practical Activities - 1hb**

No Asbestos

**B00G - R0003 - Home Base Store**

No Asbestos

**B00G - R0004 - Home Base**

No Asbestos

**B00G - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00G - R0006 - Home Base**

No Asbestos

**B00G - R0007 - Home Base Store**

No Asbestos

**B00G - R0008 - Practical Activities - 1hb**

No Asbestos

**B00G - R0009 - Practical Activities - 1hb**

No Asbestos

**B00G - R0010 - Home Base Store**

No Asbestos

**B00G - R0011 - Home Base**

No Asbestos

**B00G - R0012 - Withdrawal Space - 2hb**

No Asbestos

**B00G - R0013 - Home Base**

No Asbestos

**B00G - R0014 - Home Base Store**

No Asbestos

**B00G - R0015 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Administration/General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible. No floor space, slab on ground.

**Interior**

**B00H - R0001 - External Movement**

No Asbestos

**B00H - R0002 - Entry Vestibule**

No Asbestos

**B00H - R0003 - Movement**

No Asbestos

**B00H - R0004 - Interview**

No Asbestos

**B00H - R0005 - Principal**

No Asbestos

**B00H - R0006 - Deputy Principal**

No Asbestos

**B00H - R0007 - Staff Toilet**

No Asbestos

**B00H - R0008 - Staff Toilet**

No Asbestos

**B00H - R0009 - Staff Room**

No Asbestos

**B00H - R0010 - Staff Room Annexe**

No Asbestos

**B00H - R0011 - Security Store**

No Asbestos

**B00H - R0012 - Interview/Office - Type 3**

No Asbestos

**B00H - R0013 - Cleaning Distributed Store**

No Asbestos

**B00H - R0014 - Staff Toilet**

No Asbestos

**B00H - R0015 - Access Shower/Toilet**

No Asbestos

**B00H - R0016 - Sick Bay**

No Asbestos

**B00H - R0017 - Duplicating Workroom**

No Asbestos

**B00H - R0018 - Clerical Office**

No Asbestos

**B00H - R0019 - Main Switch Board**

No Asbestos

**B00H - R0020 - Home Base/Practical Activities**

No Asbestos

**B00H - R0021 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0022 - Home Base Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Building Services - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B001 - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Other - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00J - R0001 - Canteen**

No Asbestos

**B00J - R0002 - Canteen Office/Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00K - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00K - R0001 - Communal Space**

No Asbestos

**B00K - R0002 - Raised Platform**

No Asbestos

**B00K - R0003 - Movement**

No Asbestos

**B00K - R0004 - Stairs**

No Asbestos

**B00K - R0005 - Movement**

No Asbestos

**B00K - R0006 - Hall Chair Store**

No Asbestos

**B00K - R0007 - Communal/Performance Store**

No Asbestos

**B00K - R0008 - Toilets - Girls**

No Asbestos

**B00K - R0009 - Toilet - Lobby**

No Asbestos

**B00K - R0010 - P.E. Store**

No Asbestos

**B00K - R0011 - Toilet - Lobby**

No Asbestos

**B00K - R0012 - Toilets - Boys**

No Asbestos

**B00K - R0013 - Sound Cupboard**

No Asbestos

**B00K - R0014 - Cleaning Distributed Store**

No Asbestos

**B00K - R0015 - Plant**

No Asbestos

**B00K - R0016 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00K - R0017 - Access Shower/Toilet/Change**

No Asbestos

**B00K - R0018 - Outdoor Learning Area**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D11844 - Learning Unit - Standard With P.A.A. : Placement Date - 9/07/2012**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

**R2 - Home Base Store**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 603 - D11904 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 14/03/2007**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12109 - Learning Unit - Standard With P.A.A. : Placement Date - 21/10/1997**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017