


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bullarah Public School (4228)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Moree Plains

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : AECOM : 29 - Apr - 2016

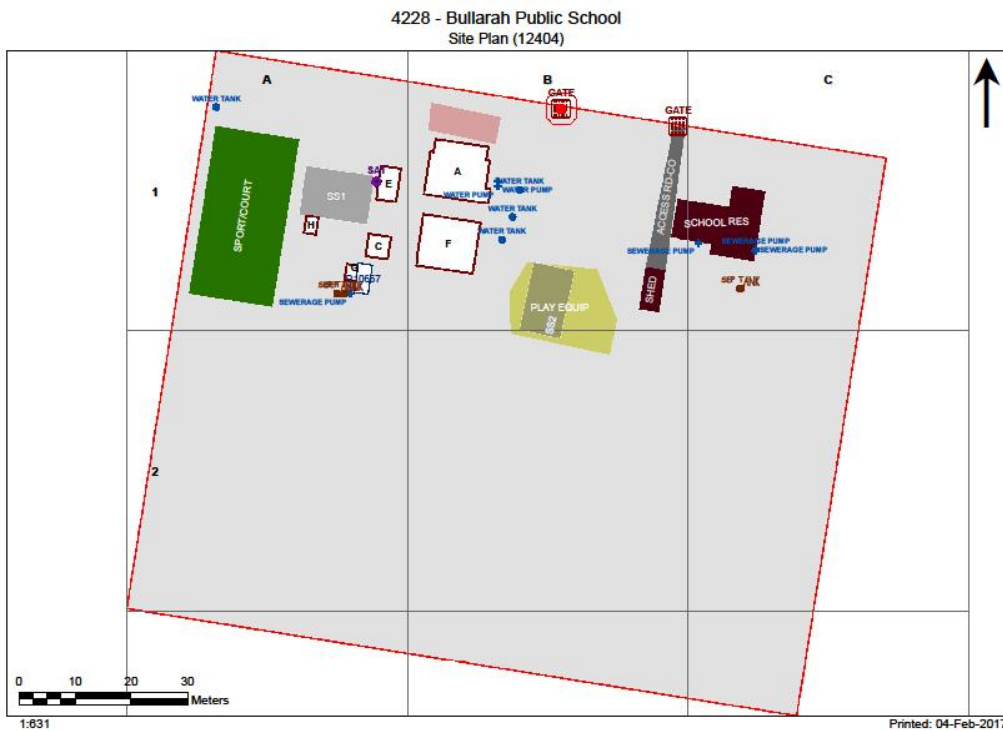

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1959 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction AR0008, 3.5m					
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard - visually assumed						
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction 3.8m						
Wall Cladding	Flat AC Sheeting 4228/B00A/Wall Cladding/S1					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris	15Unit	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	Medium Priority (4-5)
Assumed Asbestos - Area inaccessible western access						

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4228/B00A/R0001/Ceiling Structures/Linings/S2	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Wall Linings Internal	Flat AC Sheeting 4228/B00A/R0001/Wall Linings Internal/S3	20m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos)						

B00A - R0006 - Resource/Toy Space

No Asbestos

B00A - R0007 - Staff Toilet

No Asbestos

B00A - R0008 - Clerical Office/Workroom

No Asbestos

B00A - R0009 - Reading Area

No Asbestos

B00A - R0010 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1959 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible slab to ground, no access points.

Interior

B00C - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1959 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible slab to ground, no access points.					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible no access points.					
Eaves Linings	Flat AC Sheeting 4228/B00E/Eaves Linings/S4					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 4228/B00A/Wall Cladding/S1					No Asbestos Detected

Interior

B00E - R0001 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible slab to ground, no access points.

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2007 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible slab to ground, no access points.

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 843 - D10667 - Country Toilet - Reltb - Boys/Girls : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	2 m2

R3 - Female toilet

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017