


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Balarang Public School (4291)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Shellharbour

Initial Survey : Noel Arnold & Associates : 04 - May - 2008
Reviewed By : AECOM : 18 - Jun - 2015

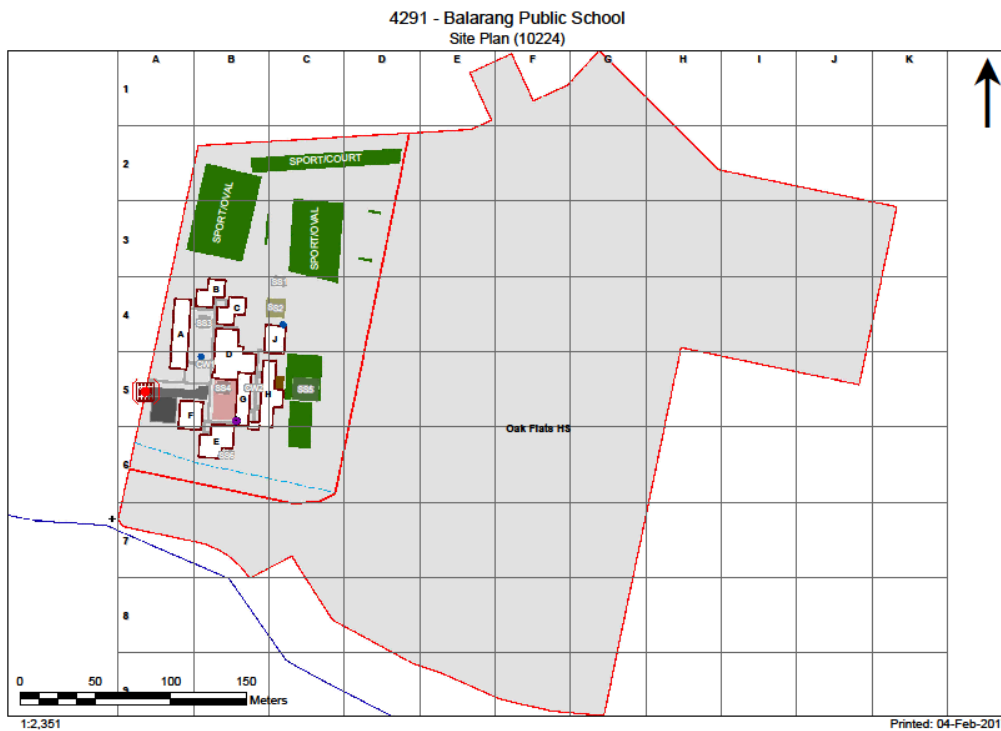

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00A/R0011/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
In-fill-panel	Compressed AC Sheet					No Asbestos Detected
	4291/B00C/In-fill-panel/S5					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00A/R0011/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	

B00A - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00A/R0011/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	

B00A - R0012 - Toilets - Boys

Recently Modified Space Requires Inspection

B00A - R0013 - Disabled Shower/Toilet

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Building Services - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00B/Eaves Linings/S9					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Height Restriction
Ceiling Voids - Raked Ceiling	Non Accessible Area					- Area inaccessible
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00B - R0001 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00G/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00B - R0002 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00C/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00B - R0003 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00C/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00B - R0004 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00D/R0013/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0005 - Withdrawal Space - 1hb

No Asbestos

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - General Storeroom

No Asbestos

B00B - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0009 - Craft Store

No Asbestos

B00B - R0010 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00B/Eaves Linings/S9					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Height Restriction
In-fill-panel	Compressed AC Sheet					No Asbestos Detected
	4291/B00C/In-fill-panel/S5					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00C - R0001 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00C/R0006/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0002 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00C/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Withdrawal Space - 1hb

No Asbestos

B00C - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00C/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00C - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00C/R0006/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0007 - Movement

No Asbestos

B00C - R0008 - Sports Store

No Asbestos

B00C - R0009 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities/Pupil Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00D - R0001 - Communal Space

No Asbestos

B00D - R0002 - Raised Platform

Floor Coverings Res/Textile	Vinyl Tiles					
4291/B00F/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected		

B00D - R0003 - Hall Chair Store

No Asbestos

B00D - R0004 - General Assistant/Bulk Store

No Asbestos

B00D - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0006 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		

B00D - R0007 - Staff Toilet

No Asbestos

B00D - R0008 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		

B00D - R0009 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		

B00D - R0010 - Movement

No Asbestos

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - General Assistant/Bulk Store

No Asbestos

B00D - R0013 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00D/R0013/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00D/R0018/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0015 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

No Asbestos

B00D - R0016 - Movement

No Asbestos

B00D - R0017 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00D/R0018/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0018 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00D/R0013/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00D/R0018/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0019 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00D/R0018/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00E/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00E - R0001 - Seminar/Study

No Asbestos

B00E - R0002 - Library Office/Workroom

No Asbestos

B00E - R0003 - Seminar/Study

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00E - R0004 - Communications Room

No Asbestos

B00E - R0005 - Reading Area

No Asbestos

B00E - R0006 - Library Office/Workroom

No Asbestos

B00E - R0007 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00E - R0008 - Cleaning Distributed Store

No Asbestos

B00E - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0010 - Movement

No Asbestos

B00E - R0011 - Toilets - Girls

No Asbestos

B00E - R0012 - Toilets - Boys

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Administration/Staff Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00F/Eaves Linings/S7					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00F - R0001 - Principal

No Asbestos

B00F - R0002 - Staff Room Annexe

No Asbestos

B00F - R0003 - Movement

No Asbestos

B00F - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00F/Eaves Linings/S7					Chrysotile (white asbestos)

B00F - R0005 - Interview

No Asbestos

B00F - R0006 - Clerical Office

No Asbestos

B00F - R0007 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00F - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00F - R0009 - Sick Bay

Floor Coverings Res/Textile	Vinyl Tiles					
	4291/B00F/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00F - R0010 - Staff Room Annexe

No Asbestos

B00F - R0011 - Cleaning Supplies

No Asbestos

B00F - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0013 - Cleaning Distributed Store

No Asbestos

B00F - R0014 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4291/B00F/R0014/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00F - R0015 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00F/R0014/Wall Linings Internal/S2					Chrysotile (white asbestos)	
B00F - R0016 - Staff Room						
Floor Coverings Res/Textile	Vinyl Tiles					
4291/B00F/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Staff Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00G - R0001 - Home Base

No Asbestos

B00G - R0002 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00G - R0007 - General Storeroom

No Asbestos

B00G - R0008 - Special Programs Room

No Asbestos

B00G - R0009 - Movement

No Asbestos

B00G - R0010 - Movement

No Asbestos

B00G - R0011 - Staff Toilet

No Asbestos

B00G - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0013 - General Storeroom

No Asbestos

B00G - R0014 - Cleaning Distributed Store

No Asbestos

B00G - R0015 - Staff Shower/Change

No Asbestos

B00G - R0016 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00G - R0017 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00G - R0018 - Movement

No Asbestos

B00G - R0019 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4291/B00G/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00H - R0001 - Home Base

No Asbestos

B00H - R0002 - Home Base Store

No Asbestos

B00H - R0005 - Home Base

No Asbestos

B00H - R0006 - Home Base Store

No Asbestos

B00H - R0007 - Home Base

No Asbestos

B00H - R0008 - Toilets - Boys/Girls

No Asbestos

B00H - R0009 - Home Base Store

No Asbestos

B00H - R0012 - Home Base

No Asbestos

B00H - R0013 - Home Base Store

No Asbestos

B00H - R0014 - Movement

No Asbestos

B00H - R0015 - General Assistant/Bulk Store

No Asbestos

B00H - R0016 - General Assistant/Bulk Store

No Asbestos

B00H - R0017 - Main Switch Board

No Asbestos

B00H - R0018 - Outdoor Learning Area

No Asbestos

B00H - R0019 - Personal Effects Storage

No Asbestos

B00H - R0020 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - General Learning/Special Purpose Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00J - R0001 - Practical Activities

No Asbestos

B00J - R0002 - Withdrawal Space - 1hb

No Asbestos

B00J - R0003 - Home Base Store

No Asbestos

B00J - R0004 - Special Programs Room

No Asbestos

B00J - R0005 - Security Store

No Asbestos

B00J - R0006 - Security Store

No Asbestos

B00J - R0007 - Garden Store

No Asbestos

B00J - R0008 - General Assistant/Bulk Store

No Asbestos

B00J - R0009 - Sports Store

No Asbestos

B00J - R0010 - Home Base

No Asbestos

B00J - R0011 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017