


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bardia Public School (4311)  
**Region :** South Western Sydney  
**State Electorate :** Macquarie Fields  
**Local Government Area :** Campbelltown

**Initial Survey :** Noel Arnold & Associates : 19 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 28 - Dec - 2016

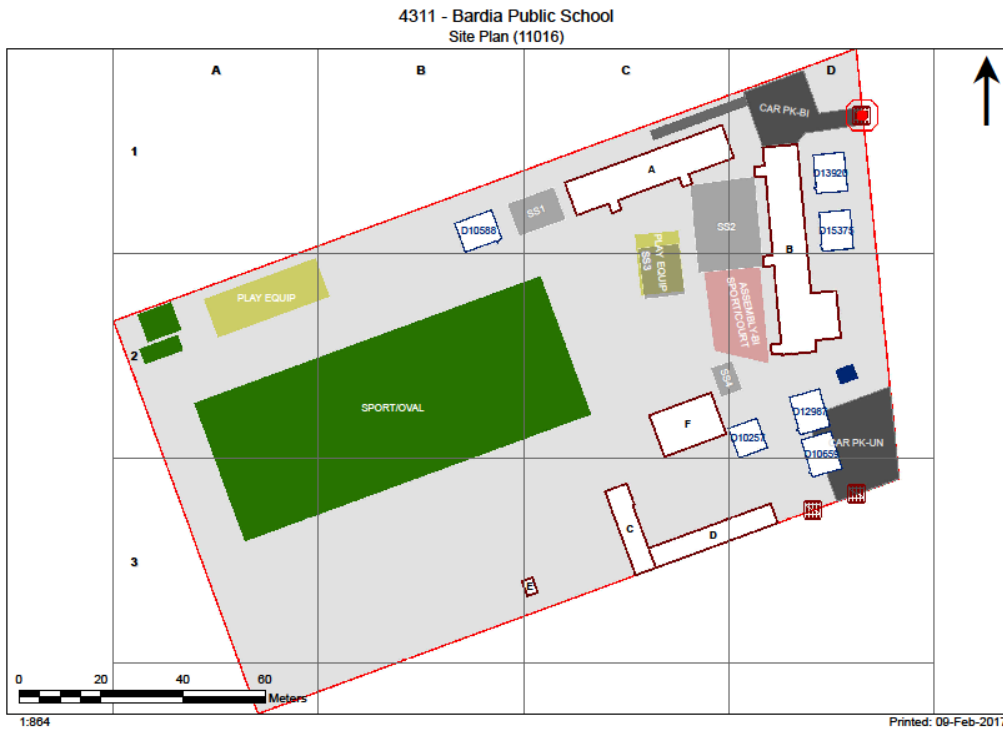

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/Eaves Linings/S6					<b>Chrysotile (white asbestos)</b>
Gable Ends	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/Gable Ends/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Void	No Asbestos Found					

**Interior**

**B00A - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/R9004/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0002 - Personal Effects Storage**

No Asbestos

**B00A - R0003 - Home Base**

No Asbestos

**B00A - R0004 - Home Base Store**

No Asbestos

**B00A - R0005 - General Storeroom**

No Asbestos

**B00A - R0006 - K.L.A. Store**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - Home Base Store**

No Asbestos

**B00A - R0009 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0010 - Home Base**

No Asbestos

**B00A - R0011 - Home Base**

No Asbestos

**B00A - R0012 - Home Base Store**

No Asbestos

**B00A - R0013 - Personal Effects Storage**

No Asbestos

**B00A - R0014 - Personal Effects Storage**

No Asbestos

**B00A - R0015 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/R9004/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0016 - Home Base**

No Asbestos

**B00A - R0017 - Home Base Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R9001 - General Storeroom</b>						
No Asbestos						
<b>B00A - R9002 - Sports Store</b>						
No Asbestos						
<b>B00A - R9003 - Toilets - Girls</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4311/B00A/R9004/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R9004 - Drinking Facilities</b>						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4311/B00A/R9004/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R9005 - Drinking Facilities</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4311/B00A/R9004/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R9006 - Toilets - Boys</b>						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4311/B00A/R9004/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R9007 - Garden Store</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Administration - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/Eaves Linings/S6					<b>Chrysotile (white asbestos)</b>
Gable Ends	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00A/Gable Ends/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4311/B00B/Underfloor Voids/S9					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4311/B00B/Underfloor Voids/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B00B - R0001 - Principal**

No Asbestos

**B00B - R0002 - General Storeroom**

No Asbestos

**B00B - R0003 - Plant**

No Asbestos

**B00B - R0004 - General Storeroom**

No Asbestos

**B00B - R0005 - Staff Toilet**

No Asbestos

**B00B - R0006 - Entry Vestibule**

No Asbestos

**B00B - R0007 - External Movement**

No Asbestos

**B00B - R0008 - Sick Bay**

No Asbestos

**B00B - R0009 - Movement**

No Asbestos

**B00B - R0010 - Clerical Office**

No Asbestos

**B00B - R0011 - Clerical Office**

No Asbestos

**B00B - R0012 - Staff Room**

No Asbestos

**B00B - R0013 - General Storeroom**

No Asbestos

**B00B - R0014 - Interview**

No Asbestos

**B00B - R0015 - Special Programs Room**

No Asbestos

**B00B - R0016 - Personal Effects Storage**

No Asbestos

**B00B - R0017 - Home Base Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00B - R0018 - Movement**

No Asbestos

**B00B - R0019 - External Movement**

No Asbestos

**B00B - R0020 - Home Base**

No Asbestos

**B00B - R0021 - Practical Activities - 1hb**

No Asbestos

**B00B - R0022 - Home Base**

No Asbestos

**B00B - R0023 - External Movement**

No Asbestos

**B00B - R0024 - Home Base Store**

No Asbestos

**B00B - R0025 - Toilets - Boys/Girls**

No Asbestos

**B00B - R0026 - Personal Effects Storage**

No Asbestos

**B00B - R0027 - Movement**

No Asbestos

**B00B - R0028 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1962 - Timber (Timber)**

**Exterior**

Underfloor Voids	Flat AC Sheeting	1m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4311/B00D/Underfloor Voids/S10					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B00C - R0001 - Other-Community Use**

No Asbestos

**B00C - R0002 - Staff Shower/Change**

Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00C/R0002/Wall Linings Internal/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0003 - Covered Outdoor Learning Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1962 - Timber (Timber)****Exterior**

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4311/B00D/Underfloor Voids/S10					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4311/B00D/Underfloor Voids/S12					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior****B00D - R0001 - Clerical Office**

No Asbestos

**B00D - R0002 - Movement**

No Asbestos

**B00D - R0003 - Communal Space**

No Asbestos

**B00D - R0006 - Movement**

No Asbestos

**B00D - R0007 - Clerical Office**

No Asbestos

**B00D - R0008 - Movement**

No Asbestos

**B00D - R0009 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00D/R0009/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	12m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00D/R0010/Wall Linings Internal/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00D - R0010 - Toilets - Boys/Girls**

Wall Linings Internal	Flat AC Sheeting	6m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00D/R0010/Wall Linings Internal/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00D - R0011 - Communal Space**

No Asbestos

**B00D - R0012 - Performance Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Building Services - 1962 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4311/B00E/Eaves Linings/S7				<b>Chrysotile (white asbestos)</b>	
Roof	Corrugated AC Sheeting	12m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	4311/B00E/Roof/S13				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00E - R0001 - Sports Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Movement**

No Asbestos

**B00F - R0002 - Reading Area**

No Asbestos

**B00F - R0003 - Library Office/Workroom**

No Asbestos

**B00F - R0004 - Communications Room**

No Asbestos

**B00F - R0005 - K.L.A. Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 801 - D10257 - FSU : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		8.64 m2

### Interior

#### R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		45 m2

#### R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

**OS 602 - D10588 - Learning Unit - Standard With P.A.A. : Placement Date - 12/11/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D10659 - Learning Unit - Standard With P.A.A. : Placement Date - 22/07/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D12987 - Learning Unit - Standard With P.A.A. : Placement Date - 28/10/2014**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos		70 m2
---------	---------------	------------------	--	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		3 m2

**- D13144 - : Placement Date - 30/08/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**OS 602 - D13920 - Learning Unit - Standard With P.A.A. : Placement Date - 24/11/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D15375 - Learning Unit - Standard With P.A.A. : Placement Date - 24/09/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**- D17098 - : Placement Date - 30/08/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**There are no asbestos related file attachment(s) for this school.**

2017