


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Busby Public School (4337)
Region : South Western Sydney
State Electorate : Liverpool
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 06 - May - 2008
Reviewed By : Parsons Brinckerhoff : 03 - Jan - 2017

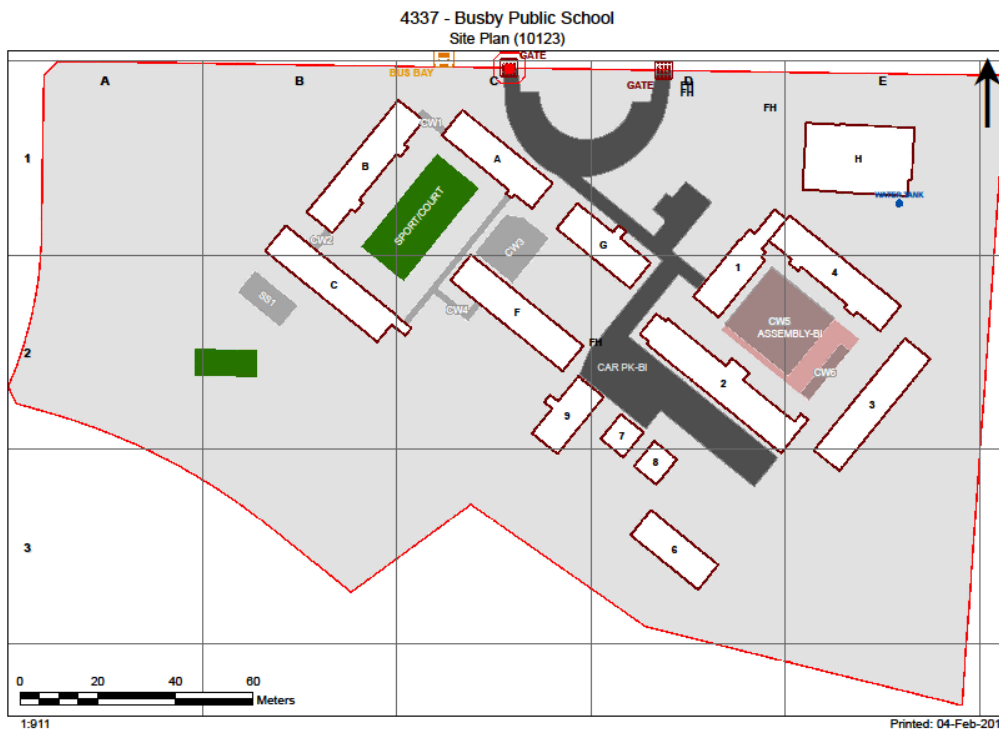

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Staff Facilities/Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Eaves Linings/S12			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Gable Verge Lining/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Non Accessible Area - No access - No key to locked manhole access					
Ceiling Void	No Asbestos Found					

Interior**B001 - R0001 - Movement**

No Asbestos

B001 - R0002 - Canteen Office/Store

No Asbestos

B001 - R0003 - Canteen Office/Store

No Asbestos

B001 - R0004 - Canteen

No Asbestos

B001 - R0005 - Staff Room

No Asbestos

B001 - R0006 - Movement

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B001/R0006/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0007 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B001/R0006/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0008 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B001/R0006/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0009 - Cleaning Distributed Store

Non Accessible

B001 - R0010 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B001/R0010/Ceiling Structures/Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B001/R0010/Wall Linings Internal/S26			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B001 - R0011 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4337/B001/R0011/Floor Coverings Res/Textile/S9			No Asbestos Detected		

B001 - R0012 - Interview

No Asbestos

B001 - R0013 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B002/R0009/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		

In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0015 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B002/R0009/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		

In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0016 - Entry Vestibule

No Asbestos

B001 - R0017 - Plant

No Asbestos

B001 - R0018 - Staff Room Annexe

No Asbestos

B001 - R0019 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Eaves Linings/S12			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Gable Verge Lining/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4337/B00F/Underfloor Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B002 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B002 - R0002 - Movement

No Asbestos

B002 - R0003 - Personal Effects Storage

No Asbestos

B002 - R0004 - Home Base

No Asbestos

B002 - R0005 - Home Base

No Asbestos

B002 - R0006 - Personal Effects Storage

No Asbestos

B002 - R0007 - General Storeroom

No Asbestos

B002 - R0008 - Movement

No Asbestos

B002 - R0009 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B002 - R0010 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B002 - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B002 - R0012 - Cleaning Distributed Store						
No Asbestos						
B002 - R0013 - Home Base						
No Asbestos						
B002 - R0014 - Home Base						
No Asbestos						
B002 - R0015 - Personal Effects Storage						
No Asbestos						
B002 - R0016 - Movement						
No Asbestos						
B002 - R0017 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B002 - R0018 - General Storeroom						
No Asbestos						
B002 - R9001 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - General Learning/Support Unit - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Eaves Linings/S12			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Gable Verge Lining/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4337/B00F/Underfloor Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B003 - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B003/R0015/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B003/R0015/In-fill-panel/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B003 - R0002 - Movement

No Asbestos

B003 - R0003 - Home Base Store

No Asbestos

B003 - R0004 - Home Base - P

No Asbestos

B003 - R0005 - Practical Activities - P - 1hb

No Asbestos

B003 - R0006 - Toilets - Boys/Girls

No Asbestos

B003 - R0007 - Home Base Store

No Asbestos

B003 - R0008 - Home Base - P

No Asbestos

B003 - R0009 - Home Base - P

No Asbestos

B003 - R0010 - Cleaning Distributed Store

No Asbestos

B003 - R0011 - Home Base Store

No Asbestos

B003 - R0012 - General Storeroom

No Asbestos

B003 - R0013 - Personal Effects Storage

No Asbestos

B003 - R0014 - Movement

No Asbestos

B003 - R0015 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B003/R0015/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B003/R0015/In-fill-panel/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B003 - R0016 - Craft Store

No Asbestos

B003 - R0017 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - General Learning/Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	57m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Eaves Linings/S12					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Gable Verge Lining/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B004 - R0001 - P.E. Store

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0004 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0005 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0006 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0009 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B004 - R0010 - Handwashing Facilities

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B002/R0009/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B004 - R0011 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B002/R0009/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B004 - R0012 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B002/R0009/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B004 - R1001 - Home Base						
No Asbestos						
B004 - R1002 - Home Base Store						
No Asbestos						
B004 - R1003 - Personal Effects Storage						
No Asbestos						
B004 - R1004 - General Storeroom						
No Asbestos						
B004 - R1005 - Movement						
No Asbestos						
B004 - R1006 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B003/R0015/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B003/R0015/In-fill-panel/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B004 - R1007 - Home Base						
No Asbestos						
B004 - R1008 - Home Base Store						
No Asbestos						
B004 - R1009 - Home Base						
No Asbestos						
B004 - R1010 - Home Base Store						
No Asbestos						
B004 - R1011 - Personal Effects Storage						
No Asbestos						
B004 - R1012 - Movement						
No Asbestos						
B004 - R1013 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B003/R0015/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B003/R0015/In-fill-panel/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B004 - R1014 - Personal Effects Storage						
No Asbestos						
B004 - R1015 - Home Base						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - Communal Facilities - 1963 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4337/B006/Underfloor Voids/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4337/B006/Underfloor Voids/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B006 - R0001 - Cleaning Distributed Store

No Asbestos

B006 - R0002 - Raised Platform

No Asbestos

B006 - R0003 - Communal/Performance Store

No Asbestos

B006 - R0004 - Communal Space

No Asbestos

B006 - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Other-Community Use - 1963 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	Non Accessible Area - No Access - Manhole is bolted shut

Interior

B007 - R0001 - Other-Community Use

No Asbestos

B007 - R0002 - Other-Community Use

No Asbestos

B007 - R0003 - Other-Community Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - General Learning - 1963 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B008 - R0001 - Movement

No Asbestos

B008 - R0002 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - Staff Facilities/Building Services - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Eaves Linings/S12			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B009/Gable Verge Lining/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4337/B00F/Underfloor Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B009 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B002/R0009/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B009 - R0002 - Other-Vacant

No Asbestos

B009 - R0003 - Home Base

No Asbestos

B009 - R0004 - Home Base Store

No Asbestos

B009 - R0005 - General Storeroom

No Asbestos

B009 - R0006 - Movement

No Asbestos

B009 - R0007 - General Storeroom

No Asbestos

B009 - R0008 - Home Base

No Asbestos

B009 - R0009 - Cleaning Distributed Store

No Asbestos

B009 - R9001 - General Storeroom

No Asbestos

B009 - R9002 - Cleaning Supplies

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Eaves Linings/S13				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Gable Verge Lining/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4337/B00A/Underfloor Voids/S17				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4337/B00A/Underfloor Voids/S20				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					

Interior**B00A - R0001 - Duplicating Workroom**

No Asbestos

B00A - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0002/Wall Linings Internal/S1				Chrysotile (white asbestos)	

B00A - R0003 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0002/Wall Linings Internal/S1				Chrysotile (white asbestos)	

B00A - R0004 - Clerical Office

No Asbestos

B00A - R0005 - Uniform Shop

No Asbestos

B00A - R0006 - Security Store

No Asbestos

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Entry Vestibule

No Asbestos

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0010 - Principal

No Asbestos

B00A - R0011 - Staff Toilet

No Asbestos

B00A - R0012 - General Storeroom

No Asbestos

B00A - R0013 - General Storeroom

No Asbestos

B00A - R0014 - Cleaning Distributed Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0015 - Distribution Board						
No Asbestos						
B00A - R0016 - Community Clinic						
No Asbestos						
B00A - R0017 - Sick Bay						
No Asbestos						
B00A - R0018 - Interview						
No Asbestos						
B00A - R0019 - Movement						
No Asbestos						
B00A - R0020 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R9001 - Security Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Eaves Linings/S13				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Gable Verge Lining/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Home Base**

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	1m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Home Base Store

No Asbestos

B00B - R0010 - Personal Effects Storage

No Asbestos

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	1m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0013 - Home Base Store

No Asbestos

B00B - R0014 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R9001 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
4337/B00B/R9012/Partition Walls (Cubicles)/S5						
B00B - R9002 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9003 - Handwashing Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9004 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9005 - Sports Store						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9006 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9007 - Sports Store						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9008 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9009 - Handwashing Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9010 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9011 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9012 - Toilets - Girls						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00B/R9012/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					
	4337/B00B/R9012/Partition Walls (Cubicles)/S5			No Asbestos Detected		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Eaves Linings/S13				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Gable Verge Lining/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4337/B00C/Underfloor Voids/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0002 - Home Base

No Asbestos

B00C - R0003 - Home Base Store

No Asbestos

B00C - R0004 - Craft Store

No Asbestos

B00C - R0005 - Personal Effects Storage

No Asbestos

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00B/R9012/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0008 - Home Base Store

No Asbestos

B00C - R0009 - Home Base Store

No Asbestos

B00C - R0010 - Home Base

No Asbestos

B00C - R0011 - Home Base

No Asbestos

B00C - R0012 - Home Base Store

No Asbestos

B00C - R0013 - Craft Store

No Asbestos

B00C - R0014 - Personal Effects Storage

No Asbestos

B00C - R0015 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R0016 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

4337/B00B/R9012/Ceiling Structures/Linings/S4	Chrysotile (white asbestos) , Amosite (brown asbestos)
---	---

In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	----	----------------------	--------------------	---------	--------------------

4337/B00A/R0020/In-fill-panel/S2	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------------	---

B00C - R0017 - General Storeroom

No Asbestos

B00C - R0018 - Home Base Store

No Asbestos

B00C - R0019 - Home Base

No Asbestos

B00C - R9001 - Security Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Eaves Linings/S13			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Gable Verge Lining/S14			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4337/B00F/Underfloor Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - General Storeroom

No Asbestos

B00F - R0004 - Personal Effects Storage

No Asbestos

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/R0006/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0007 - General Storeroom

No Asbestos

B00F - R0008 - Home Base Store

No Asbestos

B00F - R0009 - Home Base

No Asbestos

B00F - R0010 - Home Base

No Asbestos

B00F - R0011 - Home Base Store

No Asbestos

B00F - R0012 - Home Base Store

No Asbestos

B00F - R0013 - Personal Effects Storage

No Asbestos

B00F - R0014 - Movement

No Asbestos

B00F - R0015 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00F/R0006/Ceiling Structures/Linings/S23				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0016 - Home Base Store

No Asbestos

B00F - R0017 - Home Base Store

No Asbestos

B00F - R0018 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Eaves Linings/S13				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00F/Gable Verge Lining/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4337/B00G/Underfloor Voids/S22				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00G/R9001/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00A/R0020/In-fill-panel/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0002 - Reading Area

No Asbestos

B00G - R0003 - K.L.A. Store

No Asbestos

B00G - R0004 - Staff Toilet

No Asbestos

B00G - R0005 - Staff Toilet

No Asbestos

B00G - R0006 - Library Office/Workroom

No Asbestos

B00G - R0007 - K.L.A. Store

No Asbestos

B00G - R9001 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4337/B00G/R9001/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Communal Space

No Asbestos

B00H - R0002 - Movement

No Asbestos

B00H - R0003 - Raised Platform

No Asbestos

B00H - R0004 - Movement

No Asbestos

B00H - R0005 - Movement

No Asbestos

B00H - R0006 - Hall Chair Store

No Asbestos

B00H - R0007 - Communal/Performance Store

No Asbestos

B00H - R0008 - P.E. Store

No Asbestos

B00H - R0009 - Toilet - Lobby

No Asbestos

B00H - R0010 - Toilets - Girls

No Asbestos

B00H - R0011 - Sound Cupboard

No Asbestos

B00H - R0012 - Toilet - Lobby

No Asbestos

B00H - R0013 - Toilets - Boys

No Asbestos

B00H - R0014 - Cleaning Distributed Store

No Asbestos

B00H - R0015 - Plant

No Asbestos

B00H - R0016 - Main Switch Board

No Asbestos

B00H - R0017 - Access Shower/Toilet

No Asbestos

B00H - R0018 - Covered Outdoor Learning Area

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017