

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Belair Public School (4370)
Region : Hunter/Central Coast
State Electorate : Charlestown
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 02 - Apr - 2008
Reviewed By : AECOM : 17 - Jun - 2016



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible. Staff within room requested that we did not enter man hole (ceiling lining contains ACM).					
Gable Verge Lining	Flat AC Sheeting	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	14m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	8m2	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	2m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Duplicating Workroom**

Floor Coverings Res/Textile	Vinyl Tiles	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00A - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Wall tiles	Vinyl Tiles	4370/B00A/R0002/Wall tiles/S21				No Asbestos Detected

B00A - R0003 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	North, South, West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4370/B00E/Room+1/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Wall tiles	Vinyl Tiles	4370/B00A/R0002/Wall tiles/S21				No Asbestos Detected

B00A - R0005 - Deputy Principal

No Asbestos

B00A - R0006 - Sick Bay

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Entry Vestibule

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R0009 - Movement

No Asbestos

B00A - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	8m	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	2m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)	

B00A - R0011 - Clerical Office

Ceiling Structures/Linings	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	26m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

B00A - R0012 - Library Office/Workroom

No Asbestos

B00A - R0013 - Cleaning Distributed Store

No Asbestos

B00A - R0014 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

B00A - R0015 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

B00A - R0016 - Principal

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Staff Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris	0.5m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	4370/B00B/Underfloor Voids - Packing to Floor Joists/S23					Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	14m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	14m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	3m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting	0.02m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Interior

B00B - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	11m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	3m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)

B00B - R0002 - Staff Room

No Asbestos

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base

No Asbestos

B00B - R0007 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

B00B - R0008 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void hatch located.					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible no void hatch located.					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	14m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	10m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	3m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	4m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	2m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	4m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00C - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground.					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 4370/B00D/Gable Verge Lining/S3	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Eaves Linings	Flat AC Sheeting 4370/B00D/R0001/Ceiling Structures/Linings/S1	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel	Flat AC Sheeting 4370/B00D/In-fill-panel/S4	4m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel	Flat AC Sheeting 4370/B00D/In-fill-panel/S5	2m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)

Interior**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4370/B00D/R0001/Ceiling Structures/Linings/S1	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel	Flat AC Sheeting 4370/B00D/In-fill-panel/S4	9m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel	Flat AC Sheeting 4370/B00D/In-fill-panel/S5	2m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)

B00D - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0003 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0004 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0005 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0008 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles 4370/B00D/R0008/Floor Coverings Res/Textile/S2	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

B00D - R0009 - Practical Activities - 1hb

--	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other-After School Care/General Learning - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Gable Verge Lining	Flat AC Sheeting	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	8m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	2m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting	0.02m2	Man hole cover above R0004	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	4370/B00E/R0001/Wall Linings Internal/S8					
In-fill-panel	Flat AC Sheeting	6m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	2m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)

B00E - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	4370/B00E/R0002/Wall Linings Internal/S9					

B00E - R0003 - Out Of School Hours Care Centre

Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00E - R0004 - Out Of School Hours Care Centre

Floor Coverings Res/Textile	Vinyl Tiles	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	14m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	8m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	2m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5				Chrysotile (white asbestos)	
Ceiling Voids	Flat AC Sheeting	0.02m2	Man hole cover above FR0003	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

Interior

B00F - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	8m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	2m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5				Chrysotile (white asbestos)	

B00F - R0002 - Home Base

No Asbestos

B00F - R0003 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00F - R0004 - Movement


Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00F - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00F - R0006 - Home Base

No Asbestos

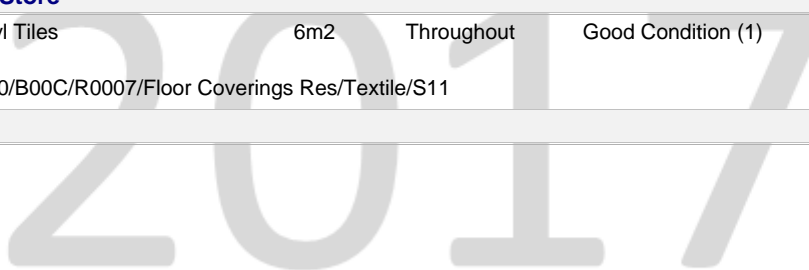

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library/Communal Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Area inaccessible no void hatch located.					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	12m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	3m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S5					Chrysotile (white asbestos)

Interior

B00G - R0001 - Movement

No Asbestos

B00G - R0002 - Cleaning Supplies

No Asbestos

B00G - R0003 - Sports Store

No Asbestos

B00G - R0004 - Sports Store

No Asbestos

B00G - R0005 - General Assistant/Bulk Store

No Asbestos

B00G - R0006 - Reading Area

No Asbestos

B00G - R0007 - Reading Area

No Asbestos

B00G - R0008 - K.L.A. Store

No Asbestos

B00G - R0009 - Library Office/Workroom

No Asbestos

B00G - R0010 - Library Office/Workroom

No Asbestos

B00G - R0011 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities/General Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	14m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	14m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
Ceiling Voids	AC Fragments/Debris	0.05m2	Damaged fcs man hole cover in ceiling space above HR0004	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	4370/B00H/Ceiling Voids/S22					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

Interior**B00H - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00H - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00H - R0003 - Toilets - Boys/Girls

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00H - R0004 - Canteen Office/Store

Wall Linings Internal	Flat AC Sheeting	1m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00H - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	3m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)

B00H - R0006 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00H - R0007 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00K/R0001/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	4m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00H - R0008 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00H - R0009 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00K/R0001/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00H - R0010 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00H - R0011 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning/Pupil Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void hatch located.					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	14m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)

Interior

B00I - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	12m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)

B00I - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00I - R0003 - Toilets - Boys/Girls

No Asbestos

B00I - R0004 - Home Base

No Asbestos

B00I - R0005 - Home Base

No Asbestos

B00I - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00I - R0007 - Toilets - Boys/Girls


No Asbestos

B00I - R0008 - Home Base

No Asbestos

B00I - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

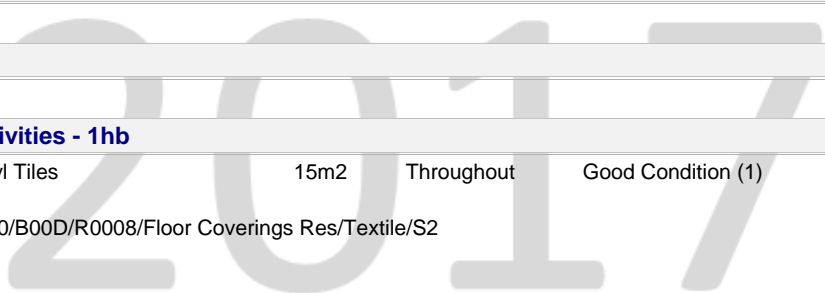

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Communal Facilities/General Learning - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	26m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	14m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	0.02m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Interior

B00J - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	14m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)

B00J - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00J - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00A/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00J - R0004 - Toilets - Boys/Girls

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00J - R0005 - Home Base

In-fill-panel	Flat AC Sheeting	12m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)

B00J - R0006 - Home Base

In-fill-panel	Flat AC Sheeting	8m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)

B00J - R0007 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00J - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00J - R0009 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00C/R0007/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
B00J - R0010 - Special Programs Room						
In-fill-panel	Flat AC Sheeting	8m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
4370/B00D/In-fill-panel/S4					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - access to small portion within K9001 however no access to remainder of floor space,					
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	14m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

Interior

B00K - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00K/R0001/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00K - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00K/R0001/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00K - R0004 - Movement

No Asbestos

B00K - R0005 - Home Base

No Asbestos

B00K - R0006 - Movement

No Asbestos

B00K - R0007 - Home Base Store

No Asbestos

B00K - R0008 - Home Base Store

No Asbestos

B00K - R9001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	14m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	10m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

Interior

B00L - R0001 - Home Base

In-fill-panel	Flat AC Sheeting	8m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0002 - Home Base Store

In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00L - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	14m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0005 - Home Base Store

In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0006 - Home Base

In-fill-panel	Flat AC Sheeting	8m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0007 - Home Base

In-fill-panel	Flat AC Sheeting	8m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0008 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00L - R0009 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Administration/Staff Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible- slab to ground.					
Gable Verge Lining	Flat AC Sheeting	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/Gable Verge Lining/S3				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	18m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	6m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

Interior**B00M - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	6m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00M - R0002 - Movement

In-fill-panel	Flat AC Sheeting	2m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00M - R0003 - Cleaning Distributed Store

No Asbestos

B00M - R0004 - Interview

In-fill-panel	Flat AC Sheeting	3m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00M - R0005 - General Storeroom

No Asbestos

B00M - R0006 - Withdrawal Space - 1hb

In-fill-panel	Flat AC Sheeting	8m	North, South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00M - R0007 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17.67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	
Infill panels	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

B00M - R0008 - Main Switch Board

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00C/R0007/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00M - R0009 - Staff Toilet

In-fill-panel	Flat AC Sheeting	8m	North, South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4370/B00D/In-fill-panel/S4				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - R0010 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities/General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Covered Outdoor Learning Area

No Asbestos

B00N - R0002 - Communal Space

No Asbestos

B00N - R0003 - Movement

No Asbestos

B00N - R0004 - Raised Platform

No Asbestos

B00N - R0005 - Ramp

No Asbestos

B00N - R0006 - Movement

No Asbestos

B00N - R0007 - Hall Chair Store

No Asbestos

B00N - R0008 - Communal/Performance Store

No Asbestos

B00N - R0009 - P.E. Store

No Asbestos

B00N - R0010 - Toilet - Lobby

No Asbestos

B00N - R0011 - Toilets - Girls

No Asbestos

B00N - R0012 - Sound Cupboard

No Asbestos

B00N - R0013 - Toilet - Lobby

No Asbestos

B00N - R0014 - Toilets - Boys

No Asbestos

B00N - R0015 - Cleaning Distributed Store

No Asbestos

B00N - R0016 - General Storeroom

No Asbestos

B00N - R0017 - Main Switch Board

No Asbestos

B00N - R0018 - Access Shower/Toilet

No Asbestos

B00N - R0019 - Canteen

No Asbestos

B00N - R0020 - Canteen Office/Store

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D11461 - Learning Unit - Standard/Withdrawal : Placement Date - 29/01/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D14571 - Learning Unit - Standard/Withdrawal : Placement Date - 25/01/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017