


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Busby West Public School (4396)
Region : South Western Sydney
State Electorate : Liverpool
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 23 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

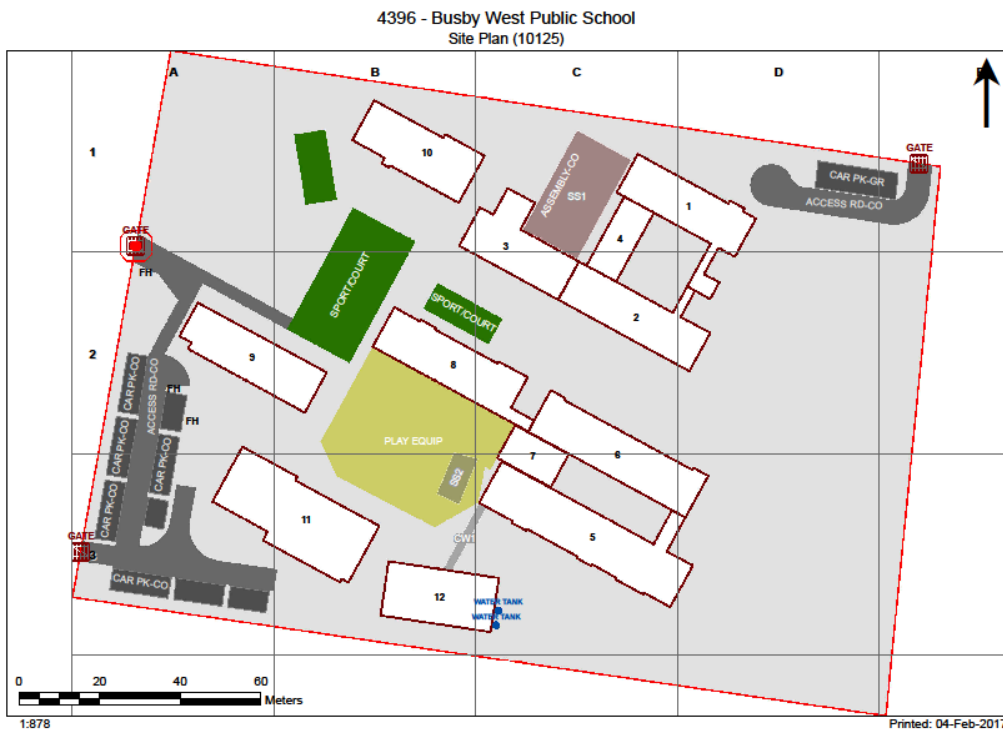

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Administration/General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B001 - R0001 - Principal (26.34 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0002 - General Storeroom (0.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

B001 - R0003 - Staff Toilet (4.21 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0003/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0004 - Distribution Board (1.91 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0005 - Entry Vestibule (27.13 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0006 - Plant (0.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

B001 - R0007 - Deputy Principal (12.49 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0008 - Deputy Principal (10.43 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0009 - Movement (9.5 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B001 - R0010 - Cleaning Distributed Store (4.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - R0011 - Clerical Office (14.52 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0012 - Duplicating Workroom (58.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0013 - General Storeroom (3.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0014 - Sick Bay (9.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0015 - General Storeroom (3.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0016 - Movement (4 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0018 - Home Base Store (3.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B001/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0019 - Home Base (57.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0021 - Movement (95.81 m2)						
No Asbestos						
B001 - R0022 - Stairs (5.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B002/R0017/Ceiling Structures/Linings/S4					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R0023 - Stairs (5.84 m2)						
No Asbestos						
B001 - R1001 - Staff Room Annexe (14.04 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1002 - Music Store (7.96 m2)						
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1003 - Movement (20.88 m2)						
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1004 - Cleaning Distributed Store (1.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4396/B001/R0006/Floor Coverings Res/Textile/S7	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1005 - Distribution Board (1.2 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles 4396/B001/R0006/Floor Coverings Res/Textile/S7	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1006 - Staff Toilet (5.09 m2)						
Wall Linings Internal	Flat AC Sheeting 4396/B001/R0003/Wall Linings Internal/S8	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B001 - R1007 - Staff Toilet (6.26 m2)						
Wall Linings Internal	Flat AC Sheeting 4396/B001/R0003/Wall Linings Internal/S8	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B001 - R1008 - General Storeroom (2.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4396/B001/R0006/Floor Coverings Res/Textile/S7	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R1009 - Staff Room Annexe (19.62 m2)						
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1010 - General Storeroom (19.87 m2)						
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1011 - Home Base (58.69 m2)						
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B001 - R1013 - Home Base Store (3.97 m2)						
Ceiling Structures/Linings	Vermiculite 4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	4396/B002/R1006/Floor Coverings Res/Textile/S6					No Asbestos Detected
B001 - R1014 - General Storeroom (13.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R1015 - Movement (4 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R1017 - Home Base (57.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R1018 - Home Base Store (3.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4396/B002/R1006/Floor Coverings Res/Textile/S6					No Asbestos Detected
B001 - R1019 - Movement (104.24 m2)						
No Asbestos						
B001 - R1020 - Stairs (7.64 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B001 - R1021 - Stairs (18.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning/Support Unit - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B002 - R0001 - Home Base (57.2 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B002 - R0002 - Home Base Store (3.92 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B002/R0005/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B002 - R0003 - Practical Activities - 1hb (17.59 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B002 - R0005 - Home Base Store - M (3.92 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B002/R0005/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B002 - R0006 - Home Base - M (56.88 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B002 - R0007 - Home Base (56.1 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B002 - R0012 - Canteen (20.9 m2)

No Asbestos

B002 - R0013 - Canteen Office/Store (3.06 m2)

No Asbestos

B002 - R0014 - Canteen Office/Store (3.63 m2)

No Asbestos

B002 - R0015 - Movement (26.83 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B002 - R0016 - Movement (103.2 m2)

No Asbestos

B002 - R0017 - Movement (5.91 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B002 - R0018 - Home Base Store (4.32 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B002 - R0019 - Access Shower/Toilet (14.51 m2)						
No Asbestos						
B002 - R1001 - Home Base (57.12 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1002 - Home Base Store (3.92 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
B002 - R1003 - Personal Effects Storage (13.28 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1004 - Movement (3.91 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1006 - Home Base Store (3.92 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
B002 - R1007 - Home Base (56.96 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1008 - Home Base (57.04 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1009 - Home Base Store (3.92 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
B002 - R1010 - Personal Effects Storage (13.31 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1011 - Movement (3.81 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B002 - R1013 - Home Base Store (3.92 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
						<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
-----------------------------	-------------	--	--	--	--	----------------------

B002 - R1014 - Home Base (57.19 m2)

Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
						<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B002 - R1015 - Movement (103.2 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Administration/General Learning - 1967 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B003 - R0001 - Movement (14.42 m2)**

No Asbestos

B003 - R0002 - Staff Room (108.2 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B003 - R0003 - Staff Kitchen (13.1 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

In-fill-panel	Flat AC Sheeting					
	4396/B003/R0003/In-fill-panel/S19					No Asbestos Detected

B003 - R0004 - Movement (5.45 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B003 - R0006 - Personal Effects Storage (6.02 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B003 - R0007 - Home Base Store (6.29 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B002/R0005/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B003 - R0008 - Home Base (57.36 m2)

Ceiling Structures/Linings	Vermiculite					
	4396/B002/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B003 - R0009 - Movement (67.04 m2)

No Asbestos

B003 - R0010 - Sports Store (8.12 m2)

No Asbestos

B003 - R0011 - Movement (2.69 m2)

No Asbestos

B003 - R0012 - Distribution Board (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B003 - R0013 - General Storeroom (1.83 m2)

No Asbestos

B003 - R0014 - Movement (2.96 m2)

No Asbestos

B003 - R0015 - General Assistant/Bulk Store (17.95 m2)

No Asbestos

B003 - R0016 - No Access (6.32 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B003 - R0017 - Stairs (5.14 m2)						
No Asbestos						
B003 - R1001 - Home Base (57.27 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B003 - R1002 - Home Base Store (6.32 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
B003 - R1003 - General Storeroom (8.46 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B003 - R1004 - Movement (3.85 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B003 - R1006 - Home Base Store (6.14 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
B003 - R1007 - Home Base (56.88 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B003 - R1008 - Home Base (56.88 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B003 - R1009 - Home Base Store (6.98 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		4396/B002/R1006/Floor Coverings Res/Textile/S6			No Asbestos Detected
B003 - R1010 - Personal Effects Storage (6.9 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B002/R0017/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B003 - R1012 - Movement (77.11 m2)						
No Asbestos						
B003 - R1013 - Distribution Board (0.54 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B003 - R1014 - Cleaning Supplies (23.35 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B003/R1014/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting					
	4396/B003/R0003/In-fill-panel/S19				No Asbestos Detected	

B003 - R1015 - Stairs (13.75 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B004 - R0001 - Toilets - Boys (14.53 m2)

Toilet Cistern	Fibre Cement Casting (Monocrete) 4396/B004/R0001/Cistern/S1	4Unit(s)	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet 4396/B004/R0007/Partition Walls (Cubicles)/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R0002 - Drinking Facilities (17.02 m2)

No Asbestos

B004 - R0003 - Disabled Toilet (4.6 m2)

No Asbestos

B004 - R0004 - Cleaning Distributed Store (5.77 m2)

No Asbestos

B004 - R0006 - Drinking Facilities (22.69 m2)

No Asbestos

B004 - R0007 - Toilets - Girls (14.3 m2)

Toilet Cistern	Fibre Cement Casting (Monocrete) 4396/B004/R0001/Cistern/S1	6Unit(s)	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet 4396/B004/R0007/Partition Walls (Cubicles)/S2	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R0008 - Movement (42.46 m2)

No Asbestos

B004 - R0009 - Stairs (7.77 m2)

No Asbestos

B004 - R1001 - Drinking Facilities (22.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4396/B004/R1003/Ceiling Structures/Linings/S3	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R1002 - Toilets - Girls (14.3 m2)

Toilet Cistern	Fibre Cement Casting (Monocrete) 4396/B004/R0001/Cistern/S1	5Unit(s)	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet 4396/B004/R0007/Partition Walls (Cubicles)/S2	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 4396/B004/R1003/Ceiling Structures/Linings/S3	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R1003 - Drinking Facilities (21.99 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B004/R1003/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B004 - R1004 - Toilets - Boys (14.69 m2)						
Toilet Cistern	Fibre Cement Casting (Monocrete)	4Unit(s)	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4396/B004/R0001/Cistern/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B004/R0007/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B004/R1003/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R1005 - Movement (46.31 m2)

No Asbestos

B004 - R1006 - Stairs (12.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B005 - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B005/Underfloor Voids/S21					Chrysotile (white asbestos)	

Interior

B005 - R0001 - Home Base (55.79 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0002 - Home Base Store (5.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0003 - K.L.A. Store (14.82 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0004 - Movement (4.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0006 - Home Base Store (5.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0007 - Home Base (55.55 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0008 - Home Base (55.4 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0009 - Home Base Store (5.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10						
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B005 - R0010 - Personal Effects Storage (14.82 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0011 - Movement (4.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0013 - Home Base Store (5.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0014 - Home Base (56.58 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0015 - General Storeroom (9.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B005/R0015/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B005 - R0016 - Staff Toilet (3.61 m2)						
No Asbestos						
B005 - R0017 - Staff Toilet (3.61 m2)						
No Asbestos						
B005 - R0018 - Staff Room Annexe (23.91 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0019 - Movement (2.8 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0020 - Community Clinic (13.61 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0022 - Cleaning Distributed Store (3.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4396/B006/R0016/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B005 - R0023 - Main Switch Board (2.63 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B006/R0002/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
4396/B006/R0016/Ceiling Structures/Linings/S10					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B005 - R0024 - Other-Community Use (25.21 m2)						
Ceiling Structures/Linings	Vermiculite					
4396/B006/R0016/Ceiling Structures/Linings/S10					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Unable To Sample Electrician						
B005 - R0025 - Staff Room Annexe (23.54 m2)						
Ceiling Structures/Linings	Vermiculite					
4396/B006/R0016/Ceiling Structures/Linings/S10					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B005 - R0026 - Movement (155.62 m2)						
No Asbestos						
B005 - R0027 - External Stairs (25.24 m2)						
No Asbestos						
B005 - R9001 - General Storeroom (29.39 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B006 - General Learning - 1967 - Brick/Veneer (Brick/Veneer)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B006 - R0002 - Movement (1.08 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B006/R0002/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0003 - Personal Effects Storage (5.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B006/R0002/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0004 - Home Base Store (3.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B006/R0002/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0005 - Toilets - Boys/Girls (2.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B006/R0015/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
B006 - R0007 - Home Base (57.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0008 - Home Base Store (3.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0009 - Practical Activities - 1hb (14.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4396/B006/R0017/Floor Coverings Res/Textile/S11				No Asbestos Detected	
B006 - R0012 - Home Base Store (3.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0013 - Home Base (58.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B006 - R0015 - Toilets - Boys/Girls (2.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B006/R0015/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B006 - R0016 - Home Base Store (3.07 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B006 - R0018 - Distribution Board (0.45 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B006 - R0020 - Movement (105.39 m2)						
No Asbestos						
B006 - R0021 - Home Base (57.27 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		4396/B006/R0017/Floor Coverings Res/Textile/S11			No Asbestos Detected
B006 - R0022 - Home Base Store (5 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		4396/B006/R0017/Floor Coverings Res/Textile/S11			No Asbestos Detected
B006 - R0023 - Withdrawal Space - 2hb (17.08 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		4396/B006/R0017/Floor Coverings Res/Textile/S11			No Asbestos Detected
B006 - R0024 - Home Base Store (5.03 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		4396/B006/R0017/Floor Coverings Res/Textile/S11			No Asbestos Detected
B006 - R0025 - Home Base Store (5.07 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		4396/B006/R0017/Floor Coverings Res/Textile/S11			No Asbestos Detected
B006 - R0026 - Withdrawal Space - 2hb (17.08 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		4396/B006/R0017/Floor Coverings Res/Textile/S11			No Asbestos Detected
B006 - R0027 - Home Base Store (5.07 m2)						
Ceiling Structures/Linings	Vermiculite		4396/B006/R0016/Ceiling Structures/Linings/S10			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	4396/B006/R0017/Floor Coverings Res/Textile/S11					No Asbestos Detected
B006 - R0028 - Home Base (64.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B006/R0016/Ceiling Structures/Linings/S10					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles					
	4396/B006/R0017/Floor Coverings Res/Textile/S11					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Pupil Facilities - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B007 - R0001 - Toilets - Boys (25.77 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B007/R0001/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B007/R0001/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B007 - R0002 - Toilets - Girls (28.43 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B007/R0001/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4396/B007/R0001/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B007 - R0003 - Movement (47.08 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B008 - Pre-School Facilities - 1967 - Brick/Veneer (Brick/Veneer)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B008 - R0001 - Toilets - Boys/Girls - Pre (17.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B008 - R0002 - Personal Effects - Pre (12.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B008/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B008 - R0003 - Distribution Board (0.51 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B008 - R0004 - General Storeroom - Pre (4.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B008/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B008 - R0005 - Staff Toilet - Pre (3.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B008 - R0006 - Special Programs Room (47.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B008/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B008 - R0007 - Kitchen - Pre (8.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B008/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B008 - R0009 - Home Base - Pre (55.95 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4396/B008/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B008 - R0010 - General Storeroom - Pre (7.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B008 - R0011 - Personal Effects - Pre (13 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B008 - R0012 - Movement (4.73 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B008 - R0013 - General Storeroom - Pre (7.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B008 - R0014 - Home Base - Pre (55.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B008 - R0015 - Movement (96.48 m2)						
No Asbestos						
B008 - R0016 - General Storeroom - Pre (16.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B008 - R0017 - Staff Shower/Change (5.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4396/B008/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B008 - R0018 - General Storeroom - Pre (6.18 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B008 - R0019 - Withdrawal - Pre (19.18 m2)						
Ceiling Structures/Linings	Vermiculite					
	4396/B008/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - Administration - 2004 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B009 - R0001 - Entry Vestibule (23.99 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0002 - Movement (56.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0003 - Interview (13.08 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0004 - Clerical Office/Workroom (57.38 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0005 - Principal (17.15 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0006 - Deputy Principal (13.16 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0007 - Deputy Principal (13.16 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0008 - Sick Bay (9.64 m2)

No Asbestos

B009 - R0009 - Access Shower/Toilet (5.08 m2)

No Asbestos

B009 - R0010 - Staff Room (61.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0011 - Staff Room (26.1 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0012 - Security Store (13.58 m2)

No Asbestos

B009 - R0013 - Clerical Office (23.03 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0014 - Cleaning Distributed Store (3.68 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B009 - R0015 - Staff Toilet (4.75 m2)

No Asbestos

B009 - R0016 - Staff Toilet (4.75 m2)

No Asbestos

B009 - R0017 - Staff Toilet (4.75 m2)

No Asbestos

B009 - R0018 - Main Switch Board (3.76 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - R0021 - External Movement (7.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - Library - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B010 - R0001 - Reading Area (230.35 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0002 - Library Office/Workroom (26.15 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0003 - Communications Room (7.98 m2)

No Asbestos

B010 - R0004 - K.L.A. Store (19.46 m2)

No Asbestos

B010 - R0005 - Staff Toilet (4.81 m2)

No Asbestos

B010 - R0006 - Cleaning Distributed Store (3.17 m2)

No Asbestos

B010 - R0007 - Distribution Board (0.48 m2)

Note: No inspection of live electrical installation.

No Asbestos

B010 - R0008 - External Movement (21.04 m2)

No Asbestos

B010 - R0009 - External Stairs (3.36 m2)

No Asbestos

B010 - R0010 - External Movement (11.46 m2)

No Asbestos

B010 - R0011 - External Movement (19.32 m2)

No Asbestos

B010 - R0012 - Movement (2.4 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B011 - Communal Facilities - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B011 - R0001 - Communal Space (209.03 m2)

No Asbestos

B011 - R0002 - Raised Platform (55.39 m2)

No Asbestos

B011 - R0003 - Ramp (11.93 m2)

No Asbestos

B011 - R0004 - Movement (17.66 m2)

No Asbestos

B011 - R0005 - Cleaning Distributed Store (3.46 m2)

No Asbestos

B011 - R0006 - Main Switch Board (0.63 m2)

No Asbestos

B011 - R0007 - Hall Chair Store (10.92 m2)

No Asbestos

B011 - R0008 - Communal/Performance Store (10.89 m2)

No Asbestos

B011 - R0009 - P.E. Store (16.43 m2)

No Asbestos

B011 - R0010 - Staff Kitchen (0.68 m2)

No Asbestos

B011 - R0011 - Toilet - Lobby (1.38 m2)

No Asbestos

B011 - R0012 - Toilets - Boys (6.42 m2)

No Asbestos

B011 - R0013 - Sound Cupboard (2 m2)

No Asbestos

B011 - R0014 - Toilet - Lobby (1.56 m2)

No Asbestos

B011 - R0015 - Toilets - Girls (10.14 m2)

No Asbestos

B011 - R0016 - Plant (0.37 m2)

No Asbestos

B011 - R0017 - Access Shower/Toilet/Change (8.9 m2)

No Asbestos

B011 - R0018 - Plant (0.72 m2)

No Asbestos

B011 - R0019 - Covered Outdoor Learning Area (240.55 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B012 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B012 - R0001 - Practical Activities - 1hb (20.22 m2)

No Asbestos

B012 - R0002 - Home Base (58.41 m2)

No Asbestos

B012 - R0003 - Home Base Store (6.09 m2)

No Asbestos

B012 - R0004 - Withdrawal Space - 1hb (7.68 m2)

No Asbestos

B012 - R0005 - Practical Activities - 1hb (19.38 m2)

No Asbestos

B012 - R0006 - Home Base (60.63 m2)

No Asbestos

B012 - R0007 - Home Base Store (6.08 m2)

No Asbestos

B012 - R0008 - Withdrawal Space - 2hb (11.78 m2)

No Asbestos

B012 - R0009 - Practical Activities - 1hb (19.94 m2)

No Asbestos

B012 - R0010 - Home Base (60.63 m2)

No Asbestos

B012 - R0011 - Home Base Store (6.12 m2)

No Asbestos

B012 - R0012 - Distribution Board (0.39 m2)

Note: No inspection of live electrical installation.

No Asbestos

B012 - R0013 - External Movement (69.37 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4396_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017