


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Beresford Road Public School (4405)
Region : Western Sydney
State Electorate : Prospect
Local Government Area : Holroyd

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 03 - May - 2015

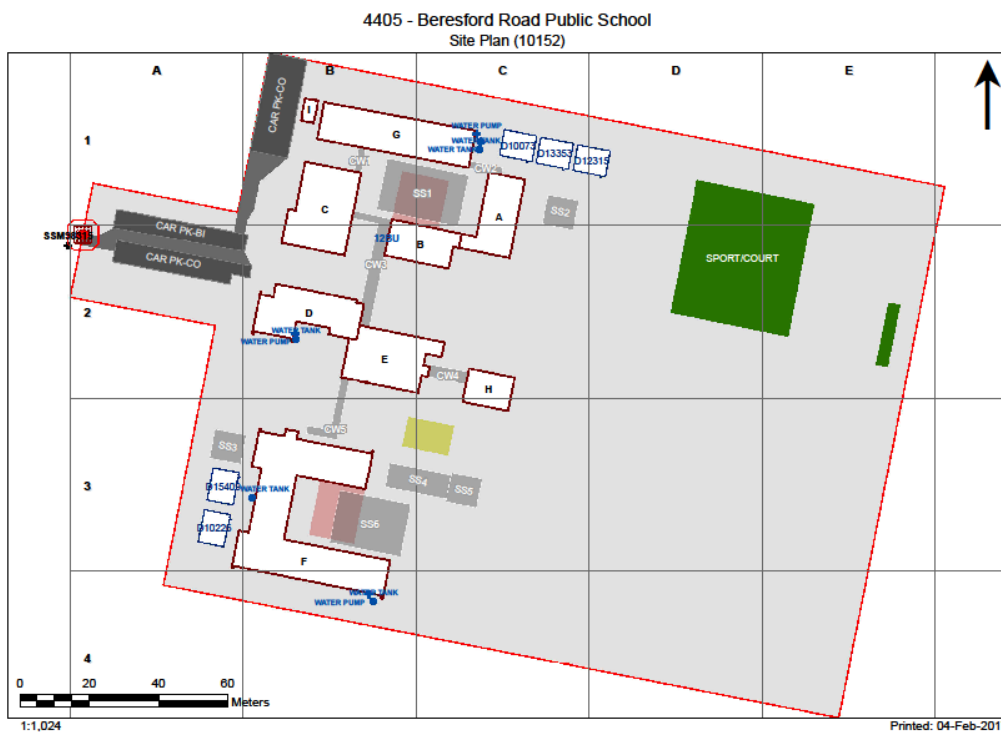

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - General Learning - 1980 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--------------------|----------------------------------|------|--------------|--------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 50m2 | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/Eaves Linings/S4 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | 20m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/Gable Verge Lining/S32 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00A - R0001 - Practical Activities - 1hb (11.23 m2)

No Asbestos

B00A - R0002 - Home Base (60.7 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|-------|------|----------------------|---------|---------------------------------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00A/R0007/Ceiling Structures/Linings/S15 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | West | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Recla Heater | | | | | |

B00A - R0003 - Home Base (59.27 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|-------|------|----------------------|---------|---------------------------------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00A/R0007/Ceiling Structures/Linings/S15 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | West | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Recla Heater | | | | | |

B00A - R0004 - Practical Activities - 1hb (12.41 m2)

No Asbestos

B00A - R0005 - Distribution Board (0.54 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0006 - Sports Store (13.47 m2)

No Asbestos

B00A - R0007 - Garden Store (14.65 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|--|--|--|--|---------------------------------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00A/R0007/Ceiling Structures/Linings/S15 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |

B00A - R0008 - Drinking Facilities (3.75 m2)

No Asbestos

B00A - R0009 - No Access (3.75 m2)

No Asbestos

B00A - R0010 - Movement (42.57 m2)

No Asbestos

B00A - R0011 - Stairs (7.46 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00A/R0011/Ceiling Structures/Linings/S37 | | | | | Chrysotile (white asbestos) |

B00A - R1001 - Practical Activities - 1hb (10.92 m2)

No Asbestos

B00A - R1002 - Home Base (61.65 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-------------------------------------------------------------|----------------------------------------------------------------------------------------|--------|--------------------|----------------------|-------------|----------------------------------------------------------|
| Sample No | | | | | Test Result | |
| Thermacon Heater | Encapsulated Insulation material within unit Assumed Asbestos - Recla Heater | 1Unit | West | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| B00A - R1003 - Home Base (60.78 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit Assumed Asbestos - Recla Heater | 1Unit | West | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| B00A - R1004 - Practical Activities - 1hb (11.08 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1005 - Home Base Store (13.95 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 4405/B00A/R1005/Floor Coverings Res/Textile/S14 | 14m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Thermacon Heater | Encapsulated Insulation material within unit Assumed Asbestos - Recla Heater | 1Unit | North | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Floor Coverings Res/Textile | Vinyl Tiles 4405/B00A/R1005/Floor Coverings Res/Textile/S35 | 14m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R1006 - General Storeroom (13.69 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 4405/B00A/R1005/Floor Coverings Res/Textile/S14 | 14m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R1007 - Movement (42.57 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00A/R1007/Ceiling Structures/Linings/S2 | 43m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R1008 - Stairs (7.04 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00A/R0011/Ceiling Structures/Linings/S37 | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - General Learning - 1980 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--------------------|----------------------------------|------|------------|--------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 40m2 | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/Eaves Linings/S4 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | 20m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/Gable Verge Lining/S32 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00B - R0001 - Movement (41.69 m2)

| | | | | | | |
|----------------------------|-----------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 42m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/R0001/Ceiling Structures/Linings/S1 | | | | | Chrysotile (white asbestos) |

B00B - R0002 - Distribution Board (0.51 m2)

Note: No inspection of live electrical installation.

| | | | | | | |
|----------------------------|------------------------------------------------|-----|-----------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Debris to Floor | Poor Condition (4) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/R0002/Ceiling Structures/Linings/S16 | | | | | Chrysotile (white asbestos) |

| | | | | | | |
|---------------------------|-----------------------------------------------|-------|------|----------------------------|---------|------------------------------------|
| Electrical Mounting Board | Resinous Board | 1Unit | West | Some Damage / Unsealed (3) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/R0002/Electrical Mounting Board/S17 | | | | | Chrysotile (white asbestos) |

B00B - R0003 - Practical Activities - 1hb (10.2 m2)

No Asbestos

B00B - R0004 - Home Base (60.84 m2)

| | | | | | | |
|------------------|----------------------------------------------|-------|-------|----------------------|---------|--------------------|
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | North | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Recla Heater | | | | | |

| | | | | | | |
|----------------------------|------------------------------------------------|-----|----------------|--------------------|---------|------------------------------------|
| Ceiling Space Access Panel | Flat AC Sheeting | 1m2 | Middle portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/R0004/Ceiling Space Access Panel/S40 | | | | | Chrysotile (white asbestos) |

B00B - R0005 - Home Base (61.33 m2)

No Asbestos

B00B - R0006 - Practical Activities - 1hb (10.55 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Communal Facilities/Pupil Facilities - 1980 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--------------------|----------------------------------|------|--------------|--------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 50m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/Eaves Linings/S4 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | 20m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/Gable Verge Lining/S32 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00C - R0001 - Communal Space (193.4 m2)

No Asbestos

B00C - R0002 - Cleaning Distributed Store (0.86 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|---------------------------------------|------------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Poor Condition - Extensive Damage (4) | Medium (2) | High Priority (6-8) |
| | 4405/B00C/R0002/Ceiling Structures/Linings/S38 | | | | | Chrysotile (white asbestos) |

B00C - R0003 - General Storeroom (0.86 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|----------------------------|------------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Some Damage - Unsealed (3) | Medium (2) | Medium Priority (4-5) |
| | 4405/B00C/R0002/Ceiling Structures/Linings/S38 | | | | | Chrysotile (white asbestos) |

B00C - R0004 - Raised Platform (56.35 m2)

No Asbestos

B00C - R0005 - Security Store (13.62 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|-----|----------------|--------------------|---------|------------------------------------|
| Ceiling Space Access Panel | Flat AC Sheeting | 1m2 | Middle portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/R0004/Ceiling Space Access Panel/S40 | | | | | Chrysotile (white asbestos) |

B00C - R0006 - Canteen (26.54 m2)

| | | | | | | |
|-----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 27m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/R0006/Floor Coverings Res/Textile/S18 | | | | | Chrysotile (white asbestos) |

B00C - R0007 - Canteen Office/Store (2.52 m2)


| | | | | | | |
|-----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/R0006/Floor Coverings Res/Textile/S18 | | | | | Chrysotile (white asbestos) |

B00C - R0008 - Canteen (5.63 m2)

No Asbestos

B00C - R0009 - Movement (80.47 m2)

| | | | | | | |
|----------------------------|-----------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 81m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/R0009/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |

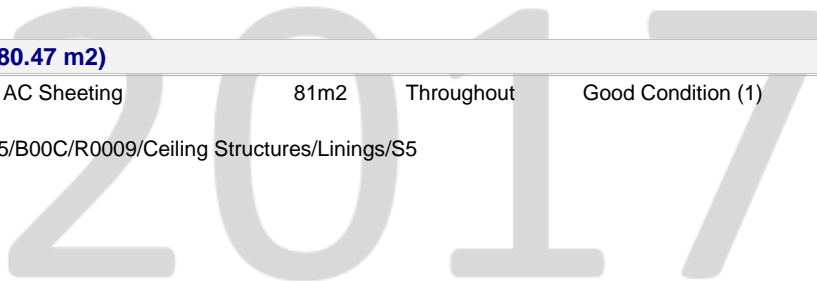

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - Administration - 1980 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|--------------------|----------------------------------|------|--------------|--------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 40m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/Eaves Linings/S4 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/Gable Verge Lining/S32 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00D - R0001 - Movement (5.95 m2)**

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0012/Ceiling Structures/Linings/S39 | | | | | Chrysotile (white asbestos) |

B00D - R0002 - Staff Room (74.64 m2)

No Asbestos

B00D - R0003 - Security Store (16.85 m2)

| | | | | | | |
|-----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0003/Floor Coverings Res/Textile/S19 | | | | | Chrysotile (white asbestos) |

B00D - R0004 - Clerical Office (13.94 m2)

No Asbestos

B00D - R0005 - Clerical Office (15.25 m2)

No Asbestos

B00D - R0006 - General Storeroom (1.98 m2)

| | | | | | | |
|-----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0003/Floor Coverings Res/Textile/S19 | | | | | Chrysotile (white asbestos) |

B00D - R0007 - Deputy Principal (13.4 m2)

No Asbestos

B00D - R0008 - Interview (13.33 m2)

No Asbestos

B00D - R0009 - Principal (22.93 m2)

| | | | | | | |
|-----------------------------|-------------------------------------------------|-----|-------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0003/Floor Coverings Res/Textile/S19 | | | | | Chrysotile (white asbestos) |

B00D - R0010 - Distribution Board (1.94 m2)

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0010/Ceiling Structures/Linings/S20 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0003/Floor Coverings Res/Textile/S19 | | | | | Chrysotile (white asbestos) |

B00D - R0011 - Interview (13.4 m2)

No Asbestos

B00D - R0012 - Movement (12.2 m2)

| | | | | | | |
|----------------------------|------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0012/Ceiling Structures/Linings/S39 | | | | | Chrysotile (white asbestos) |

B00D - R0013 - Duplicating Workroom (17.87 m2)

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------------------------------------------------------------|-------------------------------------------------|--------|--------------------|--------------------|-------------|------------------------------------|
| Sample No | | | | | Test Result | |
| B00D - R0014 - Sick Bay (8.75 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0015 - Staff Toilet (5.05 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0016 - Staff Toilet (5.01 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0017 - Cleaning Distributed Store (1.13 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0010/Ceiling Structures/Linings/S20 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0003/Floor Coverings Res/Textile/S19 | | | | | Chrysotile (white asbestos) |
| B00D - R0018 - General Assistant/Bulk Store (12.02 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00D/R0003/Floor Coverings Res/Textile/S19 | | | | | Chrysotile (white asbestos) |
| B00D - R0019 - Movement (18.22 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0020 - Entry Vestibule (21.82 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0021 - Movement (7.28 m2) | | | | | | |
| No Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - Library - 1980 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--------------------|----------------------------------|------|------------|--------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 60m2 | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/Eaves Linings/S4 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00C/Gable Verge Lining/S32 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00E - R0002 - Movement (5.1 m2)

| | | | | | | |
|----------------------------|-----------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00E/R0012/Ceiling Structures/Linings/S6 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 4405/B00E/R0002/Wall Linings Internal/S7 | | | | | |

B00E - R0005 - Communications Room (13.62 m2)

No Asbestos

B00E - R0007 - Toilets - Boys/Girls (3.85 m2)

No Asbestos

B00E - R0008 - Distribution Board (0.9 m2)

Note: No inspection of live electrical installation.

| | | | | | | |
|---------------------------|-----------------------------------------------|-------|------|--------------------|---------|------------------------------------|
| Electrical Mounting Board | Resinous Board | 1Unit | West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00E/R0008/Electrical Mounting Board/S41 | | | | | Chrysotile (white asbestos) |

B00E - R0009 - Cleaning Distributed Store (0.75 m2)

No Asbestos

B00E - R0010 - Staff Toilet (3.83 m2)

No Asbestos

B00E - R0011 - Movement (18.15 m2)

No Asbestos

B00E - R0012 - Movement (64.6 m2)

| | | | | | | |
|----------------------------|-----------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 65m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00E/R0012/Ceiling Structures/Linings/S6 | | | | | Chrysotile (white asbestos) |

B00E - R0013 - Reading Area (179.53 m2)

No Asbestos

B00E - R0014 - Library Office/Workroom (22.26 m2)

No Asbestos

B00E - R0015 - K.L.A. Store (28.33 m2)

No Asbestos



| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00F - General Learning/Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|--------------------------------------------|------------------------------------------------------------------------------|-------|--------------|----------------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting 4405/B00F/Eaves Linings/S30 | 100m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting 4405/B00F/Gable Verge Lining/S31 | 40m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |
| In-fill-panel | Flat AC Sheeting 4405/B00F/In-fill-panel/S8 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids - Packing to Floor Joists | Flat AC Sheeting 4405/B00F/Underfloor Voids - Packing to Floor Joists/S33 | 1m2 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) |
| | | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

Interior**B00F - R0001 - Home Base (57.23 m2)**

No Asbestos

B00F - R0002 - Home Base Store (6.23 m2)

No Asbestos

B00F - R0003 - Personal Effects Storage (14.81 m2)

No Asbestos

B00F - R0004 - Home Base (56.82 m2)

No Asbestos

B00F - R0005 - Home Base Store (6.16 m2)

No Asbestos

B00F - R0006 - General Storeroom (2.92 m2)

| | | | | | | |
|-----------------------------|----------------------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 4405/B00F/R0006/Floor Coverings Res/Textile/S22 | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00F - R0007 - Staff Toilet (3.71 m2)

| | | | | | | |
|-----------------------|---------------------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting 4405/B00F/R0010/Wall Linings Internal/S23 | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00F - R0008 - Staff Toilet (3.71 m2)

| | | | | | | |
|-----------------------|---------------------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting 4405/B00F/R0010/Wall Linings Internal/S23 | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00F - R0009 - Withdrawal Space - 1hb (15.7 m2)

No Asbestos

B00F - R0010 - Movement (24.11 m2)

| | | | | | | |
|-----------------------------|----------------------------------------------------------------|-----|-----------------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 4405/B00F/R0006/Floor Coverings Res/Textile/S22 | 2m2 | Within cleaners store | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|-----|-----------------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00F/R0010/Ceiling Structures/Linings/S24 | 2m2 | Within cleaners store | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

| | | | | | | |
|-----------------------|---------------------------------------------------------------|------|-----------------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting 4405/B00F/R0010/Wall Linings Internal/S23 | 10m2 | Within cleaners store | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00F - R0011 - Movement (8.93 m2)

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00F/R0017/Ceiling Structures/Linings/S12 | | | | | No Asbestos Detected |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|-----------------------------|

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|------------------------------------------------------------|----------------------------------------------|--------|--------------------|----------------------|------------------------------------|-----------------------------|
| Sample No | | | | | Test Result | |
| B00F - R0012 - Withdrawal Space - 1hb (8.76 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R0006/Floor Coverings Res/Textile/S22 | | | | | Chrysotile (white asbestos) | |
| B00F - R0013 - K.L.A. Store (21.74 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0014 - Withdrawal Space - 2hb (17.77 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0015 - Cleaning Distributed Store (2.28 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R0015/Floor Coverings Res/Textile/S36 | | | | | Chrysotile (white asbestos) | |
| B00F - R0016 - Main Switch Board (4.5 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0017 - Movement (60.34 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/R0017/Ceiling Structures/Linings/S12 | | | | | | |
| In-fill-panel | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/In-fill-panel/S8 | | | | | | |
| In-fill-panel | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/In-fill-panel/S8 | | | | | | |
| B00F - R0018 - Movement (34.77 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/R0017/Ceiling Structures/Linings/S12 | | | | | | |
| In-fill-panel | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/In-fill-panel/S8 | | | | | | |
| B00F - R0019 - Home Base (57.54 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Sealed unit | | | | | | |
| B00F - R0020 - Home Base Store (7.58 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0021 - Personal Effects Storage (13.47 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0022 - Home Base (57.76 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Unable to access sealed unit - | | | | | | |
| B00F - R0023 - Home Base Store (7.6 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0024 - Movement (80.16 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/R0017/Ceiling Structures/Linings/S12 | | | | | | |
| In-fill-panel | Flat AC Sheeting | | | | | No Asbestos Detected |
| 4405/B00F/In-fill-panel/S8 | | | | | | |
| B00F - R0025 - Personal Effects Storage (7.37 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0026 - Home Base (57.06 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 2Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Unable to access sealed units | | | | | | |
| B00F - R0027 - Home Base Store (6.2 m2) | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|------------------------------------------------------------|----------------------------------------------|--------|--------------------|------------------------------------|-------------|--------------------|
| Sample No | | | | Test Result | | |
| No Asbestos | | | | | | |
| B00F - R0028 - Home Base (85.75 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 3Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Unable to access sealed units | | | | | | |
| B00F - R0029 - Toilets - Boys/Girls (3.65 m2) | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R0010/Wall Linings Internal/S23 | | | | Chrysotile (white asbestos) | | |
| B00F - R0030 - Personal Effects Storage (12.79 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0031 - Home Base Store (3.34 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0032 - Home Base Store (3.34 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0033 - Home Base (85.83 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 3Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Unable to access sealed units | | | | | | |
| B00F - R0034 - Toilets - Boys/Girls (3.65 m2) | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R0010/Wall Linings Internal/S23 | | | | Chrysotile (white asbestos) | | |
| B00F - R0035 - Home Base (57.06 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0036 - Home Base Store (6.25 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0037 - General Storeroom (7.33 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 3Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Heaters stored in room | | | | | | |
| B00F - R9001 - External Movement (29.63 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R9002 - Toilets - Boys (41.8 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | NA | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R9002/Ceiling Structures/Linings/S9 | | | | Chrysotile (white asbestos) | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R9002/Partition Walls (Cubicles)/S11 | | | | Chrysotile (white asbestos) | | |
| B00F - R9004 - Toilets - Girls (42.1 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 43m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R9002/Ceiling Structures/Linings/S9 | | | | Chrysotile (white asbestos) | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R9002/Partition Walls (Cubicles)/S11 | | | | Chrysotile (white asbestos) | | |
| B00F - R9005 - Cleaning Distributed Store (4.76 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R9006 - Sports Store (4.1 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R9007 - Movement (3.5 m2) | | | | | | |
| No Asbestos | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------------------------------------------------------|----------------------|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No | | | | | Test Result | |
| B00F - R9008 - Sports Store (4.18 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00F - R9009 - Staff Room Annexe (56.9 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 57m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00F/R9009/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) | |
| B00F - R9010 - Disabled Shower/Toilet (14.17 m2) | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00F - R9011 - General Storeroom (15.35 m2) | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00F - R9012 - Sports Store (39.45 m2) | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|------------------------------------------------------------------------------------|-------------------------------------------------|--------|-------------------------------------|----------------------|-------------|---------------------------------------------------------------------------------------------------------------------|
| Sample No | | | | | Test Result | |
| B00G - General Learning/Pupil Facilities - 1969 - Brick/Block (Brick/Block) | | | | | | |
| Exterior | | | | | | |
| Eaves Linings | Flat AC Sheeting | 40m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00B/Eaves Linings/S4 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | 20m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00F/Gable Verge Lining/S31 | | | | | Chrysotile (white asbestos) |
| In-fill-panel | Flat AC Sheeting | 24m2 | North, Upper portion, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00G/In-fill-panel/S27 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |
| Interior | | | | | | |
| B00G - R0001 - Movement (83.22 m2) | | | | | | |
| In-fill-panel | Flat AC Sheeting | 8m | North, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00G/In-fill-panel/S27 | | | | | Chrysotile (white asbestos) |
| B00G - R0002 - Toilets - Girls (50.65 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| Partition Walls (Cubicles) | Compressed AC Sheet | 42m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00G/R0002/Partition Walls (Cubicles)/S26 | | | | | Chrysotile (white asbestos) |
| B00G - R0003 - Cleaning Distributed Store (12.4 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R0004 - Drinking Facilities (56.68 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| B00G - R0005 - Toilets - Boys (42.38 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| Partition Walls (Cubicles) | Compressed AC Sheet | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00G/R0002/Partition Walls (Cubicles)/S26 | | | | | Chrysotile (white asbestos) |
| B00G - R0006 - Home Base (56.98 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| Thermacon Heater | Encapsulated Insulation material within unit | 2Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Assumed Asbestos - Unable to access sealed units |
| B00G - R0007 - Home Base Store (6.69 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works |
| B00G - R0008 - Personal Effects Storage (6.55 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4405/B00G/R0008/Floor Coverings Res/Textile/S28 | | | | | Chrysotile (white asbestos) |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|----------------------------------------------------------|--------------------------------------------------------------------|--------|----------------------|----------------------------|------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Vermiculite 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| B00G - R0009 - Movement (17.03 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R0010 - Distribution Board (1.04 m2) | | | | | Note: No inspection of live electrical installation. | |
| No Asbestos | | | | | | |
| B00G - R0011 - Staff Toilet (5.71 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R0012 - Personal Effects Storage (6.55 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 4405/B00G/R0008/Floor Coverings Res/Textile/S28 | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Vermiculite 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| B00G - R0013 - Home Base (56.74 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) Assumed Asbestos - Unable to access sealed unit |
| B00G - R0014 - Home Base Store (6.55 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite 4405/B00G/R0002/Ceiling Structures/Linings/S25 | | | | | Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| Thermacon Heater | Encapsulated Insulation material within unit | 1Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) Assumed Asbestos - Sealed Unit |
| B00G - R0015 - Stairs (7.18 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00A/R0011/Ceiling Structures/Linings/S37 | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00G - R0016 - Stairs (3.09 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00A/R0011/Ceiling Structures/Linings/S37 | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00G - R1001 - Staff Toilet (5.7 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1002 - Distribution Board (1.02 m2) | | | | | Note: No inspection of live electrical installation. | |
| No Asbestos | | | | | | |
| B00G - R1003 - Movement (109.66 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 4405/B00G/R1003/Ceiling Structures/Linings/S29 | 110m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| In-fill-panel | Flat AC Sheeting 4405/B00G/In-fill-panel/S27 | 20m2 | North, Lower portion | Some Damage - Unsealed (3) | Medium (2) | Medium Priority (4-5) Chrysotile (white asbestos) |
| B00G - R1004 - Home Base Store (7.1 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1005 - Home Base (56.9 m2) | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------------------------------------------------------|----------------------------------------------|--------|--------------------|----------------------|------------------------------------|--------------------|
| Sample No | | | | | Test Result | |
| Thermacon Heater | Encapsulated Insulation material within unit | 2Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Sealed Units | | | | | | |
| B00G - R1006 - Home Base Store (6.73 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet (under Carpet) | | | | | |
| 4405/B00G/R1006/Floor Coverings Res/Textile/S34 | | | | | No Asbestos Detected | |
| B00G - R1007 - Personal Effects Storage (13.52 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1008 - Home Base (56.9 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 2Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Sealed Units | | | | | | |
| B00G - R1009 - Home Base Store (6.73 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1010 - Home Base (56.9 m2) | | | | | | |
| Thermacon Heater | Encapsulated Insulation material within unit | 2Unit | Variable positions | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Sealed Units | | | | | | |
| B00G - R1011 - Home Base Store (6.86 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1012 - Personal Effects Storage (6.61 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1013 - Personal Effects Storage (6.59 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1014 - Home Base (57.05 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1015 - Home Base Store (6.85 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00G - R1016 - Stairs (5.89 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00A/R0011/Ceiling Structures/Linings/S37 | | | | | Chrysotile (white asbestos) | |
| B00G - R1017 - Stairs (7.4 m2) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4405/B00A/R0011/Ceiling Structures/Linings/S37 | | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - Computer Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00H - R0001 - Special Programs Room (33.81 m2)

No Asbestos

B00H - R0002 - Special Programs Room (33.79 m2)

No Asbestos

B00H - R0003 - General Storeroom (7.59 m2)

No Asbestos

B00H - R0004 - General Storeroom (7.53 m2)

No Asbestos

B00H - R0005 - External Movement (33.78 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B001 - Pupil Facilities - 2012 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B001 - R0001 - Disabled Toilet (13.38 m2)

No Asbestos

B001 - R0002 - External Movement (7.16 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10073 - Learning Unit - Standard With P.A.A. : Placement Date - 6/11/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10226 - Learning Unit - Standard With P.A.A. : Placement Date - 23/09/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11408 - Learning Unit - Standard With P.A.A. : Placement Date - 31/12/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12315 - Learning Unit - Standard With P.A.A. : Placement Date - 6/11/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13353 - Learning Unit - Standard With P.A.A. : Placement Date - 6/11/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 750 - D14282 - Learning Unit - ESL : Placement Date - 30/12/2014

Exterior

| | | | |
|-------------|---------------------|------------------|---------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 5.76 m2 |

Interior

R1 - Esl

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 50 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 36 m2 |

OS 602 - D15409 - Learning Unit - Standard With P.A.A. : Placement Date - 3/02/2016

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15573 - Learning Unit - Standard With P.A.A. : Placement Date - 23/11/2016

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017