


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bradfordville Public School (4406)  
**Region :** Illawarra and South East  
**State Electorate :** Goulburn  
**Local Government Area :** Goulburn Mulwaree

**Initial Survey :** Noel Arnold & Associates : 12 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 12 - Jul - 2015

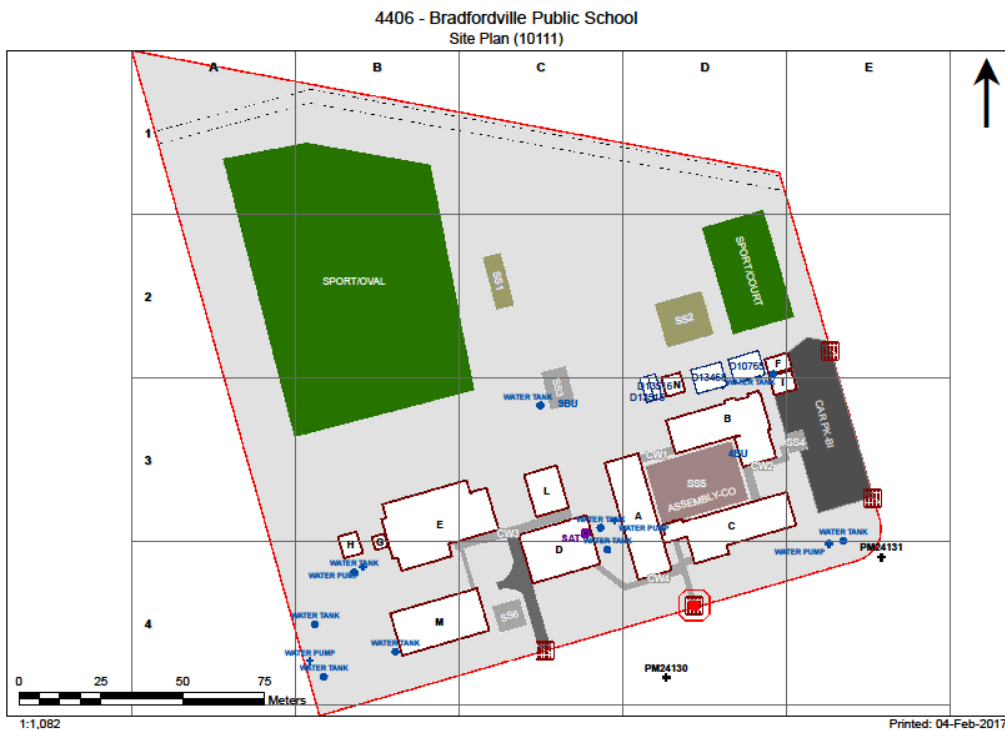

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1968 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting	35m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	15m2	Above windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/In-fill-panel/S7					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/Eaves Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00A - R0001 - Movement**

No Asbestos

**B00A - R0002 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0003 - Personal Effects Storage**

No Asbestos

**B00A - R0004 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0008/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>

**B00A - R0005 - Home Base**

No Asbestos

**B00A - R0006 - Toilets - Boys/Girls**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0008/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Vinyl Tiles	16m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0006/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0007 - Home Base**

No Asbestos

**B00A - R0008 - Toilets - Boys/Girls**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0008/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Vinyl Tiles	8m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0006/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0009 - Personal Effects Storage**

Ceiling access cover	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4406/B00A/R0009/Ceiling access cover/S8					<b>Chrysotile (white asbestos)</b>

**B00A - R0010 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0008/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0011 - Distribution Board</b>				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0012 - Home Base</b>						
No Asbestos						
<b>B00A - R0013 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0014 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0014/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1968 - Brick/Block (Brick/Block)**

**Exterior**

In-fill-panel	Flat AC Sheeting	30m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	10m2	Above windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00B/In-fill-panel/S12					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Home Base**

No Asbestos

**B00B - R0003 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Personal Effects Storage**

Ceiling access cover	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4406/B00B/R0005/Ceiling access cover/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0006 - Home Base**

No Asbestos

**B00B - R0007 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00B - R0008 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	80m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00B/R0008/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos)</b>

**B00B - R0009 - Raised Platform**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00B/R0008/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos)</b>

**B00B - R0010 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0011 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0012 - External Movement**

--	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00B/R0012/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0013 - Toilets - Girls</b>						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00B/R0012/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00B/R0015/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0014 - Staff Toilet</b>						
Incinerator	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Unable to sample as material is within</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00B/R0012/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0015 - Toilets - Boys</b>						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00B/R0012/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00B/R0015/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/Staff Facilities - 1968 - Brick/Block (Brick/Block)**

**Exterior**

In-fill-panel	Flat AC Sheeting	35m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00C/In-fill-panel/S18					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	15m2	Above windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00C/In-fill-panel/S17					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00C/Eaves Linings/S16					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00C - R0001 - Staff Room Annexe**

No Asbestos

**B00C - R0002 - Staff Room Annexe**

No Asbestos

**B00C - R0003 - Staff Room**

No Asbestos

**B00C - R0004 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Movement**

Ceiling access cover	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4406/B00C/R0005/Ceiling access cover/S19					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles	1m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0006 - Interview**

No Asbestos

**B00C - R0007 - Movement**

No Asbestos

**B00C - R0008 - Duplicating Workroom**

No Asbestos

**B00C - R0009 - Staff Room Annexe**

No Asbestos

**B00C - R0010 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0011 - Principal**

No Asbestos

**B00C - R0012 - Entry Vestibule**

No Asbestos

**B00C - R0013 - Movement**

No Asbestos

**B00C - R0014 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4406/B00A/R0002/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0015 - Clerical Office</b>						
No Asbestos						
<b>B00C - R0016 - Sick Bay</b>						
No Asbestos						
<b>B00C - R0017 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0002/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00C - R0021 - Main Switch Board</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0002/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00C/R0021/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00C - R0022 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00C/R0024/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)	
<b>B00C - R0023 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00C/R0024/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)	
<b>B00C - R0024 - Toilet - Lobby</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00C/R0024/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)	
<b>B00C - R0025 - Toilet - Lobby</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00C/R0024/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)	
<b>B00C - R0026 - External Movement</b>						
No Asbestos						
<b>B00C - R0027 - Cleaning Distributed Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00C/R0024/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4406/B00A/R0002/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00C - R0028 - External Movement</b>						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 1980 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids Non Accessible Area  
- No void

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior**

**B00D - R0001 - Reading Area**

No Asbestos

**B00D - R0002 - Communications Room**

No Asbestos

**B00D - R0003 - Library Office/Workroom**

No Asbestos

**B00D - R0004 - External Movement**

No Asbestos

**B00D - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	------------	--------------------	---------	--------------------

4406/B00D/R0005/Wall Linings Internal/S1

**Chrysotile (white asbestos)**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Communal Facilities/Pupil Facilities - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Canteen**

No Asbestos

**B00E - R0002 - Canteen Office/Store**

No Asbestos

**B00E - R0003 - External Movement**

No Asbestos

**B00E - R0004 - Sports Store**

No Asbestos

**B00E - R0005 - Plant**

No Asbestos

**B00E - R0006 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0007 - Hall Chair Store**

No Asbestos

**B00E - R0008 - Uniform Shop**

No Asbestos

**B00E - R0010 - Shower/Change**

No Asbestos

**B00E - R0011 - External Movement**

No Asbestos

**B00E - R0012 - Movement**

No Asbestos

**B00E - R0013 - Raised Platform**

No Asbestos

**B00E - R0014 - External Movement**

No Asbestos

**B00E - R0015 - Movement**

No Asbestos

**B00E - R0017 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0018 - General Storeroom**

No Asbestos

**B00E - R0019 - Communal Space**

No Asbestos

**B00E - R0022 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0023 - Sports Store**

No Asbestos

**B00E - R0024 - Disabled Shower/Toilet**

No Asbestos

**B00E - R0025 - Toilets - Boys**

No Asbestos

**B00E - R0026 - Toilet - Lobby**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R0027 - Toilet - Lobby</b>						
No Asbestos						
<b>B00E - R0028 - Toilet - Lobby</b>						
No Asbestos						
<b>B00E - R0029 - Toilets - Girls</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Shed - 1981 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00F - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Administration - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00G - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00H - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Building Services - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B001 - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - External Movement**

No Asbestos

**B00L - R0002 - Special Programs Store**

No Asbestos

**B00L - R0003 - Special Programs Room**

No Asbestos

**B00L - R0004 - Movement**

No Asbestos

**B00L - R0005 - Movement**

No Asbestos

**B00L - R0006 - Special Programs Room**

No Asbestos

**B00L - R0007 - Special Programs Store**

No Asbestos

**B00L - R0008 - Special Programs Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00M - R0001 - External Movement**

No Asbestos

**B00M - R0002 - Practical Activities/Movement - 1hb**

No Asbestos

**B00M - R0003 - Home Base Store**

No Asbestos

**B00M - R0004 - Home Base**

No Asbestos

**B00M - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00M - R0006 - Home Base**

No Asbestos

**B00M - R0007 - Home Base Store**

No Asbestos

**B00M - R0008 - Practical Activities/Movement - 1hb**

No Asbestos

**B00M - R0009 - Withdrawal Space - 1hb**

No Asbestos

**B00M - R0010 - Home Base Store**

No Asbestos

**B00M - R0011 - Home Base**

No Asbestos

**B00M - R0012 - Practical Activities/Movement - 1hb**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Storage - 2010 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00N - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10765 - Learning Unit - Standard With P.A.A. : Placement Date - 27/03/2006**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D13468 - Learning Unit - Standard With P.A.A. : Placement Date - 26/03/2015**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 841 - D13515 - Boys Toilet : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

### Interior

#### R1 - Toilets-Boys

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

**OS 840 - D13516 - Girls Toilet : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

### Interior

#### R1 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

2017