


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bardwell Park Infants School (5148)  
**Region :** Sydney  
**State Electorate :** Rockdale  
**Local Government Area :** Rockdale

**Initial Survey :** Noel Arnold & Associates : 12 - Mar - 2008  
**Register Issue Date :** 23 - Mar - 2017

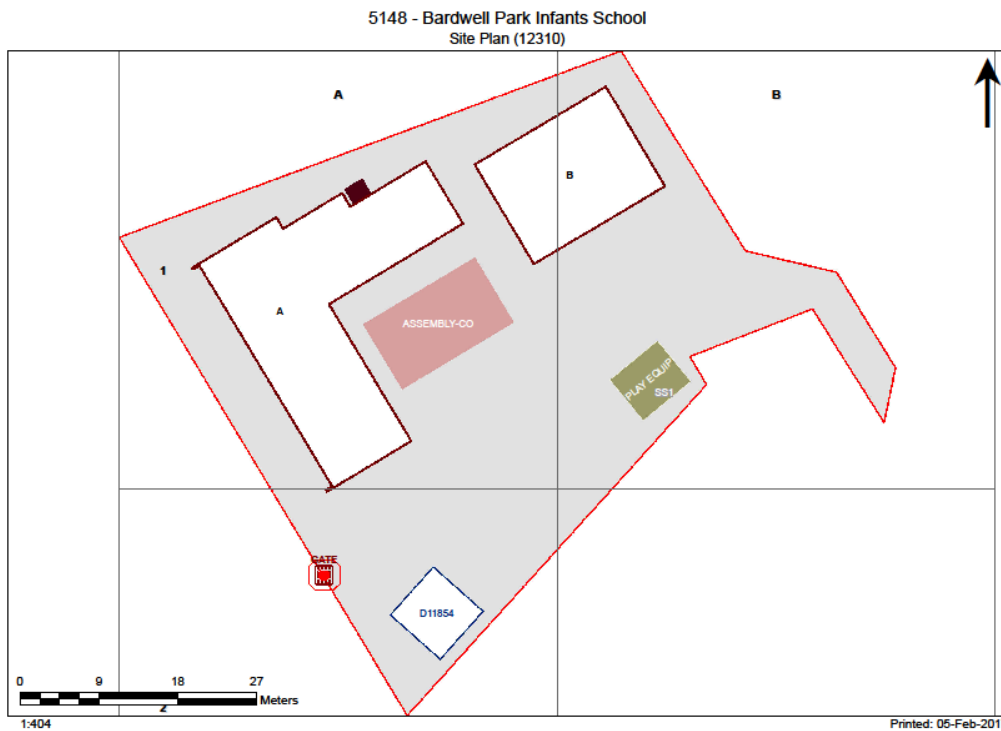

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1968 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Gable verge lining	Flat AC Sheeting	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
In-fill panels below windows	Compressed AC Sheet	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0001/Panels below windows/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior****B00A - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	119m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Panels below windows	Compressed AC Sheet	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0001/Panels below windows/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0002 - Principal**

Panels below windows	Compressed AC Sheet	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0001/Panels below windows/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0003 - General Storeroom**

No Asbestos

**B00A - R0004 - Personal Effects Storage**

No Asbestos

**B00A - R0005 - Home Base Store**

No Asbestos

**B00A - R0006 - Home Base**

Panels below windows	Compressed AC Sheet	8m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0001/Panels below windows/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0007 - Home Base**

Panels below windows	Compressed AC Sheet	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0001/Panels below windows/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0008 - Home Base Store**

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	5148/B00A/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0009 - Home Base Store**

No Asbestos

**B00A - R0010 - Personal Effects Storage**

No Asbestos

**B00A - R0011 - Practical Activities - 1hb**

No Asbestos

**B00A - R0012 - Staff Room**

No Asbestos

**B00A - R0013 - General Storeroom**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0014/Wall Linings Internal/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0014 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0014/Wall Linings Internal/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0015 - Movement</b>						
No Asbestos						
<b>B00A - R0016 - Clerical Office/Workroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R0017 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0017/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0017/Ceiling Structures/Linings/S6				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R0018 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0017/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0017/Ceiling Structures/Linings/S6				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R0019 - Cleaning Distributed Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0017/Ceiling Structures/Linings/S6				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R0020 - Sports Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R0017/Ceiling Structures/Linings/S6				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R9001 - General Assistant/Bulk Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5148/B00A/R9001/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior****B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Practical Activities - 1hb**

No Asbestos

**B00B - R0003 - Home Base Store**

No Asbestos

**B00B - R0004 - Home Base**

No Asbestos

**B00B - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00B - R0006 - Home Base**

No Asbestos

**B00B - R0007 - Home Base Store**

No Asbestos

**B00B - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### ***Demountables***

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 530 - D11854 - Library : Placement Date - 30/06/1995**

#### **Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2

#### **Interior**

##### **R1 - Reading Area**

End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

5148\_ASB\_030113\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017