


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bankstown South Infants School (5246)
Region : South Western Sydney
State Electorate : Bankstown
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 03 - Jan - 2017

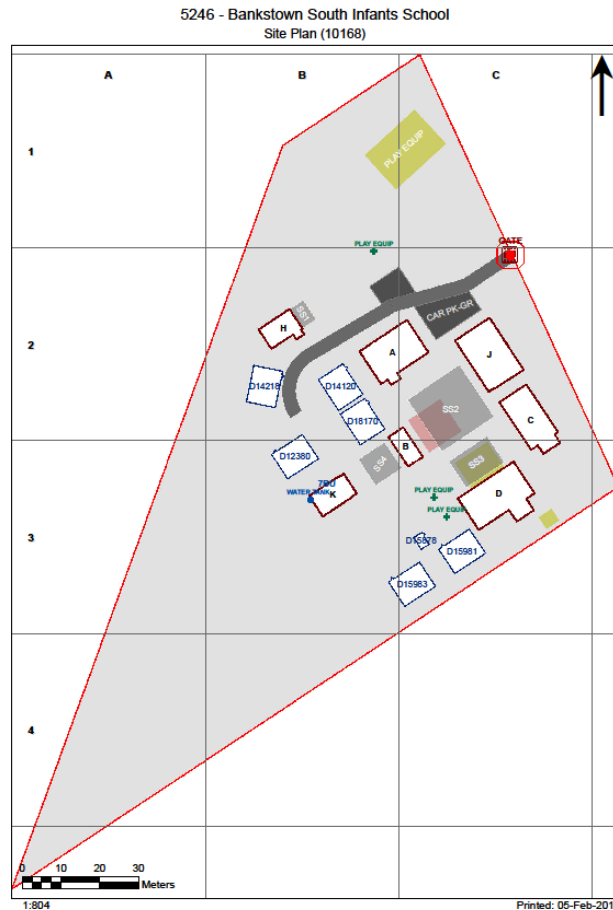

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 5246/B00A/Eaves Linings/S6					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0002 - Staff Room**

No Asbestos

B00A - R0003 - Clerical Office

No Asbestos

B00A - R0004 - Duplicating Workroom

No Asbestos

B00A - R0005 - Principal

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Clerical Office/Workroom

No Asbestos

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 5246/B00A/R0012/Wall Linings Internal/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5246/B00A/R0012/Wall Linings Internal/S7					No Asbestos Detected

B00A - R0012 - Staff Room Annexe

Wall Linings Internal	Flat AC Sheeting 5246/B00A/R0012/Wall Linings Internal/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5246/B00A/R0012/Wall Linings Internal/S7					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Canteen Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 5246/B00D/Eaves Linings/S2					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Unable to sample due to fencing					
Ceiling Void	Non Accessible Area - No manhole in building					

Interior**B00C - R0001 - Reading Area**

No Asbestos

B00C - R0002 - Home Base

No Asbestos

B00C - R0003 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting 5246/B00C/R0003/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00C - R0004 - Home Base Store

Wall Linings Internal	Flat AC Sheeting 5246/B00C/R0003/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00C - R0005 - Movement

No Asbestos

B00C - R0006 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pre-School Facilities - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 5246/B00D/Eaves Linings/S2					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00D - R0001 - Staff Toilet - Pre**

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting 5246/B00D/Eaves Linings/S2					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0002 - General Storeroom - Pre

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting 5246/B00D/Eaves Linings/S2					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0003 - Home Base - Pre

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	45m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0004 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	4m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0005 - Withdrawal - Pre

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	8m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0006 - General Storeroom - Pre

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	3m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0007 - Staff Room - Pre

Ceiling Structures/Linings	Flat AC Sheeting 5246/B00D/Eaves Linings/S2					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0008 - Kitchen - Pre

Ceiling Structures/Linings	Flat AC Sheeting 5246/B00D/Eaves Linings/S2					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 5246/B00D/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00D - R0010 - Withdrawal - Pre

Wall Linings Internal	Flat AC Sheeting 5246/B00D/R0003/Wall Linings Internal/S3	3m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0011 - Sports Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0012 - Movement						
No Asbestos						
B00D - R0013 - Practical Activities - Pre						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	5246/B00D/Eaves Linings/S2					
B00D - R0014 - Laundry - Pre						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	5246/B00D/Eaves Linings/S2					
B00D - R0015 - Access Shower/Toilet - Type 2						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	5246/B00D/Eaves Linings/S2					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2003 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00H - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - External Movement**

No Asbestos

B00J - R0002 - Reading Area

No Asbestos

B00J - R0003 - Library Office/Workroom

No Asbestos

B00J - R0004 - Communications Room

No Asbestos

B00J - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 2015 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00K - R0001 - Toilets - Boys**

No Asbestos

B00K - R0002 - Toilets - Girls

No Asbestos

B00K - R0003 - Staff Toilet

No Asbestos

B00K - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

BOOK - Toilet Block

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

BOOK - R0001 - Girls Toilet

No Asbestos

BOOK - R0002 - Boys toilet

No Asbestos

BOOK - R0003 - Staff Toilet

No Asbestos

BOOK - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D12380 - Learning Unit - Standard With P.A.A. : Placement Date - 7/01/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14120 - Learning Unit - Standard With P.A.A. : Placement Date - 8/04/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14218 - Learning Unit - Standard With P.A.A. : Placement Date - 22/12/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 837 - D15878 - Hcap Shower/Change/Toilet : Placement Date - 8/08/2002

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

OS 601 - D15981 - Learning Unit - Standard/Withdrawal : Placement Date - 26/09/1996

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D15983 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 603 - D18170 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 6/08/2008						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

5246_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017