


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bankstown Public School (7405)
Region : South Western Sydney
State Electorate : Bankstown
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Oct - 2015

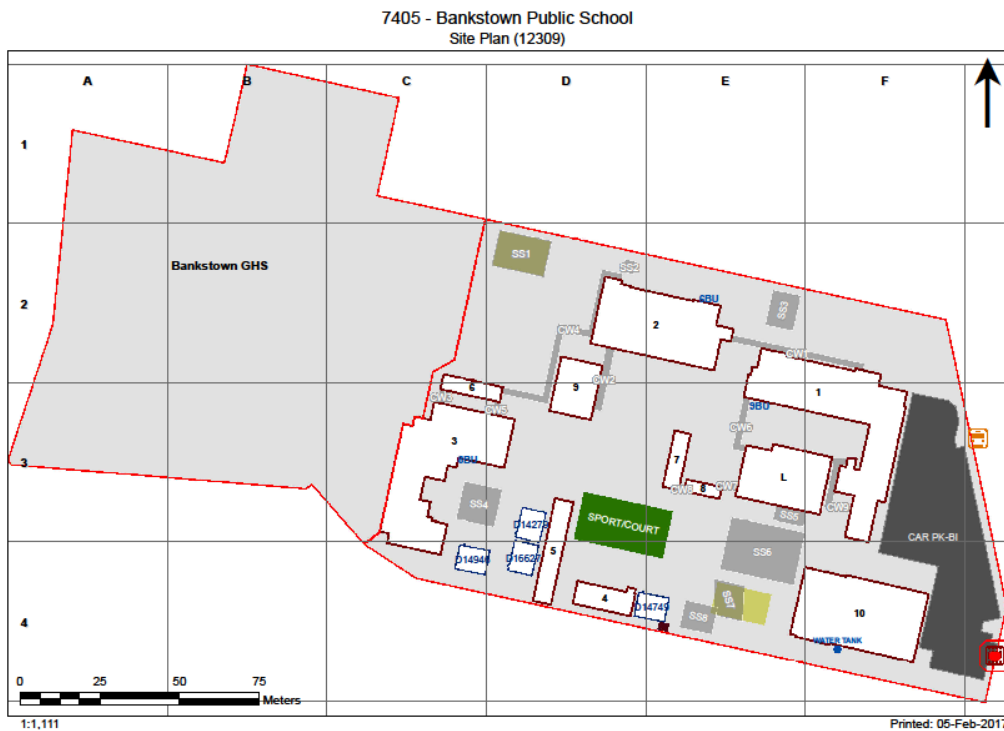

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Administration/General Learning - 1915 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B001/Eaves Linings/S13					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B001 - R0001 - Home Base (47.15 m2)						
No Asbestos						
B001 - R0002 - Home Base (47.16 m2)						
No Asbestos						
B001 - R0003 - Home Base (47.17 m2)						
No Asbestos						
B001 - R0004 - Home Base (46.24 m2)						
No Asbestos						
B001 - R0005 - Clerical Office (47.16 m2)						
No Asbestos						
B001 - R0006 - Movement (93.46 m2)						
No Asbestos						
B001 - R0007 - Sick Bay (7.67 m2)						
No Asbestos						
B001 - R0008 - General Storeroom (4.81 m2)						
No Asbestos						
B001 - R0009 - Entry Vestibule (12.04 m2)						
No Asbestos						
B001 - R0012 - Community Clinic (12.3 m2)						
No Asbestos						
B001 - R0013 - Movement (2.88 m2)						
No Asbestos						
B001 - R0014 - General Storeroom (3.84 m2)						
No Asbestos						
B001 - R0015 - Home Base (38.79 m2)						
No Asbestos						
B001 - R0016 - General Storeroom (8.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B001/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected
B001 - R0017 - Movement (12.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B001/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected
B001 - R0018 - Movement (6.64 m2)						
No Asbestos						
B001 - R0019 - Cleaning Distributed Store (5.08 m2)						
No Asbestos						
B001 - R0020 - Sports Store (6.09 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B001/R0022/Floor Coverings Res/Textile/S7				No Asbestos Detected	
B001 - R0021 - General Storeroom (6.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B001/R0022/Floor Coverings Res/Textile/S7				No Asbestos Detected	
B001 - R0022 - General Storeroom (4.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B001/R0022/Floor Coverings Res/Textile/S7				No Asbestos Detected	
B001 - R0023 - Movement (6.09 m2)						
No Asbestos						
B001 - R0024 - General Storeroom (3.48 m2)						
No Asbestos						
B001 - R0025 - Principal (16.59 m2)						
No Asbestos						
B001 - R0026 - Movement (2.85 m2)						
No Asbestos						
B001 - R0027 - Home Base (47.23 m2)						
No Asbestos						
B001 - R0028 - Home Base (48.22 m2)						
No Asbestos						
B001 - R0029 - Home Base (48.23 m2)						
No Asbestos						
B001 - R0030 - Home Base (47.96 m2)						
No Asbestos						
B001 - R0031 - Movement (76.98 m2)						
No Asbestos						
B001 - R0032 - Movement (13.63 m2)						
No Asbestos						
B001 - R0033 - General Assistant/Bulk Store (5.02 m2)						
No Asbestos						
B001 - R0034 - Staff Toilet (7.77 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B001/R0034/Wall Linings Internal/S6				Chrysotile (white asbestos)	
B001 - R0035 - Staff Toilet (4.48 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B001/R0034/Wall Linings Internal/S6				Chrysotile (white asbestos)	
B001 - R0036 - Movement (1.88 m2)						
No Asbestos						
B001 - R0037 - Movement (15.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B001/R0037/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	
B001 - R0038 - Movement (19.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B001/R0038/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
B001 - R0039 - Handwashing Facilities (15.27 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B001/R0039/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B001 - R0040 - Toilets - Boys (37.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B001/R0040/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B007/R0002/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B001 - R0042 - Movement (1.88 m2)						
No Asbestos						
B001 - R0043 - Movement (19.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
7405/B001/R0043/Ceiling Structures/Linings/S8					No Asbestos Detected	
B001 - R0044 - Stairs (9.41 m2)						
No Asbestos						
B001 - R0045 - Stairs (9.41 m2)						
No Asbestos						
B001 - R0046 - Stairs (8.75 m2)						
No Asbestos						
B001 - R0047 - Home Base Store (3.98 m2)						
No Asbestos						
B001 - R0048 - General Storeroom (3.96 m2)						
No Asbestos						
B001 - R0049 - Uniform Shop (37.94 m2)						
No Asbestos						
B001 - R1001 - Toilets - Boys/Girls (2.52 m2)						
No Asbestos						
B001 - R1002 - Movement (5.46 m2)						
No Asbestos						
B001 - R1003 - Practical Activities - 1hb (9.27 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
7405/B001/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B001 - R1004 - Home Base (48.76 m2)						
No Asbestos						
B001 - R1005 - Home Base (48.97 m2)						
No Asbestos						
B001 - R1006 - Home Base (48.9 m2)						
No Asbestos						
B001 - R1007 - Home Base (47.95 m2)						
No Asbestos						
B001 - R1008 - Movement (72.24 m2)						
No Asbestos						
B001 - R1010 - Withdrawal Space - 1hb (23.78 m2)						
No Asbestos						
B001 - R1011 - Staff Room Annexe (6.4 m2)						
No Asbestos						
B001 - R1012 - Movement (5.37 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - R1013 - Withdrawal Space - 1hb (2.35 m2)						
No Asbestos						
B001 - R1014 - General Storeroom (8.68 m2)						
No Asbestos						
B001 - R1015 - Home Base (30.51 m2)						
No Asbestos						
B001 - R1016 - Special Programs Room (30.35 m2)						
No Asbestos						
B001 - R1017 - Deputy Principal (19.45 m2)						
No Asbestos						
B001 - R1018 - Home Base (61.53 m2)						
No Asbestos						
B001 - R1019 - General Storeroom (9.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
7405/B001/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B001 - R1020 - Movement (8.02 m2)						
No Asbestos						
B001 - R1021 - Movement (92.49 m2)						
No Asbestos						
B001 - R1022 - Home Base (49.13 m2)						
No Asbestos						
B001 - R1023 - Home Base (49.14 m2)						
No Asbestos						
B001 - R1024 - Home Base (49.13 m2)						
No Asbestos						
B001 - R1025 - Home Base (49.13 m2)						
No Asbestos						
B001 - R1026 - Home Base (49.13 m2)						
No Asbestos						
B001 - R1027 - Movement (7.1 m2)						
No Asbestos						
B001 - R1028 - Stairs (11.52 m2)						
No Asbestos						
B001 - R1029 - Stairs (10.96 m2)						
No Asbestos						
B001 - R1030 - Stairs (11.12 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning - 1923 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Packing					
	7405/B002/Underfloor Voids/S14					No Asbestos Detected

Interior**B002 - R0001 - Movement (3.72 m2)**

No Asbestos

B002 - R0002 - Toilets - Boys/Girls (5.76 m2)

No Asbestos

B002 - R0003 - Movement (9.63 m2)

No Asbestos

B002 - R0009 - General Storeroom (14.56 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B001/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected

Ceiling Structures/Linings	Vermiculite					
	7405/B002/R0028/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B002 - R0010 - Movement (10.09 m2)

No Asbestos

B002 - R0011 - Personal Effects Storage (8.87 m2)

No Asbestos

B002 - R0022 - Movement (3.48 m2)

No Asbestos

B002 - R0023 - Movement (4.68 m2)

Ceiling Structures/Linings	Vermiculite					
	7405/B002/R0028/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B002 - R0024 - Movement (3.42 m2)

No Asbestos

B002 - R0026 - Staff Room Annexe (12.66 m2)

Ceiling Structures/Linings	Vermiculite					
	7405/B002/R0028/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B002 - R0027 - Movement (161.94 m2)

Ceiling Structures/Linings	Vermiculite					
	7405/B002/R0028/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B002 - R0029 - Stairs (9.68 m2)

Ceiling Structures/Linings	Vermiculite					
	7405/B002/R0029/Ceiling Structures/Linings/S20					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B002 - R0030 - Stairs (7.14 m2)

Ceiling Structures/Linings	Vermiculite					
	7405/B002/R0030/Ceiling Structures/Linings/S21					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B002 - R0031 - Entry Vestibule (10.36 m2)

No Asbestos

B002 - R0032 - Clerical Office (43.7 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B002 - R0033 - Duplicating Workroom (16.91 m2)						
No Asbestos						
B002 - R0034 - Principal (26.61 m2)						
No Asbestos						
B002 - R0035 - Access Shower/Toilet (6.98 m2)						
No Asbestos						
B002 - R0036 - Staff Room (51.76 m2)						
No Asbestos						
B002 - R0037 - Staff Room Annexe (36.25 m2)						
No Asbestos						
B002 - R0038 - Home Base Store (4.33 m2)						
No Asbestos						
B002 - R0039 - Withdrawal - M (4.74 m2)						
No Asbestos						
B002 - R0040 - Home Base (44.14 m2)						
No Asbestos						
B002 - R0041 - Movement (12.84 m2)						
No Asbestos						
B002 - R0042 - Interview (17.54 m2)						
No Asbestos						
B002 - R0043 - Interview/Office - Type 3 (20.55 m2)						
No Asbestos						
B002 - R0044 - Staff Toilet (2.28 m2)						
No Asbestos						
B002 - R0045 - Staff Toilet (2.28 m2)						
No Asbestos						
B002 - R0046 - Staff Toilet (2.28 m2)						
No Asbestos						
B002 - R0047 - Sick Bay (10.38 m2)						
No Asbestos						
B002 - R0048 - Handwashing Facilities (2.04 m2)						
No Asbestos						
B002 - R0049 - Handwashing Facilities (2.04 m2)						
No Asbestos						
B002 - R0050 - Handwashing Facilities (2.04 m2)						
No Asbestos						
B002 - R0051 - Interview/Office - Type 3 (17.53 m2)						
No Asbestos						
B002 - R0052 - Interview/Office - Type 3 (15.78 m2)						
No Asbestos						
B002 - R0053 - Movement (75.17 m2)						
No Asbestos						
B002 - R1001 - Toilets - Boys/Girls (2.27 m2)						
Wall Linings Internal	Flat AC Sheeting					
	7405/B002/R0028/Ceiling Structures/Linings/S9					No Asbestos Detected
B002 - R1002 - Movement (5.68 m2)						
No Asbestos						
B002 - R1003 - Withdrawal Space - 1hb (9.69 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B002 - R1004 - Home Base Store (6.61 m2)						
No Asbestos						
B002 - R1005 - Home Base (47.27 m2)						
No Asbestos						
B002 - R1006 - Home Base (46.03 m2)						
No Asbestos						
B002 - R1007 - Home Base (59.7 m2)						
No Asbestos						
B002 - R1008 - Home Base (47.4 m2)						
No Asbestos						
B002 - R1009 - Home Base (45.61 m2)						
No Asbestos						
B002 - R1010 - Withdrawal Space - 1hb (9.42 m2)						
No Asbestos						
B002 - R1011 - Movement (5.35 m2)						
No Asbestos						
B002 - R1012 - Cleaning Distributed Store (2.19 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
			7405/B002/R0028/Ceiling Structures/Linings/S9			
B002 - R1013 - Home Base (53.31 m2)						
No Asbestos						
B002 - R1014 - Home Base (53.74 m2)						
No Asbestos						
B002 - R1015 - Movement (81.7 m2)						
No Asbestos						
B002 - R1016 - Stairs (12.46 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
			7405/B002/R1016/Wall Linings Internal/S22			
B002 - R1017 - Stairs (12.29 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
			7405/B002/R1017/Wall Linings Internal/S23			

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B003 - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B003 - R0001 - Communal Space (45.71 m2)**

No Asbestos

B003 - R0002 - Communal Space (45.71 m2)

No Asbestos

B003 - R0003 - Movement (2.07 m2)

No Asbestos

B003 - R0004 - Movement (17.7 m2)

No Asbestos

B003 - R0005 - Cleaning Distributed Store (1.12 m2)

No Asbestos

B003 - R0006 - Cleaning Supplies (5.74 m2)

No Asbestos

B003 - R0007 - General Storeroom (15.73 m2)

No Asbestos

B003 - R0008 - Home Base (45.71 m2)

No Asbestos

B003 - R0009 - Staff Room Annexe (10.3 m2)

No Asbestos

B003 - R0010 - Movement (1.37 m2)

No Asbestos

B003 - R0011 - Home Base (45.71 m2)

No Asbestos

B003 - R0012 - Home Base (48.85 m2)

No Asbestos

B003 - R0013 - Home Base (48.85 m2)

No Asbestos

B003 - R0014 - Staff Room Annexe (10.37 m2)

No Asbestos

B003 - R0015 - Home Base (45.85 m2)

No Asbestos

B003 - R0017 - Movement (3.86 m2)

No Asbestos

B003 - R0018 - Sports Store (5.37 m2)

No Asbestos

B003 - R0019 - Hall Chair Store (1.27 m2)

No Asbestos

B003 - R0021 - Movement (1.89 m2)

No Asbestos

B003 - R0022 - Movement (33.29 m2)

No Asbestos

B003 - R0023 - Movement (50.23 m2)

No Asbestos

B003 - R0024 - Movement (68.82 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B003 - R0025 - Movement (1.89 m2)						
No Asbestos						
B003 - R0026 - Movement (143.79 m2)						
No Asbestos						
B003 - R0027 - Movement (55.88 m2)						
No Asbestos						
B003 - R0028 - Movement (33.12 m2)						
No Asbestos						
B003 - R0029 - Movement (17.75 m2)						
No Asbestos						
B003 - R0030 - Stairs (6.8 m2)						
No Asbestos						
B003 - R0031 - Movement (4.26 m2)						
No Asbestos						
B003 - R0032 - Sports Store (9.91 m2)						
No Asbestos						
B003 - R0033 - Stairs (6.79 m2)						
No Asbestos						
B003 - R0034 - General Storeroom (6.7 m2)						
No Asbestos						
B003 - R1001 - Staff Toilet (7.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	7405/B003/R1001/Floor Coverings Res/Textile/S11				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B003/R1001/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	
B003 - R1002 - General Storeroom (3.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B003/R1002/Ceiling Structures/Linings/S25				Chrysotile (white asbestos)	
B003 - R1003 - Staff Room (47.36 m2)						
No Asbestos						
B003 - R1005 - Home Base (41.51 m2)						
No Asbestos						
B003 - R1006 - Shower/Change (4.82 m2)						
Wall Linings Internal	Flat AC Sheeting	2m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B003/R1006/Wall Linings Internal/S10				Chrysotile (white asbestos)	
B003 - R1007 - Staff Toilet (8.06 m2)						
No Asbestos						
B003 - R1008 - Handwashing Facilities (7.86 m2)						
No Asbestos						
B003 - R1009 - Movement (4.38 m2)						
No Asbestos						
B003 - R1010 - Special Programs Room (15.96 m2)						
No Asbestos						
B003 - R1011 - Home Base (46.41 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B003 - R1012 - Staff Room Annexe (10.28 m2)						
No Asbestos						
B003 - R1013 - Movement (60.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B003/R1013/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	
B003 - R1014 - Home Base (46.76 m2)						
No Asbestos						
B003 - R1015 - Home Base (46.76 m2)						
No Asbestos						
B003 - R1017 - Home Base (46.76 m2)						
No Asbestos						
B003 - R1018 - Movement (54.46 m2)						
No Asbestos						
B003 - R1019 - Movement (36.05 m2)						
No Asbestos						
B003 - R1020 - Staff Room Annexe (10.29 m2)						
No Asbestos						
B003 - R1021 - Home Base (46.48 m2)						
No Asbestos						
B003 - R1022 - General Storeroom (16.38 m2)						
No Asbestos						
B003 - R1023 - Movement (4.65 m2)						
No Asbestos						
B003 - R1024 - Stairs (15.14 m2)						
No Asbestos						
B003 - R1025 - Stairs (14.73 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - Other-After School Care - 1930 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B004 - R0001 - Movement (2.56 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B004/R0001/Ceiling Structures/Linings/S36				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R0002 - Practical Activities - 1hb (6.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B004/R0002/Ceiling Structures/Linings/S37				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B004 - R0003 - General Storeroom (10.59 m2)

Wall Linings Internal	Flat AC Sheeting	50m2	North, west	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B004/R0003/Wall Linings Internal/S38				Chrysotile (white asbestos)		

B004 - R0005 - Communal Space (101.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	102m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B004/R0005/Ceiling Structures/Linings/S39				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B005 - Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 7405/B005/Wall Cladding/S1					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B005 - R0001 - Staff Toilet (3.89 m2)**

No Asbestos

B005 - R0003 - General Storeroom (6.3 m2)

No Asbestos

B005 - R0004 - General Storeroom (3.91 m2)

No Asbestos

B005 - R0005 - Canteen (28.95 m2)

No Asbestos

B005 - R0006 - Movement (50.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B005/R0006/Ceiling Structures/Linings/S31					Chrysotile (white asbestos)

B005 - R0007 - Kiln Room (1.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B005/R0007/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)

B005 - R0008 - Special Programs Room (57.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B005/R0008/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)

B005 - R0009 - Garden Store (13.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7405/B005/R0009/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B006 - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B006 - R0001 - Movement (5.88 m2)

No Asbestos

B006 - R0002 - Toilets - Boys (25.59 m2)

No Asbestos

B006 - R0003 - Toilets - Girls (25.51 m2)

No Asbestos

B006 - R0004 - Movement (5.96 m2)

No Asbestos

B006 - R0005 - Movement (6.38 m2)

No Asbestos

B006 - R0006 - Movement (6.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 7405/B007/Eaves Linings/S15					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B007 - R0001 - Drinking Facilities (20.3 m2)

No Asbestos

B007 - R0002 - Toilets - Girls (54.14 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7405/B007/R0002/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B007 - R0003 - Cleaning Distributed Store (2.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B008 - R0001 - Movement (42.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B009 - R0001 - Movement (38.48 m2)

No Asbestos

B009 - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B009 - R0003 - Home Base Store (6.01 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0004 - Home Base (59.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0006 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0008 - Practical Activities - 1hb (19.4 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1984 - Brick/Veneer (Brick/Veneer)**Exterior**

Wall Cladding	Flat AC Sheeting 7405/B00L/Wall Cladding/S2					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00L - R0001 - Movement (28.5 m2)**

No Asbestos

B00L - R0002 - Reading Area (220.05 m2)

No Asbestos

B00L - R0003 - Library Office/Workroom (12.05 m2)

No Asbestos

B00L - R0004 - Library Office/Workroom (26.2 m2)

No Asbestos

B00L - R0005 - Communications Room (42.68 m2)

No Asbestos

B00L - R0006 - General Storeroom (4.79 m2)

No Asbestos

B00L - R0007 - Cleaning Distributed Store (2.04 m2)

No Asbestos

B00L - R0008 - Movement (75.52 m2)

Wall Linings Internal	Flat AC Sheeting 7405/B00L/Wall Cladding/S2					No Asbestos Detected
Door Lining	Flat AC Sheeting 7405/B00L/R0008/In-fill-panel/S4	2m2	On Door	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

B00L - R0009 - Cleaning Distributed Store (0.86 m2)

Wall Linings Internal	Flat AC Sheeting 7405/B00L/R0009/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00L - R0010 - Movement (38.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B010 - Communal Facilities - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B010 - R0001 - Communal Space (212.63 m2)**

No Asbestos

B010 - R0002 - Disabled Shower/Toilet (4.89 m2)

No Asbestos

B010 - R0003 - Toilets - Boys (11.02 m2)

No Asbestos

B010 - R0004 - Communications Room (2.29 m2)

No Asbestos

B010 - R0005 - General Assistant/Bulk Store (17.03 m2)

No Asbestos

B010 - R0006 - Garden Store (12.99 m2)

No Asbestos

B010 - R0007 - Performance Store (10.96 m2)

No Asbestos

B010 - R0008 - Cleaning Distributed Store (6.82 m2)

No Asbestos

B010 - R0009 - Movement (8.63 m2)

No Asbestos

B010 - R0010 - Canteen Office/Store (10.2 m2)

No Asbestos

B010 - R0011 - Movement (27.27 m2)

No Asbestos

B010 - R0012 - Raised Platform (54.01 m2)

No Asbestos

B010 - R0013 - Chair Store (11.1 m2)

No Asbestos

B010 - R0014 - Cleaning Distributed Store (3.86 m2)

No Asbestos

B010 - R0015 - Main Switch Board (2.57 m2)

No Asbestos

B010 - R0016 - P.E. Store (17.16 m2)

No Asbestos

B010 - R0017 - Sports Store (17.28 m2)

No Asbestos

B010 - R0018 - Toilets - Girls (12.32 m2)

No Asbestos

B010 - R0019 - Stairs (7.04 m2)

No Asbestos

B010 - R0020 - Movement (67.88 m2)

No Asbestos

B010 - R0021 - Movement (264.38 m2)

No Asbestos

B010 - R0022 - Canteen (41.79 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D14279 - Learning Unit - Standard With P.A.A. : Placement Date - 12/12/2011

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 601 - D14749 - Learning Unit - Standard/Withdrawal : Placement Date - 5/04/2002

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D14946 - Learning Unit - Standard/Withdrawal : Placement Date - 30/12/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D16627 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 12/12/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017