


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Burwood Girls High School (8152)
Region : Sydney
State Electorate : Strathfield
Local Government Area : Burwood

Initial Survey : Noel Arnold & Associates : 05 - May - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Jul - 2015

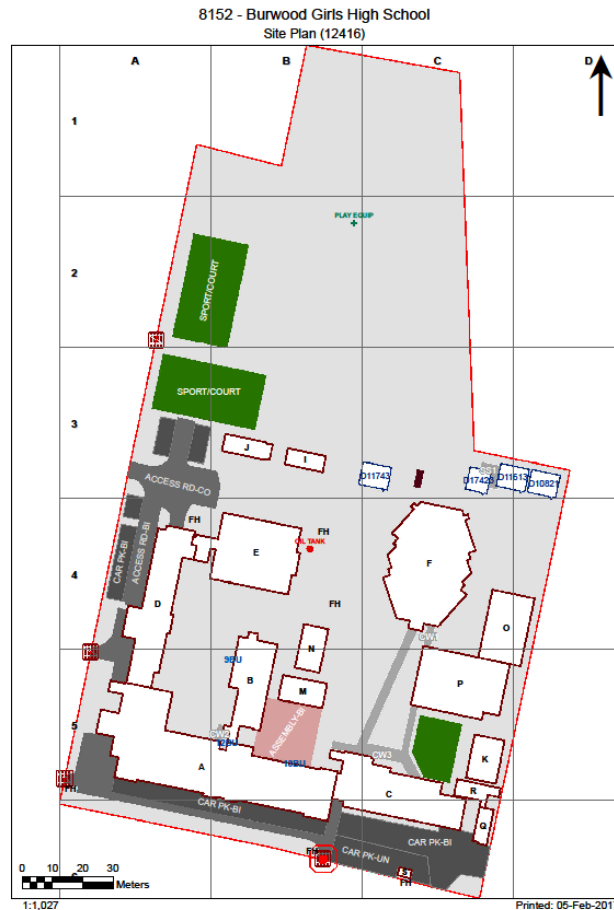

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1936 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Eaves at very high level to First floor -						
Underfloor Voids	Packing 8152/B00A/Underfloor Voids/S23					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00A - R0001 - General Storeroom (7.34 m2)

No Asbestos

B00A - R0002 - General Storeroom (13.73 m2)

No Asbestos

B00A - R0003 - Computer Learning Space (52.94 m2)

No Asbestos

B00A - R0004 - General Learning Space (47.21 m2)

No Asbestos

B00A - R0005 - General Learning Space (47.21 m2)

No Asbestos

B00A - R0006 - General Learning Space (47.22 m2)

No Asbestos

B00A - R0009 - Pupil Entry (17.43 m2)

No Asbestos

B00A - R0010 - Administration - Clerical (24.82 m2)

No Asbestos

B00A - R0011 - Administration - Clerical (47.08 m2)

No Asbestos

B00A - R0012 - General Learning Space (47.25 m2)

No Asbestos

B00A - R0013 - General Learning Space (47.29 m2)

No Asbestos

B00A - R0014 - Staff Study (56.93 m2)

No Asbestos

B00A - R0015 - External Movement (18.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00H/Awnings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0016 - General Storeroom (23.21 m2)

No Asbestos

B00A - R0017 - Staff - Toilet (4.18 m2)

No Asbestos

B00A - R0018 - Secure Storeroom (8.24 m2)

No Asbestos

B00A - R0019 - Movement (265.69 m2)

No Asbestos

B00A - R0020 - General Learning Space (47.08 m2)

No Asbestos

B00A - R0021 - General Learning Space (47.09 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0022 - Interview/Office - Type 1 (17.66 m2)						
No Asbestos						
B00A - R0023 - General Learning Space (37.78 m2)						
No Asbestos						
B00A - R0024 - General Learning Space (56.38 m2)						
No Asbestos						
B00A - R0025 - Toilets-Girls (11.35 m2)						
No Asbestos						
B00A - R0026 - Clinic - Girls (12.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00D/R1007/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00A - R0027 - Design L.S. (50.31 m2)						
No Asbestos						
B00A - R0028 - Design L.S. (53.51 m2)						
No Asbestos						
B00A - R0029 - Leading Teacher (16.84 m2)						
No Asbestos						
B00A - R0030 - External Movement (2.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00H/Awnings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0031 - External Movement (2.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00H/Awnings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0032 - External Stairs (15.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00A - R0033 - Stairs (13.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00A - R0034 - Stairs (16.63 m2)						
No Asbestos						
B00A - R0035 - Principal Office (24.92 m2)						
No Asbestos						
B00A - R0036 - Stairs (13.91 m2)						
No Asbestos						
B00A - R0037 - General Storeroom (1.31 m2)						
No Asbestos						
B00A - R0038 - Stairs (7.17 m2)						
No Asbestos						
B00A - R1001 - Study Space (9.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1002 - General Learning Space (56.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1003 - General Learning Space (49.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1004 - Music Learning Space (49.91 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1005 - General Learning Space (48.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1006 - Design L.S. (79.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1007 - General Learning Space (49.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1008 - General Learning Space (49.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1009 - General Learning Space (49.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1010 - Design L.S. (69.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00D/R1007/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00A - R1011 - Cleaning Supplies Store (17.46 m2)						
No Asbestos						
B00A - R1012 - General Storeroom (17.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1012/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R1013 - General Storeroom (3.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00A - R1014 - General Learning Space (49.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1015 - General Learning Space (50.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1016 - Staff Study (37.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	20m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1017 - Design L.S. (55.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	20m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1018 - General Storeroom (15.17 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Infill panels above concrete structure	Flat AC Sheeting	30m2	South facing, East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9				Chrysotile (white asbestos)	
B00A - R1020 - Interview/Office - Type 1 (9.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
B00A - R1022 - Staff Study (36.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	15m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1023 - General Storeroom (17.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	15m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1016/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1024 - Movement (242 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	243m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	150m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9				Chrysotile (white asbestos)	
Ceiling void access hatch panel	Flat AC Sheeting	<1m2	Outside room AR1001	Good Condition (1)	Medium (2)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
B00A - R1025 - General Storeroom (17.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	20m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Infill panels above concrete structure/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1025/Floor Coverings Res/Textile/S10				No Asbestos Detected	
B00A - R1026 - Stairs (12.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00A/R1024/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
B00A - R1027 - Stairs (11.17 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1028 - Staff - Toilet (12.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	13m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Infill panels above concrete structure/S9					Chrysotile (white asbestos)	
B00A - R1029 - Staff Study (36.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected	
B00A - R1030 - Staff Study (35.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	15m2	Above concrete structure	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Infill panels above concrete structure/S9					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
8152/B00A/R1016/Floor Coverings Res/Textile/S24					No Asbestos Detected	
B00A - R1031 - Stairs (11.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R9001 - Darkroom Space (28.64 m2)						
No Asbestos						
B00A - R9002 - Movement (4.48 m2)						
No Asbestos						
B00A - R9003 - Movement (2.99 m2)						
No Asbestos						
B00A - R9005 - Visual Arts Store (68.16 m2)						
No Asbestos						
B00A - R9006 - Cleaning Store - Distributed (16.11 m2)						
No Asbestos						
B00A - R9007 - Cleaning Supplies Store (29.48 m2)						
No Asbestos						
B00A - R9009 - Staff - Toilet (4.66 m2)						
No Asbestos						
B00A - R9011 - External Stairs (1.66 m2)						
No Asbestos						
B00A - R9012 - Stairs (7.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R9013 - Stairs (5.42 m2)						
No Asbestos						
B00A - R9014 - Movement (54.47 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R9015 - Movement (90.25 m2)

No Asbestos

B00A - R9016 - Printing/Photocopying (22.32 m2)

Ceiling Structures/Linings Flat AC Sheeting
8152/B00A/R9016/Ceiling Structures/Linings/S11

No Asbestos Detected

B00A - R9017 - Printing/Photocopying (22.78 m2)

Ceiling Structures/Linings Flat AC Sheeting
8152/B00A/R9016/Ceiling Structures/Linings/S11

No Asbestos Detected

B00A - R9018 - External Movement (120.47 m2)

Ceiling Structures/Linings Flat AC Sheeting
8152/B00B/R0013/Ceiling Structures/Linings/S18

No Asbestos Detected

B00A - R9019 - General Storeroom (22.73 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Science Learning - 1926 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - access hatch not accessible at height above book shelves and cabinets					
Underfloor Voids	Non Accessible Area - no access hatches, or peep holes to gain access to visually assess					

Interior

B00B - R0001 - Staff Study (22.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0002 - Food Technology L.S. (77.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	78m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0003 - General Storeroom (9.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0004 - Food Technology L.S. (77.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting	78m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0005 - Movement (7.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0006 - Movement (24.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0007 - Movement (34.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0008 - Computer Store (6.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0009 - Food/Research Space (16.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0010 - Pantry (10.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0011 - Food/Research Space (10.59 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0012 - Laundry (4.96 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00A/R1024/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0013 - External Movement (4.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8152/B00B/R0013/Ceiling Structures/Linings/S18				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00B - R9001 - Movement (4.68 m2)

No Asbestos

B00B - R9002 - Darkroom Space (5.31 m2)

No Asbestos

B00B - R9003 - Darkroom Space (18.85 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Music/Art - 1970 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	High level eaves throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No access to sample, eaves at 1st						
Eaves Linings	Compressed fibre board 8152/B00C/Eaves Linings/S22					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - no access, Hatch sealed under floor covering in CR0026					

Interior

B00C - R0002 - Music Store (8.07 m2)						
No Asbestos						
B00C - R0003 - Music Store (7.35 m2)						
No Asbestos						
B00C - R0004 - Practice/Seminar (8.07 m2)						
No Asbestos						
B00C - R0005 - Music Learning Space (66.5 m2)						
No Asbestos						
B00C - R0006 - Movement (25.13 m2)						
No Asbestos						
B00C - R0007 - Music Learning Space (66.32 m2)						
No Asbestos						
B00C - R0009 - General Storeroom (3.65 m2)						
No Asbestos						
B00C - R0010 - Staff - Toilet (10.29 m2)						
No Asbestos						
B00C - R0011 - Cleaning Store - Distributed (3.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00D/R1007/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00C - R0012 - Cleaning Store - Distributed (1.8 m2)						
No Asbestos						
B00C - R0013 - Resources (6.44 m2)						
No Asbestos						
B00C - R0014 - Resources (6.44 m2)						
No Asbestos						
B00C - R0015 - Staff Study (18.84 m2)						
No Asbestos						
B00C - R0016 - External Movement (63.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8152/B00C/R0016/Ceiling Structures/Linings/S19					No Asbestos Detected
B00C - R0017 - Stairs (6.88 m2)						
No Asbestos						
B00C - R0018 - General Storeroom (10.79 m2)						
No Asbestos						
B00C - R0019 - Movement (55.24 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0020 - Movement (18.34 m2)						
No Asbestos						
B00C - R0021 - External Movement (1.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00H/Awnings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0023 - Lift (3.79 m2)						
Non Accessible						
B00C - R0024 - Music Learning Space (82.96 m2)						
No Asbestos						
B00C - R0025 - Music Entry/Display (34.74 m2)						
No Asbestos						
B00C - R0026 - Music Learning Space (40.78 m2)						
No Asbestos						
B00C - R1001 - Art Learning Space (69.1 m2)						
No Asbestos						
B00C - R1002 - Resources Store (11.59 m2)						
No Asbestos						
B00C - R1003 - Art Learning Space (66.1 m2)						
No Asbestos						
B00C - R1004 - Resources Space (11.7 m2)						
No Asbestos						
B00C - R1005 - Resources Space (5.72 m2)						
No Asbestos						
B00C - R1006 - Bulk Store (5.23 m2)						
No Asbestos						
B00C - R1007 - Art Learning Space (67.74 m2)						
No Asbestos						
B00C - R1008 - Movement (19.42 m2)						
No Asbestos						
B00C - R1010 - Bulk Store (5.24 m2)						
No Asbestos						
B00C - R1011 - Cleaning Store - Distributed (4.5 m2)						
No Asbestos						
B00C - R1012 - Workshop (10.61 m2)						
No Asbestos						
B00C - R1013 - Stairs (13.33 m2)						
No Asbestos						
B00C - R1014 - Movement (89.18 m2)						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/Other - 1938 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Eaves at 2nd floor level, and not						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - no access hatch or peep holes to void below main section of D block					

Interior**B00D - R0001 - Movement (11.62 m2)**

No Asbestos

B00D - R0002 - Toilets-Girls (21.64 m2)

No Asbestos

B00D - R0003 - Toilets-Girls (21.74 m2)

No Asbestos

B00D - R0005 - Movement (7.31 m2)

No Asbestos

B00D - R0006 - Commonroom (30.55 m2)

No Asbestos

B00D - R0007 - Student Canteen (49.32 m2)

No Asbestos

B00D - R0008 - Pantry (9.9 m2)

No Asbestos

B00D - R0009 - General Storeroom (2.7 m2)

No Asbestos

B00D - R0010 - Staff - Toilet (1.53 m2)

No Asbestos

B00D - R0011 - Stairs (11.12 m2)

No Asbestos

B00D - R0012 - Movement (272.99 m2)

No Asbestos

B00D - R0013 - Cleaning Supplies (7.13 m2)

No Asbestos

B00D - R0014 - Lift (2.24 m2)

Non Accessible

B00D - R0015 - Movement (4.52 m2)

No Asbestos

B00D - R0016 - Toilets-Disabled (8.24 m2)

No Asbestos

B00D - R0017 - External Movement (56.3 m2)

No Asbestos

B00D - R1001 - Laboratory L.S. (89.17 m2)

Floor Coverings Res/Textile	Vinyl Tiles	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8152/B00D/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

B00D - R1002 - Apparatus Store (27.09 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00D/R1007/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00D - R1003 - Chemical Store (16.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00D/R1007/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00D - R1004 - General Learning Space (46.13 m2)						
No Asbestos						
B00D - R1005 - Laboratory L.S. (91.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	70m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8152/B00D/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00D/R1007/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00D - R1006 - Staff Study (32.29 m2)						
No Asbestos						
B00D - R1008 - Stairs (16.05 m2)						
No Asbestos						
B00D - R1009 - Movement (4.55 m2)						
No Asbestos						
B00D - R1010 - External Movement (70.57 m2)						
No Asbestos						
B00D - R1011 - Stairs (0.54 m2)						
No Asbestos						
B00D - R1012 - Movement (106.3 m2)						
No Asbestos						
B00D - R2001 - Design L.S. (92.74 m2)						
No Asbestos						
B00D - R2002 - Performance Workspace (45.48 m2)						
No Asbestos						
B00D - R2003 - General Learning Space (48.1 m2)						
No Asbestos						
B00D - R2004 - General Storeroom (13.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00A/R1012/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R2005 - Computer Learning Space (80.47 m2)						
No Asbestos						
B00D - R2006 - Staff Study (31.65 m2)						
No Asbestos						
B00D - R2007 - Movement (89.65 m2)						
No Asbestos						
B00D - R2008 - Stairs (16.05 m2)						
No Asbestos						
B00D - R2009 - External Movement (4.98 m2)						
No Asbestos						
B00D - R2010 - Movement (4.49 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Science/Library - 1971 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	Non Accessible Area - No access hatches, or visible peep holes
Ceiling Voids	Non Accessible Area - ceiling pitched with roof, minimal clearance, no access to void

Interior**B00E - M1001 - Workroom (15.24 m2)**

Ceiling Structures/Linings	Vermiculite 8152/B00E/R0009/Ceiling Structures/Linings/S14	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00E - M1002 - Main Area (67.64 m2)

Ceiling Structures/Linings	Vermiculite 8152/B00E/R0009/Ceiling Structures/Linings/S14	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00E - M1003 - Workroom (23.58 m2)

No Asbestos

B00E - M1004 - Workroom (13.68 m2)

No Asbestos

B00E - M1005 - Stairs (2.6 m2)

No Asbestos

B00E - M1006 - Stairs (2.61 m2)

No Asbestos

B00E - R0001 - Laboratory L.S. (91.11 m2)

Ceiling Structures/Linings	Vermiculite 8152/B00E/R0009/Ceiling Structures/Linings/S14	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00E - R0002 - Apparatus Store (16.82 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00E - R0003 - Distribution Board Cupboard (0.44 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0004 - Laboratory L.S. (91.42 m2)

Ceiling Structures/Linings	Vermiculite 8152/B00E/R0009/Ceiling Structures/Linings/S14	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00E - R0007 - Laboratory L.S. (91.01 m2)

Ceiling Structures/Linings	Vermiculite 8152/B00E/R0009/Ceiling Structures/Linings/S14	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00E - R0008 - Laboratory L.S. (91.11 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8152/B00E/R0009/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0011 - Movement (40.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0012 - General Storeroom (9.55 m2)						
No Asbestos						
B00E - R0014 - Plant (10.57 m2)						
Cable conduit	Fibre Cement Pipe 8152/B00E/R0014/AC conduit pipe/S16	3m	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0015 - External Stairs (8.06 m2)						
No Asbestos						
B00E - R0016 - Computer Learning Space (48.58 m2)						
Ceiling Structures/Linings	Vermiculite 8152/B00E/R0017/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0017 - Preparation (48.85 m2)						
Ceiling Structures/Linings	Vermiculite 8152/B00E/R0017/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8152/B00E/R0009/Floor Coverings Res/Textile/S15	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0018 - External Movement (27.74 m2)						
No Asbestos						
B00E - R1001 - Seminar (13.24 m2)						
No Asbestos						
B00E - R1002 - Seminar (11.39 m2)						
No Asbestos						
B00E - R1003 - Cleaning Store - Distributed (0.44 m2)						
No Asbestos						
B00E - R1004 - Movement (4.38 m2)						
No Asbestos						
B00E - R1005 - Plant (0.54 m2)						
No Asbestos						
B00E - R1006 - Plant (0.48 m2)						
No Asbestos						
B00E - R1007 - Distribution Board Cupboard (0.26 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00E - R1008 - Seminar (11.49 m2)						
No Asbestos						
B00E - R1009 - Seminar (13.28 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1010 - Audio Visual Workroom (28.7 m2)						
No Asbestos						
B00E - R1011 - Workroom (12.69 m2)						
No Asbestos						
B00E - R1012 - Workroom (15.72 m2)						
No Asbestos						
B00E - R1013 - Librarian (10.39 m2)						
No Asbestos						
B00E - R1014 - Staff - Toilet (2.94 m2)						
No Asbestos						
B00E - R1015 - Staff - Toilet (2.98 m2)						
No Asbestos						
B00E - R1016 - Workroom (71.28 m2)						
Ceiling Structures/Linings	Vermiculite		8152/B00E/R0009/Ceiling Structures/Linings/S14			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1017 - Main Area (327.88 m2)						
Ceiling Structures/Linings	Vermiculite		8152/B00E/R0009/Ceiling Structures/Linings/S14			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1019 - Stairs (17.21 m2)						
No Asbestos						
B00E - R1020 - Stairs (1 m2)						
No Asbestos						
B00E - R1021 - Stairs (1 m2)						
No Asbestos						
B00E - R1022 - External Movement (24.11 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 1980 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids No Asbestos Found

Interior

B00F - M0001 - Performing Arts Changeroom (15.28 m2)

Floor Coverings Res/Textile Vinyl Tiles
 8152/B00F/M0001/Floor Coverings Res/Textile/S13 **No Asbestos Detected**

B00F - M0002 - Toilets-Girls (1.82 m2)

Floor Coverings Res/Textile Vinyl Tiles
 8152/B00F/M0001/Floor Coverings Res/Textile/S13 **No Asbestos Detected**

B00F - M0003 - Shower/Change (1.77 m2)

No Asbestos

B00F - M0004 - Performing Arts Changeroom (15.8 m2)

Floor Coverings Res/Textile Vinyl Tiles
 8152/B00F/M0001/Floor Coverings Res/Textile/S13 **No Asbestos Detected**

B00F - M0005 - Shower/Change (1.78 m2)

No Asbestos

B00F - M0006 - Toilets-Girls (1.8 m2)

Floor Coverings Res/Textile Vinyl Tiles
 8152/B00F/M0001/Floor Coverings Res/Textile/S13 **No Asbestos Detected**

B00F - M0007 - Control Room (14.73 m2)

No Asbestos

B00F - M0008 - Stairs (2.76 m2)

No Asbestos

B00F - M0009 - Movement (5.22 m2)

No Asbestos

B00F - M0010 - Stairs (2.62 m2)

No Asbestos

B00F - M0011 - Movement (5.22 m2)

No Asbestos

B00F - M0014 - Stage (10.63 m2)

Ceiling Structures/Linings Fibre cement sheeting
 8152/B00F/M0014/Ceiling Structures/Linings/S20 **No Asbestos Detected**

B00F - M0015 - Stairs (1.68 m2)

No Asbestos

B00F - R0001 - Chair Store (18.77 m2)

No Asbestos

B00F - R0002 - Staff - Toilet (1.79 m2)

No Asbestos

B00F - R0004 - Staff - Toilet (26.97 m2)

No Asbestos

B00F - R0005 - Cleaning Store - Distributed (3.04 m2)

No Asbestos

B00F - R0006 - Distribution Board Cupboard (0.86 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0007 - Performing Arts Store (11.07 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00F/M0001/Floor Coverings Res/Textile/S13				No Asbestos Detected	
B00F - R0008 - Staff Kitchen (15.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8152/B00F/M0001/Floor Coverings Res/Textile/S13				No Asbestos Detected	
B00F - R0009 - Staff - Toilet (26.76 m2)						
No Asbestos						
B00F - R0010 - Movement (69.8 m2)						
No Asbestos						
B00F - R0011 - Chair Store (21.17 m2)						
No Asbestos						
B00F - R0012 - Stage (110.54 m2)						
No Asbestos						
B00F - R0013 - External Movement (2.69 m2)						
No Asbestos						
B00F - R0014 - External Movement (2.69 m2)						
No Asbestos						
B00F - R0015 - External Movement (2.69 m2)						
No Asbestos						
B00F - R0016 - External Movement (2.47 m2)						
No Asbestos						
B00F - R0017 - External Movement (15.55 m2)						
No Asbestos						
B00F - R0018 - Stairs (5.14 m2)						
No Asbestos						
B00F - R0019 - Movement (2.81 m2)						
No Asbestos						
B00F - R0020 - Stairs (4.93 m2)						
No Asbestos						
B00F - R0021 - Movement (3.75 m2)						
No Asbestos						
B00F - R0022 - Stairs (0.92 m2)						
No Asbestos						
B00F - R0023 - Multi-Purpose Space (455.35 m2)						
No Asbestos						
B00F - R9001 - General Assistants (102.79 m2)						
No Asbestos						
B00F - R9002 - Stairs (5.69 m2)						
No Asbestos						
B00F - R9003 - Stairs (5.12 m2)						
No Asbestos						
B00F - R9004 - External Movement (1.75 m2)						
No Asbestos						
B00F - R9005 - External Movement (1.75 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 2012 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - New building

Interior

B001 - R0001 - Toilets-Girls (59.49 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1938 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 8152/B00H/Eaves Linings/S3	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Awnings	Flat AC Sheeting 8152/B00H/Awnings/S4	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Non Accessible Area - no access hatches or visible peep holes					
Ceiling Voids	Flat AC Sheeting 8152/B00H/R0004/Ceiling Structures/Linings/S1	80m2	To ceiling forming ceiling void	Good Condition (1)	Medium (2)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Debris	Flat AC Sheeting 8152/B00J/Debris/S25					No Asbestos Detected

Interior

B00J - R0003 - Student Drinking Facilities (10.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8152/B00H/R0004/Ceiling Structures/Linings/S1	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
In-fill-panel above Door	Flat AC Sheeting 8152/B00H/R0004/Infill panel above door/S2	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00J - R0004 - Gymnasium (70.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8152/B00H/R0004/Ceiling Structures/Linings/S1	71m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
In-fill-panel above Door	Flat AC Sheeting 8152/B00H/R0004/Infill panel above door/S2	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning/Staff Facilities - 1950 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - General Learning Space (52.56 m2)

No Asbestos

B00K - R0002 - General Learning Space (52.48 m2)

No Asbestos

B00K - R0003 - External Movement (22.51 m2)

No Asbestos

B00K - R0004 - Staff Study (12.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1950 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - No access at height and due to restricted access above the timber second ceiling in the ceiling void
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - General Learning Space (47.04 m2)

No Asbestos

B00M - R0002 - External Movement (26.89 m2)

No Asbestos

B00M - R0003 - General Learning Space (47.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 1950 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - No access at height and due to restricted access to above maisonite second false ceiling that is present above the plasterboard new first false ceiling.

Interior

B00N - R0001 - Performance Workspace (46.65 m2)

No Asbestos

B00N - R0002 - Performance Workspace (46.65 m2)

No Asbestos

B00N - R0003 - Performing Arts Store (3.75 m2)

No Asbestos

B00N - R0004 - Movement (7.29 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
		8152/B00N/R0005/Floor Coverings Res/Textile/S17				No Asbestos Detected

B00N - R0005 - Movement (12.97 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
		8152/B00N/R0005/Floor Coverings Res/Textile/S17				No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - Performing Arts - 2009 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B000 - R0001 - Movement Studio (126.9 m2)**

No Asbestos

B000 - R0002 - Movement Studio Store (28.05 m2)

No Asbestos

B000 - R0003 - Control Room (10.25 m2)

No Asbestos

B000 - R0004 - Sport Equipment Store (20.23 m2)

No Asbestos

B000 - R0005 - Main Switchroom (7.4 m2)

No Asbestos

B000 - R0006 - Sport Equipment Store (10.72 m2)

No Asbestos

B000 - R0007 - Staff Study (22.61 m2)

No Asbestos

B000 - R0008 - External Movement (50.28 m2)

No Asbestos

B000 - R0009 - Movement Studio (26.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Physical Education - 2009 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00P - R0001 - General Learning Space (58.09 m2)**

No Asbestos

B00P - R0002 - General Learning Space (57.68 m2)

No Asbestos

B00P - R0003 - Fitness Store (18.75 m2)

No Asbestos

B00P - R0004 - Seminar (18.74 m2)

No Asbestos

B00P - R0005 - Fitness Laboratory (92.95 m2)

No Asbestos

B00P - R0006 - Change (23.94 m2)

No Asbestos

B00P - R0007 - Change (26.14 m2)

No Asbestos

B00P - R0008 - Shower (10.25 m2)

No Asbestos

B00P - R0009 - Toilets-Girls (36.21 m2)

No Asbestos

B00P - R0010 - Plant (1.01 m2)

No Asbestos

B00P - R0011 - Toilets-Boys (11.64 m2)

No Asbestos

B00P - R0012 - External Movement (176.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Music - 2009 - Steel (Steel)

Exterior

Ceiling Voids	Non Accessible Area - Flat roof - minimal void
Underfloor Voids	No Asbestos Found

Interior

B00Q - R0001 - Practice/Seminar (8.5 m2)

No Asbestos

B00Q - R0002 - Practice/Seminar (8.15 m2)

No Asbestos

B00Q - R0003 - Music Store (8.57 m2)

No Asbestos

B00Q - R0004 - Practice/Seminar (8.5 m2)

No Asbestos

B00Q - R0005 - External Movement (20.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Music - 2009 - Steel (Steel)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - flat room - minimal void

Interior

B00R - R0001 - Music Store (8.29 m2)

No Asbestos

B00R - R0002 - Practice/Seminar (23.9 m2)

No Asbestos

B00R - R0003 - Practice/Seminar (8.32 m2)

No Asbestos

B00R - R0004 - External Movement (29.43 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Building Services - 2008 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00S - R0001 - Plant (10.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10821 - Learning Unit - Standard/Withdrawal : Placement Date - 11/02/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D11613 - Learning Unit - Standard/Withdrawal : Placement Date - 11/02/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D11743 - Learning Unit - Standard/Withdrawal : Placement Date - 22/02/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 600 - D17423 - Learning Unit - Small : Placement Date - 19/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017