


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Belmont High School (8203)  
**Region :** Hunter/Central Coast  
**State Electorate :** Swansea  
**Local Government Area :** Lake Macquarie

**Initial Survey :** Noel Arnold & Associates : 27 - May - 2008  
**Reviewed By :** Grencap-NAA : 26 - Mar - 2015

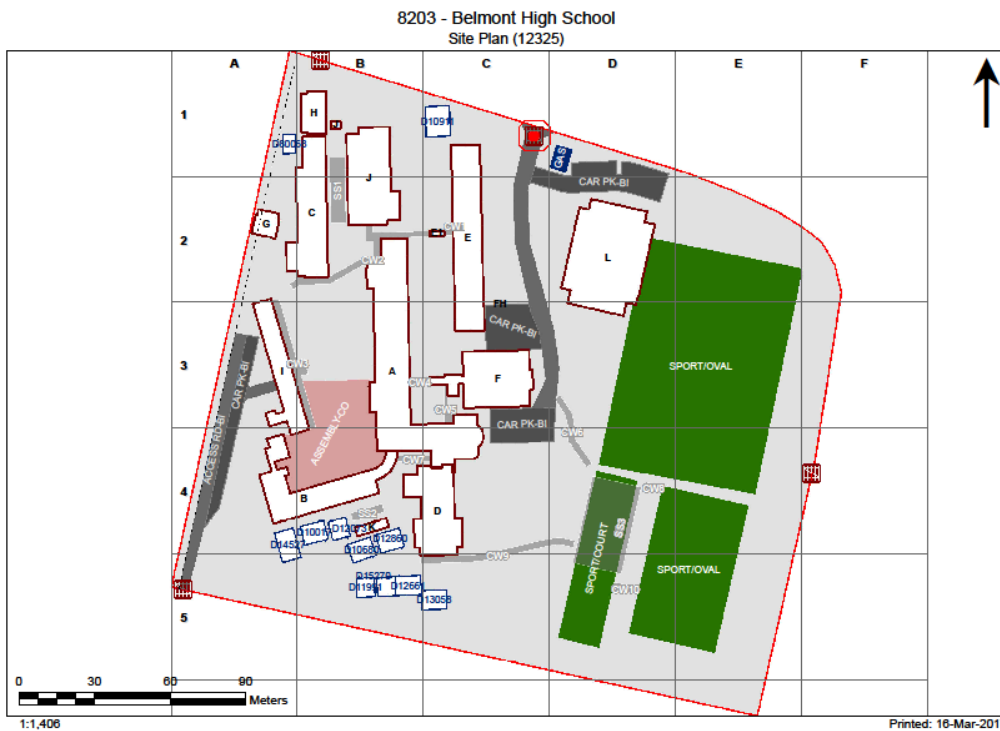

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Computer Learning - 1953 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting 8203/B00A/Eaves Linings/S27					<b>No Asbestos Detected</b>
Gable Ends	Flat AC Sheeting	8m2	North adjacent R0019	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction</b>					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0013 - Security Store (10.46 m2)**

No Asbestos

**B00A - R0014 - General Storeroom (11.51 m2)**

No Asbestos

**B00A - R0015 - Interview/Office - Type 1 (13.47 m2)**

No Asbestos

**B00A - R0016 - Staff - Toilet (4.17 m2)**

No Asbestos

**B00A - R0017 - Deputy Principal Office (15.89 m2)**

No Asbestos

**B00A - R0018 - Interview/Office - Type 1 (9.77 m2)**

No Asbestos

**B00A - R0019 - Movement (2.1 m2)**

No Asbestos

**B00A - R0020 - Administration - Clerical (41.25 m2)**

No Asbestos

**B00A - R0021 - Principal Office (18.62 m2)**

No Asbestos

**B00A - R0022 - Movement (65.57 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8203/B00A/R0022/Ceiling Structures/Linings/S28					<b>No Asbestos Detected</b>
----------------------------	--------------------------------------------------------------------	--	--	--	--	-----------------------------

**B00A - R0023 - Staff - Toilet (3.47 m2)**

Wall Linings Internal	Flat AC Sheeting 8203/B00A/R0023/Wall Linings Internal/S30					<b>No Asbestos Detected</b>
-----------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

**B00A - R0024 - Clinic - Boys (13.2 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 8203/B00A/R0024/Floor Coverings Res/Textile/S31					<b>No Asbestos Detected</b>
--------------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

**B00A - R0025 - Clinic - Girls (12.41 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 8203/B00A/R0024/Floor Coverings Res/Textile/S31					<b>No Asbestos Detected</b>
--------------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

**B00A - R0026 - Staff - Toilet (3.61 m2)**

Wall Linings Internal	Flat AC Sheeting 8203/B00A/R0023/Wall Linings Internal/S30					<b>No Asbestos Detected</b>
-----------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

**B00A - R0027 - Cleaning Store - Distributed (2.13 m2)**

No Asbestos

**B00A - R0028 - Interview/Office - Type 1 (9.92 m2)**

No Asbestos

**B00A - R0029 - Movement (32.55 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0030 - Movement (83.04 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		8203/B00A/R0030/Ceiling Structures/Linings/S29			<b>No Asbestos Detected</b>
<b>B00A - R0031 - Interview (11.82 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Administration - Clerical (18.36 m2)</b>						
Wall Linings Internal	Flat AC Sheeting		8203/B00A/R0032/Wall Linings Internal/S32			<b>No Asbestos Detected</b>
<b>B00A - R0042 - Distribution Board Cupboard (0.89 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R0043 - External Movement (9.36 m2)</b>						
No Asbestos						
<b>B00A - R0044 - Movement (9.33 m2)</b>						
No Asbestos						
<b>B00A - R0045 - Covered Area (132.41 m2)</b>						
No Asbestos						
<b>B00A - R0046 - Covered Area (55.06 m2)</b>						
No Asbestos						
<b>B00A - R0047 - General Storeroom (4.94 m2)</b>						
No Asbestos						
<b>B00A - R0048 - Seminar (20.2 m2)</b>						
No Asbestos						
<b>B00A - R0049 - General Learning Space - Type 1 (47.07 m2)</b>						
No Asbestos						
<b>B00A - R0050 - General Learning Space - Type 1 (50.07 m2)</b>						
No Asbestos						
<b>B00A - R0051 - General Learning Space - Type 1 (50.39 m2)</b>						
No Asbestos						
<b>B00A - R0052 - General Learning Space - Type 1 (50.39 m2)</b>						
No Asbestos						
<b>B00A - R0053 - Staff Study (50.39 m2)</b>						
No Asbestos						
<b>B00A - R0054 - Staff Study (50.01 m2)</b>						
No Asbestos						
<b>B00A - R0055 - Staff Study (26.77 m2)</b>						
No Asbestos						
<b>B00A - R0056 - Interview (12.79 m2)</b>						
No Asbestos						
<b>B00A - R0057 - General Storeroom (9.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet		8203/B00A/R0060/Floor Coverings Res/Textile/S33			<b>No Asbestos Detected</b>
<b>B00A - R0058 - Staff Lounge (78.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet		8203/B00A/R0060/Floor Coverings Res/Textile/S33			<b>No Asbestos Detected</b>
<b>B00A - R0059 - Distribution Board Cupboard (0.81 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R0060 - Workroom (29.56 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
8203/B00A/R0060/Floor Coverings Res/Textile/S33					<b>No Asbestos Detected</b>	
<b>B00A - R0061 - Staff - Toilet (10.96 m2)</b>						
No Asbestos						
<b>B00A - R0062 - General Storeroom (11.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
8203/B00A/R0060/Floor Coverings Res/Textile/S33					<b>No Asbestos Detected</b>	
<b>B00A - R0063 - Distribution Board Cupboard (0.93 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R0064 - Cleaning Store - Distributed (5.48 m2)</b>						
No Asbestos						
<b>B00A - R0065 - Movement (19.44 m2)</b>						
No Asbestos						
<b>B00A - R0066 - Stairs (1.87 m2)</b>						
No Asbestos						
<b>B00A - R0067 - General Storeroom (12.16 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
8203/B00A/R0060/Floor Coverings Res/Textile/S33					<b>No Asbestos Detected</b>	
<b>B00A - R0068 - Distribution Board Cupboard (1.15 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R0069 - Cleaning Store - Distributed (5.92 m2)</b>						
No Asbestos						
<b>B00A - R0070 - Stairs (1.88 m2)</b>						
No Asbestos						
<b>B00A - R0071 - Movement (18.84 m2)</b>						
No Asbestos						
<b>B00A - R0072 - Movement (236.88 m2)</b>						
No Asbestos						
<b>B00A - R0073 - Stairs (9.23 m2)</b>						
No Asbestos						
<b>B00A - R1024 - Computer Learning Space (87.91 m2)</b>						
No Asbestos						
<b>B00A - R1025 - General Learning Space - Type 1 (57.16 m2)</b>						
No Asbestos						
<b>B00A - R1026 - General Learning Space - Type 1 (59.62 m2)</b>						
No Asbestos						
<b>B00A - R1027 - General Learning Space - Type 2 (66.45 m2)</b>						
No Asbestos						
<b>B00A - R1028 - General Learning Space - Type 2 (66.32 m2)</b>						
No Asbestos						
<b>B00A - R1029 - General Learning Space - Type 1 (59.56 m2)</b>						
No Asbestos						
<b>B00A - R1030 - General Learning Space - Type 2 (66.32 m2)</b>						
No Asbestos						
<b>B00A - R1031 - General Learning Space - Type 1 (58.33 m2)</b>						
No Asbestos						
<b>B00A - R1032 - Distribution Board Cupboard (0.83 m2)</b>				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R1033 - Control Room (10.62 m2)</b>						
No Asbestos						
<b>B00A - R1034 - Movement (28.7 m2)</b>						
No Asbestos						
<b>B00A - R1035 - Performance Workshop (68.04 m2)</b>						
No Asbestos						
<b>B00A - R1036 - Seminar (28.97 m2)</b>						
No Asbestos						
<b>B00A - R1037 - Staff - Toilet (12.08 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
			8203/B00A/R0023/Wall Linings Internal/S30			
<b>B00A - R1038 - Stairs (14.65 m2)</b>						
No Asbestos						
<b>B00A - R1039 - General Storeroom (11.83 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
			8203/B00A/R0060/Floor Coverings Res/Textile/S33			
<b>B00A - R1040 - Distribution Board Cupboard (0.84 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R1041 - Movement (13.7 m2)</b>						
No Asbestos						
<b>B00A - R1042 - Stairs (14.75 m2)</b>						
No Asbestos						
<b>B00A - R1043 - Movement (13.74 m2)</b>						
No Asbestos						
<b>B00A - R1044 - Distribution Board Cupboard (0.87 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R1045 - General Storeroom (12.04 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
			8203/B00A/R0060/Floor Coverings Res/Textile/S33			
<b>B00A - R1046 - Movement (203.77 m2)</b>						
No Asbestos						
<b>B00A - R1047 - Tiered Learning Area (20.92 m2)</b>						
No Asbestos						
<b>B00A - R1048 - Performance Store (10.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
			8203/B00A/R0060/Floor Coverings Res/Textile/S33			
<b>B00A - R1049 - Lift (2.18 m2)</b>						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Technological & Applied Studies - 1953 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00B/Eaves Linings/S44			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ground Surface	AC Fragments/Debris	4Unit	South & West	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	8203/B00B/Ground Surface/S37			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - Staff - Toilet (3.96 m2)**

No Asbestos

**B00B - R0002 - Cleaning Store - Distributed (3.75 m2)**

No Asbestos

**B00B - R0003 - Movement (47.89 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8203/B00B/R0003/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>

**B00B - R0004 - Interview/Office - Type 1 (12.92 m2)**

No Asbestos

**B00B - R0005 - General Storeroom (8.1 m2)**

No Asbestos

**B00B - R0006 - Staff Study (23.24 m2)**

No Asbestos

**B00B - R0007 - Serviced Learning Space (47.6 m2)**

Chalk Board	Flat AC Sheeting					
	8203/B00B/R0007/Chalk Board/S14					<b>No Asbestos Detected</b>

**B00B - R0008 - Materials Store (4.82 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

**B00B - R0009 - Pantry (3.34 m2)**

No Asbestos

**B00B - R0010 - Laundry (6.29 m2)**

No Asbestos

**B00B - R0011 - Food Technology L.S. (67.62 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

**B00B - R0012 - Movement (72.97 m2)**

No Asbestos

**B00B - R0013 - Materials Store (9.2 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

**B00B - R0014 - Pantry (4.54 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

**B00B - R0015 - Food Technology L.S. (67.73 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet	8203/B00B/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected
<b>B00B - R0016 - Food/Research Space (19.38 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet	8203/B00B/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected
<b>B00B - R0017 - Movement (36.69 m2)</b>						
No Asbestos						
<b>B00B - R0019 - Staff - Toilet (5.33 m2)</b>						
No Asbestos						
<b>B00B - R0020 - Interview (11.75 m2)</b>						
No Asbestos						
<b>B00B - R0021 - Movement (12.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet	8203/B00B/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected
<b>B00B - R0022 - Food/Research Space (9.62 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet	8203/B00B/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected
<b>B00B - R0023 - Interview (11.69 m2)</b>						
No Asbestos						
<b>B00B - R0024 - Movement (1.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8203/B00A/R0022/Ceiling Structures/Linings/S28				No Asbestos Detected
<b>B00B - R0025 - Movement (56.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8203/B00A/R0022/Ceiling Structures/Linings/S28				No Asbestos Detected
<b>B00B - R0026 - Distribution Board Cupboard (0.22 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00B - R0027 - Movement (4.91 m2)</b>						
No Asbestos						
<b>B00B - R0028 - Stairs (14.9 m2)</b>						
No Asbestos						
<b>B00B - R0029 - Stairs (5.29 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Movement (169.67 m2)</b>						
No Asbestos						
<b>B00B - R1002 - Staff - Toilet (3.9 m2)</b>						
No Asbestos						
<b>B00B - R1003 - General Storeroom (12.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8203/B00B/R0003/Floor Coverings Res/Textile/S13				No Asbestos Detected
<b>B00B - R1004 - General Storeroom (9.08 m2)</b>						
No Asbestos						
<b>B00B - R1005 - Staff Study (23.75 m2)</b>						
No Asbestos						
<b>B00B - R1006 - General Learning Space (47.96 m2)</b>						
No Asbestos						
<b>B00B - R1007 - Resource/Project Store (8.53 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00B - R1008 - Movement (2.84 m2)</b>						
No Asbestos						
<b>B00B - R1009 - General Storeroom (4.36 m2)</b>						
No Asbestos						
<b>B00B - R1010 - General Learning Space (68.69 m2)</b>						
No Asbestos						
<b>B00B - R1011 - Design L.S. (68.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>
<b>B00B - R1012 - Materials Store (5.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>
<b>B00B - R1013 - Resource/Project Store (8.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00B/R0011/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>
<b>B00B - R1014 - General Storeroom (19.39 m2)</b>						
No Asbestos						
<b>B00B - R1015 - General Storeroom (0.6 m2)</b>						
Non Accessible						
<b>B00B - R1016 - Distribution Board Cupboard (0.22 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00B - R1017 - Stairs (14.72 m2)</b>						
No Asbestos						
<b>B00B - R1018 - Stairs (14.8 m2)</b>						
No Asbestos						
<b>B00B - R9001 - Cleaning Supplies Store (31.62 m2)</b>						
Incinerator	Encapsulated Insulation material within unit	1Unit	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						
<b>B00B - R9002 - Main Switchroom (6.98 m2)</b>						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
Electrical Cable Wrap	Cable Wrap					
	8203/B00B/R9009/Electrical Cable Wrap/S39					<b>No Asbestos Detected</b>
<b>B00B - R9003 - General Storeroom (83.37 m2)</b>						
No Asbestos						
<b>B00B - R9004 - Performing Arts Changeroom (14.21 m2)</b>						
No Asbestos						
<b>B00B - R9005 - Performing Arts Store (4.41 m2)</b>						
No Asbestos						
<b>B00B - R9007 - Movement (26.54 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00B/R9009/Ceiling Structures/Linings/S38					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Wall Linings Internal	Flat AC Sheeting					
	8203/B00A/R0032/Wall Linings Internal/S32					<b>No Asbestos Detected</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Cable Wrap	Cable Wrap 8203/B00B/R9009/Electrical Cable Wrap/S39					No Asbestos Detected
<b>B00B - R9008 - Bulk Store (8.89 m2)</b>						
No Asbestos						
<b>B00B - R9009 - Garden Store Room (15.76 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00B/R9009/Ceiling Structures/Linings/S38					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Electrical Cable Wrap	Cable Wrap 8203/B00B/R9009/Electrical Cable Wrap/S39					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Technological & Applied Studies - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00I/Eaves Linings/S41					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Materials Technology L.S. (143.25 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B00C/R0019/Wall Linings Internal/S7					

**B00C - R0002 - Welding Area (3.77 m2)**

No Asbestos

**B00C - R0003 - Resource/Project Store (7.45 m2)**

No Asbestos

**B00C - R0004 - Bulk Store (15.4 m2)**

No Asbestos

**B00C - R0005 - Materials Technology L.S. (102.45 m2)**

No Asbestos

**B00C - R0006 - Bulk Store (15.4 m2)**

No Asbestos

**B00C - R0007 - Resource/Project Store (7.54 m2)**

No Asbestos

**B00C - R0008 - Bulk Store (19.08 m2)**

No Asbestos

**B00C - R0009 - Dust Extraction Space (10.72 m2)**

No Asbestos

**B00C - R0010 - Materials Technology L.S. (117.6 m2)**

No Asbestos

**B00C - R0011 - Resource/Project Store (9.92 m2)**

No Asbestos

**B00C - R0012 - Bulk Store (15.93 m2)**

No Asbestos

**B00C - R0013 - Movement (6.24 m2)**

No Asbestos

**B00C - R0016 - Workshop (27 m2)**

Wall Cladding	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B00C/R0016/Wall Cladding/S8					

**B00C - R0018 - Cleaning Store - Distributed (3.07 m2)**

No Asbestos

**B00C - R0019 - Movement (81.86 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00C/R0019/Ceiling Structures/Linings/S43					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B00C/R0019/Wall Linings Internal/S7					

**B00C - R0020 - Disabled Toilet (10.48 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Sheet					
	8203/B00C/R0020/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>

**B00C - R0021 - Materials Store (9.44 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Multi Purpose Facilities - 1953 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

**Interior**

**B00D - M0001 - Control Room (7.34 m2)**

No Asbestos

**B00D - R0001 - General Storeroom (9.24 m2)**

No Asbestos

**B00D - R0002 - Multi-Purpose Space (263.45 m2)**

No Asbestos

**B00D - R0003 - Movement (1.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8203/B00D/R0017/Ceiling Structures/Linings/S35					<b>No Asbestos Detected</b>
----------------------------	--------------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0004 - Movement (6.64 m2)**

No Asbestos

**B00D - R0005 - Shower/Change (27.05 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 8203/B00D/R0005/Floor Coverings Res/Textile/S18					<b>No Asbestos Detected</b>
-----------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0006 - Stage (67.97 m2)**

No Asbestos

**B00D - R0007 - Movement (1.4 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8203/B00D/R0013/Floor Coverings Res/Textile/S17					<b>No Asbestos Detected</b>
-----------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0008 - Chair Store (6.08 m2)**

No Asbestos

**B00D - R0009 - Staff - Toilet (1.39 m2)**

No Asbestos

**B00D - R0010 - Shower/Change (13.78 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B00D/R0010/Partition Walls (Cubicles)/S36						<b>Chrysotile (white asbestos)</b>

**B00D - R0011 - Shower/Change (13.86 m2)**

No Asbestos

**B00D - R0012 - Staff - Toilet (1.4 m2)**

No Asbestos

**B00D - R0013 - Movement (1.4 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8203/B00D/R0013/Floor Coverings Res/Textile/S17					<b>No Asbestos Detected</b>
-----------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0014 - Shower/Change (27.23 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 8203/B00D/R0005/Floor Coverings Res/Textile/S18					<b>No Asbestos Detected</b>
-----------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0015 - Movement (6.67 m2)**

No Asbestos

**B00D - R0016 - Sport Equipment Store (55.73 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0017 - Sport Equipment Store (12.51 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		8203/B00D/R0017/Ceiling Structures/Linings/S35			<b>No Asbestos Detected</b>
<b>B00D - R0018 - Movement (2.25 m2)</b>						
No Asbestos						
<b>B00D - R0019 - Movement (1.38 m2)</b>						
No Asbestos						
<b>B00D - R9001 - Maintenance Bulk Store (19.53 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00E - General Learning/Technological & Applied Studies - 1953 - Brick/Block (Brick/Block)

#### Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Restricted Access - Flat Roof					
Eaves Linings	Flat AC Sheeting	60m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00E/R1019/Ceiling Structures/Linings/S42			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Height Restriction					

#### Interior

##### B00E - R0001 - General Storeroom (5.01 m2)

No Asbestos

##### B00E - R0002 - Movement (6 m2)

No Asbestos

##### B00E - R0012 - Staff - Toilet (4.55 m2)

No Asbestos

##### B00E - R0013 - Movement (4.95 m2)

No Asbestos

##### B00E - R0014 - Laboratory L.S. (93.64 m2)

Chalk Board	Flat AC Sheeting					No Asbestos Detected
	8203/B00E/R0017/Chalk Board/S4					
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8203/B00E/R0017/Decorative Coating/S3					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00E/R0017/Fume Cupboard/S2					
Chrysotile (white asbestos)						

##### B00E - R0018 - Sport Equipment Store (10.41 m2)

No Asbestos

##### B00E - R0019 - Movement (11.7 m2)

No Asbestos

##### B00E - R0020 - External Movement (151.2 m2)

No Asbestos

##### B00E - R0021 - Laboratory L.S. (92.5 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8203/B00E/R0017/Decorative Coating/S3					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8203/B00E/R0017/Decorative Coating/S3					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

##### B00E - R0023 - Laboratory L.S. (92.5 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8203/B00E/R0017/Decorative Coating/S3					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

##### B00E - R0024 - Stairs (3.39 m2)

No Asbestos

##### B00E - R0025 - Stairs (7.85 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R0026 - Stairs (7.59 m2)</b>						
No Asbestos						
<b>B00E - R0027 - Stairs (0.62 m2)</b>						
No Asbestos						
<b>B00E - R0028 - Movement (4.54 m2)</b>						
No Asbestos						
<b>B00E - R0029 - Movement (4.54 m2)</b>						
No Asbestos						
<b>B00E - R0030 - Stairs (0.92 m2)</b>						
No Asbestos						
<b>B00E - R0031 - Laboratory L.S. (78.13 m2)</b>						
No Asbestos						
<b>B00E - R0032 - Plant (0.49 m2)</b>						
No Asbestos						
<b>B00E - R0033 - Staff Study (65.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8203/B00E/R0017/Decorative Coating/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00E - R1001 - Cleaning Store - Distributed (4.94 m2)</b>						
No Asbestos						
<b>B00E - R1002 - Movement (5.97 m2)</b>						
No Asbestos						
<b>B00E - R1003 - Senior Study (53.5 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8203/B00E/R1003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00E - R1004 - General Learning Space (53.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8203/B00E/R1003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00E - R1005 - General Learning Space (53.28 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8203/B00E/R1003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Chalk Board	Flat AC Sheeting					
	8203/B00E/R0017/Chalk Board/S4					<b>No Asbestos Detected</b>
<b>B00E - R1006 - General Learning Space (53.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8203/B00E/R1003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00E - R1007 - Staff - Toilet (4.55 m2)</b>						
No Asbestos						
<b>B00E - R1008 - Movement (4.78 m2)</b>						
No Asbestos						
<b>B00E - R1009 - Computer Learning Space (46.74 m2)</b>						
No Asbestos						
<b>B00E - R1010 - Computer Resource (12.24 m2)</b>						
No Asbestos						
<b>B00E - R1011 - Computer Store (7.29 m2)</b>						
No Asbestos						
<b>B00E - R1012 - Computer Learning Space (52.63 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R1013 - General Learning Space (52.77 m2)</b>						
Chalk Board	Flat AC Sheeting					
	8203/B00E/R0017/Chalk Board/S4					<b>No Asbestos Detected</b>
<b>B00E - R1014 - Music Store (8.34 m2)</b>						
No Asbestos						
<b>B00E - R1015 - Cleaning Store - Distributed (4.09 m2)</b>						
No Asbestos						
<b>B00E - R1016 - General Learning Space (53.21 m2)</b>						
Chalk Board	Flat AC Sheeting					
	8203/B00E/R0017/Chalk Board/S4					<b>No Asbestos Detected</b>
<b>B00E - R1017 - General Storeroom (4.94 m2)</b>						
No Asbestos						
<b>B00E - R1018 - Movement (5.12 m2)</b>						
No Asbestos						
<b>B00E - R1019 - Movement (154.22 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	155m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00E/R1019/Ceiling Structures/Linings/S42					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00E - R1020 - Stairs (8.94 m2)</b>						
No Asbestos						
<b>B00E - R1021 - Stairs (8.39 m2)</b>						
No Asbestos						
<b>B00E - R1022 - Stairs (15.05 m2)</b>						
No Asbestos						
<b>B00E - R1023 - Movement (4.54 m2)</b>						
No Asbestos						
<b>B00E - R1024 - Movement (4.54 m2)</b>						
No Asbestos						
<b>B00E - R9001 - Sport Equipment Store (10.03 m2)</b>						
No Asbestos						
<b>B00E - R9002 - Movement (11.79 m2)</b>						
No Asbestos						
<b>B00E - R9003 - Movement (145.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8203/B00E/R0017/Decorative Coating/S3					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R9004 - Toilets-Girls (21.49 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00E/R9005/Partition Walls (Cubicles)/S12					<b>Chrysotile (white asbestos)</b>
<b>B00E - R9005 - Toilets-Boys (21.46 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00E/R9005/Partition Walls (Cubicles)/S12					<b>Chrysotile (white asbestos)</b>
<b>B00E - R9008 - Shower/Change (44.35 m2)</b>						
No Asbestos						
<b>B00E - R9009 - Shower/Change (44.43 m2)</b>						
No Asbestos						
<b>B00E - R9010 - Staff Shower (7.75 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00E - R9011 - Staff Shower (7.68 m2)**

No Asbestos

**B00E - R9012 - Movement (11.04 m2)**

No Asbestos

**B00E - R9013 - Stairs (3.04 m2)**

No Asbestos

**B00E - R9014 - Stairs (3.37 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Science/Library - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - M1001 - Seminar (15.32 m2)**

No Asbestos

**B00F - M1002 - Main Area (68.84 m2)**

No Asbestos

**B00F - M1003 - Seminar (37.83 m2)**

No Asbestos

**B00F - R0001 - Laboratory L.S. (92.08 m2)**

Ceiling Structures/Linings	Vermiculite					
	8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00F - R0002 - Apparatus Store (10.96 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>

**B00F - R0003 - Apparatus Store (17.31 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>

**B00F - R0004 - Laboratory L.S. (91.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00F - R0005 - Preparation (38.81 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					
	8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00F - R0008 - Staff Study (91.62 m2)**

Ceiling Structures/Linings	Vermiculite					
	8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00F - R0009 - Movement (40.48 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>

**B00F - R0010 - Cleaning Store - Distributed (5.46 m2)**

No Asbestos

**B00F - R0011 - Garden Store Room (12.19 m2)**

No Asbestos

**B00F - R0012 - Movement (31.31 m2)**

No Asbestos

**B00F - R0013 - Laboratory L.S. (92.08 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0015 - Distribution Board Cupboard (0.71 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00F - R0017 - Chemical Store (9.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0018 - Stairs (12.14 m2)</b>						
No Asbestos						
<b>B00F - R0019 - Study Space (48.93 m2)</b>						
No Asbestos						
<b>B00F - R1001 - Seminar (13.94 m2)</b>						
No Asbestos						
<b>B00F - R1002 - Seminar (11.97 m2)</b>						
No Asbestos						
<b>B00F - R1003 - No Access (5.93 m2)</b>						
Non Accessible						
<b>B00F - R1004 - No Access (5.93 m2)</b>						
Non Accessible						
<b>B00F - R1005 - Movement (4.65 m2)</b>						
No Asbestos						
<b>B00F - R1006 - Seminar (11.99 m2)</b>						
No Asbestos						
<b>B00F - R1007 - Seminar (13.61 m2)</b>						
No Asbestos						
<b>B00F - R1008 - Main Area (327.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8203/B00F/R0017/Ceiling Structures/Linings/S34					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1009 - Audio Visual Workroom (26.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1010 - Workroom (11.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B00F/R0009/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1011 - Librarian (11.54 m2)</b>						
No Asbestos						
<b>B00F - R1012 - Workroom (17.52 m2)</b>						
No Asbestos						
<b>B00F - R1013 - Staff - Toilet (2.24 m2)</b>						
No Asbestos						
<b>B00F - R1014 - Staff - Toilet (2.31 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00F - R1015 - Movement (39.4 m2)**

No Asbestos

**B00F - R1016 - Main Area (70.62 m2)**

Ceiling Structures/Linings Vermiculite

8203/B00F/R0017/Ceiling Structures/Linings/S34

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00F - R1017 - Stairs (12.14 m2)**

No Asbestos

**B00F - R9001 - Plant (10.63 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Technological & Applied Studies - 1953 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00G/Eaves Linings/S11					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction					

**Interior**

**B00G - R0001 - Movement (13.05 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00G/R0001/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>

**B00G - R0002 - Design L.S. (54.09 m2)**

Heater Surround	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00G/R0002/In-fill-panel/S9					<b>Chrysotile (white asbestos)</b>

**B00G - R0003 - General Storeroom (13.48 m2)**

No Asbestos

**B00G - R0004 - Resource/Project Store (5.06 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00G/R0001/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Technological & Applied Studies - 1953 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00H/Eaves Linings/S22					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior****B00H - R0003 - Materials Store (19.89 m2)**

No Asbestos

**B00H - R0005 - Materials Technology L.S. (95.81 m2)**

Chalk Board	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B00H/R0005/Chalk Board/S25					

**B00H - R0006 - Welding Area (5.78 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B00H/R0006/Wall Linings Internal/S24					

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00H/R0008/Ceiling Structures/Linings/S23					<b>Chrysotile (white asbestos)</b>

**B00H - R0007 - Materials Store (5.44 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00H/R0008/Ceiling Structures/Linings/S23					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B00H/R0006/Wall Linings Internal/S24					

**B00H - R0008 - Movement (22.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B00H/R0008/Ceiling Structures/Linings/S23					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1953 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B001/Eaves Linings/S41				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B001 - R0001 - Toilets-Boys (38.07 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8203/B001/R0001/Partition Walls (Cubicles)/S1					
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B001/R0012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>	

**B001 - R0002 - Toilets-Boys (52.19 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B001/R0012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8203/B001/R0001/Partition Walls (Cubicles)/S1					

**B001 - R0004 - Student Canteen (55.52 m2)**

No Asbestos

**B001 - R0005 - Entry (1.67 m2)**

No Asbestos

**B001 - R0006 - Staff - Toilet (1.67 m2)**

No Asbestos

**B001 - R0007 - General Storeroom (6.59 m2)**

No Asbestos

**B001 - R0008 - Pantry (5.52 m2)**

No Asbestos

**B001 - R0009 - Movement (57.4 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8203/B001/R0009/Wall Linings Internal/S40					

**B001 - R0010 - Toilets-Girls (47.64 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8203/B001/R0001/Partition Walls (Cubicles)/S1					
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B001/R0012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>	

**B001 - R0011 - Toilets-Girls (32.61 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B001/R0012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8203/B001/R0001/Partition Walls (Cubicles)/S1					

**B001 - R0012 - Movement (51.42 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8203/B001/R0012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>	

**B001 - R0013 - Uniform Shop (34.77 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B001/R0012/Ceiling Structures/Linings/S26					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0014 - Change (4.93 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8203/B001/R0012/Ceiling Structures/Linings/S26					<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Various - 1998 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 8203/B00J/Eaves Linings/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00J - R0001 - Movement (11.65 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8203/B00J/R0001/Ceiling Structures/Linings/S21					No Asbestos Detected
----------------------------	--------------------------------------------------------------------	--	--	--	--	----------------------

**B00J - R0002 - Staff Study (25.51 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
-------------------------------------------	-------------------	--	--	--	--	--

**B00J - R0003 - Art Learning Space (61.97 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0004 - Art Learning Space (61.59 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0005 - Darkroom Space (30.64 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0006 - Music Learning Space (74.76 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0007 - No Access (14.12 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0008 - Staff Study (23.92 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
-------------------------------------------	-------------------	--	--	--	--	--

**B00J - R0009 - Movement (14.69 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0010 - Study Space (70.33 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
-------------------------------------------	-------------------	--	--	--	--	--

**B00J - R0011 - Staff - Toilet (6.57 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0012 - Staff - Toilet (6.57 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0013 - Cleaning Store - Distributed (3.39 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0014 - Movement (86.16 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0015 - Security Store (19.95 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0016 - Art Learning Space (62.13 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0017 - Art Learning Space (62.23 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0018 - Distribution Board Cupboard (0.77 m2)**

Note: No inspection of live electrical installation.

No Asbestos						
-------------	--	--	--	--	--	--

**B00J - R0019 - Movement (2.52 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - R0020 - Kiln Space (7.98 m2)**

No Asbestos

**B00J - R9001 - No Access (35.07 m2)**

Non Accessible

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Building Services - 1953 - Timber Shed (Timber Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00K - R0001 - No Access (45.32 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Multi Purpose Facilities - 2008 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00L - R0001 - Chair Store (34.98 m2)**

No Asbestos

**B00L - R0002 - Large Equipment Store (50.29 m2)**

No Asbestos

**B00L - R0003 - Sport Equipment Store (19.96 m2)**

No Asbestos

**B00L - R0004 - Control Room (12 m2)**

No Asbestos

**B00L - R0006 - Toilets-Girls (21.2 m2)**

No Asbestos

**B00L - R0007 - Distribution Board Cupboard (1.04 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0008 - Toilets-Boys (17.9 m2)**

No Asbestos

**B00L - R0009 - Cleaning Store - Distributed (2.82 m2)**

No Asbestos

**B00L - R0010 - Change (20.67 m2)**

No Asbestos

**B00L - R0011 - Movement (3.4 m2)**

No Asbestos

**B00L - R0012 - Disabled Toilet (5.43 m2)**

No Asbestos

**B00L - R0013 - Change (20.88 m2)**

No Asbestos

**B00L - R0014 - First Aid (13.9 m2)**

No Asbestos

**B00L - R0015 - Gymnasium (713.83 m2)**

No Asbestos

**B00L - R0016 - External Movement (120.19 m2)**

No Asbestos

**B00L - R0017 - External Movement (13.74 m2)**

No Asbestos

**B00L - R0018 - Staff Study (42.38 m2)**

No Asbestos

**B00L - R0019 - Movement (29.55 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0E1 - Electrical Services - 1953 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B0E1 - R0021 - General Storeroom (10.47 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

### OS 601 - D10017 - Learning Unit - Standard/Withdrawal : Placement Date - 11/09/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Entry

No Asbestos Found.

##### R2 - General Learning Space

No Asbestos Found.

##### R3 - Store

No Asbestos Found.

### OS 601 - D10680 - Learning Unit - Standard/Withdrawal : Placement Date - 14/07/2010

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Entry

No Asbestos Found.

##### R2 - General Learning Space

No Asbestos Found.

##### R3 - Store

No Asbestos Found.

### NS 200 - D10911 - Art Learning Space/Workshop/Bulk Store : Placement Date - 12/02/1999

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Art Learning Space

No Asbestos Found.

##### R2 - Workshop

No Asbestos Found.

##### R3 - Bulk Store

No Asbestos Found.

### OS 600 - D11991 - Learning Unit - Small : Placement Date - 30/06/1995

#### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

#### Interior

##### R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

### OS 600 - D12073 - Learning Unit - Small : Placement Date - 30/06/1995

#### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>OS 601 - D12661 - Learning Unit - Standard/Withdrawal : Placement Date - 22/01/2004</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D12860 - Learning Unit - Standard/Withdrawal : Placement Date - 14/07/2010</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D13058 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 621 - D14527 - Single Learning Unit - H/Cap : Placement Date - 25/02/1999</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				14.4 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Home Base-I.O.</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				77 m2
<b>R2 - Toilets-Disabled</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>R3 - Laundry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
<b>OS 600 - D15270 - Learning Unit - Small : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>OS 522 - D80068 - Staff Study : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				5.76 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Staff Room</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

8203\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017