


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blacktown Girls High School (8224)
Region : Western Sydney
State Electorate : Blacktown
Local Government Area : Blacktown

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 07 - Feb - 2017

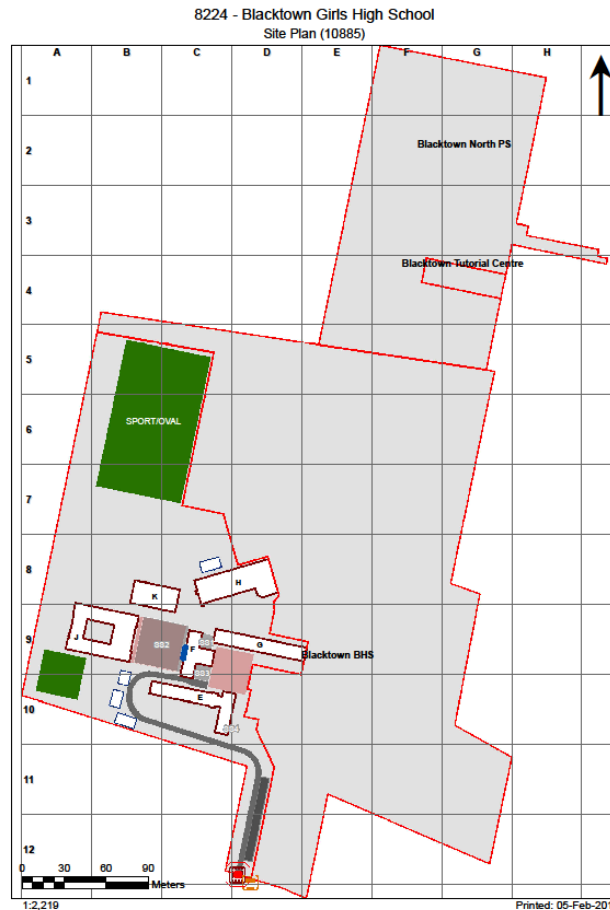

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration/General Learning - 1957 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 8224/B00E/Wall Cladding/S12					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - No access due to height restriction.

Interior**B00E - R0001 - Principal Office (16.44 m2)**

No Asbestos

B00E - R0002 - General Storeroom (0.71 m2)

No Asbestos

B00E - R0003 - General Storeroom (1.1 m2)

No Asbestos

B00E - R0004 - Interview (11.8 m2)

No Asbestos

B00E - R0005 - General Storeroom (3.94 m2)

No Asbestos

B00E - R0006 - Administration - Clerical (12.48 m2)

No Asbestos

B00E - R0007 - Public Entry (34.62 m2)

No Asbestos

B00E - R0008 - Movement (3.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8224/B00F/R0006/Ceiling Structures/Linings/S1

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0009 - Interview/Office - Type 1 (8.24 m2)

No Asbestos

B00E - R0010 - Staff - Toilet (8.19 m2)

No Asbestos

B00E - R0011 - General Storeroom (4.49 m2)

No Asbestos

B00E - R0012 - General Storeroom (4.49 m2)

No Asbestos

B00E - R0013 - Distribution Board Cupboard (0.08 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0014 - Movement (2.76 m2)

No Asbestos

B00E - R0015 - Administration - Clerical (18.4 m2)

No Asbestos

B00E - R0016 - Administration - Clerical (16.7 m2)

No Asbestos

B00E - R0017 - Clinic - Girls (8.04 m2)

No Asbestos

B00E - R0018 - Computer Learning Space (45.93 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected	
B00E - R0019 - Administration - Clerical (16.47 m2)						
No Asbestos						
B00E - R0020 - Pupil Entry (18.69 m2)						
No Asbestos						
B00E - R0021 - Staff - Toilet (6.56 m2)						
No Asbestos						
B00E - R0022 - Laboratory L.S. (73.6 m2)						
No Asbestos						
B00E - R0023 - Preparation (24.43 m2)						
No Asbestos						
B00E - R0024 - General Storeroom (6.32 m2)						
No Asbestos						
B00E - R0025 - Cleaning Supplies Store (7.02 m2)						
No Asbestos						
B00E - R0026 - General Learning Space (41.85 m2)						
No Asbestos						
B00E - R0027 - Movement (2.81 m2)						
No Asbestos						
B00E - R0028 - Distribution Board Cupboard (0.07 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00E - R0029 - Deputy Principal Office (17.28 m2)						
No Asbestos						
B00E - R0030 - General Storeroom (15.29 m2)						
No Asbestos						
B00E - R0031 - Preparation (18.07 m2)						
No Asbestos						
B00E - R0032 - Laboratory L.S. (93.1 m2)						
No Asbestos						
B00E - R0033 - Movement (81.54 m2)						
No Asbestos						
B00E - R0034 - Movement (63.21 m2)						
No Asbestos						
B00E - R0035 - Stairs (1.67 m2)						
No Asbestos						
B00E - R0036 - Stairs (1.62 m2)						
No Asbestos						
B00E - R1002 - Computer Resource (10.34 m2)						
No Asbestos						
B00E - R1003 - Commonroom (10.34 m2)						
No Asbestos						
B00E - R1004 - Interview (10.15 m2)						
No Asbestos						
B00E - R1005 - Staff Kitchen (10.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00E/R1005/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1007 - General Storeroom (7.37 m2)						
No Asbestos						
B00E - R1008 - Staff Study (64.8 m2)						
No Asbestos						
B00E - R1009 - Distribution Board Cupboard (0.06 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00E - R1010 - Movement (14.96 m2)						
No Asbestos						
B00E - R1011 - General Learning Space (51.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00E - R1012 - General Learning Space (51.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00E - R1013 - General Learning Space (51.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00E - R1014 - Movement (69.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00E - R1015 - Distribution Board Cupboard (0.06 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00E - R1016 - General Learning Space (51.85 m2)						
No Asbestos						
B00E - R1017 - General Learning Space (51.85 m2)						
No Asbestos						
B00E - R1018 - Careers Advisers Office (25.48 m2)						
No Asbestos						
B00E - R1019 - Movement (9.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00E - R1020 - Movement (6.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8224/B00E/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00E - R1021 - Stairs (14.16 m2)						
No Asbestos						
B00E - R1022 - Stairs (15.49 m2)						
No Asbestos						
B00E - R1023 - Performance Workshop (108.96 m2)						
No Asbestos						
B00E - R1024 - Student Change - Type 2 (5.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00E/R1026/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00E - R1025 - Performing Arts Chair Store (5.11 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00E/R1026/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)	
B00E - R1026 - Movement (29.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00E/R1026/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Pupil Facilities - 1957 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/Eaves Linings/S16					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - Student Canteen (48.51 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00F - R0002 - General Storeroom (5.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00F - R0003 - Staff - Toilet (1.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00F - R0004 - General Storeroom (2.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00F - R0005 - Toilets-Girls (53.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0007 - Toilets-Girls (54.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00F/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0008 - Movement (60.85 m2)

Wall Linings Internal	Flat AC Sheeting					
	8224/B00F/R0008/Wall Linings Internal/S17					No Asbestos Detected

B00F - R0009 - Food Technology L.S. (126.55 m2)

No Asbestos

B00F - R0010 - Laundry (1.06 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00F - R0011 - Chair Storeroom (13.09 m2)

No Asbestos

B00F - R0012 - Pantry (7.01 m2)

No Asbestos

B00F - R0013 - General Storeroom (13.7 m2)

No Asbestos

B00F - R0014 - Preparation - Materials (20.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Technological & Applied Studies - 1957 - Concrete Framed (Concrete Framed)**Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No access due to height restrictions.						
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No access due to height restriction.						

Interior**B00G - R0001 - Staff - Toilet (3.87 m2)**

No Asbestos

B00G - R0002 - Staff - Toilet (3.87 m2)

No Asbestos

B00G - R0003 - Staff Study (59.45 m2)

No Asbestos

B00G - R0004 - Cleaning Store - Distributed (2.16 m2)

No Asbestos

B00G - R0005 - General Storeroom (2.88 m2)

No Asbestos

B00G - R0006 - Interview (18.46 m2)

No Asbestos

B00G - R0007 - Cleaning Store - Distributed (1.08 m2)

No Asbestos

B00G - R0008 - Computer Learning Space (65.52 m2)

No Asbestos

B00G - R0009 - Computer Learning Space (65.16 m2)

No Asbestos

B00G - R0010 - General Learning Space (52.12 m2)

No Asbestos

B00G - R0011 - General Learning Space (52.12 m2)

No Asbestos

B00G - R0012 - General Learning Space (52.13 m2)

No Asbestos

B00G - R0013 - General Learning Space (68.17 m2)

No Asbestos

B00G - R0014 - Movement (167.47 m2)

No Asbestos

B00G - R0015 - Stairs (1.62 m2)

No Asbestos

B00G - R0016 - Stairs (1.62 m2)

No Asbestos

B00G - R1001 - Textiles Technology L.S. (68.16 m2)

No Asbestos

B00G - R1003 - Computer Learning Space (52.2 m2)

No Asbestos

B00G - R1004 - Textiles Technology L.S. (52.19 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1005 - Resource/Project Store (10.44 m2)						
No Asbestos						
B00G - R1009 - General Learning Space (52.2 m2)						
No Asbestos						
B00G - R1010 - General Learning Space (52.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00G - R1011 - General Learning Space (52.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00G - R1012 - Interview/Office - Type 1 (18.82 m2)						
No Asbestos						
B00G - R1013 - General Storeroom (5.4 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00G - R1014 - Cleaning Store - Distributed (1.12 m2)						
No Asbestos						
B00G - R1015 - General Learning Space (68.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00G - R1016 - Movement (60.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00G - R1020 - Movement (80.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00G/R1020/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00G - R1021 - General Storeroom (12.53 m2)						
No Asbestos						
B00G - R1022 - Stairs (13.67 m2)						
No Asbestos						
B00G - R1023 - Stairs (14.5 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Technological & Applied Studies/Art - 1957 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 8224/B00H/Eaves Linings/S18					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00H - R0001 - Music Learning Space (51.82 m2)**

No Asbestos

B00H - R0004 - Resources Store (8.5 m2)

No Asbestos

B00H - R0008 - Movement (6.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00H/R0047/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0009 - Administration - Clerical (8.93 m2)

No Asbestos

B00H - R0010 - Staff Study (20.5 m2)

No Asbestos

B00H - R0011 - Staff - Toilet (4 m2)

No Asbestos

B00H - R0014 - Design L.S. (66.31 m2)

No Asbestos

B00H - R0035 - Kiln Space (9.49 m2)

No Asbestos

B00H - R0036 - Art Outdoor Area (91.96 m2)

No Asbestos

B00H - R0037 - Art Learning Space (106.21 m2)

No Asbestos

B00H - R0038 - Movement (67.33 m2)

No Asbestos

B00H - R0039 - Distribution Board Cupboard (1.03 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0040 - Cleaning Store - Distributed (4.29 m2)

No Asbestos

B00H - R0041 - Movement (70.75 m2)

No Asbestos

B00H - R0042 - Design L.S. (53.29 m2)

No Asbestos

B00H - R0043 - Security Store (25.11 m2)

No Asbestos

B00H - R0044 - Staff Study (9.27 m2)

No Asbestos

B00H - R0045 - Staff Study (43.01 m2)

No Asbestos

B00H - R0046 - Movement (2.24 m2)

No Asbestos

B00H - R0047 - Movement (2.91 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8224/B00H/R0047/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		

- B00H - R0048 - Clinic - Girls (13.31 m2)**
No Asbestos
- B00H - R0049 - Laundry (8.7 m2)**
No Asbestos
- B00H - R0050 - Food/Research Space (15.74 m2)**
No Asbestos
- B00H - R0051 - Interview/Office - Type 1 (13.39 m2)**
No Asbestos
- B00H - R0052 - Food Technology L.S. (66.12 m2)**
No Asbestos
- B00H - R0053 - Food Technology L.S. (66.15 m2)**
No Asbestos
- B00H - R0054 - General Storeroom (4.66 m2)**
No Asbestos
- B00H - R0055 - Resources Space (7.57 m2)**
No Asbestos
- B00H - R0056 - Art Learning Space (65.85 m2)**
No Asbestos
- B00H - R0057 - Art Learning Space (66.22 m2)**
No Asbestos
- B00H - R0058 - Resources Store (6.19 m2)**
No Asbestos
- B00H - R0059 - Resources Store (6.18 m2)**
No Asbestos
- B00H - R0060 - Darkroom Space (28.34 m2)**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Various - 1965 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior**B00J - R0001 - Sport Equipment Store (9.74 m2)**

No Asbestos

B00J - R0002 - Sport Equipment Store (21.48 m2)

No Asbestos

B00J - R0003 - Fitness Laboratory (173.16 m2)

No Asbestos

B00J - R0004 - Sport Equipment Store (20.72 m2)

No Asbestos

B00J - R0005 - Cleaning Store - Distributed (1.4 m2)

No Asbestos

B00J - R0006 - Movement (294.92 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R0007 - Stairs (1.67 m2)

No Asbestos

B00J - R1001 - Main Switchroom (4.9 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R1002 - General Assistants (27.91 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

B00J - R1003 - General Storeroom (24.69 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R1004 - Staff - Toilet (5.35 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R1005 - General Storeroom (4.84 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R1006 - Cleaning Supplies Store (20.28 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R1007 - Laboratory L.S. (92.07 m2)

Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window Sill	Compressed AC Sheet	10m	South	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8224/B00J/R1007/Window Cill/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1008 - Apparatus Store (9.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1009 - Preparation (28.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	5m	South	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8224/B00J/R1007/Window Cill/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1010 - Laboratory L.S. (98.8 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	10m	South	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8224/B00J/R1007/Window Cill/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1011 - Cleaning Store - Distributed (1.4 m2)						
No Asbestos						
B00J - R1012 - Performance Workspace (78.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R1013 - Distribution Board Cupboard (0.62 m2)						
No Asbestos						
B00J - R1014 - Performing Arts Store (4 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R1015 - Performing Arts Changeroom (4.83 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R1016 - General Storeroom (8.79 m2)						
Ceiling Structures/Linings	Vermiculite	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1036/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8224/B00J/R1036/Wall Linings Internal/S19					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R1017 - General Learning Space (59.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R1018 - Apparatus Store (9.06 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1019 - Preparation (28.78 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1020 - Laboratory L.S. (91.07 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	10m	North	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8224/B00J/R1007/Window Cill/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1021 - Chemical Store (25.55 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1022 - Staff Study (25.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R1023 - General Storeroom (25.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R1024 - Cleaning Store - Distributed (10.47 m2)						
No Asbestos						
B00J - R1025 - Shower/Change (30.69 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1025/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R1026 - Toilets-Girls (17.74 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R1027 - Movement (4.04 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R1028 - Staff Change (4.77 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R1029 - Cleaning Store - Distributed (4.99 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R1030 - Staff - Toilet (5.22 m2)						
Ceiling Structures/Linings	Vermiculite	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8224/B00J/R1036/Ceiling Structures/Linings/S20 <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00J - R1032 - Movement (157.53 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8224/B00J/R1032/Wall Linings Internal/S10					No Asbestos Detected
B00J - R1033 - Stairs (4.44 m2)						
No Asbestos						
B00J - R1034 - Stairs (9.3 m2)						
No Asbestos						
B00J - R1035 - Movement (148.58 m2)						
Wall Linings Internal	Flat AC Sheeting 8224/B00J/R1036/Wall Linings Internal/S19					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8224/B00J/R1036/Ceiling Structures/Linings/S20 <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00J - R1036 - General Storeroom (59.74 m2)						
Wall Linings Internal	Flat AC Sheeting 8224/B00J/R1036/Wall Linings Internal/S19					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8224/B00J/R1036/Ceiling Structures/Linings/S20 <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00J - R2001 - Staff Study (32.98 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2002 - Staff - Toilet (6.53 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2003 - General Storeroom (13.67 m2)						
No Asbestos						
B00J - R2004 - Administration - Clerical (12.61 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2005 - Resources (12.6 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2006 - General Learning Space (64.2 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2007 - Staff Study (25.85 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2008 - General Learning Space (59.6 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2009 - General Storeroom (5.72 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2010 - General Storeroom (3.98 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2011 - Staff Study (25.37 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2012 - General Storeroom (5.95 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00J - R2013 - General Storeroom (6.05 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00J - R2014 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2015 - General Learning Space (51.85 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2016 - General Learning Space (51.47 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2017 - General Learning Space (58.8 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R2018 - Cleaning Store - Distributed (1.4 m2)						
No Asbestos						
B00J - R2019 - Staff Study (25.67 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2020 - General Storeroom (5.07 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R2021 - Music Store (3.11 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R2022 - Movement (3.74 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R2023 - Computer Learning Space (52.27 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R2024 - Music Store (5.25 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R2025 - Music Store (4.35 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R1002/Floor Coverings Res/Textile/S7	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R2026 - Distribution Board Cupboard (0.67 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00J - R2027 - Music Learning Space (59.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00J - R2028 - General Storeroom (6.22 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00J - R2029 - Movement (6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R2030 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R2031 - General Learning Space (52.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R2032 - General Storeroom (6.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R2033 - General Storeroom (5.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R2034 - General Learning Space (52.26 m2)						
Ceiling Structures/Linings	Vermiculite					
	8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8224/B00J/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00J - R2035 - General Learning Space (44.82 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8224/B00J/R2035/Floor Coverings Res/Textile/S11	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R2036 - Interview/Office - Type 1 (12.25 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2037 - Staff Room (18.41 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2038 - General Storeroom (4.68 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2039 - Movement (1.44 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2040 - Distribution Board Cupboard (0.63 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2041 - Staff - Toilet (2.12 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2042 - Staff - Toilet (4.73 m2)						
Ceiling Structures/Linings	Vermiculite 8224/B00J/R0006/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00J - R2043 - Movement (183.6 m2)						
No Asbestos						
B00J - R2044 - Stairs (15.03 m2)						
No Asbestos						
B00J - R2045 - Stairs (9.3 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Library - 1997 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00K - R0001 - Seminar (14.12 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0002 - Seminar (14.12 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0003 - Seminar (14.99 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0004 - Cleaning Store - Distributed (4.32 m2)

No Asbestos

B00K - R0005 - Toilets-Unisex (4.6 m2)

No Asbestos

B00K - R0006 - Movement (3.94 m2)

No Asbestos

B00K - R0007 - Main Area (351.8 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0008 - Entry (15.04 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0009 - Movement (9.16 m2)

No Asbestos

B00K - R0010 - Distribution Board Cupboard (1.17 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0011 - Librarian (11.28 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0012 - Workroom (36.65 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00K - R0013 - Computer Resource (26.6 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 831 - D14601 - Girls Shower/Change/Toilet : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				14.4 m2

Interior

R1 - Change Room

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R2 - Staff Room

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				11 m2

R3 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2

R4 - Hot water unit

Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
---------	---------------	------------------	--	--	--	------

R5 - Area in front of staff room

Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
---------	---------------	------------------	--	--	--	------

OS 601 - D14603 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

OS 720 - D14610 - Science Laboratory/Prep Room : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2

Interior

R1 - Laboratory L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				90 m2

R2 - Preparation

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				19 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
OS 760 - D14699 - Woodwork/Store : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2
Interior						
R1 - Woodwork						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				91 m2
R2 - Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017