


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blakehurst High School (8236)
Region : Sydney
State Electorate : Kogarah
Local Government Area : Kogarah

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

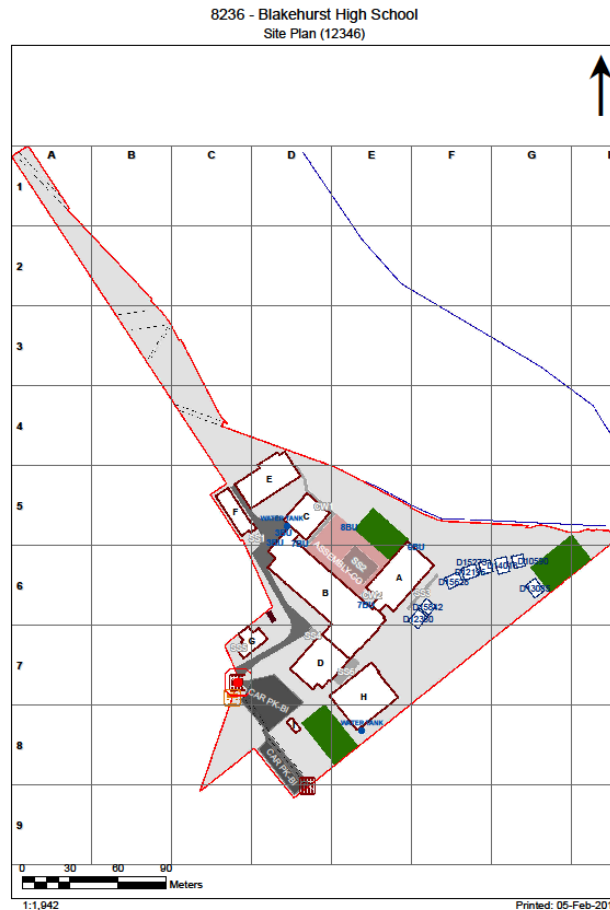

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Science Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	Non Accessible Area - No access - No Manholes in Building - Access through roof only					
Underfloor Voids	Non Accessible Area - No access - Stored goods prevents access					
Ground Area	AC Fragments/Debris	1m2	East, Demountable Buildings	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	8236/B00A/Ground Area/S33			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00A - R0001 - Laboratory L.S. (91.7 m2)**

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0002 - Preparation (47.43 m2)

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0003 - Laboratory L.S. (90.17 m2)

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0004 - Staff Study (36.9 m2)

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0005 - Distribution Board Cupboard (1.82 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0005/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0006 - Cleaning Store - Distributed (3.46 m2)

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0007 - Staff - Toilet (4.73 m2)

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0008 - Staff - Toilet (4.82 m2)

Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0010 - Toilets-Girls (24.41 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0011 - Toilets-Boys (22.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Chemical Store (58.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0013 - Laboratory L.S. (90.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0014 - Preparation (47.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0015 - Laboratory L.S. (91.7 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0016 - Movement (1.65 m2)						
No Asbestos						
B00A - R0018 - Movement (145.18 m2)						
No Asbestos						
B00A - R0019 - Lift (2.38 m2)						
No Asbestos						
B00A - R0020 - External Movement (34.04 m2)						
No Asbestos						
B00A - R0021 - Stairs (18.45 m2)						
No Asbestos						
B00A - R1001 - Main Area (510.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - Seminar (9.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - Seminar (11.74 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1004 - Seminar (8.16 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1005 - Seminar (9.22 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1006 - Workroom (28.1 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1007 - Secure Storeroom (24.48 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1008 - Computer Learning Space (43.89 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1009 - Librarian (12.68 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1010 - Cleaning Store - Distributed (4.17 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1011 - Distribution Board Cupboard (1.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8236/B00A/R1011/Ceiling Structures/Linings/S25	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00A - R1012 - Movement (56.6 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8236/B00A/R0001/Floor Coverings Res/Textile/S2	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1013 - Toilets-Girls (12.68 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1014 - Toilets-Boys (19.79 m2)						
Ceiling Structures/Linings	Vermiculite 8236/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1015 - Movement (1.55 m2)						
No Asbestos						
B00A - R1017 - External Movement (31.46 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00A - R1018 - Stairs (28.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration/General Learning - 1960 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 8236/B00B/R0013/Wall Linings Internal/S5					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 8236/B00B/Eaves Linings/S19					No Asbestos Detected
Ceiling Void	Non Accessible Area - No Access - Access through roof only					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Computer Learning Space (79.82 m2)**

Ceiling Structures/Linings	Vermiculite 8236/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0002 - Computer Store (5.18 m2)

No Asbestos

B00B - R0003 - General Learning Space (28.37 m2)

No Asbestos

B00B - R0004 - General Storeroom (10.01 m2)

No Asbestos

B00B - R0007 - Toilets-Boys (4.56 m2)

No Asbestos

B00B - R0008 - Staff Shower (2.42 m2)

No Asbestos

B00B - R0009 - Staff Study (4.62 m2)

No Asbestos

B00B - R0010 - Cleaning Store - Distributed (6.7 m2)

No Asbestos

B00B - R0011 - Sport Equipment Store (13.55 m2)

No Asbestos

B00B - R0012 - Staff Study (11.46 m2)

No Asbestos

B00B - R0013 - Growing/Breeding (49.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8236/B00B/R0013/Wall Linings Internal/S5					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 8236/B00B/R0013/Wall Linings Internal/S5					No Asbestos Detected

B00B - R0014 - General Assistants (5.91 m2)

No Asbestos

B00B - R0015 - Staff - Toilet (5.54 m2)

No Asbestos

B00B - R0017 - General Storeroom (17.81 m2)

No Asbestos

B00B - R0018 - Distribution Board Cupboard (0.43 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0019 - General Storeroom (4.25 m2)

No Asbestos

B00B - R0020 - General Storeroom (13.67 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0021 - Staff - Toilet (9.2 m2)						
No Asbestos						
B00B - R0022 - Administration - Clerical (33.5 m2)						
No Asbestos						
B00B - R0023 - Principal Office (15.4 m2)						
No Asbestos						
B00B - R0024 - General Storeroom (1.62 m2)						
No Asbestos						
B00B - R0025 - Movement (35.74 m2)						
No Asbestos						
B00B - R0026 - Leading Teacher (13.66 m2)						
No Asbestos						
B00B - R0027 - General Storeroom (23.57 m2)						
No Asbestos						
B00B - R0028 - Deputy Principal Office (11.73 m2)						
No Asbestos						
B00B - R0029 - Administration - Clerical (33.86 m2)						
Ceiling Structures/Linings	Vermiculite					
		8236/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0030 - General Learning Space (51.41 m2)						
Ceiling Structures/Linings	Vermiculite					
		8236/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0031 - General Learning Space (51.41 m2)						
Ceiling Structures/Linings	Vermiculite					
		8236/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0032 - General Storeroom (8.35 m2)						
No Asbestos						
B00B - R0033 - Main Switchroom (4.34 m2)						
No Asbestos						
B00B - R0034 - Staff Study (12.92 m2)						
No Asbestos						
B00B - R0035 - Food Technology L.S. (95.05 m2)						
No Asbestos						
B00B - R0036 - Food/Research Space (19.89 m2)						
No Asbestos						
B00B - R0037 - Food Technology L.S. (94.57 m2)						
No Asbestos						
B00B - R0038 - Laundry (7.3 m2)						
No Asbestos						
B00B - R0040 - Secure Storeroom (10.38 m2)						
No Asbestos						
B00B - R0041 - Movement (7.21 m2)						
No Asbestos						
B00B - R0042 - Movement (574.79 m2)						
Ceiling Structures/Linings	Vermiculite					
		8236/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0043 - Commonroom (83.73 m2)						
Ceiling Structures/Linings	Vermiculite		8236/B00A/R0001/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0044 - Staff Study (10.06 m2)						
No Asbestos						
B00B - R0045 - Clinic (22.1 m2)						
No Asbestos						
B00B - R0046 - Clinic-Toilets (3.64 m2)						
No Asbestos						
B00B - R0047 - General Learning Space (53.07 m2)						
Ceiling Structures/Linings	Vermiculite		8236/B00A/R0001/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0048 - Staff Lounge (49.17 m2)						
Ceiling Structures/Linings	Vermiculite		8236/B00A/R0001/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0049 - Darkroom Space (11.83 m2)						
No Asbestos						
B00B - R0050 - Music Learning Space (94.31 m2)						
Ceiling Structures/Linings	Vermiculite		8236/B00A/R0001/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0051 - Music Store (19.71 m2)						
No Asbestos						
B00B - R0052 - General Learning Space (32.45 m2)						
No Asbestos						
B00B - R0053 - External Movement (6.42 m2)						
No Asbestos						
B00B - R0054 - Movement (14.45 m2)						
Wall Linings Internal	Flat AC Sheeting		8236/B00B/R0013/Wall Linings Internal/S5			No Asbestos Detected
B00B - R0055 - Movement (19.31 m2)						
No Asbestos						
B00B - R0056 - Movement (53.73 m2)						
Wall Linings Internal	Flat AC Sheeting		8236/B00B/R0013/Wall Linings Internal/S5			No Asbestos Detected
B00B - R0057 - Movement (12.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		8236/B00B/R0013/Wall Linings Internal/S5			No Asbestos Detected
B00B - R0058 - Toilets-Boys (24.48 m2)						
No Asbestos						
B00B - R0059 - Student Canteen (31.47 m2)						
No Asbestos						
B00B - R0060 - Student Canteen (4.65 m2)						
No Asbestos						
B00B - R0061 - Staff - Toilet (3.56 m2)						
No Asbestos						
B00B - R0063 - Movement (39.13 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0064 - General Learning Space (50.05 m2)						
No Asbestos						
B00B - R0065 - Store (2.19 m2)						
No Asbestos						
B00B - R0066 - Toilets-Girls (25.61 m2)						
No Asbestos						
B00B - R0067 - Store (5.89 m2)						
No Asbestos						
B00B - R0068 - General Assistants (4.53 m2)						
No Asbestos						
B00B - R0069 - Ramp (12.6 m2)						
Infill panels under window Flat AC Sheeting 8236/B00B/R0069/Infill panels under window/S28						
						No Asbestos Detected
B00B - R1001 - General Learning Space (68.55 m2)						
No Asbestos						
B00B - R1004 - General Learning Space (68.34 m2)						
No Asbestos						
B00B - R1005 - Staff Study (25.43 m2)						
No Asbestos						
B00B - R1006 - General Storeroom (4.54 m2)						
No Asbestos						
B00B - R1007 - General Storeroom (7.08 m2)						
No Asbestos						
B00B - R1008 - General Storeroom (3.64 m2)						
No Asbestos						
B00B - R1009 - General Learning Space (52.56 m2)						
No Asbestos						
B00B - R1010 - Cleaning Store - Distributed (3.23 m2)						
No Asbestos						
B00B - R1011 - Staff Lounge (51.77 m2)						
No Asbestos						
B00B - R1012 - General Storeroom (7.12 m2)						
No Asbestos						
B00B - R1013 - Computer Learning Space (65.63 m2)						
No Asbestos						
B00B - R1014 - General Learning Space (65.7 m2)						
No Asbestos						
B00B - R1015 - General Learning Space (65.7 m2)						
No Asbestos						
B00B - R1016 - Staff Study (33.73 m2)						
No Asbestos						
B00B - R1017 - General Learning Space (65.79 m2)						
No Asbestos						
B00B - R1018 - General Storeroom (5.9 m2)						
No Asbestos						
B00B - R1019 - General Storeroom (4.56 m2)						
No Asbestos						
B00B - R1020 - General Learning Space (51.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	B00B - R1021 - General Learning Space (65.25 m2)					
	No Asbestos					
	B00B - R1024 - General Learning Space (68.66 m2)					
	No Asbestos					
	B00B - R1025 - General Learning Space (65.77 m2)					
	No Asbestos					
	B00B - R1026 - Design L.S. (65.77 m2)					
	No Asbestos					
	B00B - R1027 - General Storeroom (10.24 m2)					
	No Asbestos					
	B00B - R1028 - General Storeroom (5.27 m2)					
	No Asbestos					
	B00B - R1029 - General Storeroom (10.58 m2)					
	No Asbestos					
	B00B - R1030 - General Storeroom (5.28 m2)					
	No Asbestos					
	B00B - R1031 - Design L.S. (65.77 m2)					
	No Asbestos					
	B00B - R1032 - General Learning Space (65.59 m2)					
	No Asbestos					
	B00B - R1033 - General Learning Space (65.86 m2)					
	No Asbestos					
	B00B - R1034 - General Learning Space (66.5 m2)					
	No Asbestos					
	B00B - R1035 - General Learning Space (66.69 m2)					
	No Asbestos					
	B00B - R1036 - Movement (27.21 m2)					
	No Asbestos					
	B00B - R1037 - External Movement (4.7 m2)					
	No Asbestos					
	B00B - R1038 - Movement (273.18 m2)					
	No Asbestos					
	B00B - R1039 - Staff Study (62.37 m2)					
	No Asbestos					
	B00B - R1040 - Staff Study (61.52 m2)					
	No Asbestos					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Technological & Applied Studies - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8236/B00B/Eaves Linings/S19					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Wood Technology L.S. (78.17 m2)

No Asbestos

B00C - R0002 - Materials Store (15.86 m2)

No Asbestos

B00C - R0003 - Computer Resource (18.44 m2)

No Asbestos

B00C - R0004 - Staff Study (17.53 m2)

Floor Coverings Res/Textile	Vinyl Sheet 8236/B00C/R0004/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00C - R0005 - Cleaning Store - Distributed (3.62 m2)

No Asbestos

B00C - R0006 - Staff - Toilet (1.29 m2)

No Asbestos

B00C - R0007 - Garden Store Room (10.59 m2)

No Asbestos

B00C - R0008 - Metal Technology L.S. (93.83 m2)

Wall Linings Internal	Flat AC Sheeting 8236/B00C/R0008/Wall Linings Internal/S6	3m2	NE Corner- Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	--	-----	-----------------------------	--------------------	---------	---

B00C - R0009 - Welding Area (3.93 m2)

No Asbestos

B00C - R0010 - Resource/Project Store (9.58 m2)

No Asbestos

B00C - R0011 - Resource/Project Store (16.45 m2)

No Asbestos

B00C - R0012 - Materials Technology L.S. (78.15 m2)

No Asbestos

B00C - R0013 - Movement (44.8 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00D - Multi Purpose Facilities - 1978 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00D - M0001 - Chair Store (12.81 m2)**

No Asbestos

B00D - M0002 - Control Room (9.24 m2)

No Asbestos

B00D - M0003 - Plant (20.22 m2)

No Asbestos

B00D - R0001 - Staff Study (5.87 m2)

No Asbestos

B00D - R0002 - Staff Shower (2.37 m2)

No Asbestos

B00D - R0003 - Toilets-Girls (4.68 m2)

No Asbestos

B00D - R0005 - Multi-Purpose Space (394.63 m2)

No Asbestos

B00D - R0006 - Sport Equipment Store (13.09 m2)

No Asbestos

B00D - R0007 - Chair Store (12.65 m2)

No Asbestos

B00D - R0008 - Toilets-Girls (9.91 m2)

Ceiling Structures/Linings Flat AC Sheeting
8236/B00D/R0009/Ceiling Structures/Linings/S8 **No Asbestos Detected**

B00D - R0009 - Movement (1.45 m2)

Ceiling Structures/Linings Flat AC Sheeting
8236/B00D/R0009/Ceiling Structures/Linings/S8 **No Asbestos Detected**

B00D - R0010 - Toilets-Boys (9.91 m2)

Ceiling Structures/Linings Flat AC Sheeting
8236/B00D/R0009/Ceiling Structures/Linings/S8 **No Asbestos Detected**

B00D - R0011 - Movement (1.54 m2)

Ceiling Structures/Linings Flat AC Sheeting
8236/B00D/R0009/Ceiling Structures/Linings/S8 **No Asbestos Detected**

B00D - R0012 - Stage (85.71 m2)

No Asbestos

B00D - R0013 - Distribution Board Cupboard (0.91 m2)

No Asbestos

Note: No inspection of live electrical installation.

B00D - R0014 - Movement (5.83 m2)

No Asbestos

B00D - R0015 - Movement (4.83 m2)

No Asbestos

B00D - R0016 - Gymnasium (44.32 m2)

No Asbestos

B00D - R0017 - Cleaning Supplies Store (3.79 m2)

No Asbestos

B00D - R9001 - Chair Store (63.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00D - R9002 - Cleaning Supplies Store (20.67 m2)

No Asbestos

B00D - R9003 - Movement (6.7 m2)

No Asbestos

B00D - R9004 - Movement (3.13 m2)

No Asbestos

B00D - R9005 - Cleaning Store - Distributed (0.65 m2)

No Asbestos

B00D - R9006 - Public Entry (2.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Art/Science - 1961 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 8236/B00E/Eaves Linings/S21					No Asbestos Detected
Wall Cladding	Compressed AC Sheet 8236/B00E/Wall Cladding/S20					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 8236/B00E/Underfloor Voids - Packing to Floor Joists/S32	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ground Area	AC Fragments/Debris 8236/B00E/Ground Area/S34	1m2	South-East	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00E - R0001 - Art Learning Space (59.12 m2)**

Ceiling Structures/Linings	Vermiculite 8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0002 - Kiln Space (19.56 m2)

Ceiling Structures/Linings	Vermiculite 8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0003 - Resources Store (10.87 m2)

Ceiling Structures/Linings	Vermiculite 8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0004 - Resources Store (4.09 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8236/B00E/R0004/Floor Coverings Res/Textile/S29	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00E - R0005 - Distribution Board Cupboard (0.65 m2)

No Asbestos						Note: No inspection of live electrical installation.
-------------	--	--	--	--	--	--

B00E - R0006 - Movement (27.61 m2)

Ceiling Structures/Linings	Vermiculite 8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8236/B00E/R0006/Floor Coverings Res/Textile/S10					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 8236/B00E/R0006/Floor Coverings Res/Textile/S11	8m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00E - R0007 - Art Learning Space (69.21 m2)

Ceiling Structures/Linings	Vermiculite 8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Wall Linings Internal	Flat AC Sheeting 8236/B00E/R0007/Wall Linings Internal/S12					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00E - R0008 - Art Learning Space (68 m2)

Ceiling Structures/Linings	Vermiculite 8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0009 - Resources Store (9.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8236/B00E/R0006/Floor Coverings Res/Textile/S10					No Asbestos Detected
B00E - R0010 - Cleaning Store - Distributed (9.37 m2)						
Non Accessible						
B00E - R0011 - Movement (2.56 m2)						
No Asbestos						
B00E - R1001 - Staff - Toilet (5.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00E/R1009/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
B00E - R1002 - Staff Study (17.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1003 - Movement (104.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1004 - Preparation - Science (52.34 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1005 - General Learning Space (52.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1006 - General Learning Space (52.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1007 - General Learning Space (52.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1008 - Interview/Office - Type 1 (14.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1009 - Staff - Toilet (5.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00E/R1009/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
B00E - R1010 - Distribution Board Cupboard (0.61 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1011 - General Storeroom (26.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8236/B00E/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00E - R1012 - Movement (3.45 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8236/B00E/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1013 - Laboratory L.S. (85.77 m2)

Ceiling Structures/Linings Vermiculite
 8236/B00E/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8236/B00E/R0006/Floor Coverings Res/Textile/S10 **No Asbestos Detected**

B00E - R1014 - Preparation (9.54 m2)

Ceiling Structures/Linings Vermiculite
 8236/B00E/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8236/B00E/R0006/Floor Coverings Res/Textile/S10 **No Asbestos Detected**

B00E - R1015 - Preparation (28.41 m2)

Ceiling Structures/Linings Vermiculite
 8236/B00E/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8236/B00E/R0006/Floor Coverings Res/Textile/S10 **No Asbestos Detected**

B00E - R1016 - Laboratory L.S. (84.79 m2)

Ceiling Structures/Linings Vermiculite
 8236/B00E/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8236/B00E/R0006/Floor Coverings Res/Textile/S10 **No Asbestos Detected**

B00E - R1017 - Apparatus Store (9.59 m2)

Ceiling Structures/Linings Vermiculite
 8236/B00E/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1960 - Steel (Steel)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00F - R0001 - Workshop Area (114.26 m2)**

Wall Linings Internal Flat AC Sheeting
8236/B00F/R0001/Wall Linings Internal/S14 **No Asbestos Detected**

B00F - R0002 - Metal Technology Bay (17.1 m2)

Wall Linings Internal Flat AC Sheeting
8236/B00F/R0001/Wall Linings Internal/S14 **No Asbestos Detected**

B00F - R0003 - Welding Area (4.73 m2)

Wall Linings Internal Flat AC Sheeting
8236/B00F/R0003/Wall Linings Internal/S27 **No Asbestos Detected**

B00F - R0004 - Resource/Project Store (13.04 m2)

Wall Linings Internal Flat AC Sheeting
8236/B00F/R0001/Wall Linings Internal/S14 **No Asbestos Detected**

B00F - R0005 - Design L.S. (60.21 m2)

No Asbestos

B00F - R0006 - Design L.S. (30.36 m2)

Wall Linings Internal Flat AC Sheeting
8236/B00F/R0001/Wall Linings Internal/S14 **No Asbestos Detected**

B00F - R0007 - General Storeroom (7.17 m2)

No Asbestos

B00F - R0008 - General Storeroom (6.45 m2)

No Asbestos

B00F - R0009 - General Storeroom (15.86 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Music - 1960 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8236/B00G/Eaves Linings/S22					Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8236/B00G/Underfloor Voids/S24					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Void	No Asbestos Found					

Interior**B00G - R0001 - Staff Shower (5.04 m2)**

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0002 - Cleaning Store - Distributed (0.44 m2)

No Asbestos

B00G - R0003 - Movement (5.47 m2)

No Asbestos

B00G - R0004 - Staff Study (10.23 m2)

No Asbestos

B00G - R0005 - Staff - Toilet (1.61 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0006 - Movement (3.87 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0007 - Commonroom (12.62 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8236/B00G/R0007/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00G - R0008 - General Storeroom (0.33 m2)

No Asbestos

B00G - R0009 - Movement (8.66 m2)

No Asbestos

B00G - R0010 - Staff - Toilet (4.65 m2)

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0011 - Movement (11.09 m2)

No Asbestos

B00G - R0012 - Computer Learning Space (15.42 m2)

No Asbestos

B00G - R0013 - Movement (46.09 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0014 - Music Store (3.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0014/Ceiling Structures/Linings/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0014/Ceiling Structures/Linings/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0014/Floor Coverings Res/Textile/S30			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8236/B00G/R0014/Floor Coverings Res/Textile/S31			Chrysotile (white asbestos)		

B00G - R0015 - General Storeroom (38.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Physical Education - 2009 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00H - R0001 - Gymnasium (621.19 m2)**

No Asbestos

B00H - R0002 - Staff Study (33.69 m2)

No Asbestos

B00H - R0003 - Large Equipment Store (22.8 m2)

No Asbestos

B00H - R0004 - Change (29.2 m2)

No Asbestos

B00H - R0005 - Change (29.19 m2)

No Asbestos

B00H - R0006 - First Aid (12.27 m2)

No Asbestos

B00H - R0007 - Cleaning Store - Distributed (3.18 m2)

No Asbestos

B00H - R0008 - Toilets-Disabled (8.92 m2)

No Asbestos

B00H - R0009 - Main Switchroom (7.6 m2)

No Asbestos

B00H - R0010 - Utility Space (0.82 m2)

No Asbestos

B00H - R0011 - Utility Space (0.76 m2)

No Asbestos

B00H - R0012 - External Movement (100.97 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B001 - R0001 - General Storeroom (35.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 600 - D10590 - Learning Unit - Small : Placement Date - 11/12/2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 601 - D12196 - Learning Unit - Standard/Withdrawal : Placement Date - 7/11/2007

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D12350 - Learning Unit - Standard/Withdrawal : Placement Date - 24/01/2005

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 601 - D13085 - Learning Unit - Standard/Withdrawal : Placement Date - 20/04/2009

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
NS 110 - D14018 - Learning Unit - Single Secondary/Secure : Placement Date - 8/02/2006						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
R2 - Entry						
No Asbestos Found.						
R3 - Secure Storeroom						
No Asbestos Found.						
OS 600 - D15275 - Learning Unit - Small : Placement Date - 26/02/1998						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
OS 601 - D15628 - Learning Unit - Standard/Withdrawal : Placement Date - 21/09/2015						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						
OS 600 - D15842 - Learning Unit - Small : Placement Date - 22/01/2004						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8236_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017