


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bonnyrigg High School (8260)  
**Region :** South Western Sydney  
**State Electorate :** Cabramatta  
**Local Government Area :** Fairfield

**Initial Survey :** Noel Arnold & Associates : 05 - May - 2008  
**Reviewed By :** Greencap-NAA : 13 - Aug - 2014

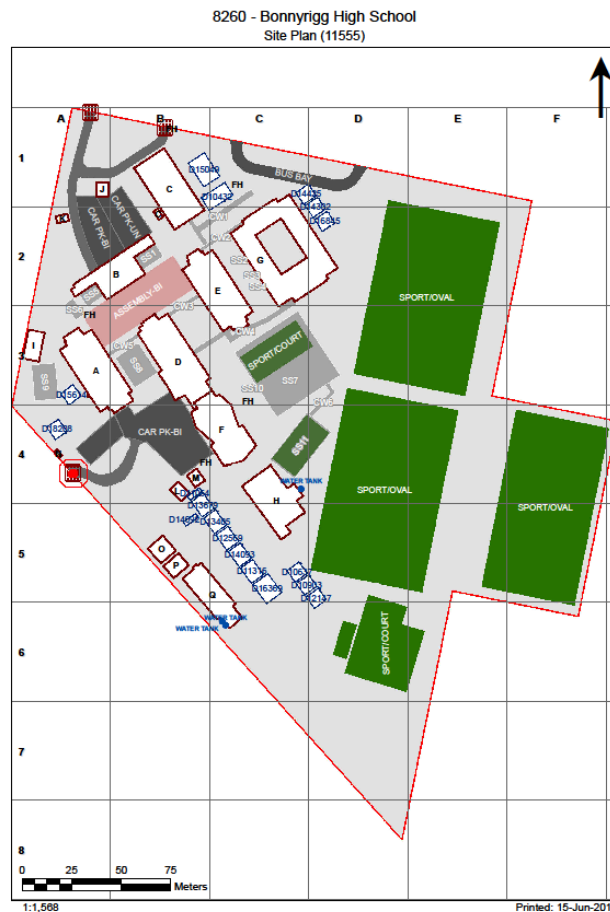

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - Technological & Applied Studies/General Learning - 1960 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	150m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00A/R0022/Ceiling Structures/Linings/S22			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
In-fill-panel	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction - Approx. 4m</b>					
Ceiling Voids	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Computer Learning Space (74.69 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00A/R0001/Floor Coverings Res/Textile/S16			<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	8260/B00A/R0001/Floor Coverings Res/Textile/S17					

**B00A - R0002 - Control Room (9.34 m2)**

No Asbestos

**B00A - R0009 - General Storeroom (4.55 m2)**

No Asbestos

**B00A - R0010 - Bulk Store (19.91 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0012 - Computer Resource (25.67 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0013 - Main Switchroom (8.97 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0019 - Food Technology L.S. (67.52 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0020 - Cleaning Store - Distributed (5.18 m2)**

No Asbestos

**B00A - R0021 - Movement (155.14 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8260/B00A/R0021/Ceiling Structures/Linings/S15			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0022 - External Movement (2.44 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R0022/Ceiling Structures/Linings/S22				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
<b>B00A - R0027 - Handwashing Facilities (2.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0028 - Cleaning Store - Distributed (3.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0029 - Staff - Toilet (6.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0031 - Stairs (1.82 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Stairs (2.52 m2)</b>						
No Asbestos						
<b>B00A - R0033 - External Movement (1.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0035 - External Movement (1.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0036 - External Movement (1.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0037 - External Movement (1.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8260/B00A/R0021/Ceiling Structures/Linings/S15				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00A - R0038 - Kitchen - Type 1 (113.86 m2)</b>						
No Asbestos						
<b>B00A - R0039 - General Storeroom (15.62 m2)</b>						
No Asbestos						
<b>B00A - R0040 - Preparation (15.69 m2)</b>						
No Asbestos						
<b>B00A - R0041 - Laundry (8.45 m2)</b>						
No Asbestos						
<b>B00A - R0042 - General Storeroom (8.38 m2)</b>						
No Asbestos						
<b>B00A - R0043 - Kitchen - Type 1 (85.85 m2)</b>						
No Asbestos						
<b>B00A - R0044 - General Learning Space (41.95 m2)</b>						
No Asbestos						
<b>B00A - R0045 - Lift (1.54 m2)</b>						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0046 - External Movement (11.08 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00A - R1001 - Staff - Toilet (2.86 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R1001/Partition Walls (Cubicles)/S7					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1002 - General Learning Space (53.16 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
8260/B00A/R1005/Floor Coverings Res/Textile/S18						
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
8260/B00A/R1005/Floor Coverings Res/Textile/S19						
Floor Coverings Res/Textile	Vinyl Underlay					<b>No Asbestos Detected</b>
8260/B00A/R1005/Floor Coverings Res/Textile/S20						
<b>B00A - R1003 - General Storeroom (7.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
8260/B00A/R1009/Floor Coverings Res/Textile/S8						
<b>B00A - R1004 - Cleaning Store - Distributed (3.9 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Staff Study (32.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
8260/B00A/R1005/Floor Coverings Res/Textile/S18						
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
8260/B00A/R1005/Floor Coverings Res/Textile/S19						
Floor Coverings Res/Textile	Vinyl Underlay					<b>No Asbestos Detected</b>
8260/B00A/R1005/Floor Coverings Res/Textile/S20						
<b>B00A - R1006 - Staff - Toilet (7.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
8260/B00A/R1009/Floor Coverings Res/Textile/S8						
<b>B00A - R1007 - Resources Store (12.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
8260/B00A/R1009/Floor Coverings Res/Textile/S8						
<b>B00A - R1008 - General Learning Space (65.86 m2)</b>						
No Asbestos						
<b>B00A - R1009 - General Storeroom (2.01 m2)</b>						
No Asbestos						
<b>B00A - R1010 - General Storeroom (4.14 m2)</b>						
No Asbestos						
<b>B00A - R1011 - General Storeroom (3.1 m2)</b>						
No Asbestos						
<b>B00A - R1012 - Textiles Technology L.S. (66.84 m2)</b>						
No Asbestos						
<b>B00A - R1013 - Resources Store (3.2 m2)</b>						
No Asbestos						
<b>B00A - R1014 - Staff - Toilet (2.88 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R1001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	
<b>B00A - R1015 - General Learning Space (53.38 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
8260/B00A/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected	
<b>B00A - R1016 - General Learning Space (52.73 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
8260/B00A/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected	
<b>B00A - R1017 - General Learning Space (52.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
8260/B00A/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected	
<b>B00A - R1018 - Performance Workshop (26.14 m2)</b>						
No Asbestos						
<b>B00A - R1019 - General Storeroom (11.6 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8260/B00A/R1009/Floor Coverings Res/Textile/S8					No Asbestos Detected	
<b>B00A - R1020 - General Storeroom (10.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8260/B00A/R1009/Floor Coverings Res/Textile/S8					No Asbestos Detected	
<b>B00A - R1021 - General Learning Space (53.24 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00A/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
8260/B00A/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected	
<b>B00A - R1022 - Movement (126.67 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
8260/B00A/R1022/Floor Coverings Res/Textile/S21					No Asbestos Detected	
<b>B00A - R1023 - Stairs (11.94 m2)</b>						
No Asbestos						
<b>B00A - R1024 - Stairs (11.74 m2)</b>						
No Asbestos						
<b>B00A - R9001 - General Assistants (13.02 m2)</b>						
No Asbestos						
<b>B00A - R9002 - General Storeroom (8.68 m2)</b>						
No Asbestos						
<b>B00A - R9004 - Staff - Toilet (3.82 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Room+1 - Lift

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**

**Exterior**

Wall Cladding	Flat AC Sheeting 8260/B00B/Wall Cladding/S23	20m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Non Accessible Area - No access point to ceiling void					

**Interior**

**B00B - R0001 - Toilets-Girls (76.03 m2)**

No Asbestos

**B00B - R0002 - General Storeroom (10.73 m2)**

No Asbestos

**B00B - R0003 - Student Canteen (58.02 m2)**

No Asbestos

**B00B - R0005 - Pantry (8.47 m2)**

No Asbestos

**B00B - R0006 - General Storeroom (3.71 m2)**

No Asbestos

**B00B - R0007 - Toilets-Boys (59.56 m2)**

No Asbestos

**B00B - R0008 - Movement (218.51 m2)**

Infill panels	Flat AC Sheeting 8260/B00B/Wall Cladding/S23	10m2	North & South Upper Portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0009 - Cleaning Store - Distributed (7.94 m2)**

No Asbestos

**B00B - R0010 - Staff - Toilet (2.01 m2)**

No Asbestos

**B00B - R0011 - General Storeroom (6.42 m2)**

No Asbestos

**B00B - R0012 - Movement (9.34 m2)**

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Technological & Applied Studies - 1960 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	200m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00C/R0022/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Encapsulated Insulation material within unit					
	8260/B00C/Ceiling Voids/S29				<b>No Asbestos Detected</b>	

**Interior****B00C - R0001 - Materials Technology L.S. (81.03 m2)**

No Asbestos

**B00C - R0002 - General Storeroom (8.26 m2)**

No Asbestos

**B00C - R0003 - Materials Store (10.73 m2)**

No Asbestos

**B00C - R0004 - Materials Store (26.62 m2)**

Floor Coverings Res/Textile	Adhesive					
	8260/B00C/R0004/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00C/R0004/Floor Coverings Res/Textile/S26				<b>No Asbestos Detected</b>	

**B00C - R0005 - Plant (4.78 m2)**

Floor Coverings Res/Textile	Flat AC Sheeting					
	8260/B00C/R0005/Floor Coverings Res/Textile/S28				<b>No Asbestos Detected</b>	

**B00C - R0006 - Materials Technology L.S. (80.29 m2)**

No Asbestos

**B00C - R0007 - Materials Store (14.1 m2)**

No Asbestos

**B00C - R0008 - Metal Technology Bay (40.59 m2)**

No Asbestos

**B00C - R0010 - Staff - Toilet (7.3 m2)**

No Asbestos

**B00C - R0019 - Materials Store (18.7 m2)**

No Asbestos

**B00C - R0020 - External Movement (3.1 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00C/R0022/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0021 - Movement (72.2 m2)**

No Asbestos

**B00C - R0022 - External Movement (3.1 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00C/R0022/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0023 - General Storeroom (26.73 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile Adhesive  
 8260/B00C/R0023/Floor Coverings Res/Textile/S27 **No Asbestos Detected**

**B00C - R0024 - Wood Technology Bay (39.94 m2)**

No Asbestos

**B00C - R0025 - Materials Technology L.S. (119.83 m2)**

No Asbestos

**B00C - R0026 - Metal Technology Bay (41.05 m2)**

No Asbestos

**B00C - R0027 - Staff Study (28.38 m2)**

No Asbestos

**B00C - R0028 - Tea Room (2.26 m2)**

Floor Coverings Res/Textile Adhesive  
 8260/B00C/R0023/Floor Coverings Res/Textile/S27 **No Asbestos Detected**

**B00C - R0029 - Plant (7.84 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration/General Learning - 1961 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 8260/B00E/R1014/Wall Linings Internal/S14					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction - Approx. 5m</b>						
Ceiling Voids	Vermiculite 8260/B00D/R0001/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Encapsulated Insulation material within unit 8260/B00D/Ceiling Voids/S37					<b>No Asbestos Detected</b>

**Interior****B00D - R0001 - General Learning Space (54.26 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00D/R0001/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8260/B00D/R0026/Floor Coverings Res/Textile/S30	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
Floor Coverings Res/Textile	Adhesive 8260/B00D/R0026/Floor Coverings Res/Textile/S31					<b>No Asbestos Detected</b>

**B00D - R0010 - Control Room (10.96 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00D/R0001/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0026 - General Learning Space (54.12 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00D/R0001/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8260/B00D/R0026/Floor Coverings Res/Textile/S30	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
Floor Coverings Res/Textile	Adhesive 8260/B00D/R0026/Floor Coverings Res/Textile/S31					<b>No Asbestos Detected</b>

**B00D - R0027 - Cleaning Store - Distributed (4.94 m2)**

No Asbestos

**B00D - R0028 - Movement (19.91 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00D/R0001/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0031 - External Movement (1.61 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8260/B00D/R0067/Wall Linings Internal/S32					<b>No Asbestos Detected</b>
----------------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0032 - External Movement (2.11 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8260/B00D/R0067/Wall Linings Internal/S32					<b>No Asbestos Detected</b>
----------------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

**B00D - R0034 - Stairs (0.29 m2)**

No Asbestos

**B00D - R0035 - Stairs (0.29 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R0036 - General Storeroom (1.95 m2)</b>						
No Asbestos						
<b>B00D - R0037 - General Storeroom (1.95 m2)</b>						
No Asbestos						
<b>B00D - R0038 - Pupil Entry (42.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8260/B00D/R0001/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0040 - External Movement (10.03 m2)</b>						
No Asbestos						
<b>B00D - R0041 - External Movement (11.48 m2)</b>						
No Asbestos						
<b>B00D - R0042 - Stairs (4.04 m2)</b>						
No Asbestos						
<b>B00D - R0043 - Stairs (4.04 m2)</b>						
No Asbestos						
<b>B00D - R0044 - External Movement (15.73 m2)</b>						
No Asbestos						
<b>B00D - R0045 - External Movement (10.34 m2)</b>						
No Asbestos						
<b>B00D - R0046 - Visitors Office (12.01 m2)</b>						
No Asbestos						
<b>B00D - R0047 - Interview/Meeting (11.29 m2)</b>						
No Asbestos						
<b>B00D - R0048 - Interview/Meeting (11.84 m2)</b>						
No Asbestos						
<b>B00D - R0049 - Movement (1.57 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		8260/B00D/R0067/Wall Linings Internal/S32			No Asbestos Detected
<b>B00D - R0050 - Administration - Executive (12.66 m2)</b>						
No Asbestos						
<b>B00D - R0051 - Principal Office (22.94 m2)</b>						
No Asbestos						
<b>B00D - R0052 - Staff - Toilet (4.84 m2)</b>						
Wall Linings Internal	Flat AC Sheeting		8260/B00D/R0067/Wall Linings Internal/S32			No Asbestos Detected
<b>B00D - R0053 - Plant (2.82 m2)</b>						
No Asbestos						
<b>B00D - R0054 - Staff - Toilet (4.96 m2)</b>						
Wall Linings Internal	Flat AC Sheeting		8260/B00D/R0067/Wall Linings Internal/S32			No Asbestos Detected
<b>B00D - R0056 - Staff Kitchen (4.7 m2)</b>						
No Asbestos						
<b>B00D - R0057 - Leading Teacher (12.7 m2)</b>						
No Asbestos						
<b>B00D - R0058 - Deputy Principal Office (12.95 m2)</b>						
No Asbestos						
<b>B00D - R0059 - Administration - Executive (20.23 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00D - R0060 - Leading Teacher (13.63 m2)</b>						
No Asbestos						
<b>B00D - R0061 - Movement (15.39 m2)</b>						
No Asbestos						
<b>B00D - R0062 - Deputy Principal Office (13.63 m2)</b>						
No Asbestos						
<b>B00D - R0063 - Administration - Clerical (11.39 m2)</b>						
No Asbestos						
<b>B00D - R0064 - Administration - Clerical (14.97 m2)</b>						
No Asbestos						
<b>B00D - R0065 - General Storeroom (8.47 m2)</b>						
No Asbestos						
<b>B00D - R0066 - Clinic (9.5 m2)</b>						
No Asbestos						
<b>B00D - R0067 - Toilets-Unisex (5.34 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	8260/B00D/R0067/Wall Linings Internal/S32					<b>No Asbestos Detected</b>
<b>B00D - R0068 - Administration - Clerical (48.09 m2)</b>						
No Asbestos						
<b>B00D - R0069 - External Movement (6.38 m2)</b>						
No Asbestos						
<b>B00D - R0070 - Movement (19.05 m2)</b>						
No Asbestos						
<b>B00D - R0071 - Movement (45.11 m2)</b>						
No Asbestos						
<b>B00D - R0072 - Printing/Photocopying (23.79 m2)</b>						
No Asbestos						
<b>B00D - R0073 - Movement (90.29 m2)</b>						
No Asbestos						
<b>B00D - R0074 - Cleaning Store - Distributed (1.13 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	8260/B00D/R0067/Wall Linings Internal/S32					<b>No Asbestos Detected</b>
<b>B00D - R0075 - Printing/Photocopying (4.7 m2)</b>						
No Asbestos						
<b>B00D - R0076 - External Movement (37.59 m2)</b>						
No Asbestos						
<b>B00D - R0078 - Movement (19.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00D/R0001/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00D/R0026/Floor Coverings Res/Textile/S30					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	8260/B00D/R0026/Floor Coverings Res/Textile/S31					<b>No Asbestos Detected</b>
<b>B00D - R0079 - Lift (1.54 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00D - R0080 - Plant (0.77 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Recently Modified Space	Requires Inspection					
<b>B00D - R0081 - External Movement (1.98 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00D - R1001 - General Learning Space (53.02 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8260/B00D/R0067/Wall Linings Internal/S32					
<b>B00D - R1002 - General Learning Space (52 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8260/B00D/R0067/Wall Linings Internal/S32					
<b>B00D - R1003 - Staff Study (52.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8260/B00D/R1022/Floor Coverings Res/Textile/S33					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8260/B00D/R1022/Floor Coverings Res/Textile/S34					
Floor Coverings Res/Textile	Vinyl Underlay					No Asbestos Detected
	8260/B00D/R1022/Floor Coverings Res/Textile/S35					
<b>B00D - R1004 - General Storeroom (19.07 m2)</b>						
No Asbestos						
<b>B00D - R1005 - General Storeroom (13.18 m2)</b>						
No Asbestos						
<b>B00D - R1006 - General Learning Space (66.65 m2)</b>						
No Asbestos						
<b>B00D - R1007 - General Storeroom (6.46 m2)</b>						
No Asbestos						
<b>B00D - R1008 - General Learning Space (53.23 m2)</b>						
No Asbestos						
<b>B00D - R1009 - Office/Store (7.87 m2)</b>						
No Asbestos						
<b>B00D - R1010 - Cleaning Store - Distributed (2.94 m2)</b>						
No Asbestos						
<b>B00D - R1012 - Staff - Toilet (7.92 m2)</b>						
No Asbestos						
<b>B00D - R1016 - Multi-Purpose Space (118.91 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8260/B00D/R1022/Floor Coverings Res/Textile/S33					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8260/B00D/R1022/Floor Coverings Res/Textile/S34					
Floor Coverings Res/Textile	Vinyl Underlay					No Asbestos Detected
	8260/B00D/R1022/Floor Coverings Res/Textile/S35					
<b>B00D - R1017 - Staff Kitchen (8.95 m2)</b>						
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8260/B00D/R1011/Floor Coverings Res/Textile/S36					
<b>B00D - R1018 - Stairs (15.08 m2)</b>						
No Asbestos						
<b>B00D - R1019 - Stairs (5.28 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R1020 - Stairs (5.28 m2)**

No Asbestos

**B00D - R1021 - Movement (31.31 m2)**

Floor Coverings Res/Textile	Adhesive					
	8260/B00D/R1011/Floor Coverings Res/Textile/S36					<b>No Asbestos Detected</b>

**B00D - R1022 - Movement (103.87 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8260/B00D/R1022/Floor Coverings Res/Textile/S33					<b>No Asbestos Detected</b>

Floor Coverings Res/Textile	Adhesive					
	8260/B00D/R1022/Floor Coverings Res/Textile/S34					<b>No Asbestos Detected</b>

Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00D/R1022/Floor Coverings Res/Textile/S35					<b>No Asbestos Detected</b>

**B00D - R1023 - Chair Store (3.57 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8260/B00D/R1022/Floor Coverings Res/Textile/S33					<b>No Asbestos Detected</b>

Floor Coverings Res/Textile	Adhesive					
	8260/B00D/R1022/Floor Coverings Res/Textile/S34					<b>No Asbestos Detected</b>

Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00D/R1022/Floor Coverings Res/Textile/S35					<b>No Asbestos Detected</b>

**B00D - R1024 - General Storeroom (3.33 m2)**

Recently Modified Space Requires Inspection

**B00D - R1025 - Movement (4.16 m2)**

Recently Modified Space Requires Inspection

**B00D - R1026 - General Learning Space (50.59 m2)**

Recently Modified Space Requires Inspection

**B00D - R1027 - G.L.S. Store (12.33 m2)**

Recently Modified Space Requires Inspection

**B00D - Room+1 - Added Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/General Learning/Physical Education - 1962 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 8260/B00E/R0012/Ceiling Structures/Linings/S42					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction - Approx. 5m</b>						
Ceiling Voids	Non Accessible Area - No access points to ceiling void					
Underfloor Voids	No Asbestos Found					

**Interior****B00E - R0001 - Main Area (440.58 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0005 - Librarian (14.2 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0006 - Seminar (14.2 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0007 - Office/Store (13.89 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0008 - Careers Advisers Office (13.78 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0010 - Distribution Board Cupboard (0.42 m2)**

No Asbestos						Note: No inspection of live electrical installation.
-------------	--	--	--	--	--	------------------------------------------------------

**B00E - R0012 - External Movement (2.07 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8260/B00E/R0012/Ceiling Structures/Linings/S42					<b>No Asbestos Detected</b>
----------------------------	--------------------------------------------------------------------	--	--	--	--	-----------------------------

**B00E - R0014 - Computer Room (34.12 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0017 - Staff Study (23.81 m2)**

Wall Linings Internal	Flat AC Sheeting 8260/B00E/R0012/Ceiling Structures/Linings/S42					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0018 - Tea Room (3.18 m2)**

Ceiling Structures/Linings	Vermiculite 8260/B00E/R0029/Ceiling Structures/Linings/S40					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0019 - Staff - Toilet (4.02 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8260/B00E/R0029/Ceiling Structures/Linings/S40				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R0020 - Plant (0.46 m2)</b>						
No Asbestos						
<b>B00E - R0021 - Library Administration (46.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8260/B00E/R0029/Ceiling Structures/Linings/S40				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R0022 - Tea Room (4.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8260/B00E/R0029/Ceiling Structures/Linings/S40				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R0023 - Stairs (2.16 m2)</b>						
No Asbestos						
<b>B00E - R0024 - External Movement (1.79 m2)</b>						
No Asbestos						
<b>B00E - R0025 - External Movement (1.73 m2)</b>						
No Asbestos						
<b>B00E - R0026 - External Movement (1.79 m2)</b>						
No Asbestos						
<b>B00E - R0027 - External Movement (1.79 m2)</b>						
No Asbestos						
<b>B00E - R0028 - Stairs (2.04 m2)</b>						
No Asbestos						
<b>B00E - R0029 - Movement (19.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8260/B00E/R0029/Ceiling Structures/Linings/S40				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R0030 - General Storeroom (4.41 m2)</b>						
No Asbestos						
<b>B00E - R0031 - Cleaning Store - Distributed (4.41 m2)</b>						
No Asbestos						
<b>B00E - R0032 - Movement (19.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8260/B00E/R0029/Ceiling Structures/Linings/S40				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R0033 - Main Entry (20.38 m2)</b>						
No Asbestos						
<b>B00E - R1001 - General Learning Space (53.02 m2)</b>						
No Asbestos						
<b>B00E - R1002 - General Learning Space (52 m2)</b>						
No Asbestos						
<b>B00E - R1003 - General Learning Space (52 m2)</b>						
No Asbestos						
<b>B00E - R1004 - General Learning Space (51.93 m2)</b>						
No Asbestos						
<b>B00E - R1005 - General Learning Space (52.87 m2)</b>						
No Asbestos						
<b>B00E - R1006 - General Storeroom (4.58 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
No Asbestos							
<b>B00E - R1009 - Laboratory L.S. (92.78 m2)</b>							
No Asbestos							
<b>B00E - R1010 - Preparation - Science (26.28 m2)</b>							
No Asbestos							
<b>B00E - R1011 - Laboratory L.S. (95.16 m2)</b>							
No Asbestos							
<b>B00E - R1012 - General Storeroom (4.62 m2)</b>							
No Asbestos							
<b>B00E - R1013 - Distribution Board Cupboard (0.69 m2)</b>				Note: No inspection of live electrical installation.			
No Asbestos							
<b>B00E - R1015 - Staff Study (44.93 m2)</b>							
No Asbestos							
<b>B00E - R1016 - Tea Room (3.03 m2)</b>							
No Asbestos							
<b>B00E - R1017 - Stairs (10.58 m2)</b>							
No Asbestos							
<b>B00E - R1018 - Stairs (7.21 m2)</b>							
No Asbestos							
<b>B00E - R1019 - Cleaning Store - Distributed (6.41 m2)</b>							
Floor Coverings Res/Textile	Adhesive	8260/B00E/R1019/Floor Coverings Res/Textile/S41				<b>No Asbestos Detected</b>	
<b>B00E - R1020 - Movement (112.03 m2)</b>							
No Asbestos							
<b>B00E - Room+1 - Lift</b>							
No Asbestos							

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Multi Purpose Facilities/Physical Education - 1962 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	200m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - No access points to ceiling void					

**Interior****B00F - R0001 - Staff - Toilet (4.36 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R0002/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Toilets-Unisex (8.43 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R0002/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>

**B00F - R0003 - Movement (13.39 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8260/B00F/R0003/Ceiling Structures/Linings/S38					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00F - R0004 - Staff Kitchen (7.15 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8260/B00F/R0003/Ceiling Structures/Linings/S38					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00F - R0005 - Multi-Purpose Space (363.27 m2)**

No Asbestos

**B00F - R0006 - Stage (111.56 m2)**

No Asbestos

**B00F - R0007 - General Storeroom (16.01 m2)**

No Asbestos

**B00F - R0009 - Performing Arts Store (15.87 m2)**

No Asbestos

**B00F - R0011 - External Movement (25.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

**B00F - R0012 - Movement (6.51 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

**B00F - R0013 - Stairs (2.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

**B00F - R0014 - Movement (6.67 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

**B00F - R0015 - Stairs (2.18 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

**B00F - R0017 - External Movement (9.34 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00F - R0018 - Lift (1.65 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00F - R0019 - Chair Storeroom (8.72 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00F - R1001 - Multi-Purpose Space (30.1 m2)</b>						
No Asbestos						
<b>B00F - R1002 - General Storeroom (25.86 m2)</b>						
No Asbestos						
<b>B00F - R1003 - Performing Arts Store (26.39 m2)</b>						
No Asbestos						
<b>B00F - R1004 - Movement (11.68 m2)</b>						
No Asbestos						
<b>B00F - R9003 - Movement (3.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9004 - Movement (6 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9005 - Sport Equipment Store (25 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9006 - Sport Equipment Store (15.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9009 - Movement (3.73 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9010 - External Movement (25.46 m2)</b>						
No Asbestos						
<b>B00F - R9011 - Cleaning Store - Distributed (5.11 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
8260/B00F/R9008/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>	
<b>B00F - R9012 - Shower (3.55 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9007/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9013 - Change (31.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9007/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9014 - Plant (0.89 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Flue	Fibre Cement Pipe	1Unit	Central	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9017/Flue/S39					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00F - R9015 - Stairs (2.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9016 - Change (35.06 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9007/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9017 - Plant (0.96 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Flue	Fibre Cement Pipe	1Unit	Central	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9017/Flue/S39					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00F - R9018 - General Storeroom (5.15 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
8260/B00F/R9008/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>	
<b>B00F - R9019 - Shower (3.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9007/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9020 - Stairs (2.25 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00F/R9008/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Science Learning/General Learning - 1969 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-------	--------------	--------------------	---------	--------------------

**Assumed Asbestos - Height Restriction - Approx. 8m**

Ceiling Voids	Non Accessible Area - No access point to ceiling void					
---------------	----------------------------------------------------------	--	--	--	--	--

Underfloor Voids - Slab on Ground	No Asbestos Found					
-----------------------------------	-------------------	--	--	--	--	--

**Interior**

**B00G - R0001 - Cleaning Store - Distributed (6.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00G/R0003/Floor Coverings Res/Textile/S44					<b>Chrysotile (white asbestos)</b>	

Floor Coverings Res/Textile	Adhesive					
8260/B00G/R0003/Floor Coverings Res/Textile/S45					<b>No Asbestos Detected</b>	

**B00G - R0003 - General Storeroom (6.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00G/R0003/Floor Coverings Res/Textile/S44					<b>Chrysotile (white asbestos)</b>	

Floor Coverings Res/Textile	Adhesive					
8260/B00G/R0003/Floor Coverings Res/Textile/S45					<b>No Asbestos Detected</b>	

**B00G - R0004 - Laboratory L.S. (92.7 m2)**

Wall Linings Internal	Vermiculite					
8260/B00G/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00G - R0005 - Preparation - Science (28.79 m2)**

Wall Linings Internal	Vermiculite					
8260/B00G/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00G - R0006 - Preparation - Science (9.76 m2)**

Ceiling Structures/Linings	Vermiculite					
8260/B00G/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00G - R0007 - Laboratory L.S. (92.67 m2)**

Wall Linings Internal	Vermiculite					
8260/B00G/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00G - R0008 - Chemical Store (26.18 m2)**

No Asbestos

**B00G - R0010 - Staff - Toilet (4.04 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00G/R0011/Partition Walls (Cubicles)/S9					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite					
8260/B00G/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00G - R0011 - Staff - Toilet (4.06 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00G/R0011/Partition Walls (Cubicles)/S9					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0012 - Toilets-Boys (33.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)  8260/B00G/R0011/Partition Walls (Cubicles)/S9 Chrysotile (white asbestos)
<b>B00G - R0013 - Change (39.91 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0014 - Shower (6.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8260/B00G/R0025/Floor Coverings Res/Textile/S43					No Asbestos Detected
<b>B00G - R0015 - Distribution Board Cupboard (0.77 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00G - R0016 - Sport Equipment Store (11.66 m2)</b>						
No Asbestos						
<b>B00G - R0017 - Computer Learning Space (51.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8260/B00G/R0003/Floor Coverings Res/Textile/S44	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8260/B00G/R0003/Floor Coverings Res/Textile/S45					No Asbestos Detected
<b>B00G - R0018 - Computer Store (6.82 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8260/B00G/R0003/Floor Coverings Res/Textile/S44	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8260/B00G/R0003/Floor Coverings Res/Textile/S45					No Asbestos Detected
<b>B00G - R0019 - Laboratory L.S. (92.98 m2)</b>						
Wall Linings Internal	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0020 - Preparation - Science (28.85 m2)</b>						
Wall Linings Internal	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0021 - General Storeroom (9.69 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0022 - Laboratory L.S. (93.36 m2)</b>						
Wall Linings Internal	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0023 - General Storeroom (26.84 m2)</b>						
No Asbestos						
<b>B00G - R0024 - General Learning Space (53.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0025 - General Storeroom (5.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8260/B00G/R0025/Floor Coverings Res/Textile/S43					No Asbestos Detected
<b>B00G - R0026 - Distribution Board Cupboard (0.66 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00G - R0027 - External Movement (335.17 m2)</b>						
No Asbestos						
<b>B00G - R0028 - Garden Store Room (12.35 m2)</b>						
No Asbestos						
<b>B00G - R0029 - General Storeroom (15 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8260/B00G/R0011/Partition Walls (Cubicles)/S9	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00G - R0030 - Plant (0.91 m2)</b>						
No Asbestos						
<b>B00G - R0031 - General Storeroom (7.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0032 - Staff Study (49.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8260/B00G/R0003/Floor Coverings Res/Textile/S44	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8260/B00G/R0003/Floor Coverings Res/Textile/S45					No Asbestos Detected
<b>B00G - R0033 - Tea Room (2.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R0034 - External Stairs (2.41 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00G - R0035 - Cleaning Store - Distributed (5.93 m2)**

No Asbestos

**B00G - R0036 - External Stairs (4.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00G/R1034/Ceiling Structures/Linings/S46				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0037 - External Stairs (2.47 m2)**

No Asbestos

**B00G - R0038 - Lift (1.54 m2)**

Recently Modified Space Requires Inspection

**B00G - R0039 - Plant (1.21 m2)**

Recently Modified Space Requires Inspection

**B00G - R1001 - General Learning Space (53.09 m2)**

Ceiling Structures/Linings	Vermiculite	8260/B00G/R0002/Ceiling Structures/Linings/S13		<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8260/B00G/R0003/Floor Coverings Res/Textile/S44				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Adhesive	8260/B00G/R0003/Floor Coverings Res/Textile/S45		<b>No Asbestos Detected</b>		

**B00G - R1002 - General Storeroom (7.07 m2)**

Ceiling Structures/Linings	Vermiculite	8260/B00G/R0002/Ceiling Structures/Linings/S13		<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8260/B00G/R1039/Floor Coverings Res/Textile/S47		<b>No Asbestos Detected</b>		
Floor Coverings Res/Textile	Adhesive	8260/B00G/R1039/Floor Coverings Res/Textile/S48		<b>No Asbestos Detected</b>		
Floor Coverings Res/Textile	Vinyl Underlay	8260/B00G/R1039/Floor Coverings Res/Textile/S49		<b>No Asbestos Detected</b>		

**B00G - R1003 - General Learning Space (52.8 m2)**

Ceiling Structures/Linings	Vermiculite	8260/B00G/R0002/Ceiling Structures/Linings/S13		<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Ceiling Structures/Linings	Adhesive	8260/B00G/R0025/Floor Coverings Res/Textile/S43		<b>No Asbestos Detected</b>		

**B00G - R1004 - General Learning Space (52.65 m2)**

Ceiling Structures/Linings	Vermiculite	8260/B00G/R0002/Ceiling Structures/Linings/S13		<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive	8260/B00G/R0025/Floor Coverings Res/Textile/S43		<b>No Asbestos Detected</b>		

**B00G - R1006 - General Learning Space (52.43 m2)**

Ceiling Structures/Linings	Vermiculite	8260/B00G/R0002/Ceiling Structures/Linings/S13		<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R0025/Floor Coverings Res/Textile/S43					No Asbestos Detected
<b>B00G - R1007 - General Storeroom (6.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R0025/Floor Coverings Res/Textile/S43					No Asbestos Detected
<b>B00G - R1008 - General Learning Space (52.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R0025/Floor Coverings Res/Textile/S43					No Asbestos Detected
<b>B00G - R1009 - General Storeroom (6.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1010 - Staff Study (30.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1011 - Music Learning Space (54.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1012 - Music Store (7.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1013 - Music Learning Space (54.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1014 - Music Store (6.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1015 - Distribution Board Cupboard (0.71 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00G/R1034/Ceiling Structures/Linings/S46					Chrysotile (white asbestos) , Amosite (brown asbestos)
<i>Note: No inspection of live electrical installation.</i>						
<b>B00G - R1016 - Art Learning Space (53.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1017 - Project Store - Type 1 (11.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1018 - Art Learning Space (65.67 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1020 - Art Learning Space (52.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1021 - General Storeroom (9.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1022 - Art Learning Space (52.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1023 - General Storeroom (12.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1026 - General Learning Space (53.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R0025/Floor Coverings Res/Textile/S43					No Asbestos Detected
<b>B00G - R1027 - General Storeroom (6.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8260/B00G/R1039/Floor Coverings Res/Textile/S47					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R1039/Floor Coverings Res/Textile/S48					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00G/R1039/Floor Coverings Res/Textile/S49					No Asbestos Detected
<b>B00G - R1028 - Distribution Board Cupboard (1.09 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00G/R1034/Ceiling Structures/Linings/S46					Chrysotile (white asbestos) , Amosite (brown asbestos)
<i>Note: No inspection of live electrical installation.</i>						
<b>B00G - R1029 - Staff - Toilet (4.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1030 - Music Store (21.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8260/B00G/R1039/Floor Coverings Res/Textile/S47					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R1039/Floor Coverings Res/Textile/S48					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00G/R1039/Floor Coverings Res/Textile/S49					No Asbestos Detected
<b>B00G - R1033 - Staff - Toilet (4.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1034 - External Movement (218.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	218m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00G/R1034/Ceiling Structures/Linings/S46					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - R1035 - Bulk Store (9.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1037 - Staff - Toilet (40.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8260/B00G/R1039/Floor Coverings Res/Textile/S47					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R1039/Floor Coverings Res/Textile/S48					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00G/R1039/Floor Coverings Res/Textile/S49					No Asbestos Detected
<b>B00G - R1039 - General Storeroom (12.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8260/B00G/R1039/Floor Coverings Res/Textile/S47					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8260/B00G/R1039/Floor Coverings Res/Textile/S48					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Underlay					
	8260/B00G/R1039/Floor Coverings Res/Textile/S49					No Asbestos Detected
<b>B00G - R1040 - Dark Room (24.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1041 - Darkroom Space (2.18 m2)</b>						
No Asbestos						
<b>B00G - R1042 - Workshop (35.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1043 - Kiln Space (9.43 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8260/B00G/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Kiln	Encapsulated Insulation material within unit	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Assumed asbestos incased in unit</b>
<b>B00G - R1044 - External Stairs (15.57 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8260/B00G/R1034/Ceiling Structures/Linings/S46	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Physical Education - 1985 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00H - R0001 - Gymnasium (502.53 m2)**

No Asbestos

**B00H - R0002 - Sport Equipment Store (31.18 m2)**

No Asbestos

**B00H - R0003 - Fitness Laboratory (19.18 m2)**

No Asbestos

**B00H - R0004 - Sport Equipment Store (3.26 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning - 1962 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - General Learning Space (47.13 m2)**

No Asbestos

**B00I - R0002 - General Learning Space (47.41 m2)**

No Asbestos

**B00I - R0003 - External Movement (24.79 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Storage - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00J/Eaves Linings/S50				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00J - R0001 - General Storeroom (40.74 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Storage - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	3m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8260/B00K/Eaves Linings/S51				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00K - R0001 - Chair Store (20.44 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Mechanical Services - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00L - R0001 - Machine Storage (47 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Storage - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids - Flat Roof      No Asbestos Found

**Interior**

**B00M - R0001 - Chair Store (42.97 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Building Services - 2009 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00N - R0001 - Plant (5.89 m2)**

Gas Valve	Gasket material	1Unit	Central	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------	-----------------	-------	---------	--------------------	---------	--------------------

**Assumed Asbestos - Assumed asbestos incased in unit**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Storage - 2013 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B000 - R0001 - Garden Store Room (97.06 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Storage - 2013 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00P - R0001 - Garden Store Room (77.35 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - GA Shed**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**Build+1 - Room+1 - Added Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+2 - Bus Shed**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**Build+2 - Room+1 - Added Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 760 - D10432 - Woodwork/Store : Placement Date - 22/09/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Woodwork**

No Asbestos Found.

**R2 - Store**

No Asbestos Found.

**OS 600 - D10637 - Learning Unit - Small : Placement Date - 22/10/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**OS 600 - D10903 - Learning Unit - Small : Placement Date - 22/10/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**OS 840 - D11064 - Girls Toilet : Placement Date - 29/07/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Toilets-Girls**

No Asbestos Found.

**OS 602 - D11316 - Learning Unit - Standard With P.A.A. : Placement Date - 26/10/2012**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 720 - D11554 - Science Laboratory/Prep Room : Placement Date - 20/12/2014**

**Exterior**

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result
<b>Interior</b>						
<b>R1 - Laboratory L.S.</b>						
No Asbestos Found.						
<b>R2 - Preparation</b>						
No Asbestos Found.						
<b>OS 601 - D11596 - Learning Unit - Standard/Withdrawal : Placement Date - 30/10/2013</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D11630 - Learning Unit - Standard/Withdrawal : Placement Date - 30/10/2013</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D11885 - Learning Unit - Standard/Withdrawal : Placement Date - 30/10/2013</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 600 - D12147 - Learning Unit - Small : Placement Date - 22/10/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
No Asbestos Found.						
<b>OS 601 - D12569 - Learning Unit - Standard/Withdrawal : Placement Date - 25/10/2012</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D13405 - Learning Unit - Standard/Withdrawal : Placement Date - 19/01/2012</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D13561 - Learning Unit - Standard/Withdrawal : Placement Date - 15/02/2013</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D13679 - Learning Unit - Standard/Withdrawal : Placement Date - 18/01/2012</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D14093 - Learning Unit - Standard/Withdrawal : Placement Date - 26/10/2012</b>						
<b>Exterior</b>						
No Asbestos Found.						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - General Learning Space**

No Asbestos Found.

**R3 - Store**

No Asbestos Found.

**OS 600 - D14302 - Learning Unit - Small : Placement Date - 19/12/2014**

**Exterior**

Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

**Interior**

**R1 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**OS 600 - D14425 - Learning Unit - Small : Placement Date - 19/12/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**OS 710 - D14593 - Home Science/Pantry/Laundry : Placement Date - 19/12/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - Food Technology L.S.**

No Asbestos Found.

**R3 - Laundry**

No Asbestos Found.

**OS 840 - D14692 - Girls Toilet : Placement Date - 29/07/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Toilets-Girls**

No Asbestos Found.

**NS 280 - D15049 - Wood Metal Technics/Heat Area/Storage : Placement Date - 12/03/2016**

**Exterior**

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result
<b>Interior</b>						
<b>R1 - Materials Technology L.S.</b>						
No Asbestos Found.						
<b>R2 - Welding Area</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>R4 - Entry</b>						
No Asbestos Found.						
<b>OS 600 - D15614 - Learning Unit - Small : Placement Date - 30/11/2016</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
No Asbestos Found.						
<b>NS 240 - D16369 - Music Learning Space/Store : Placement Date - 17/04/2014</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Music Learning Space</b>						
No Asbestos Found.						
<b>R2 - Store</b>						
No Asbestos Found.						
<b>R3 - Entry</b>						
No Asbestos Found.						
<b>OS 600 - D16845 - Learning Unit - Small : Placement Date - 6/03/2015</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
No Asbestos Found.						
<b>OS 600 - D18208 - Learning Unit - Small : Placement Date - 30/11/2016</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

8260\_ASB\_150514\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017