


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Blayney High School (8357)  
**Region :** Western NSW  
**State Electorate :** Bathurst  
**Local Government Area :** Blayney

**Initial Survey :** Noel Arnold & Associates : 30 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 09 - Nov - 2016

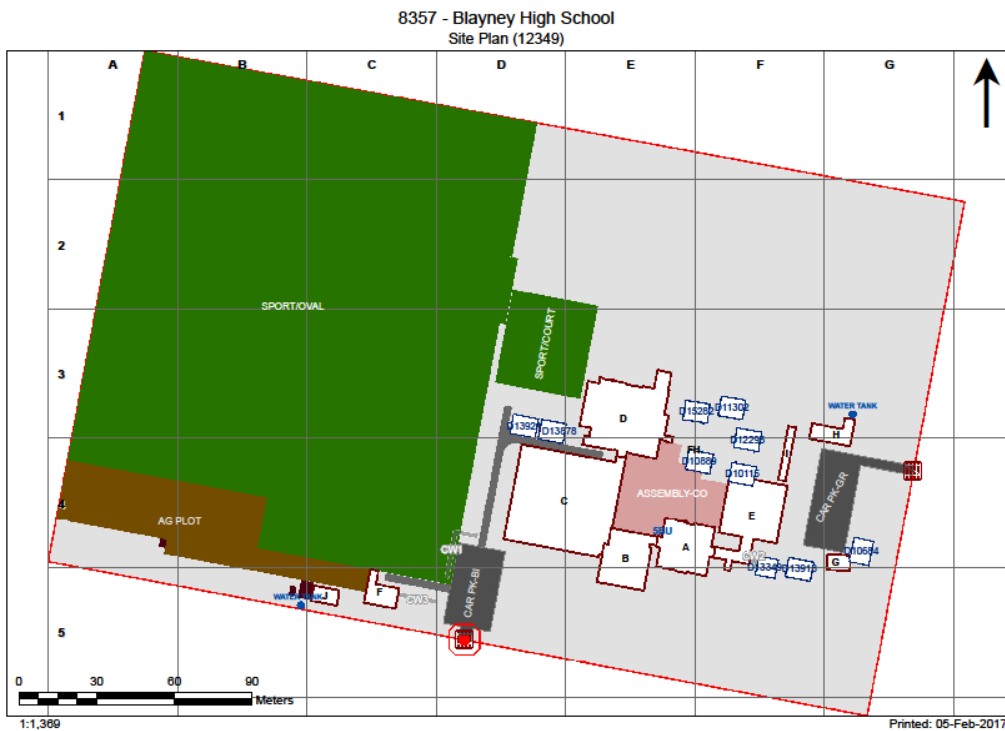

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - General Learning - 1973 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
<b>Interior</b>						
<b>B00A - R0001 - General Learning Space (53.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0002 - Distribution Board Cupboard (0.67 m2)</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00A - R0003 - Staff Study (24.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0004 - Cleaning Store - Distributed (1.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0004/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0005 - Toilets-Boys (24.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8357/B00A/R0006/Partition Walls (Cubicles)/S4					No Asbestos Detected
<b>B00A - R0006 - Toilets-Girls (25.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8357/B00A/R0006/Partition Walls (Cubicles)/S4					No Asbestos Detected
<b>B00A - R0007 - General Learning Space (53.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0008 - Cleaning Store - Distributed (21.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0009 - General Learning Space (53.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0010 - Movement (84.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0011 - Stairs (4.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1001 - Senior Study (53.29 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1002 - Distribution Board Cupboard (0.66 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting 8357/B00A/R1002/Ceiling Structures/Linings/S19					No Asbestos Detected
Electrical Backing Board	Resinous Board	1Unit	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
<b>B00A - R1003 - General Storeroom (24.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8357/B00A/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected
<b>B00A - R1004 - General Learning Space (54.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1005 - Staff Study (28.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1006 - General Learning Space (54.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1007 - General Learning Space (53.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1008 - Movement (55.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1009 - Interview/Office - Type 1 (11.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1010 - Stairs (4.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1011 - Movement (9.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8357/B00A/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration - 1973 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

**Interior****B00B - R0001 - Movement (74.16 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
8357/B00B/R0008/Ceiling Structures/Linings/S1 **No Asbestos Detected**

**B00B - R0002 - Movement (39.52 m2)**

No Asbestos

**B00B - R0003 - Staff - Toilet (6.52 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 6m2 East Good Condition (1) Low (1) Low Priority (2-3)  
8357/B00B/R0003/Partition Walls (Cubicles)/S2 **Chrysotile (white asbestos)**

**B00B - R0004 - Staff - Toilet (5.84 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 6m2 West Good Condition (1) Low (1) Low Priority (2-3)  
8357/B00B/R0003/Partition Walls (Cubicles)/S2 **Chrysotile (white asbestos)**

**B00B - R0005 - Interview/Office - Type 1 (20.33 m2)**

No Asbestos

**B00B - R0006 - Commonroom (57.27 m2)**

No Asbestos

**B00B - R0007 - Clinic - Boys (9.62 m2)**

No Asbestos

**B00B - R0008 - Security Store (5.98 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
8357/B00B/R0008/Ceiling Structures/Linings/S1 **No Asbestos Detected**

**B00B - R0009 - Deputy Principal Office (17.04 m2)**

No Asbestos

**B00B - R0010 - Principal Office (17.79 m2)**

No Asbestos

**B00B - R0011 - Staff - Toilet (2.85 m2)**

No Asbestos

**B00B - R0012 - General Storeroom (2.1 m2)**

No Asbestos

**B00B - R0013 - Cleaning Store - Distributed (2.1 m2)**

No Asbestos

**B00B - R0014 - Administration - Clerical (19.99 m2)**

No Asbestos

**B00B - R0015 - Duplicating Workroom (19.19 m2)**

No Asbestos

**B00B - R0016 - Administration - Clerical (12.17 m2)**

No Asbestos

**B00B - R0017 - Main Switchroom (6.62 m2)**

Electrical Cupboard Lining Flat AC Sheeting 2Unit South Good Condition (1) Low (1) Low Priority (2-3)  
8357/B00B/R0017/Electrical Cupboard Lining/S28 **Chrysotile (white asbestos)**

**B00B - R0018 - Movement (29.59 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
8357/B00B/R0008/Ceiling Structures/Linings/S1 **No Asbestos Detected**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Multi Purpose Facilities - 1992 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00C - R0001 - Cleaning Supplies Store (7.59 m2)**

No Asbestos

**B00C - R0002 - Music Store (7.59 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0003 - Movement (13.4 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8357/B00C/R0027/Ceiling Structures/Linings/S11

**Chrysotile (white asbestos)**

**B00C - R0004 - Staff - Toilet (2.35 m2)**

No Asbestos

**B00C - R0005 - Cleaning Store - Distributed (2.35 m2)**

No Asbestos

**B00C - R0006 - General Storeroom (4.79 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8357/B00C/R0027/Ceiling Structures/Linings/S11

**Chrysotile (white asbestos)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	-----	------------	--------------------	---------	--------------------

8357/B00C/R0006/Floor Coverings Res/Textile/S12

**Chrysotile (white asbestos)**

**B00C - R0007 - General Storeroom (12.38 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8357/B00C/R0027/Ceiling Structures/Linings/S11

**Chrysotile (white asbestos)**

**B00C - R0008 - Student Canteen (40.45 m2)**

Wall Linings Internal	Flat AC Sheeting					
-----------------------	------------------	--	--	--	--	--

8357/B00C/R0008/Wall Linings Internal/S13

**No Asbestos Detected**

**B00C - R0009 - Cleaning Store - Distributed (11.61 m2)**

No Asbestos

**B00C - R0010 - Distribution Board Cupboard (0.58 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0011 - Toilets-Boys (17.08 m2)**

Ceiling Structures/Linings	Vermiculite					
----------------------------	-------------	--	--	--	--	--

8357/B00C/R0011/Ceiling Structures/Linings/S14

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00C - R0012 - Shower/Change (41.01 m2)**

Ceiling Structures/Linings	Vermiculite					
----------------------------	-------------	--	--	--	--	--

8357/B00C/R0011/Ceiling Structures/Linings/S14

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00C - R0013 - Movement (25.21 m2)**

Ceiling Structures/Linings	Vermiculite					
----------------------------	-------------	--	--	--	--	--

8357/B00C/R0011/Ceiling Structures/Linings/S14

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00C - R0014 - Staff Study (10.36 m2)**

Ceiling Structures/Linings	Vermiculite					
----------------------------	-------------	--	--	--	--	--

8357/B00C/R0011/Ceiling Structures/Linings/S14

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0015 - General Assistants (10.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00C/R0011/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0016 - Stage (112.99 m2)</b>						
No Asbestos						
<b>B00C - R0017 - Staff Study (10.39 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00C/R0006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8357/B00C/R0011/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0018 - General Storeroom (10.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00C/R0018/Ceiling Structures/Linings/S24					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8357/B00C/R0018/Floor Coverings Res/Textile/S26					Chrysotile (white asbestos)
<b>B00C - R0019 - Movement (24.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00C/R0011/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0020 - Shower/Change (41.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00C/R0011/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0021 - Toilets-Girls (17.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00C/R0011/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0022 - Sport Equipment Store (13.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00C/R0027/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
<b>B00C - R0023 - Sport Equipment Store (44.91 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00C/R0027/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
<b>B00C - R0024 - Sport Equipment Store (48.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00C/R0027/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
<b>B00C - R0025 - Movement (123.99 m2)</b>						
No Asbestos						
<b>B00C - R0026 - Multi-Purpose Space (443.08 m2)</b>						
No Asbestos						
<b>B00C - R0027 - Movement (128.33 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	129m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00C/R0027/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					
	8357/B00E/R0013/In-fill-panel/S7					No Asbestos Detected
<b>B00C - R0028 - Movement (176.31 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	177m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00C/R0027/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00D - General Learning/Technological & Applied Studies - 1973 - Brick/Block (Brick/Block)

#### Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

#### Interior

##### B00D - R0001 - Resource/Project Store (12.09 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0002 - Art Learning Space (69.52 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0003 - Toilets-Boys (22.98 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0004 - Toilets-Girls (33.57 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0005 - Darkroom Space (10.32 m2)

No Asbestos

##### B00D - R0007 - Resource/Project Store (14.09 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0008 - General Storeroom (8.19 m2)

No Asbestos

##### B00D - R0009 - Cleaning Store - Distributed (8.19 m2)

No Asbestos

##### B00D - R0010 - Materials Technology L.S. (83.01 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0011 - Resource/Project Store (21.48 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0012 - Resource/Project Store (12.16 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0015 - Materials Technology L.S. (82.91 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0016 - Resource/Project Store (15.3 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

##### B00D - R0017 - Resources Store (11.01 m2)

Ceiling Structures/Linings	Vermiculite 8357/B00D/R0021/Ceiling Structures/Linings/S15	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0021/Ceiling Structures/Linings/S15				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0018 - Kiln Space (17.59 m2)</b>						
No Asbestos						
<b>B00D - R0019 - General Storeroom (8.1 m2)</b>						
No Asbestos						
<b>B00D - R0020 - Distribution Board Cupboard (0.57 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00D - R0021 - Movement (149.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0021/Ceiling Structures/Linings/S15				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0022 - Darkroom Space (31.43 m2)</b>						
No Asbestos						
<b>B00D - R0023 - Movement (2.95 m2)</b>						
No Asbestos						
<b>B00D - R0024 - Stairs (0.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0021/Ceiling Structures/Linings/S15				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0025 - Stairs (0.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0021/Ceiling Structures/Linings/S15				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0026 - Materials Store (38.76 m2)</b>						
No Asbestos						
<b>B00D - R0027 - Plant (4.96 m2)</b>						
No Asbestos						
<b>B00D - R0028 - Store (21.5 m2)</b>						
No Asbestos						
<b>B00D - R0029 - Welding Area (4.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0037/Ceiling Structures/Linings/S25				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0030 - Welding Area (5.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0037/Ceiling Structures/Linings/S25				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0031 - Welding Area (3.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0037/Ceiling Structures/Linings/S25				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0032 - General Learning Space (13.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0037/Ceiling Structures/Linings/S25				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0033 - Welding Area (3.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8357/B00D/R0037/Ceiling Structures/Linings/S25				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0034 - Welding Area (2.97 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0037/Ceiling Structures/Linings/S25					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0035 - General Learning Space (56.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0037/Ceiling Structures/Linings/S25					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0037 - Movement (14.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0037/Ceiling Structures/Linings/S25					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0038 - Lift (2.24 m2)</b>						
No Asbestos						
<b>B00D - R1001 - Laboratory L.S. (90.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1002 - Preparation (32.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1003 - General Storeroom (1.11 m2)</b>						
No Asbestos						
<b>B00D - R1004 - Growing/Breeding (16.61 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1006 - Distribution Board Cupboard (0.52 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00D - R1007 - Cleaning Store - Distributed (1.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1008 - Staff - Toilet (3.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1009 - Staff - Toilet (3.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1011 - Apparatus Store (28.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1012 - General Storeroom (6.31 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00D/R1029/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)
<b>B00D - R1013 - Duplicating Workroom (13.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1014 - Staff Study (31.35 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R1017 - Laundry (16.81 m2)</b>						
No Asbestos						
<b>B00D - R1018 - Resources Store (9.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1019 - Materials Store (6.52 m2)</b>						
No Asbestos						
<b>B00D - R1020 - Pantry (16.77 m2)</b>						
No Asbestos						
<b>B00D - R1021 - Food Technology L.S. (67.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1022 - Shower/Change (6.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1023 - Computer Store (6.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1024 - Computer Learning Space (56.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1025 - Movement (106.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1026 - Stairs (8.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0021/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1027 - Stairs (8.95 m2)</b>						
No Asbestos						
<b>B00D - R1028 - Kitchen - Type 1 (100.28 m2)</b>						
No Asbestos						
<b>B00D - R1029 - Movement (17.65 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00D/R1029/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)
<b>B00D - R1030 - Movement (13.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8357/B00D/R0037/Ceiling Structures/Linings/S25					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1031 - Computer Store (6.8 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00D/R1029/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/Science Learning - 1971 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
8357/B00E/Ceiling Void/S18					<b>Chrysotile (white asbestos)</b>	

**Interior****B00E - R0001 - Laboratory L.S. (91.6 m2)**

No Asbestos

**B00E - R0002 - Computer Learning Space (58.53 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8357/B00E/R0013/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00E - R0003 - Laboratory L.S. (91.7 m2)**

No Asbestos

**B00E - R0004 - Chemical Store (23.56 m2)**

No Asbestos

**B00E - R0005 - Preparation (43.65 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8357/B00E/R0013/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Floor Coverings Res/Textile	Vinyl Tiles	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	

**B00E - R0006 - Distribution Board Cupboard (0.67 m2)**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	

**B00E - R0007 - Cleaning Store - Distributed (0.66 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	

**B00E - R0008 - Staff Study (7.01 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8357/B00E/R0013/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Floor Coverings Res/Textile	Vinyl Tiles	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	

**B00E - R0011 - Movement (153.39 m2)**

No Asbestos

**B00E - R0012 - Cleaning Store - Distributed (4.68 m2)**

No Asbestos

**B00E - R0014 - Stairs (4.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R1017/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	

**B00E - R0015 - Movement (48.98 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8357/B00D/R0037/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00E - R0016 - Lift (2.24 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R0017 - Toilets-Disabled (9.94 m2)</b>						
No Asbestos						
<b>B00E - R1001 - Movement (6.33 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R1017/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00E - R1002 - Seminar (52.99 m2)</b>						
No Asbestos						
<b>B00E - R1003 - General Storeroom (5.94 m2)</b>						
No Asbestos						
<b>B00E - R1004 - Librarian (8.24 m2)</b>						
No Asbestos						
<b>B00E - R1005 - General Storeroom (11.27 m2)</b>						
No Asbestos						
<b>B00E - R1007 - Toilets-Boys (3.06 m2)</b>						
No Asbestos						
<b>B00E - R1008 - Cleaning Store - Distributed (2.62 m2)</b>						
No Asbestos						
<b>B00E - R1009 - Distribution Board Cupboard (0.73 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00E - R1010 - Toilets-Girls (3.06 m2)</b>						
No Asbestos						
<b>B00E - R1011 - Audio Visual Workroom (12.96 m2)</b>						
No Asbestos						
<b>B00E - R1012 - Audio Visual Workroom (12.96 m2)</b>						
No Asbestos						
<b>B00E - R1013 - Workroom (12.88 m2)</b>						
No Asbestos						
<b>B00E - R1014 - Workroom (12.88 m2)</b>						
No Asbestos						
<b>B00E - R1015 - Main Area (160.4 m2)</b>						
No Asbestos						
<b>B00E - R1016 - Entry (29.01 m2)</b>						
No Asbestos						
<b>B00E - R1018 - Stairs (7.92 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R1017/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00E - R1019 - Movement (74.31 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8357/B00E/R1019/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Agricultural Science - 1973 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00F/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>

**Interior****B00F - R0001 - General Storeroom (13.21 m2)**

Wall Linings Internal	Flat AC Sheeting	18m2	North, South, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00F/R0002/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Machine Storage (31.32 m2)**

Wall Linings Internal	Flat AC Sheeting	24m2	North, South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00F/R0002/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>

**B00F - R0003 - Garden Store Room (6.79 m2)**

Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00F/R0003/Wall Linings Internal/S22					<b>Chrysotile (white asbestos)</b>

**B00F - R0004 - General Storeroom (20.51 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00F/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>

**B00F - R0005 - Covered Area (34.63 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8357/B00F/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 2004 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00G - R0001 - General Assistants (54.45 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Agricultural Science - 2004 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00H - R0001 - Machine Storage (72.18 m2)**

No Asbestos

**B00H - R0002 - Class Tools Storage (7.3 m2)**

No Asbestos

**B00H - R0003 - Movement (13.18 m2)**

No Asbestos

**B00H - R0004 - Covered Area (19.3 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Railway Carriage - 2004 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00I - R0001 - Railway Carriage (54.7 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Other - 2008 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - Agriculture Covered Area (57.33 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D10115 - Learning Unit - Standard/Withdrawal : Placement Date - 19/06/2001**

### Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D10684 - Learning Unit - Standard/Withdrawal : Placement Date - 9/01/2001**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D10889 - Learning Unit - Standard/Withdrawal : Placement Date - 14/05/2003**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D11302 - Learning Unit - Standard/Withdrawal : Placement Date - 8/10/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 601 - D12296 - Learning Unit - Standard/Withdrawal : Placement Date - 15/01/2010</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 520 - D13349 - Staff Study : Placement Date - 25/10/1996</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
<b>Interior</b>						
<b>R1 - Staff Room</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>OS 601 - D13878 - Learning Unit - Standard/Withdrawal : Placement Date - 11/02/1998</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D13918 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D13921 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D15282 - Learning Unit - Standard/Withdrawal : Placement Date - 22/01/2014</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017