


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bankstown Senior College (8381)  
**Region :** South Western Sydney  
**State Electorate :** Bankstown  
**Local Government Area :** Bankstown

**Initial Survey :** Noel Arnold & Associates : 22 - Apr - 2008  
**Reviewed By :** Greencap-NAA : 13 - Aug - 2014

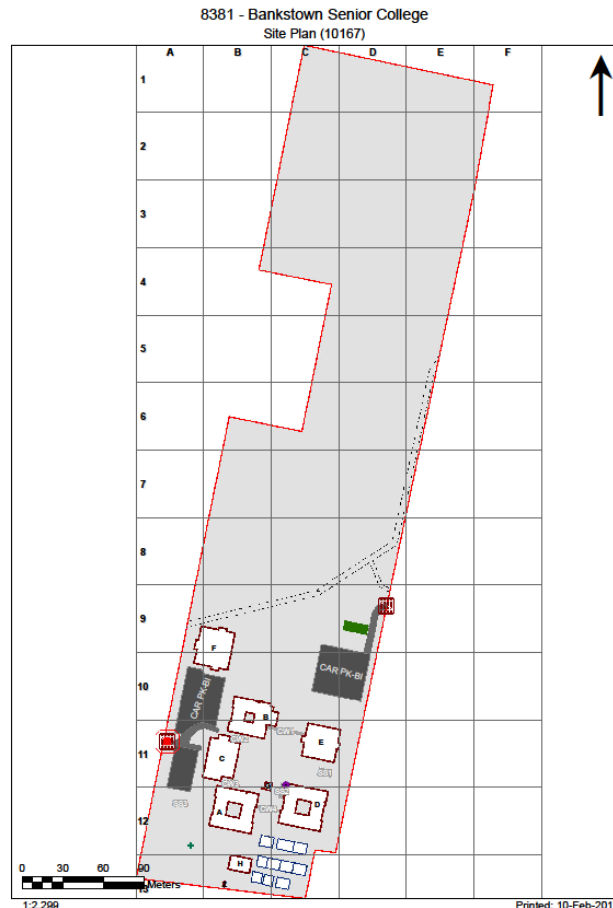

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1966 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00A - R0001 - General Learning Space (59.64 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected

**B00A - R0002 - Staff - Toilet (2.99 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8381/B00A/R0002/Partition Walls (Cubicles)/S8	3m2	North, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>

**B00A - R0003 - Cleaning Store - Distributed (0.2 m2)**

No Asbestos

**B00A - R0004 - Distribution Board Cupboard (0.67 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0006 - Principal Office (22.74 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00A - R0007 - General Storeroom (3.1 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00A/R0031/Floor Coverings Res/Textile/S13	3.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

**B00A - R0008 - Staff - Toilet (2.92 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00A - R0014 - Staff - Toilet (3.81 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00A - R0015 - Staff - Toilet (3.79 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00A - R0019 - Distribution Board Cupboard (0.91 m2)**

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00A - R0020 - Cleaning Store - Distributed (2.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00A - R0021 - General Learning Space (54.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R0022 - Computer Learning Space (53.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00A - R0023 - General Storeroom (6.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive under lenolium	6.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00A/R0031/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
<b>B00A - R0024 - General Storeroom (6.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles					
	8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R0025 - Office/Store (24.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00A - R0027 - General Storeroom (19.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive under lenolium	19.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00A/R0031/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
<b>B00A - R0028 - Deputy Principal Office (19.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00A - R0031 - Plant (2.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive under lenolium	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00A/R0031/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infill panel - Higher	Flat AC Sheeting 8381/B00C/R1027/Wall Linings Internal/S7					No Asbestos Detected
<b>B00A - R0032 - Public Reception (57.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0033 - Toilets-Disabled (5.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0035 - Interview/Meeting (8.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0036 - Interview/Meeting (8.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0037 - Toilets-Unisex (2.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0038 - First Aid (16.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0039 - Interview/Office - Type 1 (16.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0040 - Staff - Toilet (2.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0041 - External Movement (181.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8381/B00C/R1027/Wall Linings Internal/S7					No Asbestos Detected
Door lining	Flat AC Sheeting 8381/B00C/R1027/Wall Linings Internal/S7					No Asbestos Detected
<b>B00A - R0042 - External Stairs (2.57 m2)</b>						
No Asbestos						
<b>B00A - R0043 - External Stairs (2.62 m2)</b>						
No Asbestos						
<b>B00A - R0044 - External Movement (35.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8381/B00C/R1027/Wall Linings Internal/S7					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Door lining	Flat AC Sheeting 8381/B00C/R1027/Wall Linings Internal/S7					No Asbestos Detected
<b>B00A - R0045 - External Movement (1.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0046 - Administration - Clerical (48.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0047 - Seminar - Type 2 (24.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0048 - Tea Room (5.76 m2)</b>						
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00A/R0031/Floor Coverings Res/Textile/S13	5.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
<b>B00A - R0049 - Pupil Entry (12.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0050 - Movement (16.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1001 - Staff - Toilet (3.12 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 8381/B00A/R0002/Partition Walls (Cubicles)/S8	3m2	North, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R1002 - Cleaning Store - Distributed (0.21 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8381/B00D/R1016/Ceiling Structures/Linings/S10	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R1003 - Distribution Board Cupboard (0.62 m2)</b>						
No Asbestos				Note: No inspection of live electrical installation.		
<b>B00A - R1004 - General Learning Space (53.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R1005 - General Storeroom (4.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1006 - General Storeroom (5.39 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1007 - General Learning Space (59.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R1013 - General Learning Space (53.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R1014 - Distribution Board Cupboard (0.87 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	AC Fragments/Debris 8381/B00D/R1016/Ceiling Structures/Linings/S10	0.2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
<b>B00A - R1015 - Cleaning Store - Distributed (3.05 m2)</b>						
No Asbestos						
<b>B00A - R1020 - General Learning Space (59.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1021 - External Movement (126.55 m2)</b>						
No Asbestos						
<b>B00A - R1022 - Staff Study (80.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1023 - Staff Study (98.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1024 - Staff Study (12.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1026 - Computer Learning Space (53.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1027 - External Movement (24.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1028 - External Stairs (4.76 m2)</b>						
No Asbestos						
<b>B00A - R1029 - External Stairs (4.84 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1030 - Commonroom (75.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00A - R1031 - Tea Room (10.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Adhesive under lenolium	10.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00A/R0031/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
<b>B00A - R1032 - External Movement (0.82 m2)</b>						
No Asbestos						
<b>B00A - R1033 - External Movement (1.46 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Technological & Applied Studies/Music/Art - 1966 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00B - R0005 - General Storeroom (11.58 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00B - R0006 - Plant (4.21 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00B - R0011 - General Storeroom (9.09 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
-----------------------------	--	------	------------	--------------------	---------	--

**B00B - R0014 - Distribution Board Cupboard (0.71 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0015 - Cleaning Store - Distributed (0.22 m2)**

No Asbestos

**B00B - R0016 - Staff - Toilet (2.94 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

Partition Walls (Cubicles)	Compressed AC Sheet 8381/B00A/R0002/Partition Walls (Cubicles)/S8	2m2	North, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
----------------------------	--	-----	-----------------------	--------------------	---------	---

**B00B - R0017 - External Movement (108.89 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00B - R0019 - Apparatus Store (13.58 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
-----------------------------	--	------	------------	--------------------	---------	--

**B00B - R0021 - Wood Technology L.S. (97.5 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00B - R0022 - Laboratory L.S. (100.22 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0023 - Laboratory L.S. (86.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Workbench	Compressed AC Sheet 8381/B00D/R0008/Workbench/S11	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00B - R0025 - Preparation - Science (28.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00B - R0026 - External Movement (1.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0030 - External Stairs (2.45 m2)</b>						
No Asbestos						
<b>B00B - R0031 - External Movement (0.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0032 - Workshop Area (124.85 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00B - R0033 - Store (4.62 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00B - R0034 - Project Store - Type 1 (13.29 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00B - R0035 - Materials Store (10.39 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00B - R0036 - Dust Extraction Space (6.48 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00B - R0037 - Outdoor Learning Area (68.17 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00B - R1004 - Computer Learning Space (93.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R1006 - Plant (1.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1007 - General Storeroom (1.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1012 - Music Learning Space (86.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1015 - Distribution Board Cupboard (0.87 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Ceiling Structures/Linings	Flat AC Sheeting 8381/B00B/R1015/Ceiling Structures/Linings/S12	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00B - R1016 - Laundry (2.94 m2)</b>						
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1017 - External Movement (87.33 m2)</b>						
No Asbestos						
<b>B00B - R1019 - Art Learning Space (28.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1020 - Computer Learning Space (26.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1021 - Music Learning Space (26.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive under carpet 8381/B00B/R0029/Floor Coverings Res/Textile/S14	26.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1022 - Music Store (26.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1023 - Music Learning Space (27.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1024 - Staff Study (67.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1025 - Metal Technology L.S. (66.56 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1026 - Chair Store (3.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1027 - Darkroom Space (1.48 m2)</b>						
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1028 - Dark Room (25.13 m2)</b>						
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1029 - Tea Room (1.94 m2)</b>						
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00B/R0029/Floor Coverings Res/Textile/S14	1.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1030 - System Administrators Office (29.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1031 - External Movement (0.37 m2)</b>						
No Asbestos						
<b>B00B - R1032 - External Stairs (4.7 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Technological & Applied Studies - 1966 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids Non Accessible Area  
- No access points

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00C - R0001 - Movement (20.78 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0011 - General Storeroom (2.96 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0012 - Staff - Toilet (2.87 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Wall Linings Internal Compressed AC Sheet 4m2 North, Middle portion Good Condition (1) Low (1) Low Priority (2-3)  
8381/B00C/R0012/Wall Linings Internal/S6 **Chrysotile (white asbestos)**

**B00C - R0013 - Pantry (6.3 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0015 - Movement (20.69 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0017 - Student Canteen (46.13 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0021 - Toilets-Disabled (5.03 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0022 - Cleaning Store - Distributed (4.57 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0023 - Distribution Board Cupboard (0.58 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0024 - Toilets-Boys (28.81 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R0025 - Toilets-Girls (29.09 m2)**

Ceiling Structures/Linings Vermiculite  
8381/B00C/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0026 - Food/Research Space (30.67 m2)</b>						
No Asbestos						
<b>B00C - R0027 - Food Technology L.S. (106.89 m2)</b>						
No Asbestos						
<b>B00C - R0028 - Pantry (13.44 m2)</b>						
No Asbestos						
<b>B00C - R0029 - Movement (32.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8381/B00C/R0032/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0030 - Student Canteen (159.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8381/B00C/R1027/Wall Linings Internal/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0031 - General Assistants (17.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8381/B00C/R0032/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0032 - External Movement (55.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8381/B00C/R0032/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0033 - Stairs (2.56 m2)</b>						
No Asbestos						
<b>B00C - R0034 - Stairs (2.54 m2)</b>						
No Asbestos						
<b>B00C - R0035 - Plant (2.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8381/B00C/R0032/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0036 - Machine Storage (17.89 m2)</b>						
No Asbestos						
<b>B00C - R1008 - Seminar/Study (62.5 m2)</b>						
No Asbestos						
<b>B00C - R1011 - Distribution Board Cupboard (0.59 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00C - R1012 - Tiered Learning Area (63.29 m2)</b>						
No Asbestos						
<b>B00C - R1013 - Control Room (4.66 m2)</b>						
No Asbestos						
<b>B00C - R1014 - Plant (8.15 m2)</b>						
No Asbestos						
<b>B00C - R1015 - General Storeroom (2.24 m2)</b>						
No Asbestos						
<b>B00C - R1016 - Toilets-Boys (25.6 m2)</b>						
No Asbestos						
<b>B00C - R1017 - Staff Shower (2.67 m2)</b>						
No Asbestos						
<b>B00C - R1018 - Staff - Toilet (2.75 m2)</b>						
No Asbestos						
<b>B00C - R1019 - Toilets-Girls (25.84 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00C - R1020 - Movement (86.74 m2)</b>						
No Asbestos						
<b>B00C - R1021 - Interview/Office - Type 1 (21.03 m2)</b>						
No Asbestos						
<b>B00C - R1022 - Plant (4.51 m2)</b>						
No Asbestos						
<b>B00C - R1023 - General Storeroom (4.45 m2)</b>						
No Asbestos						
<b>B00C - R1024 - Staff Study (13.44 m2)</b>						
No Asbestos						
<b>B00C - R1025 - Movement (8.27 m2)</b>						
No Asbestos						
<b>B00C - R1026 - Movement (8.28 m2)</b>						
No Asbestos						
<b>B00C - R1027 - External Movement (53.95 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	8381/B00C/R1027/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
<b>B00C - R1028 - Stairs (14.48 m2)</b>						
No Asbestos						
<b>B00C - R1029 - Stairs (13.85 m2)</b>						
No Asbestos						
<b>B00C - R1030 - Careers Advisers Office (20.17 m2)</b>						
No Asbestos						
<b>B00C - R1031 - Plant (2.61 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Science Learning - 1966 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids	Non Accessible Area - No access points					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00D - R0001 - General Storeroom (26.06 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00D - R0002 - General Storeroom (9.49 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00A/R0031/Floor Coverings Res/Textile/S13	9.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00D - R0003 - General Storeroom (9.33 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive under lenolium 8381/B00A/R0031/Floor Coverings Res/Textile/S13	9.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00D - R0004 - Cleaning Store - Distributed (2.96 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

**B00D - R0005 - Distribution Board Cupboard (0.84 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0006 - Computer Learning Space (51.99 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected

**B00D - R0010 - Chemical Store (9.02 m2)**

No Asbestos

**B00D - R0015 - Distribution Board Cupboard (0.59 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0016 - Cleaning Store - Distributed (0.19 m2)**

No Asbestos

**B00D - R0017 - Staff - Toilet (2.96 m2)**

Ceiling Structures/Linings	Vermiculite 8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8381/B00A/R0002/Partition Walls (Cubicles)/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R0018 - Art Learning Space (59.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive under lenolium	59.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8381/B00A/R0031/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R0020 - Art Learning Space (53.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive under lenolium	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8381/B00A/R0031/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R0021 - External Movement (159.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0023 - Apparatus Store (13.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0025 - Chemical Store (12.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0026 - Computer Store (12.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive under lenolium	12.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8381/B00A/R0031/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R0029 - Pottery Store (43.82 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0030 - Kiln Space (6.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Kiln	Encapsulated Insulation material within unit	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Encased in unit</b>						
<b>B00D - R0031 - External Movement (1.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8381/B00C/R0032/Ceiling Structures/Linings/S3				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0033 - Laboratory L.S. (100.43 m2)</b>						
No Asbestos						
<b>B00D - R0034 - Preparation - Science (29.02 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R0035 - Laboratory L.S. (85.66 m2)</b>						
No Asbestos						
<b>B00D - R0036 - Toilet - Lobby (2.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0037 - Toilets-Girls (19.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0038 - Toilet - Lobby (3.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0039 - Toilets-Boys (22.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00A/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R0040 - External Stairs (2.4 m2)</b>						
No Asbestos						
<b>B00D - R0041 - External Stairs (2.4 m2)</b>						
No Asbestos						
<b>B00D - R1001 - General Learning Space (53.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00D - R1003 - General Storeroom (11.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1004 - Cleaning Store - Distributed (2.96 m2)</b>						
No Asbestos						
<b>B00D - R1005 - Distribution Board Cupboard (0.84 m2)</b>						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8381/B00D/R1016/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R1006 - General Learning Space (54.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1007 - General Storeroom (21.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles					
	8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00D - R1008 - General Learning Space (59.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1009 - General Learning Space (52.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1010 - General Learning Space (53.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1011 - General Learning Space (59.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1014 - General Learning Space (54.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1015 - Distribution Board Cupboard (0.58 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	0.58m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8381/B00D/R1016/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Note: No inspection of live electrical installation.						
<b>B00D - R1016 - Cleaning Store - Distributed (0.25 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00D/R1016/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R1017 - Staff - Toilet (2.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	North, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8381/B00A/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R1018 - General Learning Space (59.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1019 - General Storeroom (13.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8381/B00A/R0024/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00D - R1020 - Art Learning Space (52.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8381/B00C/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive under lenolium	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8381/B00A/R0031/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1021 - General Storeroom (12.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8381/B00C/R0032/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8381/B00A/R0024/Floor Coverings Res/Textile/S9						
<b>B00D - R1023 - External Movement (24.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8381/B00C/R0032/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00D - R1024 - External Movement (120.24 m2)</b>						
No Asbestos						
<b>B00D - R1025 - General Storeroom (16.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8381/B00C/R0032/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00D - R1026 - Tea Room (4.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8381/B00C/R0032/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Adhesive under lenolium	4.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8381/B00A/R0031/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1027 - External Movement (1.85 m2)</b>						
No Asbestos						
<b>B00D - R1028 - External Stairs (4.73 m2)</b>						
No Asbestos						
<b>B00D - R1029 - External Stairs (4.56 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00E - Library - 1994 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00E - R0003 - Study Space (14.76 m2)**

No Asbestos

**B00E - R0004 - Study Space (14.5 m2)**

No Asbestos

**B00E - R0005 - Study Space (14.65 m2)**

No Asbestos

**B00E - R0006 - Seminar (29.84 m2)**

No Asbestos

**B00E - R0007 - Study Space (14.64 m2)**

No Asbestos

**B00E - R0008 - Entry (19 m2)**

No Asbestos

**B00E - R0009 - Toilets-Unisex (4.04 m2)**

No Asbestos

**B00E - R0010 - Toilets-Unisex (3.81 m2)**

No Asbestos

**B00E - R0011 - Cleaning Store - Distributed (3.86 m2)**

No Asbestos

**B00E - R0012 - Audio Visual Workroom (26.71 m2)**

No Asbestos

**B00E - R0013 - Distribution Board Cupboard (1.03 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0015 - Librarian (16.77 m2)**

No Asbestos

**B00E - R0016 - Study Space (18.22 m2)**

No Asbestos

**B00E - R0017 - Main Area (290 m2)**

No Asbestos

**B00E - R0018 - External Movement (11.89 m2)**

No Asbestos

**B00E - R0019 - External Movement (13.3 m2)**

No Asbestos

**B00E - R0020 - Computer Learning Space (44.81 m2)**

No Asbestos

**B00E - R0021 - Plant (0.81 m2)**

No Asbestos

**B00E - R0022 - Library Administration (29.71 m2)**

No Asbestos

**B00E - R0023 - Tea Room (4 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Multi Purpose Facilities - 1992 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 8381/B00F/In-fill-panel/S2					<b>No Asbestos Detected</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00F - R0001 - Sport Equipment Store (29.45 m2)**

Non Accessible

**B00F - R0003 - Stage (85.22 m2)**

No Asbestos

**B00F - R0005 - Distribution Board Cupboard (0.53 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0007 - Movement (8.62 m2)**

No Asbestos

**B00F - R0008 - Staff Kitchen (11.48 m2)**

No Asbestos

**B00F - R0010 - Multi-Purpose Space (439.7 m2)**

No Asbestos

**B00F - R0011 - External Movement (10.64 m2)**

No Asbestos

**B00F - R0012 - External Movement (11.88 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8381/B00F/R0013/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00F - R0013 - External Movement (13.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8381/B00F/R0013/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00F - R0014 - Stairs (2.34 m2)**

No Asbestos

**B00F - R0015 - Toilet - Lobby (2.98 m2)**

No Asbestos

**B00F - R0016 - Toilets-Boys (17.97 m2)**

No Asbestos

**B00F - R0017 - General Storeroom (1.82 m2)**

No Asbestos

**B00F - R0018 - Sport Equipment Store (7.92 m2)**

No Asbestos

**B00F - R0019 - Plant (0.57 m2)**

No Asbestos

**B00F - R0020 - Stairs (2.34 m2)**

No Asbestos

**B00F - R0021 - Toilet - Lobby (2.97 m2)**

No Asbestos

**B00F - R0022 - Toilets-Girls (19.27 m2)**

No Asbestos

**B00F - R0023 - Stairs (1.96 m2)**

No Asbestos

**B00F - R0024 - Stairs (1.91 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00F - R0025 - Movement (17.46 m2)**

No Asbestos

**B00F - R1001 - Change (44.91 m2)**

No Asbestos

**B00F - R1002 - Control Room (5.9 m2)**

No Asbestos

**B00F - R1003 - Movement (2.23 m2)**

No Asbestos

**B00F - R1004 - Movement (2.21 m2)**

No Asbestos

**B00F - R1005 - Cleaning Store - Distributed (5.93 m2)**

No Asbestos

**B00F - R1006 - Change (45.93 m2)**

No Asbestos

**B00F - R1007 - Stairs (2.68 m2)**

No Asbestos

**B00F - R1008 - Stairs (2.74 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Main Switchroom (5.35 m2)**

No Asbestos

**B00G - R0002 - Cleaning Supplies Store (8.77 m2)**

No Asbestos

**B00G - R0003 - External Movement (9.22 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Library - 2011 - Fibre Cement Clad (Fibre Cement Clad)****Exterior**

Ceiling Voids - Flat Roof    No Asbestos Found

Underfloor Voids            No Asbestos Found

**Interior****B00H - R0001 - Main Area (91.95 m2)**

No Asbestos

**B00H - R0002 - Secure Storeroom (9.87 m2)**

No Asbestos

**B00H - R0003 - Communication Space (8.41 m2)**

No Asbestos

**B00H - R0004 - Interview/Office - Type 1 (20.53 m2)**

No Asbestos

**B00H - R0005 - External Movement (31.75 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Z - Building Services - 1990 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00Z - R0001 - Plant (1.74 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - Covered Walkway between A and C**

**Exterior**

No Asbestos

**Interior**

**Build+1 - Room+1 - Room 1**

Ceiling Structures/Linings Vermiculite  
 8381/B00C/R0032/Ceiling Structures/Linings/S3

**Limited Samples Taken**

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 520 - D11524 - Staff Study : Placement Date - 30/06/1995**

### Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

### Interior

#### R1 - Staff Room

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**OS 601 - D11527 - Learning Unit - Standard/Withdrawal : Placement Date - 26/09/1996**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D11548 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D11549 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D11685 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 600 - D11689 - Learning Unit - Small : Placement Date - 25/02/1999</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>OS 601 - D11782 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 600 - D14740 - Learning Unit - Small : Placement Date - 9/01/1997</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>NS 111 - D15278 - Learning Unit - Double Secondary/Secure : Placement Date - 3/02/2017</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Entry</b>						
No Asbestos Found.						
<b>R4 - Secure Storeroom</b>						
No Asbestos Found.						
<b>R5 - Secure Storeroom</b>						
No Asbestos Found.						
<b>R6 - Entry</b>						
No Asbestos Found.						
<b>OS 751 - D15888 - Learning Unit - ESL : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Es1</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>R2 - Es1</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>OS 831 - D15980 - Girls Shower/Change/Toilet : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				14.4 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Change Room</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R2 - Staff Room</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				11 m2
<b>R3 - Toilets-Girls</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
<b>R4 - Hot water unit</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
<b>R5 - Area in front of staff room</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017