


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Barrenjoey High School (8454)
Region : Northern Sydney
State Electorate : Pittwater
Local Government Area : Pittwater

Initial Survey : Noel Arnold & Associates : 14 - Jan - 2010
Reviewed By : AECOM : 20 - Oct - 2014

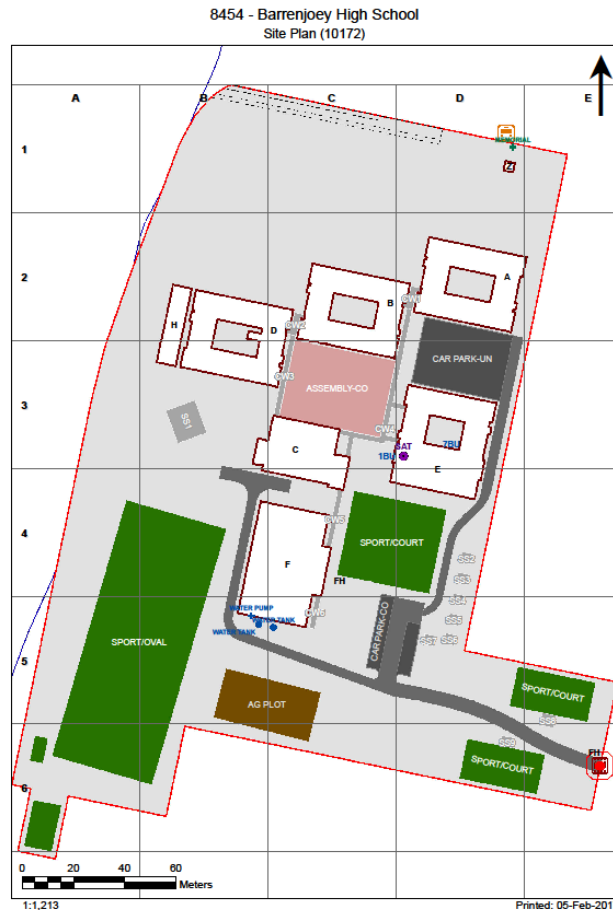

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning/Staff Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.					
Ceiling Voids	No Asbestos Found					

Interior**B00A - R0001 - Administration - Clerical (25.03 m2)**

Ceiling Structures/Linings	Vermiculite	8454/B00A/R0031/Ceiling Structures/Linings/S1				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0003 - General Storeroom (3.57 m2)

No Asbestos

B00A - R0004 - General Storeroom (1.13 m2)

Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4				Chrysotile (white asbestos)		

B00A - R0005 - Staff - Toilet (2.79 m2)

No Asbestos

B00A - R0006 - Laboratory L.S. (85.83 m2)

Ceiling Structures/Linings	Vermiculite	8454/B00A/R0031/Ceiling Structures/Linings/S1				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00A - R0007 - Preparation - Science (28.84 m2)

Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

Ceiling Structures/Linings	Vermiculite	8454/B00A/R0031/Ceiling Structures/Linings/S1				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0008 - Resources Store (8.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

Ceiling Structures/Linings	Vermiculite	8454/B00A/R0031/Ceiling Structures/Linings/S1				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0009 - Laboratory L.S. (93.52 m2)

Ceiling Structures/Linings	Vermiculite	8454/B00A/R0031/Ceiling Structures/Linings/S1				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00A - R0010 - Printing/Photocopying (26.02 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0011 - Toilets-Boys (26.3 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0012 - Resources Store (11.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0012/Floor Coverings Res/Textile/S3	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0013 - General Learning Space (52.63 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0014 - Cleaning Store - Distributed (3.55 m2)						
No Asbestos						
B00A - R0015 - General Storeroom (1.25 m2)						
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0016 - Cleaning Store - Distributed (2.77 m2)						
No Asbestos						
B00A - R0017 - General Learning Space (58.5 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0020 - Archive Store (12.57 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0021 - Administration - Clerical (24.48 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0022 - Principal Office (19.58 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0023 - Resources Store (2.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0024 - Staff - Toilet (2.86 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0025 - Staff - Toilet (4.2 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Staff - Toilet (4.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0028 - Uniform Shop (13.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0030 - General Storeroom (12.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0032 - External Stairs (2.2 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)
B00A - R0033 - External Stairs (2.27 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)
B00A - R0034 - Ancillary Staff (12.79 m2)						
Window Putty	Putty	2Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)
B00A - R0035 - Staff Kitchen (4.97 m2)						
No Asbestos						
B00A - R0036 - Movement (3.45 m2)						
No Asbestos						
B00A - R0037 - Public Reception (47.92 m2)						
Window Putty	Putty	3Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)
B00A - R0038 - Deputy Principal Office (17.95 m2)						
No Asbestos						
B00A - R0039 - Deputy Principal Office (20.41 m2)						
No Asbestos						
B00A - R0040 - Clinic (6.16 m2)						
No Asbestos						
B00A - R0041 - Cleaning Supplies Store (9.09 m2)						
No Asbestos						
B00A - R0042 - Administration - Clerical (14.5 m2)						
Window Putty	Putty	3Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
	8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)
B00A - R0043 - Interview/Meeting (24.27 m2)						
No Asbestos						
B00A - R0044 - Handwashing Facilities (0.19 m2)						
No Asbestos						
B00A - R0045 - External Movement (175.58 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1001 - Leading Teacher (12.92 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Electrical Hazard</i>						
B00A - R1004 - Distribution Board Cupboard (1.17 m2)					Note: No inspection of live electrical installation.	
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1005 - Staff - Toilet (2.79 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1007 - General Learning Space (52.7 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1008 - General Learning Space (52.63 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1009 - Toilets-Girls (26.92 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8454/B00A/R1009/Partition Walls (Cubicles)/S5	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1010 - Resources Store (5.61 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1011 - General Learning Space (52.63 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1012 - Resources Store (5.78 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1013 - Distribution Board Cupboard (1.25 m2)					Note: No inspection of live electrical installation.	
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1014 - Cleaning Store - Distributed (2.79 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1015 - Textiles Technology L.S. (71.83 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R1016 - Resources Store (2.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8454/B00A/R0031/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1017 - Change (6.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8454/B00A/R0031/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1018 - Computer Learning Space (66.21 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8454/B00A/R0031/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1019 - Resources Store (2.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8454/B00A/R0031/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1020 - General Learning Space (52.77 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8454/B00A/R0031/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R1022 - General Learning Space (58.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8454/B00A/R0031/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R1023 - External Movement (169.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8454/B00A/R1023/Ceiling Structures/Linings/S12					
B00A - R1024 - Resources Store (6.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1025 - Resources Store (6.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Window sealant	Mastic	1Unit	Window set	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)
B00A - R1026 - External Stairs (6.05 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8454/B00A/R1023/Ceiling Structures/Linings/S12					
B00A - R1027 - External Stairs (5.96 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Expansion gap sealant to lower walls	Mastic 8454/B00B/R1031/Expansion gap sealant to lower walls/S20	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 8454/B00A/R1023/Ceiling Structures/Linings/S12				No Asbestos Detected	
B00A - R1028 - Staff Study (34.06 m2)						
Window Putty	Putty 8454/B00A/R1025/Window sealant/S19	2Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R1029 - General Learning Space (23.9 m2)						
Window Putty	Putty 8454/B00A/R1025/Window sealant/S19	1Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R1030 - Commonroom (126.38 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8454/B00A/R0023/Floor Coverings Res/Textile/S2	125m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Window Putty	Putty 8454/B00A/R1025/Window sealant/S19	10Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R1031 - Staff Kitchen (11.35 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8454/B00A/R0023/Floor Coverings Res/Textile/S2	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R1032 - Handwashing Facilities (0.18 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & Applied Studies/Art/Music - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction Height Restriction						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
- No underfloor voids identified. Building constructed slab on ground.						

Interior**B00B - R0001 - Music Learning Space (51.75 m2)**

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0002 - Music Store (6.24 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0003 - Resources Store (6.02 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0004 - Music Store (3.43 m2)

No Asbestos

B00B - R0005 - Cleaning Store - Distributed (1.67 m2)

Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4					Chrysotile (white asbestos)	

B00B - R0006 - Staff - Toilet (2.72 m2)

No Asbestos

B00B - R0007 - Computer Learning Space (58.34 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	South facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R0008 - Metal Technology L.S. (92.89 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R0011 - Wood Technology L.S. (85.35 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R0012 - Class Tools Storage (5.53 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R0013 - Music Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0014 - Music Store (5.79 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R0015 - General Storeroom (6.31 m2)						
No Asbestos						
B00B - R0016 - General Storeroom (7.9 m2)						
No Asbestos						
B00B - R0017 - General Storeroom (1.18 m2)						
Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4					Chrysotile (white asbestos)	
B00B - R0018 - Laundry (2.79 m2)						
No Asbestos						
B00B - R0023 - Food Technology L.S. (66.26 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0026 - External Movement (173.06 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0028 - External Stairs (2.4 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)	
B00B - R0029 - Class Tools Storage (9.11 m2)						
No Asbestos						
B00B - R0030 - Welding Area (8.22 m2)						
Window sealant	Mastic	2Unit	Window sets (presumed below silicone in some areas)	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00B - R0031 - Wood Technology Bay (16.42 m2)						
Window sealant	Mastic	2Unit	Window sets (presumed below silicone in some areas)	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00B - R0032 - Dust Extraction Space (4.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8454/B00B/R0032/Floor Coverings Res/Textile/S22					No Asbestos Detected	
B00B - R0033 - External Stairs (2.56 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)	
B00B - R0034 - Preparation - Materials (25.98 m2)						
Window Putty	Putty	2Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
Window Putty	Putty	2Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00B - R0035 - Food Technology L.S. (66.7 m2)						
Window Putty	Putty	5Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
8454/B00B/R0032/Floor Coverings Res/Textile/S22					No Asbestos Detected	
B00B - R0036 - Class Tools Storage (9.27 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8454/B00B/R0032/Floor Coverings Res/Textile/S22					No Asbestos Detected	
Window Putty	Putty	1Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00B - R0037 - Practice/Seminar (43.34 m2)						
Window Putty	Putty	3Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00B - R0038 - Control Room (3.73 m2)						
No Asbestos						
B00B - R0039 - Staff Study (56.48 m2)						
Window Putty	Putty	4Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0040 - Tea Room (1.56 m2)						
No Asbestos						
B00B - R0041 - Handwashing Facilities (0.19 m2)						
No Asbestos						
B00B - R1003 - Distribution Board Cupboard (1.41 m2)						
Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4					Chrysotile (white asbestos)	
B00B - R1004 - Staff - Toilet (2.77 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - Wood Technology L.S. (79.42 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Electrical Hazard</i>						
B00B - R1008 - Wood Technology L.S. (85.02 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Electrical Hazard</i>						
B00B - R1011 - Resources Store (5.53 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1012 - Music Learning Space (52.56 m2)						
No Asbestos						
B00B - R1013 - Resources Store (5.78 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1014 - Distribution Board Cupboard (1.19 m2)						
Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4					Chrysotile (white asbestos)	
B00B - R1015 - Cleaning Store - Distributed (2.77 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1016 - Art Learning Space (71.69 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R1017 - Resources Store (6.19 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1019 - Resources Store (6.21 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1025 - External Movement (175.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8454/B00B/R1025/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R1026 - Dust Extraction Space (4.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1027 - Wood Technology Bay (46.58 m2)						
Remnant bituminous flooring adhesive	Bituminous adhesive 8454/B00B/R1027/Remnant bituminous flooring adhesive/S23	12m2	Floor	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Window sealant	Mastic 8454/B00A/R1025/Window sealant/S19	4Unit	Window sets	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1028 - Dust Extraction Space (4.61 m2)						
No Asbestos						
B00B - R1030 - External Stairs (6.02 m2)						
Expansion gap sealant to lower walls	Mastic 8454/B00B/R1031/Expansion gap sealant to lower walls/S20	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1031 - External Stairs (6.06 m2)						
Expansion gap sealant to lower walls	Mastic 8454/B00B/R1031/Expansion gap sealant to lower walls/S20	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1032 - Wood Technology L.S. (52.08 m2)						
Window Putty	Putty 8454/B00A/R1025/Window sealant/S19	4Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1033 - Staff Study (41.07 m2)						
Window Putty	Putty 8454/B00A/R1025/Window sealant/S19	3Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00B - R1034 - Resources Store (3.67 m2)						
No Asbestos						
B00B - R1035 - Resources Store (11.55 m2)						
No Asbestos						
B00B - R1036 - Visual Arts Workshop (52.49 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R1037 - Handwashing Facilities (0.19 m2)

No Asbestos

B00B - R1038 - Art Learning Space (79.5 m2)

Window Putty	Putty	6Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------	-------	-------	--------	--------------------	---------	--------------------

8454/B00A/R1025/Window sealant/S19	Chrysotile (white asbestos)
------------------------------------	------------------------------------

Floor Coverings Res/Textile	Vinyl Sheet					
-----------------------------	-------------	--	--	--	--	--

8454/B00B/R0032/Floor Coverings Res/Textile/S22	No Asbestos Detected
---	-----------------------------

B00B - R1039 - Art Learning Space (65.88 m2)

Window Putty	Putty	4Unit	Window	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------	-------	-------	--------	--------------------	---------	--------------------

8454/B00A/R1025/Window sealant/S19	Chrysotile (white asbestos)
------------------------------------	------------------------------------

Floor Coverings Res/Textile	Vinyl Sheet					
-----------------------------	-------------	--	--	--	--	--

8454/B00B/R0032/Floor Coverings Res/Textile/S22	No Asbestos Detected
---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Physical Education - 1969 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Ceiling Voids	Non Accessible Area - Ceiling void generally inaccessible due to fixed ceilings and absence of designated entry points.					
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.					

Interior

B00C - R0001 - Chair Store (14.18 m2)

No Asbestos

B00C - R0002 - Main Switchroom (11.57 m2)

No Asbestos

B00C - R0003 - Practice/Seminar (10.8 m2)

No Asbestos

B00C - R0004 - Movement (7.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8454/B00C/R0016/Ceiling Structures/Linings/S6			No Asbestos Detected	
----------------------------	------------------	---	--	--	-----------------------------	--

B00C - R0005 - Sport Equipment Store (13.24 m2)

No Asbestos

B00C - R0006 - General Storeroom (13.96 m2)

No Asbestos

B00C - R0007 - Distribution Board Cupboard (0.57 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0008 - Student Canteen (54.77 m2)

Floor Coverings Res/Textile	Vinyl Tiles	60m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R0009 - Pantry (2.45 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R0023/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R0011 - Fitness Laboratory (21.78 m2)

No Asbestos

B00C - R0012 - Movement (16.51 m2)

No Asbestos

B00C - R0013 - Multi-Purpose Space (313.88 m2)

No Asbestos

B00C - R0015 - Sport Equipment Store (6.12 m2)

No Asbestos

B00C - R0016 - Sport Equipment Store (14.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8454/B00C/R0016/Ceiling Structures/Linings/S6			No Asbestos Detected	
----------------------------	------------------	---	--	--	-----------------------------	--

B00C - R0018 - Sport Equipment Store (4.78 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00C - R0019 - Handwashing Facilities (1.32 m2)						
No Asbestos						
B00C - R0020 - Chair Store (14.12 m2)						
No Asbestos						
B00C - R0021 - General Storeroom (11.2 m2)						
No Asbestos						
B00C - R0022 - Movement (5.17 m2)						
No Asbestos						
B00C - R0023 - Movement (3.66 m2)						
No Asbestos						
B00C - R0024 - Stairs (4 m2)						
No Asbestos						
B00C - R0025 - Movement (6.72 m2)						
No Asbestos						
B00C - R0026 - Movement (3.44 m2)						
No Asbestos						
B00C - R0027 - Stairs (4.08 m2)						
No Asbestos						
B00C - R0028 - External Movement (51.03 m2)						
No Asbestos						
B00C - R0029 - External Movement (26.46 m2)						
No Asbestos						
B00C - R0030 - General Storeroom (1.75 m2)						
No Asbestos						
B00C - R0031 - Staff - Toilet (1.75 m2)						
No Asbestos						
B00C - R1001 - Sport Equipment Store (11.24 m2)						
No Asbestos						
B00C - R1002 - General Storeroom (6.46 m2)						
No Asbestos						
B00C - R1003 - Sport Equipment Store (1.03 m2)						
No Asbestos						
B00C - R1005 - Change (38.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
		8454/B00C/R0016/Ceiling Structures/Linings/S6				
B00C - R1006 - Movement (12.42 m2)						
No Asbestos						
B00C - R1007 - General Storeroom (11.2 m2)						
No Asbestos						
B00C - R1008 - General Storeroom (6.48 m2)						
No Asbestos						
B00C - R1009 - Sport Equipment Store (1.03 m2)						
No Asbestos						
B00C - R1011 - Change (33.6 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
		8454/B00A/R1009/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
		8454/B00C/R0016/Ceiling Structures/Linings/S6				

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1012 - Movement (12.5 m2)						
No Asbestos						
B00C - R1013 - Stairs (15.49 m2)						
No Asbestos						
B00C - R1014 - Stairs (15.4 m2)						
No Asbestos						
B00C - R1015 - Toilets-Boys (34.2 m2)						
Ceiling Structures/Linings	Compressed AC Sheet		8454/B00C/R0016/Ceiling Structures/Linings/S6			No Asbestos Detected
B00C - R1016 - Plant (4.22 m2)						
No Asbestos						
B00C - R1017 - Toilets-Girls (34 m2)						
Ceiling Structures/Linings	Compressed AC Sheet		8454/B00C/R0016/Ceiling Structures/Linings/S6			No Asbestos Detected
B00C - R1018 - Plant (4.24 m2)						
No Asbestos						
B00C - R1019 - Plant (4.32 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Science Learning/General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.					
Ceiling Voids	No Asbestos Found					

Interior**B00D - R0001 - General Learning Space (52.63 m2)**

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0002 - General Storeroom (7.47 m2)

No Asbestos

B00D - R0003 - Other-Vacant (0.97 m2)

Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4 Chrysotile (white asbestos)						

B00D - R0004 - Staff - Toilet (3.64 m2)

No Asbestos

B00D - R0005 - Laboratory L.S. (84.87 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0006 - Preparation - Science (29.26 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0007 - Resources Store (9.15 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0008 - Laboratory L.S. (92.69 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0009 - General Learning Space (58.12 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00D - R0010 - Staff Study (12.95 m2)

Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0011 - Resources Store (5.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0012/Floor Coverings Res/Textile/S3	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0012 - Computer Learning Space (52.34 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0013 - General Storeroom (0.96 m2)						
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0014 - Cleaning Supplies Store (13.7 m2)						
No Asbestos						
B00D - R0015 - Toilets-Boys (29.7 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8454/B00A/R1009/Partition Walls (Cubicles)/S5	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0016 - Apparatus Store (25.91 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0012/Floor Coverings Res/Textile/S3	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0019 - Leading Teacher (19.27 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0020 - Resources Store (5.93 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0021 - Laboratory L.S. (92.62 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0022 - Chemical Store (25.91 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0012/Floor Coverings Res/Textile/S3	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0023 - Toilets-Girls (28.22 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8454/B00A/R1009/Partition Walls (Cubicles)/S5	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0025 - External Movement (202.67 m2)						
Expansion gap sealant	Mastic 8454/B00D/R0025/Expansion gap sealant/S24					No Asbestos Detected
B00D - R0026 - Lift (2.24 m2)						
No Asbestos						
B00D - R0027 - External Stairs (2.82 m2)						
Expansion gap sealant to lower walls	Mastic 8454/B00B/R1031/Expansion gap sealant to lower walls/S20	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0028 - External Stairs (3.06 m2)						
Expansion gap sealant to lower walls	Mastic 8454/B00B/R1031/Expansion gap sealant to lower walls/S20	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0029 - Archive Store (5.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0012/Floor Coverings Res/Textile/S3	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0030 - Staff Study (33.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0012/Floor Coverings Res/Textile/S3	33m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Window sealant	Mastic 8454/B00A/R1025/Window sealant/S19	3Unit	Window sets	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0031 - Handwashing Facilities (0.41 m2)						
No Asbestos						
B00D - R0032 - Plant (0.59 m2)						
No Asbestos						
B00D - R1001 - General Storeroom (11.42 m2)						
No Asbestos						
B00D - R1002 - General Learning Space (52.63 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1003 - Distribution Board Cupboard (0.9 m2)						
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1004 - Staff - Toilet (3.59 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1005 - General Learning Space (57.96 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R1006 - Resources Store (12.39 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00D/R1006/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00D - R1007 - Staff Study (25.62 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1008 - Resources Store (12.47 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00D/R1006/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00D - R1009 - General Learning Space (51.98 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1010 - General Learning Space (51.39 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1011 - General Learning Space (57.6 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1012 - Movement (3.88 m2)						
No Asbestos						
B00D - R1013 - Office/Store (12.99 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R1014 - General Learning Space (52.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1015 - Resources Store (5.51 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1016 - Distribution Board Cupboard (0.68 m2)				Note: No inspection of live electrical installation.		
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1017 - Cleaning Store - Distributed (4.42 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1018 - General Learning Space (57.96 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R1019 - Staff Study (25.7 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R1020 - General Learning Space (52.05 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R1021 - General Learning Space (51.97 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1022 - Careers Advisers Office (25.05 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1023 - Movement (2.42 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00D/R1023/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00D - R1026 - Project Store - Type 1 (31.55 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1028 - Leading Teacher (19.12 m2)						
Flooring (below carpet)	Pink fibrous backing/flooring					
8454/B00D/R1028/Flooring (below carpet)/S25					No Asbestos Detected	
Window sealant	Mastic	2Unit	Window sets	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00D - R1029 - Staff Kitchen (4.21 m2)						
Flooring (below carpet)	Pink fibrous backing/flooring					
8454/B00D/R1028/Flooring (below carpet)/S25					No Asbestos Detected	
B00D - R1030 - External Movement (184.61 m2)						
Expansion gap sealant	Mastic					
8454/B00D/R0025/Expansion gap sealant/S24					No Asbestos Detected	
Wall lining	Flat AC Sheeting	18m2	Northern exterior wall of DR1001.	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Presumed asbestos as a precaution.						
Wall lining	Flat AC Sheeting	2m2	linfill panel around door to DR1012.	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Presumed asbestos as a precaution.						
B00D - R1031 - External Stairs (7.58 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)	
B00D - R1032 - External Stairs (7.63 m2)						
Expansion gap sealant to lower walls	Mastic	2m	Between pre-cast wall panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00B/R1031/Expansion gap sealant to lower walls/S20					Chrysotile (white asbestos)	
B00D - R1033 - Handwashing Facilities (0.59 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Library/General Learning/Science Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.					
Ceiling Voids	No Asbestos Found					

Interior

B00E - R0001 - Toilets-Unisex (10.75 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1009/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)		

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0002 - Cleaning Store - Distributed (2.41 m2)

No Asbestos

B00E - R0008 - Audio Visual Workroom (24.41 m2)

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0009 - Librarian (13.35 m2)

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0010 - Library Administration (59.84 m2)

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0011 - Resources Store (13.27 m2)

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00E/R0014/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		

B00E - R0012 - Toilets-Unisex (10.47 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1009/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)		

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0013 - Cleaning Store - Distributed (2.31 m2)

No Asbestos

B00E - R0014 - Resources Store (5.42 m2)

Ceiling Structures/Linings	Vermiculite		8454/B00A/R0031/Ceiling Structures/Linings/S1		Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00E/R0014/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00E - R0015 - General Learning Space (49.39 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0016 - General Learning Space (57.63 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0017 - Staff Study (25.41 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0018 - Staff Study (19.67 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0019 - Leading Teacher (12.66 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0021 - Performance Workspace (97.67 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0022 - External Movement (182.77 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8454/B00A/R0031/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00E - R0023 - Resources Store (12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00E/R0014/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00E - R0024 - Performance Store (13.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00E/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Window sealant	Mastic	2Unit	Window sets	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00E - R0025 - External Stairs (5 m2)						
Expansion gap material	Mastic	4m	Expansion gaps to walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00E/R1026/Expansion gap material/S21					Chrysotile (white asbestos)	
B00E - R0026 - External Stairs (5.07 m2)						
Expansion gap material	Grey hardened mastic	4m	Expansion gaps to walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00E/R1026/Expansion gap material/S21					Chrysotile (white asbestos)	
Brown fibrous mastic / dampcourse	Mastic					
8454/B00E/R0026/Brown fibrous mastic / dampcourse/S26					No Asbestos Detected	
B00E - R0027 - Handwashing Facilities (0.37 m2)						
No Asbestos						
B00E - R0028 - Handwashing Facilities (0.37 m2)						
No Asbestos						
B00E - R0029 - Computer Store (5.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00E/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00E - R0030 - System Administrators Office (12.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00E/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00E - R0031 - Main Area (271.18 m2)						
Window Putty	Putty	3Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00E - R0032 - General Learning Space (53.15 m2)						
Window Putty	Putty	2Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00E - R0033 - Computer Learning Space (61.99 m2)						
No Asbestos						
B00E - R0034 - Senior Study (49.62 m2)						
Window Putty	Putty	4Unit	Windows	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1025/Window sealant/S19					Chrysotile (white asbestos)	
B00E - R1001 - Staff - Toilet (2.77 m2)						
Ceiling Structures/Linings	Vermiculite					
8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00E - R1002 - Distribution Board Cupboard (0.57 m2)						
Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8454/B00A/R1004/Door Lining/S4					Chrysotile (white asbestos)	
B00E - R1003 - General Learning Space (50.9 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1004 - Resources Store (4.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1005 - General Storeroom (3.74 m2)						
No Asbestos						
B00E - R1006 - Leading Teacher (12.78 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1007 - General Learning Space (57.55 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1008 - General Learning Space (51.98 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1009 - General Learning Space (52.13 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1010 - Staff Study (25.66 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1011 - General Learning Space (57.56 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00E - R1012 - Staff - Toilet (2.72 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1013 - Handwashing Facilities (0.31 m2)						
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1014 - Distribution Board Cupboard (0.59 m2) Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting 8454/B00A/R1004/Door Lining/S4	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1015 - General Learning Space (51.05 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1016 - Resources Store (5.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1017 - Resources Store (4.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1018 - Resources Store (14.23 m2)						
Wall Linings Internal	Flat AC Sheeting 8454/B00E/R1018/Wall Linings Internal/S10	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1019 - Resources Store (31.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8454/B00A/R0023/Floor Coverings Res/Textile/S2	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1020 - Laboratory L.S. (91.46 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1021 - Preparation - Science (22.45 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1022 - Resources Store (2.54 m2)						
Ceiling Structures/Linings	Vermiculite 8454/B00A/R0031/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1023 - Resources Store (12.67 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8454/B00A/R0031/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1024 - Laboratory L.S. (84.01 m2)

Ceiling Structures/Linings Vermiculite
 8454/B00A/R0031/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1025 - External Movement (161.56 m2)

No Asbestos

B00E - R1026 - External Stairs (7.61 m2)

Expansion gap material	Mastic	4m	Expansion gaps to walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00E/R1026/Expansion gap material/S21					Chrysotile (white asbestos)	

B00E - R1027 - External Stairs (7.65 m2)

Expansion gap material	Mastic	4m	Expansion gaps to walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8454/B00E/R1026/Expansion gap material/S21					Chrysotile (white asbestos)	

B00E - R1028 - Handwashing Facilities (0.32 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities/Performance Learning - 1995 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - R0002 - Toilets-Girls (31.87 m2)**

No Asbestos

B00F - R0003 - Staff - Toilet (3.95 m2)

No Asbestos

B00F - R0004 - Plant (0.9 m2)

No Asbestos

B00F - R0005 - Movement (15.38 m2)

No Asbestos

B00F - R0006 - Toilets-Disabled (4.95 m2)

No Asbestos

B00F - R0007 - Distribution Board Cupboard (1.43 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0008 - General Storeroom (15.98 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00F - R0009 - Staff Kitchen (14.26 m2)**

No Asbestos

B00F - R0010 - Multi-Purpose Space (612.22 m2)

No Asbestos

B00F - R0011 - General Storeroom (14.41 m2)

No Asbestos

B00F - R0013 - Cleaning Store - Distributed (3.04 m2)

No Asbestos

B00F - R0014 - Toilets-Boys (31.8 m2)

No Asbestos

B00F - R0016 - External Movement (10.41 m2)

No Asbestos

B00F - R0019 - External Movement (85.35 m2)

No Asbestos

B00F - R0021 - Chair Store (57.25 m2)

No Asbestos

B00F - R0022 - External Movement (7.68 m2)

No Asbestos

B00F - R0023 - External Movement (7.66 m2)

No Asbestos

B00F - R0024 - External Movement (2.54 m2)

No Asbestos

B00F - R0025 - Performance Store (22.56 m2)

No Asbestos

B00F - R0026 - Sport Equipment Store (24.31 m2)

No Asbestos

B00F - R0027 - Art Entry/Display (101.63 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0028 - Performance Store (3.13 m2)						
No Asbestos						
B00F - R0029 - Stage (140.91 m2)						
No Asbestos						
B00F - R0030 - Plant (1.73 m2)						
No Asbestos						
B00F - R0031 - Plant (1.86 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Art/Building Services - 2010 - Steel (Steel)

Exterior

No Asbestos

Interior

B00H - R0001 - Art Learning Space (57.16 m2)

No Asbestos

B00H - R0002 - Kiln Space (1.68 m2)

No Asbestos

B00H - R0003 - Art Learning Space (58.79 m2)

No Asbestos

B00H - R0004 - General Assistants (58.33 m2)

No Asbestos

B00H - R0005 - External Movement (46.01 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 1990 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00Z - R0001 - Plant (5.95 m2)

No Asbestos

B00Z - R0002 - Plant (5.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8454_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017