


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Barham High School (8461)  
**Region :** Riverina  
**State Electorate :** Murray  
**Local Government Area :** Wakool

**Initial Survey :** Noel Arnold & Associates : 19 - Dec - 2007  
**Reviewed By :** Parsons Brinckerhoff : 15 - Feb - 2017

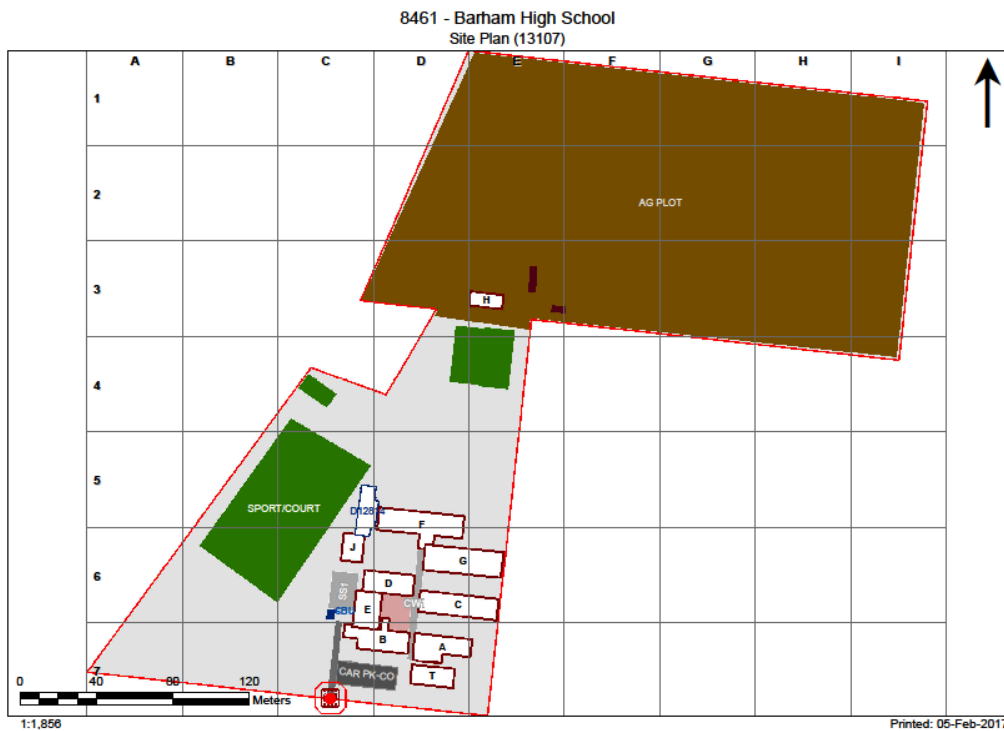

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1966 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8461/B00A/Eaves Linings/S18	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	AC Fragments/Debris 8461/B00A/Ceiling Voids/S16	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior****B00A - R0001 - Administration - Clerical (21.12 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Area inaccessible Requires some</b>
Floor Coverings Res/Textile	Vinyl Tiles 8461/B00A/R0001/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>

**B00A - R0002 - Seminar (20.38 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00A - R0003 - Commonroom (41.44 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Area inaccessible Requires some</b>

**B00A - R0004 - Staff - Toilet (5.67 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Area inaccessible Not sampled due to</b>

**B00A - R0005 - Cleaning Store - Distributed (2.6 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8461/B00A/R0014/Ceiling Structures/Linings/S7	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	---	-----	--------------	--------------------	---------	---

**B00A - R0006 - Staff - Toilet (5.58 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00A - R0007 - Principal Office (18.32 m2)**

No Asbestos

**B00A - R0008 - Staff - Toilet (5.44 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected
<b>B00A - R0009 - General Storeroom (0.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected
<b>B00A - R0010 - Staff Kitchen (2.33 m2)</b>						
No Asbestos						
<b>B00A - R0011 - Deputy Principal Office (19.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0012 - Main Switchroom (12.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard Not sampled due to</b>						
<b>B00A - R0013 - Public Entry (32.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					No Asbestos Detected
<b>B00A - R0014 - General Storeroom (7.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R0015 - Administration - Clerical (30.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0016 - Pupil Entry (3.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0017 - Movement (77.42 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	78m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Various - 1966 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8461/B00T/R0002/Repair panel to wall/S1					<b>No Asbestos Detected</b>
Wall Cladding	Flat AC Sheeting 8461/B00B/Wall Cladding/S10					<b>No Asbestos Detected</b>

**Interior****B00B - R0001 - Materials Technology L.S. (55.95 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8461/B00A/R0001/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Requires some dismantling of unit to</b>

**B00B - R0002 - Food/Research Space (9.63 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

**B00B - R0003 - Pantry (9.41 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

**B00B - R0004 - General Storeroom (6.88 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8461/B00A/R0001/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>

**B00B - R0005 - Food Technology L.S. (81.81 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Requires some dismantling of unit to</b>

**B00B - R0006 - Staff Study (13.95 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

**B00B - R0007 - Laundry (13.91 m2)**

Ceiling Structures/Linings	Vermiculite 8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

**B00B - R0008 - General Assistants (20.06 m2)**

No Asbestos

**B00B - R0009 - Sport Equipment Store (23.64 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00B - R0010 - Movement (60.94 m2)</b>						
No Asbestos						
<b>B00B - R0011 - General Storeroom (5.56 m2)</b>						
No Asbestos						
<b>B00B - R0012 - Stage (5.17 m2)</b>						
No Asbestos						
<b>B00B - R0013 - Stairs (6.75 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Movement (58.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R1002 - General Learning Space (55.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Requires some dismantling of unit to</i>						
<b>B00B - R1003 - General Learning Space (54.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Requires some dismantling of unit to</i>						
<b>B00B - R1004 - Staff Study (26.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Requires some dismantling of unit to</i>						
<b>B00B - R1005 - General Storeroom (13.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1006 - General Storeroom (13.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8461/B00A/R0001/Floor Coverings Res/Textile/S8					No Asbestos Detected
<b>B00B - R1007 - Seminar (28.09 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings

Vermiculite

8461/B00A/R0011/Ceiling Structures/Linings/S5

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00B - R1008 - Stairs (15.24 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Technological & Applied Studies - 1966 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00C/Eaves Linings/S19					<b>Chrysotile (white asbestos)</b>
Wall Cladding	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8461/B00B/Wall Cladding/S10					

**Interior****B00C - R0001 - Plant (3.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00C/R0001/Floor Coverings Res/Textile/S14					

**B00C - R0002 - Materials Store (18.04 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00C/R0001/Floor Coverings Res/Textile/S14					

**B00C - R0003 - Resource/Project Store (4.99 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00C/R0001/Floor Coverings Res/Textile/S14					

**B00C - R0004 - Materials Technology L.S. (82.07 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0005 - Welding Area (4.04 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0006 - Materials Store (8.46 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0007 - Staff Study (10.3 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0008 - Materials Technology L.S. (85.32 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0009 - Senior Seminar (26.53 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0010 - Computer Learning Space (56.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0011 - Movement (94.54 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	95m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00C/R0011/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00D - Pupil Facilities - 1966 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids	AC Fragments/Debris	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8461/B00D/Ceiling Voids/S17					<b>Chrysotile (white asbestos)</b>
<b>Interior</b>						
<b>B00D - R0001 - Shower/Change (44.97 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0002 - General Storeroom (9.78 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0003 - Toilets-Boys (26.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00D/R0008/Partition Walls (Cubicles)/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0004 - Staff Shower (7.3 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0005 - Cleaning Store - Distributed (3.05 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0006 - Staff Shower (7.22 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0007 - Toilets-Girls (26.53 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00D/R0008/Partition Walls (Cubicles)/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00D - R0008 - Shower/Change (44.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8461/B00D/R0008/Partition Walls (Cubicles)/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R0009 - Interview/Office - Type 1 (9.77 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8461/B00A/R0014/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00D - R0010 - Movement (58.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8461/B00A/R0014/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting					
8461/B00D/R0010/Wall Linings Internal/S11				<b>No Asbestos Detected</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1966 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00E/Eaves Linings/S21					<b>Chrysotile (white asbestos)</b>

**Interior****B00E - R0001 - Movement (51.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0002 - Multi-Purpose Space (90.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0003 - Movement (34.27 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8461/B00E/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0004 - Student Canteen (50.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0005 - Pantry (2.35 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0006 - Staff - Toilet (3.55 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00A/R0014/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Various - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**Interior**

**B00F - R0001 - Laboratory L.S. (108.15 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00F - R0002 - Movement (107.25 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00F - R0003 - General Storeroom (4.68 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00F - R0004 - General Learning Space (53.36 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Requires some dismantling of unit to</i>						

**B00F - R0005 - General Storeroom (6.08 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00F - R0006 - Cleaning Store - Distributed (6.07 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00F - R0007 - Staff Study (39.17 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00F - R0008 - Staff - Toilet (5.31 m2)**

Incinerator	Encapsulated Insulation material within unit	8461/B00A/R0011/Ceiling Structures/Linings/S5				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Partition Walls (Cubicles)	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8461/B00F/R0009/Partition Walls (Cubicles)/S15						Chrysotile (white asbestos)

**B00F - R0009 - Staff - Toilet (5.65 m2)**

Ceiling Structures/Linings	Vermiculite	8461/B00A/R0011/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8461/B00F/R0009/Partition Walls (Cubicles)/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0010 - Interview/Office - Type 1 (9.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00F - R0011 - Distribution Board Cupboard (1.21 m2)</b>						
					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board	2Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Not sampled due to live electrical</b>						
<b>B00F - R0012 - Clinic - Boys (18.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Requires some dismanting of unit to</b>						
<b>B00F - R0013 - Clinic-Waiting (4.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8461/B00A/R0009/Floor Coverings Res/Textile/S6						
<b>B00F - R0014 - Staff Study (39.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00F - R0015 - Stairs (5.01 m2)</b>						
No Asbestos						
<b>B00F - R0016 - Stairs (6.51 m2)</b>						
No Asbestos						
<b>B00F - R0017 - External Movement (48.79 m2)</b>						
No Asbestos						
<b>B00F - R1004 - Seminar (13.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00F - R1006 - Distribution Board Cupboard (0.98 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00F - R1013 - Darkroom Space (6.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00F - R1015 - Stairs (22.85 m2)</b>						
No Asbestos						
<b>B00F - R1016 - Computer Room (12.94 m2)</b>						
No Asbestos						
<b>B00F - R1017 - Art Learning Space (101.53 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R1018 - Craft Store (13.73 m2)</b>						
No Asbestos						
<b>B00F - R1019 - Movement (5.02 m2)</b>						
No Asbestos						
<b>B00F - R1020 - Craft Room (3.94 m2)</b>						
No Asbestos						
<b>B00F - R1021 - Stairs (9.35 m2)</b>						
No Asbestos						
<b>B00F - R1022 - Main Area (204.92 m2)</b>						
No Asbestos						
<b>B00F - R1023 - Movement (21.31 m2)</b>						
No Asbestos						
<b>B00F - R1024 - General Storeroom (24.23 m2)</b>						
No Asbestos						
<b>B00F - R1025 - Movement (11.57 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Science/General Learning - 1973 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00G/Eaves Linings/S22					<b>Chrysotile (white asbestos)</b>
Awnings	No Asbestos Found					

**Interior****B00G - R0001 - Movement (119.43 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00G/R0001/Ceiling Structures/Linings/S23					<b>Chrysotile (white asbestos)</b>

**B00G - R0002 - Movement (13.89 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00G - R0003 - Cleaning Store - Distributed (8.46 m2)**

Non Accessible

**B00G - R0004 - Laboratory L.S. (101.79 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00G - R0005 - Plant Space (12.91 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					

**B00G - R0006 - Chemical Store (3.18 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					

**B00G - R0007 - Preparation (33.19 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					

**B00G - R0008 - Laboratory L.S. (100.68 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8461/B00A/R0011/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8461/B00A/R0009/Floor Coverings Res/Textile/S6					

**B00G - R0009 - Staff - Toilet (20.59 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0010 - Cleaning Store - Distributed (3.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0011 - Staff - Toilet (24.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0012 - Main Switchroom (8.5 m2)</b>						
No Asbestos						
<b>B00G - R0013 - General Storeroom (10.1 m2)</b>						
No Asbestos						
<b>B00G - R0014 - Movement (6.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0015 - Stairs (6.69 m2)</b>						
No Asbestos						
<b>B00G - R0016 - Movement (10.69 m2)</b>						
No Asbestos						
<b>B00G - R1003 - Movement (61.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1005 - General Learning Space (51.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1006 - General Learning Space (52.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Requires some dismantling of unit to</i>						
<b>B00G - R1007 - General Learning Space (53.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1008 - General Learning Space (53.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1009 - Movement (17.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8461/B00A/R0011/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1010 - General Storeroom (8.4 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8461/B00A/R0011/Ceiling Structures/Linings/S5 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00G - R1011 - Stairs (6.17 m2)**

No Asbestos

**B00G - R1012 - Staff Study (53.31 m2)**

No Asbestos

**B00G - R1013 - Stairs (13.39 m2)**

No Asbestos

**B00G - R1014 - Movement (14.53 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Agricultural Science - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00H/Eaves Linings/S24				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00H - R0001 - Shower/Change (8.31 m2)**

No Asbestos

**B00H - R0002 - Machine Storage (12.56 m2)**

No Asbestos

**B00H - R0003 - General Storeroom (12.61 m2)**

No Asbestos

**B00H - R0004 - General Storeroom (20.93 m2)**

No Asbestos

**B00H - R0005 - Class Tools Storage (12.56 m2)**

No Asbestos

**B00H - R0006 - Shower/Change (8.31 m2)**

No Asbestos

**B00H - R0007 - Movement (41.58 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Agricultural Science - 2001 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - Staff Kitchen (10.07 m2)**

No Asbestos

**B00J - R0002 - General Learning Space (54.31 m2)**

No Asbestos

**B00J - R0003 - General Learning Space (54.23 m2)**

No Asbestos

**B00J - R0004 - Movement (20.72 m2)**

No Asbestos

**B00J - R0005 - General Storeroom (10.1 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00T - Pupil Facilities/Music - 1966 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00T/Eaves Linings/S25			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Stump packing	Flat AC Sheeting	4Unit(s)	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00T/Stump packing/S26			<b>Chrysotile (white asbestos)</b>		
Wall Cladding	Flat AC Sheeting	14m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00T/Wall Cladding/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00T - R0001 - Staff Study (9.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00T/R0001/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Wall Linings Internal	Flat AC Sheeting	8461/B00T/R0001/Wall Linings Internal/S3				<b>No Asbestos Detected</b>
-----------------------	------------------	--	--	--	--	-----------------------------

**B00T - R0002 - General Learning Space (52.19 m2)**

Repair panel to wall	Flat AC Sheeting	8461/B00T/R0002/Repair panel to wall/S1				<b>No Asbestos Detected</b>
----------------------	------------------	---	--	--	--	-----------------------------

**B00T - R0003 - Music Learning Space (89.33 m2)**

No Asbestos

**B00T - R0004 - Music Store (17.81 m2)**

No Asbestos

**B00T - R0005 - Movement (41.91 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8461/B00T/R0001/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Floor Coverings Res/Textile	Compressed AC Sheet	8461/B00T/R0005/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>
-----------------------------	---------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 812 - D12814 - FSU/Shelter/Stores : Placement Date - 17/09/2003**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Canteen**

No Asbestos Found.

**R2 - Covered Area/food service**

No Asbestos Found.

**R3 - Store**

No Asbestos Found.

**R4 - Sports Store**

No Asbestos Found.

**R5 - Garden Store**

No Asbestos Found.

**R6 - Change Room**

No Asbestos Found.

**R7 - Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017