


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Baulkham Hills High School (8464)
Region : Western Sydney
State Electorate : Baulkham Hills
Local Government Area : The Hills

Initial Survey : Noel Arnold & Associates : 03 - Apr - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

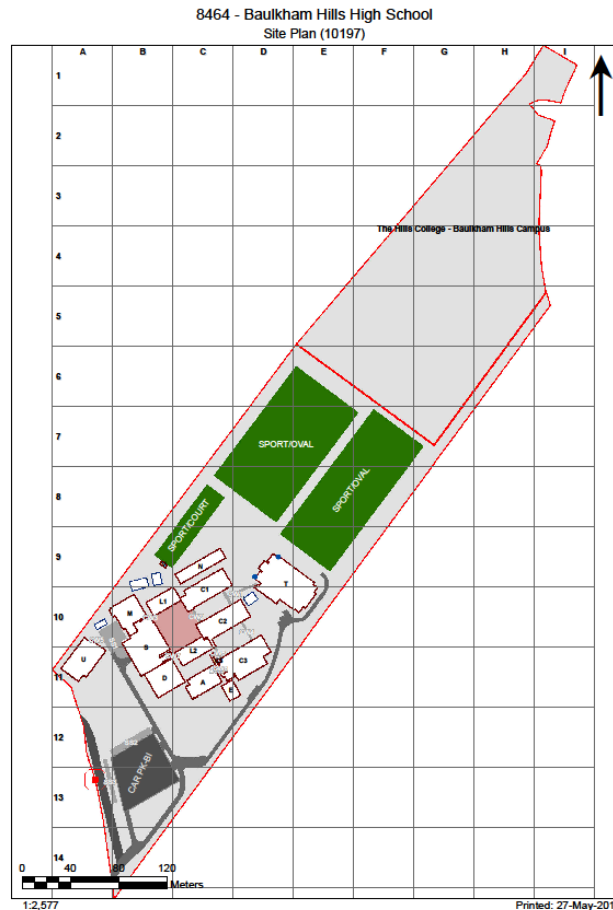

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1971 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Underfloor Voids - Slab on Ground	No Asbestos Found					
Underfloor Voids	Fibre Cement Pipe	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S44					Chrysotile (white asbestos)
Sunhood (Louvers)	Flat AC Sheeting	5m2	Packing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S43					Chrysotile (white asbestos)

Interior

B00A - R0001 - Deputy Principal Office (17.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					No Asbestos Detected
	8464/B00D/R1013/Ceiling Structures/Linings/S30					

B00A - R0002 - Staff - Toilet (7.91 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0C3/R0014/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					No Asbestos Detected
	8464/B00D/R1013/Ceiling Structures/Linings/S30					
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0003 - Cleaning Store - Distributed (1.9 m2)

No Asbestos

B00A - R0004 - Clinic-Toilets (9.75 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0C3/R0014/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					No Asbestos Detected
	8464/B00D/R1013/Ceiling Structures/Linings/S30					
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0007 - Staff Study (13.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					No Asbestos Detected
	8464/B00D/R1013/Ceiling Structures/Linings/S30					

B00A - R0009 - Distribution Board Cupboard (0.67 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	------------	--------------------	---------	--------------------

Assumed Asbestos - Live, encased material

B00A - R0011 - External Movement (1.06 m2)

No Asbestos

B00A - R0012 - Administration - Clerical (28.21 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0013 - Administration - Clerical (13.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0014 - Principal Office (16.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0015 - General Storeroom (3.03 m2)						
No Asbestos						
B00A - R0016 - Staff - Toilet (3.22 m2)						
No Asbestos						
B00A - R0017 - Interview/Office - Type 1 (13.87 m2)						
Ceiling Structures/Linings	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0018 - External Movement (1.06 m2)						
No Asbestos						
B00A - R0020 - External Movement (1.06 m2)						
No Asbestos						
B00A - R0022 - Administration - Executive (6.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0023 - Deputy Principal Office (16.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0024 - Public Reception (102.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	102m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0025 - Clinic (20.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0018/Floor Coverings Res/Textile/S1	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00A - R0026 - Administration - Clerical (12.05 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0018/Floor Coverings Res/Textile/S1	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected

B00A - R0027 - Store (2.47 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - Various - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Expansion Joints - Walls	Mastic	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/Expansion Joints - Walls/S32					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Sunhood (Louvers)	Flat AC Sheeting	5m2	Packing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S43					Chrysotile (white asbestos)
Sunhood (Louvers)	Fibre Cement Pipe	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S44					Chrysotile (white asbestos)

Interior**B00D - R0001 - Food Technology L.S. (82.48 m2)**

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0002 - Pantry (15.89 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0003 - Food/Research Space (15.54 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0004 - Food Technology L.S. (82.2 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0005 - Laundry (15.7 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0006 - General Storeroom (5.97 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0007 - General Storeroom (4.32 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0008 - Cleaning Store - Distributed (4.97 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0009 - External Movement (1.8 m2)

No Asbestos

B00D - R0010 - Staff Study (40.83 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
B00D - R0011 - Commonroom (100.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0011/Floor Coverings Res/Textile/S29	5m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	101m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
B00D - R0012 - General Storeroom (4.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0018/Floor Coverings Res/Textile/S1	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0013 - Distribution Board Cupboard (1.32 m2)				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0018/Floor Coverings Res/Textile/S1	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0014 - Movement (8.82 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0018/Floor Coverings Res/Textile/S1	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
B00D - R0015 - External Movement (1.41 m2)						
No Asbestos						
B00D - R0016 - Toilets-Girls (39.6 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet 8464/B00D/R0016/Partition Walls (Cubicles)/S3	50m2	West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
B00D - R0017 - Toilets-Girls (24.97 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet 8464/B00D/R0016/Partition Walls (Cubicles)/S3	40m2	West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
B00D - R0018 - Movement (68.41 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0019 - External Movement (1.8 m2)						
No Asbestos						
B00D - R1001 - Textiles Technology L.S. (65.22 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00D - R1002 - General Storeroom (4.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8464/B00D/R1002/Floor Coverings Res/Textile/S5				No Asbestos Detected		
B00D - R1003 - Materials Store (10.46 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8464/B00D/R1003/Floor Coverings Res/Textile/S4				No Asbestos Detected		
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
B00D - R1004 - Performance Workspace (65.67 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R0014/Ceiling Structures/Linings/S28				No Asbestos Detected		
B00D - R1005 - Staff Study (32.06 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00D - R1006 - Music Learning Space (64.76 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00D - R1007 - Music Learning Space (64.78 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00D - R1008 - Bulk Store (13.36 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
B00D - R1009 - Art Learning Space (64.51 m2)						
Wall Linings Internal	Flat AC Sheeting					
8464/B00D/R1009/Wall Linings Internal/S31				No Asbestos Detected		
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
B00D - R1010 - Art Learning Space (65.23 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30		No Asbestos Detected				
B00D - R1011 - Distribution Board Cupboard (1.49 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	3Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - live at time of inspection						
B00D - R1012 - Cleaning Store - Distributed (0.84 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R0014/Ceiling Structures/Linings/S28		No Asbestos Detected				
B00D - R1013 - Movement (65.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1		Chrysotile (white asbestos)				
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30		No Asbestos Detected				
B00D - R1014 - External Movement (1.4 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

No Asbestos

Interior

B00E - R0001 - Senior Study (117.3 m2)

No Asbestos

B00E - R0002 - External Movement (24.82 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00M - Technological & Applied Studies/Art - 1971 - Brick/Block (Brick/Block)**Exterior**

Expansion Joints - Walls	Mastic	5m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/Expansion Joints - Walls/S32				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00M - R0001 - Metal Technology L.S. (82.39 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B00M/R0001/Floor Coverings Res/Textile/S11				No Asbestos Detected	

B00M - R0002 - Materials Store (10.83 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00M - R0003 - Welding Area (22.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B00M/R0001/Floor Coverings Res/Textile/S11				No Asbestos Detected	
Furnace	Millboard	1Unit	On Shelf	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Encased Material					

Exhaust Hood	Flat AC Sheeting					
	8464/B00M/R0003/Exhaust Hood/S45				No Asbestos Detected	

B00M - R0004 - Metal Technology L.S. (82.21 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00M - R0005 - General Storeroom (17.32 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00M - R0006 - Art Learning Space (63.17 m2)

Floor Coverings Res/Textile	Vinyl Tiles	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00M - R0007 - Bulk Store (7.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00M - R0008 - Kiln Space (14.29 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00M - R0009 - Movement (37.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00M - R0010 - External Movement (1.43 m2)						
No Asbestos						
B00M - R0011 - Distribution Board Cupboard (2.75 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Live, sealed unit						
jewelry kiln	Compressed AC Sheet	0.5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8464/B00M/R0011/jewelry kiln/S33				Chrysotile (white asbestos)		
jewelry kiln	Loose Fill	0.5m2	Variable positions	Friable Asbestos (5)	High (3)	High Priority (6-8)
8464/B00M/R0011/jewelry kiln/S34				, Amosite (brown asbestos)		
furnace	Compressed AC Sheet	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00M/R0011/furnace/S35				Chrysotile (white asbestos)		
B00M - R0012 - Cleaning Store - Distributed (1.65 m2)						
No Asbestos						
B00M - R0013 - Toilets-Boys (67.56 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00M/R0013/Partition Walls (Cubicles)/S10				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00M - R0015 - Senior Study (30.11 m2)						
No Asbestos						
B00M - R0016 - Machine Storage (21.01 m2)						
No Asbestos						
B00M - R0017 - Plant (10.46 m2)						
No Asbestos						
B00M - R1001 - Wood Technology L.S. (83.21 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
B00M - R1004 - Wood Technology Bay (21.09 m2)						
No Asbestos						
B00M - R1005 - Wood Technology L.S. (83.12 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
B00M - R1006 - Materials Store (12.63 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		
B00M - R1007 - Cleaning Store - Distributed (0.64 m2)						
No Asbestos						
B00M - R1008 - Design L.S. (52.59 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B00M/R1008/Floor Coverings Res/Textile/S36					No Asbestos Detected
B00M - R1009 - Staff Study (25.75 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00M - R1010 - Design L.S. (52.19 m2)						
No Asbestos						
B00M - R1011 - Materials Store (12.93 m2)						
No Asbestos						
B00M - R1012 - Distribution Board Cupboard (1 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	4Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Encased Material						
B00M - R1013 - Movement (53.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00M - R1014 - External Movement (1.43 m2)						
No Asbestos						
B00M - R1015 - General Storeroom (10.46 m2)						
Floor Coverings Res/Textile	Resinous Membrane					
	8464/B00M/R1015/Floor Coverings Res/Textile/S37					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8464/B00S/R0022/Ceiling Structures/Linings/S24					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning/Science - 2014 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00N - R0001 - Staff Kitchen (12.57 m2)**

No Asbestos

B00N - R0002 - Staff Study (50.08 m2)

No Asbestos

B00N - R0003 - Laboratory L.S. (89.14 m2)

No Asbestos

B00N - R0004 - Preparation (20.71 m2)

No Asbestos

B00N - R0005 - Laboratory L.S. (89 m2)

No Asbestos

B00N - R0006 - Staff Kitchen (11.06 m2)

No Asbestos

B00N - R0007 - Staff Study (29.5 m2)

No Asbestos

B00N - R0008 - External Movement (71.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Multi Purpose Facilities - 1971 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
building mastic	Mastic	10m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/Expansion Joints - Walls/S32					Chrysotile (white asbestos)

Interior

B00S - R0002 - Chair Store (19.27 m2)

No Asbestos

B00S - R0003 - Staff - Toilet (3.24 m2)

No Asbestos

B00S - R0004 - General Storeroom (6.41 m2)

No Asbestos

B00S - R0005 - Staff - Toilet (3.19 m2)

No Asbestos

B00S - R0006 - Sport Equipment Store (17 m2)

No Asbestos

B00S - R0007 - Cleaning Store - Distributed (0.97 m2)

No Asbestos

B00S - R0008 - Distribution Board Cupboard (0.76 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00S - R0010 - General Storeroom (6.54 m2)

No Asbestos

B00S - R0011 - General Storeroom (17.28 m2)

No Asbestos

B00S - R0012 - Sport Equipment Store (15.91 m2)

No Asbestos

B00S - R0013 - Main Switchroom (9.99 m2)

Electrical Mounting Board	Resinous Board	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	--------------------	--------------------	---------	--------------------

Assumed Asbestos - live at time of inspection

B00S - R0016 - External Movement (52.15 m2)

No Asbestos

B00S - R0017 - General Storeroom (5.29 m2)

No Asbestos

B00S - R0021 - External Movement (28.72 m2)

Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected

B00S - R0022 - Movement (61.35 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00S/R0022/Ceiling Structures/Linings/S24					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00S - R0023 - Movement (14.69 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00S - R0024 - Sport Equipment Store (22.29 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting 8464/B00S/R0024/Wall Linings Internal/S9					No Asbestos Detected
B00S - R0025 - General Assistants (16.65 m2)						
No Asbestos						
B00S - R0026 - Stairs (12.55 m2)						
No Asbestos						
B00S - R0027 - Sport Equipment Store (3 m2)						
No Asbestos						
B00S - R0028 - Sport Equipment Store (3 m2)						
No Asbestos						
B00S - R0029 - Vending Machines (18.25 m2)						
No Asbestos						
B00S - R0031 - Stairs (12.26 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0032 - Movement (52.52 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00S - R0033 - Multi-Purpose Space (73.11 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0034 - Stairs (10.82 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0035 - Stairs (6.49 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0036 - Tiered Learning Area (58.19 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0037 - Stairs (6.49 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0038 - Multi-Purpose Space (100.77 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R0039 - Student Canteen (148.31 m2)						
No Asbestos						
B00S - R0040 - Store - Coolroom (4.97 m2)						
No Asbestos						
B00S - R0041 - Pantry (5.32 m2)						
No Asbestos						
B00S - R0042 - External Movement (193.33 m2)						
No Asbestos						
B00S - R1002 - Cleaning Store - Distributed (3.42 m2)						
No Asbestos						
B00S - R1003 - Staff Shower (7.34 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8464/B00S/R1007/Partition Walls (Cubicles)/S7	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)		
B00S - R1004 - Staff - Toilet (7.51 m2)							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	
8464/B00S/R1007/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)		
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1005 - Shower/Change (63.24 m2)							
Wall, Room Divider Shared with Boys / Girls Shower	Flat AC Sheeting	8464/B00S/R1005/wall, Room Divider Shared with Boys/ Girls Shower/S8				No Asbestos Detected	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	
8464/B00S/R1007/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)		
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1006 - Shower/Change (63.76 m2)							
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	
8464/B00S/R1007/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)		
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1007 - Staff - Toilet (7.78 m2)							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	
8464/B00S/R1007/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)		
B00S - R1008 - Staff Shower (7.3 m2)							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	
8464/B00S/R1007/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)		
Ceiling Structures/Linings	Paper	8464/B00D/R1009/Wall Linings Internal/S31				No Asbestos Detected	
B00S - R1009 - Cleaning Store - Distributed (3.38 m2)							
No Asbestos							
B00S - R1012 - External Movement (48.91 m2)							
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1013 - External Movement (47.84 m2)							
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1014 - Stairs (9.27 m2)							
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1015 - Stairs (9.03 m2)							
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
B00S - R1016 - Stairs (2.49 m2)							

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R1017 - Tiered Learning Area (22.32 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R1018 - Stairs (2.49 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R1019 - Movement (7.87 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R1020 - Control Room (7.41 m2)						
No Asbestos						
B00S - R1021 - Movement (7.2 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R1022 - Movement (66.04 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B00S - R1023 - Multi Media Workshop (67.26 m2)						
No Asbestos						
B00S - R1024 - Stairs (17.92 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00T - Multi Purpose Facilities - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00T - R0001 - Gymnasium (971.62 m2)**

No Asbestos

B00T - R0002 - Clinic - Boys (12.13 m2)

No Asbestos

B00T - R0003 - Movement (6.99 m2)

No Asbestos

B00T - R0004 - Staff - Toilet (2.64 m2)

No Asbestos

B00T - R0005 - Staff Shower (2.23 m2)

No Asbestos

B00T - R0006 - Disabled Toilet (4.5 m2)

No Asbestos

B00T - R0007 - Chair Store (28.98 m2)

No Asbestos

B00T - R0008 - Performing Arts Store (23.17 m2)

No Asbestos

B00T - R0009 - Stage (40.86 m2)

No Asbestos

B00T - R0010 - Chair Store (20.27 m2)

No Asbestos

B00T - R0011 - Utility Space (0.59 m2)

No Asbestos

B00T - R0012 - Distribution Board Cupboard (0.58 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00T - R0013 - Utility Space (0.69 m2)

No Asbestos

B00T - R0014 - Shower/Change (41.56 m2)

No Asbestos

B00T - R0015 - Movement (7.83 m2)

No Asbestos

B00T - R0016 - Toilets - Girls (29.86 m2)

No Asbestos

B00T - R0017 - Control Room (10.65 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00T - R0018 - Toilets - Boys (23.76 m2)**

No Asbestos

B00T - R0019 - Movement (7.82 m2)

No Asbestos

B00T - R0020 - Shower/Change (42.34 m2)

No Asbestos

B00T - R0021 - Cleaning Store - Distributed (3.53 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00T - R0022 - Sport Equipment Store (3.45 m2)						
No Asbestos						
B00T - R0023 - External Movement (33.03 m2)						
No Asbestos						
B00T - R0024 - Stairs (16.84 m2)						
No Asbestos						
B00T - R0025 - Movement (33.16 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00U - R0001 - External Movement (101.94 m2)**

No Asbestos

B00U - R0002 - Multi-Purpose Space (494 m2)

No Asbestos

B00U - R0003 - General Storeroom (31.44 m2)

No Asbestos

B00U - R0004 - Staff Kitchen (11.4 m2)

No Asbestos

B00U - R0005 - Toilet - Lobby (1.32 m2)

No Asbestos

B00U - R0006 - Toilets - Girls (6.54 m2)

No Asbestos

B00U - R0007 - Toilets-Disabled (5.12 m2)

No Asbestos

B00U - R0008 - Toilet - Lobby (1.62 m2)

No Asbestos

B00U - R0009 - Toilets - Boys (6.89 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - Storage - 2012 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00V - R0001 - Sport Equipment Store (15.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - General Learning - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Sunhood (Louvers)	Fibre Cement Pipe	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S44					Chrysotile (white asbestos)
Sunhood (Louvers)	Flat AC Sheeting	5m2	Packing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S43					Chrysotile (white asbestos)

Interior**B0C1 - R0001 - General Learning Space (52.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	8464/B0C1/R0021/Ceiling Structures/Linings/S22					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected

B0C1 - R0002 - General Storeroom (5.12 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B0C1/R0021/Ceiling Structures/Linings/S22					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected

B0C1 - R0003 - General Storeroom (8.62 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8464/B00S/R0022/Ceiling Structures/Linings/S24					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0C1 - R0004 - Duplicating Workroom (27.41 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B0C1 - R0005 - Sport Equipment Store (21.32 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B00S/R0022/Ceiling Structures/Linings/S24					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected

B0C1 - R0006 - Cleaning Store - Distributed (2.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8464/B0C2/R0017/Ceiling Structures/Linings/S19					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B0C1 - R0007 - Staff Study (10.8 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00S/R0022/Ceiling Structures/Linings/S24					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R0008 - Distribution Board Cupboard (0.95 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Membrane	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B0C1 - R0009 - Security Store (31.81 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00S/R0022/Ceiling Structures/Linings/S24					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R0010 - Staff - Toilet (7.17 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R0011 - General Storeroom (4.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0C1 - R0012 - Staff - Toilet (5.08 m2)						
No Asbestos						
B0C1 - R0013 - External Movement (56.48 m2)						
No Asbestos						
B0C1 - R0014 - General Learning Space (53.1 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R0015 - General Learning Space (53.02 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R0016 - General Storeroom (12.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R0017 - General Learning Space (52.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8464/B0C1/R0010/Floor Coverings Res/Textile/S13				No Asbestos Detected
B0C1 - R0018 - Staff Study (25.85 m2)						
Ceiling Structures/Linings	Vermiculite	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8464/B0C1/R0010/Floor Coverings Res/Textile/S13				No Asbestos Detected
B0C1 - R0019 - External Movement (0.93 m2)						
No Asbestos						
B0C1 - R0020 - General Learning Space (52.44 m2)						
Ceiling Structures/Linings	Vermiculite	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8464/B0C1/R0010/Floor Coverings Res/Textile/S13				No Asbestos Detected
B0C1 - R0021 - Movement (84.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8464/B0C1/R0010/Floor Coverings Res/Textile/S13				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	8464/B00D/R0014/Ceiling Structures/Linings/S28				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C1 - R0022 - General Storeroom (10.26 m2)						
No Asbestos						
B0C1 - R0023 - Stairs (8.38 m2)						
No Asbestos						
B0C1 - R0024 - Stairs (5.35 m2)						
No Asbestos						
B0C1 - R1001 - General Learning Space (53.75 m2)						
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8464/B0C1/R0010/Floor Coverings Res/Textile/S13				No Asbestos Detected
B0C1 - R1002 - Movement (18.34 m2)						
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected
B0C1 - R1003 - General Learning Space (53.31 m2)						
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8464/B0C1/R0010/Floor Coverings Res/Textile/S13				No Asbestos Detected
B0C1 - R1004 - General Learning Space (53.31 m2)						
Ceiling Structures/Linings	Paper	8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1005 - Distribution Board Cupboard (1.27 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	To Wall	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B0C1 - R1006 - Cleaning Store - Distributed (4 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C1 - R1007 - Careers Advisers Office (11.16 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1008 - Staff Study (39.28 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1009 - External Movement (47.01 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C1 - R1010 - General Learning Space (53.61 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0021/Ceiling Structures/Linings/S22					No Asbestos Detected
B0C1 - R1011 - General Storeroom (18.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C1 - R1012 - Movement (27.75 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1013 - General Learning Space (53.15 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1014 - General Learning Space (53.16 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0C1 - R1015 - Staff Study (18.36 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1016 - General Learning Space (53.75 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C1 - R1017 - Stairs (15.41 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C1 - R1018 - Stairs (10.42 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B0C2 - General Learning - 1971 - Brick/Block (Brick/Block)**Exterior**

Sunhood (Louvers)	Fibre Cement Pipe	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S44					Chrysotile (white asbestos)
Sunhood (Louvers)	Flat AC Sheeting	5m2	Packing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S43					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B0C2 - R0001 - General Learning Space (53.1 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)

B0C2 - R0002 - Computer Learning Space (53.09 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)

B0C2 - R0003 - Special Learning Space (39.39 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)

B0C2 - R0004 - Special Learning Space (52.36 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)

B0C2 - R0005 - Special Learning Space (53.23 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R0006 - External Movement (83.92 m2)						
No Asbestos						
B0C2 - R0007 - General Storeroom (4.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C2 - R0008 - Staff - Toilet (5.03 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R0009 - Staff - Toilet (6.96 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
B0C2 - R0010 - Chemical Store (31.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0011/Floor Coverings Res/Textile/S29	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R0011 - Distribution Board Cupboard (0.95 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B0C2 - R0013 - Cleaning Store - Distributed (2.68 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R0015 - General Storeroom (11.69 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
B0C2 - R0016 - General Learning Space (53.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R0017 - Movement (87.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R0018 - External Movement (0.94 m2)						
No Asbestos						
B0C2 - R0019 - External Movement (0.95 m2)						
No Asbestos						
B0C2 - R0020 - General Storeroom (10.26 m2)						
No Asbestos						
B0C2 - R0021 - Stairs (8.47 m2)						
No Asbestos						
B0C2 - R0022 - Stairs (5.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R0025 - Staff Study (26.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R0026 - General Learning Space (24.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8464/B00D/R0014/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R0027 - General Storeroom (8.14 m2)						
Ceiling Structures/Linings	Vermiculite					
8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C2 - R1001 - General Learning Space (53.53 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R1002 - Staff Study (19.14 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R1003 - General Learning Space (53.39 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R1004 - General Learning Space (53.31 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R1005 - General Storeroom (19.14 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0011/Floor Coverings Res/Textile/S46					Chrysotile (white asbestos)	
B0C2 - R1006 - General Learning Space (53.45 m2)						
Ceiling Structures/Linings	Paper					
8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R1007 - External Movement (71.76 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C2 - R1009 - Distribution Board Cupboard (1.27 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	4Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B0C2 - R1013 - General Learning Space (53.46 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R1014 - General Learning Space (53.46 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R1015 - Movement (17.53 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R1016 - General Learning Space (53.61 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C2 - R1017 - Stairs (14.14 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C2 - R1018 - Stairs (10.26 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C2 - R1019 - Movement (25.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B0C2 - R1020 - Staff Study (57.55 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B00D/R0011/Floor Coverings Res/Textile/S29	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 8464/B00D/R0011/Floor Coverings Res/Textile/S46	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B0C3 - General Learning/Library - 1971 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8464/B0C3/Eaves Linings/S38					No Asbestos Detected
Sunhood (Louvers)	Fibre Cement Pipe 8464/B00D/Sunhood (Louvers)/S44	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Sunhood (Louvers)	Flat AC Sheeting 8464/B00D/Sunhood (Louvers)/S43	5m2	Packing	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B0C3 - M1001 - Lift (2.1 m2)**

No Asbestos

B0C3 - M1002 - Movement (7.66 m2)

Ceiling Structures/Linings	Paper 8464/B00M/R1008/Floor Coverings Res/Textile/S36					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B0C3 - M1003 - Movement (45.08 m2)

Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B0C3 - R0003 - Chair Store (12.49 m2)

Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B0C3 - R0004 - Audio Visual Workroom (31.48 m2)

Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B0C3 - R0005 - Workroom (45.79 m2)

Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B0C3 - R0006 - Librarian (13.11 m2)

Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B0C3 - R0007 - Senior Study (6.48 m2)

Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

Wall Linings Internal	Flat AC Sheeting 8464/B0C3/R0007/Wall Linings Internal/S16					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B0C3 - R0008 - Senior Study (5.28 m2)

Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

Wall Linings Internal	Flat AC Sheeting 8464/B0C3/R0007/Wall Linings Internal/S16					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B0C3 - R0009 - Senior Study (5.93 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8464/B0C3/R0007/Wall Linings Internal/S16					No Asbestos Detected
B0C3 - R0012 - External Movement (43.21 m2)						
No Asbestos						
B0C3 - R0013 - Movement (24.04 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0C3 - R0014 - Toilets-Boys (12.3 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0C3 - R0015 - Cleaning Store - Distributed (1.49 m2)						
No Asbestos						
B0C3 - R0016 - Distribution Board Cupboard (1.1 m2)						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	4Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - live at time of inspection</i>						
B0C3 - R0017 - General Storeroom (4.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0018/Floor Coverings Res/Textile/S1	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0C3 - R0018 - Toilets-Girls (14.57 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0C3 - R0019 - General Storeroom (4.25 m2)						
Ceiling Structures/Linings	Vermiculite 8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0C3 - R0020 - General Storeroom (4.92 m2)						
No Asbestos						
B0C3 - R0021 - Stairs (3.52 m2)						
No Asbestos						
B0C3 - R0022 - Stairs (4.57 m2)						
No Asbestos						
B0C3 - R0023 - External Stairs (3.91 m2)						
No Asbestos						
B0C3 - R0024 - Stairs (1.38 m2)						
No Asbestos						
B0C3 - R0025 - Movement (15.89 m2)						
No Asbestos						
B0C3 - R0026 - Toilets-Disabled (11.91 m2)						
No Asbestos						
B0C3 - R0027 - Lift (2.1 m2)						
No Asbestos						
B0C3 - R0028 - Librarian (535.36 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R0014/Ceiling Structures/Linings/S28					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R1001 - General Learning Space (53.32 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C3 - R1002 - Movement (16.9 m2)						
No Asbestos						
B0C3 - R1003 - General Learning Space (53.01 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C3 - R1004 - General Learning Space (53.02 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C3 - R1005 - Staff Study (18.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B0C1/R0010/Floor Coverings Res/Textile/S13					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R1006 - Distribution Board Cupboard (0.9 m2)						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	4Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - live at time of inspection						
B0C3 - R1007 - Staff Study (39.47 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C3 - R1008 - Movement (17.24 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0C3 - R1009 - External Movement (39.39 m2)						
No Asbestos						
B0C3 - R1010 - Cleaning Store - Distributed (6.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B00M/R1008/Floor Coverings Res/Textile/S36					No Asbestos Detected
B0C3 - R1011 - General Storeroom (6.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8464/B00M/R1008/Floor Coverings Res/Textile/S36					No Asbestos Detected
B0C3 - R1012 - General Learning Space (53.09 m2)						
Ceiling Structures/Linings	Vermiculite					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R1013 - General Learning Space (50.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	8464/B00M/R1008/Floor Coverings Res/Textile/S36					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R1014 - General Learning Space (67.58 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00M/R1008/Floor Coverings Res/Textile/S36					No Asbestos Detected
B0C3 - R1015 - Staff Study (17.96 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Paper
 8464/B00M/R1008/Floor Coverings Res/Textile/S36 **No Asbestos Detected**

B0C3 - R1016 - General Learning Space (53.16 m2)

Ceiling Structures/Linings Paper
 8464/B00M/R1008/Floor Coverings Res/Textile/S36 **No Asbestos Detected**

B0C3 - R1017 - Stairs (8.06 m2)

No Asbestos

B0C3 - R1018 - External Stairs (6.42 m2)

No Asbestos

B0C3 - R1019 - Stairs (6.38 m2)

No Asbestos

B0C3 - R1020 - Movement (8.35 m2)

No Asbestos

B0C3 - R1021 - Lift (2.1 m2)

No Asbestos

B0C3 - R1022 - External Movement (27.02 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0L1 - Science - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Sunhood (Louvers)	Fibre Cement Pipe	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S44					Chrysotile (white asbestos)
Sunhood (Louvers)	Flat AC Sheeting	5m2	Packing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8464/B00D/Sunhood (Louvers)/S43					Chrysotile (white asbestos)

Interior**B0L1 - R0001 - Laboratory L.S. (91.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	8464/B0L1/R0006/Ceiling Structures/Linings/S20					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0L1 - R0002 - Lift (0.26 m2)

No Asbestos

B0L1 - R0003 - Staff Study (31.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B0L1 - R0004 - General Storeroom (3.17 m2)

No Asbestos

B0L1 - R0005 - General Storeroom (13.13 m2)

No Asbestos

B0L1 - R0006 - Laboratory L.S. (91.43 m2)

Ceiling Structures/Linings	Vermiculite					
	8464/B0L1/R0006/Ceiling Structures/Linings/S20					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0L1 - R0007 - Distribution Board Cupboard (0.8 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B0L1 - R0008 - Cleaning Store - Distributed (0.8 m2)

No Asbestos

B0L1 - R0009 - External Movement (66.48 m2)

No Asbestos

B0L1 - R1001 - Laboratory L.S. (91.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					No Asbestos Detected
	8464/B00D/R1013/Ceiling Structures/Linings/S30					

B0L1 - R1002 - Lift (0.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B0L1 - R1003 - Staff Study (31.37 m2)

Floor Coverings Res/Textile	Vinyl Tiles	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L1 - R1004 - Apparatus Store (3.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L1 - R1005 - Apparatus Store (13.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L1 - R1006 - Laboratory L.S. (91.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L1 - R1007 - Distribution Board Cupboard (0.9 m2)						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
B0L1 - R1008 - Lift (0.9 m2)						
Electrical Backing Board	Paper	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L1 - R1009 - External Movement (63.04 m2)						
Ceiling Structures/Linings	Paper					
	8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B0L2 - Science - 1971 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 8464/B0L2/Wall Cladding/S40					No Asbestos Detected
Sunhood (Louvers)	Fibre Cement Pipe 8464/B00D/Sunhood (Louvers)/S44	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Sunhood (Louvers)	Flat AC Sheeting 8464/B00D/Sunhood (Louvers)/S43	5m2	Packing	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B0L2 - R0001 - Cleaning Supplies Store (9.8 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8464/B0L1/R0001/Floor Coverings Res/Textile/S12	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

B0L2 - R0002 - Movement (2.84 m2)

No Asbestos

B0L2 - R0003 - Chair Store (11.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8464/B00D/R0018/Floor Coverings Res/Textile/S1	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B0L2 - R0004 - Laboratory L.S. (91.81 m2)

Ceiling Structures/Linings	Vermiculite 8464/B0L2/R0004/Ceiling Structures/Linings/S27	92m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) , Amosite (brown asbestos)
----------------------------	---	------	------------	----------------------	---------	---

Heat-proof Mat	Flat AC Sheeting 8464/B0L2/R0009/Heat-proof Mat/S39					No Asbestos Detected
----------------	--	--	--	--	--	-----------------------------

B0L2 - R0005 - Lift (0.26 m2)

No Asbestos

B0L2 - R0006 - Preparation (31.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8464/B0L1/R0001/Floor Coverings Res/Textile/S12	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

Ceiling Structures/Linings	Vermiculite 8464/B0L2/R0004/Ceiling Structures/Linings/S27	32m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) , Amosite (brown asbestos)
----------------------------	---	------	------------	----------------------	---------	---

Heat-proof Mat	Flat AC Sheeting 8464/B0L2/R0009/Heat-proof Mat/S39					No Asbestos Detected
----------------	--	--	--	--	--	-----------------------------

B0L2 - R0007 - Apparatus Store (3.17 m2)

No Asbestos

B0L2 - R0008 - Chemical Store (13.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8464/B0L1/R0001/Floor Coverings Res/Textile/S12	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

Ceiling Structures/Linings	Vermiculite 8464/B0L2/R0004/Ceiling Structures/Linings/S27	14m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) , Amosite (brown asbestos)
----------------------------	---	------	------------	----------------------	---------	---

Heat-proof Mat	Flat AC Sheeting 8464/B0L2/R0009/Heat-proof Mat/S39					No Asbestos Detected
----------------	--	--	--	--	--	-----------------------------

B0L2 - R0009 - Laboratory L.S. (91.72 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	92m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8464/B0L2/R0004/Ceiling Structures/Linings/S27					, Amosite (brown asbestos)	
Heat-proof Mat	Flat AC Sheeting					No Asbestos Detected
8464/B0L2/R0009/Heat-proof Mat/S39						
B0L2 - R0010 - External Movement (62.69 m2)						
No Asbestos						
B0L2 - R0011 - Distribution Board Cupboard (0.83 m2)					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Live						
B0L2 - R0012 - Cleaning Store - Distributed (0.72 m2)						
No Asbestos						
B0L2 - R1001 - Chair Store (8.15 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
8464/B0L2/Wall Cladding/S40						
B0L2 - R1002 - External Movement (2.77 m2)						
No Asbestos						
B0L2 - R1003 - Darkroom Space (11.21 m2)						
Ceiling Structures/Linings	Paper					No Asbestos Detected
8464/B00D/R1013/Ceiling Structures/Linings/S30						
B0L2 - R1004 - Laboratory L.S. (91.72 m2)						
Ceiling Structures/Linings	Paper					No Asbestos Detected
8464/B00D/R1013/Ceiling Structures/Linings/S30						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B0L1/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
B0L2 - R1005 - Lift (0.26 m2)						
Wall Linings Internal	Flat AC Sheeting	1m2	Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8464/B0L2/R1012/Wall Linings Internal/S42					Chrysotile (white asbestos)	
Lift Motor	Textile	1Unit	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Assumed Asbestos - Electrical Hazard Rope 'lift windings						
B0L2 - R1006 - Preparation (31.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Paper					No Asbestos Detected
8464/B00D/R1013/Ceiling Structures/Linings/S30						
B0L2 - R1007 - General Storeroom (3.17 m2)						
Ceiling Structures/Linings	Paper					No Asbestos Detected
8464/B00D/R1013/Ceiling Structures/Linings/S30						
B0L2 - R1008 - Preparation (13.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Paper					No Asbestos Detected
8464/B00D/R1013/Ceiling Structures/Linings/S30						
B0L2 - R1009 - Laboratory L.S. (91.82 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8464/B00D/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L2 - R1010 - External Movement (62.86 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
B0L2 - R1011 - Distribution Board Cupboard (0.9 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Electrical Backing Board	Resinous Board	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - live						
B0L2 - R1012 - Lift (0.62 m2)						
Ceiling Structures/Linings	Paper 8464/B00D/R1013/Ceiling Structures/Linings/S30					No Asbestos Detected
Electrical Backing Board	Resinous Board	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - live						
Wall Linings Internal	Flat AC Sheeting 8464/B0L2/R1012/Wall Linings Internal/S42	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

NS 110 - D10541 - Learning Unit - Single Secondary/Secure : Placement Date - 22/01/2002

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

R2 - Entry

No Asbestos Found.

R3 - Secure Storeroom

No Asbestos Found.

OS 601 - D14488 - Learning Unit - Standard/Withdrawal : Placement Date - 4/05/2009

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 760 - D14594 - Woodwork/Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Woodwork

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

R2 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

NS 020 - D70091 - Staff Study/Store : Placement Date - 15/07/2003

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Staff Room						
No Asbestos Found.						
R2 - Store						
No Asbestos Found.						
R3 - Entry						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017