


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bombala High School (8486)
Region : Illawarra and South East
State Electorate : Monaro
Local Government Area : Bombala

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : AECOM : 18 - Jun - 2015

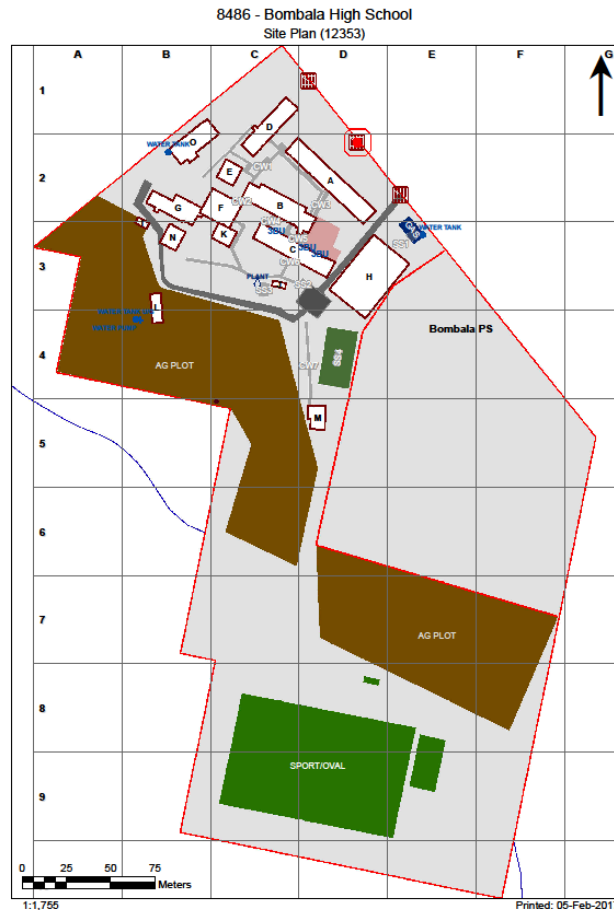

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00A/Eaves Linings/S9					Chrysotile (white asbestos)	

Interior

B00A - R0001 - Commonroom (33.49 m2)

No Asbestos

B00A - R0002 - Leading Teacher (17.88 m2)

Ceiling Structures/Linings	Vermiculite	8486/B00A/R0019/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0003 - Administration - Clerical (13.13 m2)

Ceiling Structures/Linings	Vermiculite	8486/B00A/R0019/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0004 - Audio Visual Workroom (13.09 m2)

Ceiling Structures/Linings	Vermiculite	8486/B00A/R0019/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0005 - Interview/Office - Type 1 (12.91 m2)

Ceiling Structures/Linings	Vermiculite	8486/B00A/R0019/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0006 - Administration - Clerical (26.51 m2)

Ceiling Structures/Linings	Vermiculite	8486/B00A/R0019/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0009 - Main Area (52.43 m2)

No Asbestos

B00A - R0012 - Librarian (6.53 m2)

No Asbestos

B00A - R0013 - Seminar (14.67 m2)

No Asbestos

B00A - R0014 - Seminar (14.94 m2)

No Asbestos

B00A - R0015 - Staff - Toilet (8.9 m2)

Ceiling Structures/Linings	Vermiculite	8486/B00A/R0019/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0016 - Distribution Board Cupboard (0.78 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00A/Eaves Linings/S9					Chrysotile (white asbestos)	

B00A - R0017 - Staff - Toilet (13.86 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0018 - Public Entry (6.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8486/B00A/Eaves Linings/S9	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0019 - Movement (94.92 m2)						
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0020 - Deputy Principal Office (15.16 m2)						
No Asbestos						
B00A - R0021 - Principal Office (16.68 m2)						
No Asbestos						
B00A - R0022 - Staff - Toilet (3.25 m2)						
No Asbestos						
B00A - R0023 - General Storeroom (3.2 m2)						
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8486/B00B/R0006/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0024 - Staff - Toilet (4.8 m2)						
No Asbestos						
B00A - R0025 - Cleaning Store - Distributed (2.67 m2)						
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0026 - Staff - Toilet (4.02 m2)						
No Asbestos						
B00A - R0027 - Clinic - Boys (12.18 m2)						
No Asbestos						
B00A - R0028 - General Storeroom (0.64 m2)						
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8486/B00B/R0006/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0029 - Staff Kitchen (5.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8486/B00B/R0006/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0030 - Movement (7.67 m2)						
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0031 - Movement (53.79 m2)						
Ceiling Structures/Linings	Vermiculite 8486/B00A/R0019/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0032 - Main Area (72.85 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Flat AC Sheeting	6m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)	
B00A - R0033 - Librarian (20.38 m2)						
In-fill-panel	Flat AC Sheeting	2m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Science - 1973 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00B/R0014/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement (89.06 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8486/B00B/R0006/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0002 - Distribution Board Cupboard (0.58 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0003 - Laboratory L.S. (91.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8486/B00B/R0006/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0004 - Main Switchroom (6.42 m2)

Electrical Mounting Board	Resinous Board	3Unit	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00B - R0005 - Leading Teacher (12.69 m2)

No Asbestos

B00B - R0006 - Preparation (45.55 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8486/B00B/R0006/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8486/B00B/R0006/Floor Coverings Res/Textile/S4					

B00B - R0007 - Chemical Store (3.19 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8486/B00B/R0006/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0008 - Laboratory L.S. (90.87 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8486/B00B/R0006/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0009 - Apparatus Store (24.13 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8486/B00B/R0006/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00D/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R0010 - General Storeroom (4.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00D/R0003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R0011 - Stairs (18.47 m2)						
Ceiling Structures/Linings	Vermiculite					
8486/B00B/R0006/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0012 - Stairs (6.35 m2)						
Ceiling Structures/Linings	Vermiculite					
8486/B00B/R0006/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0013 - Movement (17.76 m2)						
No Asbestos						
B00B - R0014 - Movement (26.87 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	Adjacent to Entrance	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00B/R0014/Wall linings adjacent entrance/S5					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8486/B00B/R0014/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00B - R0015 - Lift (2.25 m2)						
No Asbestos						
B00B - R1001 - Movement (85.67 m2)						
Ceiling Structures/Linings	Vermiculite					
8486/B00B/R0006/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1002 - Distribution Board Cupboard (0.85 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1003 - Resources Store (13.55 m2)						
Ceiling Structures/Linings	Vermiculite					
8486/B00B/R0006/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles					
8486/B00B/R0006/Floor Coverings Res/Textile/S4					No Asbestos Detected	
B00B - R1004 - Kiln Space (12.59 m2)						
Ceiling Structures/Linings	Vermiculite					
8486/B00B/R0006/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles					
8486/B00B/R0006/Floor Coverings Res/Textile/S4					No Asbestos Detected	
B00B - R1005 - Art Learning Space (66.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8486/B00B/R0006/Floor Coverings Res/Textile/S4					No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
8486/B00B/R0006/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1006 - Darkroom Space (12.61 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8486/B00B/R0006/Floor Coverings Res/Textile/S4			No Asbestos Detected	
B00B - R1007 - Computer Resource (5.8 m2)						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8486/B00B/R0006/Floor Coverings Res/Textile/S4			No Asbestos Detected	
B00B - R1008 - Computer Learning Space (56.12 m2)						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8486/B00B/R0006/Floor Coverings Res/Textile/S4			No Asbestos Detected	
B00B - R1009 - Materials Store (11.54 m2)						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8486/B00B/R0006/Floor Coverings Res/Textile/S4			No Asbestos Detected	
B00B - R1010 - General Storeroom (5.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8486/B00B/R0006/Floor Coverings Res/Textile/S4			No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1011 - Design L.S. (67.38 m2)						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1012 - Stairs (24.46 m2)						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1013 - Stairs (24.68 m2)						
Ceiling Structures/Linings	Vermiculite	8486/B00B/R0006/Ceiling Structures/Linings/S3			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1973 - Brick/Block (Brick/Block)**Exterior**

Flue	Fibre Cement Pipe	1m	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Eaves Linings	Flat AC Sheeting	56m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00C/Eaves Linings/S13					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00C - R0001 - Staff - Toilet (5.03 m2)**

No Asbestos

B00C - R0002 - Office/Store (4.11 m2)

No Asbestos

B00C - R0003 - Student Canteen (34.86 m2)

No Asbestos

B00C - R0004 - Movement (164.95 m2)

No Asbestos

B00C - R0005 - Distribution Board Cupboard (0.49 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00C - R0006 - General Storeroom (23.09 m2)**

No Asbestos

B00C - R0007 - Cleaning Supplies Store (9.76 m2)

No Asbestos

B00C - R0008 - Toilets-Boys (41.3 m2)

No Asbestos

B00C - R0009 - Toilets-Disabled (7.53 m2)

No Asbestos

B00C - R0011 - Toilets-Girls (35.45 m2)

No Asbestos

B00C - R0012 - Darkroom Space (8.12 m2)

No Asbestos

B00C - R0013 - Cleaning Store - Distributed (6.05 m2)

Flue	Fibre Cement Pipe	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
------	-------------------	-----	---------------	--------------------	---------	--------------------

Assumed Asbestos - Area inaccessible**B00C - R0014 - Senior Seminar (25.55 m2)**

No Asbestos

B00C - R0015 - Senior Study (42.97 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1960 - Concrete (Concrete)**Exterior**

Eaves Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Cladding	Flat AC Sheeting	4m2	South wall of Room DR0009	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00D - R0001 - General Learning Space (67.34 m2)**

No Asbestos

B00D - R0002 - Computer Learning Space (52.79 m2)

No Asbestos

B00D - R0003 - General Storeroom (25.77 m2)

Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/R0003/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00D - R0004 - Staff Study (25.74 m2)

No Asbestos

B00D - R0005 - Movement (58.06 m2)

No Asbestos

B00D - R0006 - Pupil Entry (2.41 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00D/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0007 - Staff Study (25.92 m2)

No Asbestos

B00D - R0008 - General Learning Space (67.59 m2)

No Asbestos

B00D - R0009 - Staff - Toilet (3.91 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8486/B00D/R0009/Wall Linings Internal/S12					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies - 1951 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting 8486/B00E/R0006/Ceiling Structures/Linings/S11	No Asbestos Detected				
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Movement (7.56 m2)

No Asbestos

B00E - R0002 - Staff Study (8.9 m2)

No Asbestos

B00E - R0003 - Pantry (4.4 m2)

No Asbestos

B00E - R0004 - Food Technology L.S. (75.91 m2)

No Asbestos

B00E - R0005 - Food/Research Space (6.82 m2)

No Asbestos

B00E - R0006 - Laundry (6.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8486/B00E/R0006/Ceiling Structures/Linings/S11	No Asbestos Detected				
----------------------------	--	-----------------------------	--	--	--	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1960 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00F/Eaves Linings/S15					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	NA	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	8486/B00F/Eaves Linings/S15					Chrysotile (white asbestos)

Interior

B00F - R0001 - Materials Store (74.94 m2)

No Asbestos

B00F - R0002 - Materials Technology L.S. (95.32 m2)

No Asbestos

B00F - R0003 - Welding Area (5.07 m2)

No Asbestos

B00F - R0004 - Metal Technology Bay (17.54 m2)

No Asbestos

B00F - R0005 - Movement (5.33 m2)

No Asbestos

B00F - R0006 - Movement (82.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	27m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00G/R0009/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00G - R0001 - Design L.S. (52.22 m2)**

No Asbestos

B00G - R0002 - Distribution Board Cupboard (0.42 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0003 - Materials Store (12.09 m2)

No Asbestos

B00G - R0004 - Materials Technology L.S. (79.31 m2)

No Asbestos

B00G - R0005 - Resource/Project Store (6.21 m2)

No Asbestos

B00G - R0006 - Materials Store (6.15 m2)

No Asbestos

B00G - R0007 - Movement (4.07 m2)

No Asbestos

B00G - R0009 - External Movement (72.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00G/R0009/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00G - R0010 - Materials Store (38.61 m2)

No Asbestos

B00G - R0011 - Plant (4.12 m2)

No Asbestos

B00G - R9001 - Materials Store (15.47 m2)

No Asbestos

B00G - R9002 - Plant (3.05 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Multi Purpose Facilities - 1981 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab on Ground
No Asbestos Found

Interior**B00H - R0003 - Main Switchroom (2.99 m2)**

No Asbestos

B00H - R0004 - Toilets-Boys (17.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)	

B00H - R0005 - Shower/Change (33.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	52m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	

B00H - R0006 - Performing Arts Store (51.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	58m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	

B00H - R0007 - Shower/Change (32.7 m2)

Wall Linings Internal	Flat AC Sheeting	52m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	22m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)	

B00H - R0008 - Toilets-Girls (17.7 m2)

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	22m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)	

B00H - R0009 - Cleaning Store - Distributed (3.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00H - R0011 - Student Canteen (14.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8486/B00H/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	22m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00H - R0012 - Music Store (8.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	35m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8486/B00H/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00H - R0013 - Staff Study (8.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8486/B00H/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	50m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00H - R0014 - Sport Equipment Store (20.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	24m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00H/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00H - R0016 - Multi-Purpose Space (464.33 m2)						
No Asbestos						
B00H - R0017 - Movement (5.87 m2)						
No Asbestos						
B00H - R0019 - Movement (5.82 m2)						
No Asbestos						
B00H - R0020 - Stage (59.15 m2)						
No Asbestos						
B00H - R0021 - Lift (3.05 m2)						
No Asbestos						
B00H - R0022 - External Movement (192.18 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0023 - Chair Store (33.28 m2)						
Recently Modified Space Requires Inspection						
B00H - R0024 - Other (7.66 m2)						
Recently Modified Space Requires Inspection						
B00H - R0025 - Gymnasium (8.64 m2)						
Recently Modified Space Requires Inspection						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Agricultural Science - 2004 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B001 - R0001 - Machine Storage (24.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1960 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8486/B00J/Eaves Linings/S18					No Asbestos Detected

Interior

B00J - R0001 - Cleaning Supplies Store (11.94 m2)

No Asbestos

B00J - R0002 - Bulk Store (8.32 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00K - General Learning - 1960 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m2	Adjacent to Entrance	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Height Restriction					

Interior

B00K - R0005 - General Assistants (7.59 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0006 - Movement (5.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0007 - Commonroom (12.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0008 - Staff Study (35.38 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0009 - General Storeroom (8.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0010 - Staff Study (23.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	8m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0011 - Staff - Toilet (6.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00K/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Agricultural Science - 1989 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Animal Space (24.9 m2)

No Asbestos

B00L - R0002 - Machine Storage (30.8 m2)

No Asbestos

B00L - R0003 - Staff - Toilet (2.22 m2)

No Asbestos

B00L - R0004 - Machine Storage (33.59 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Music - 2004 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00B/R0014/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Height Restriction					
Ceiling Voids	No Asbestos Found					

Interior**B00M - R0001 - Staff Study (8.76 m2)**

No Asbestos

B00M - R0002 - Movement (11.19 m2)

No Asbestos

B00M - R0003 - Practice/Seminar (11.48 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00M/R0003/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00M/R0003/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00M - R0004 - Music Learning Space (49.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8486/B00M/R0003/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00M - R0005 - Music Store (18.81 m2)

No Asbestos

B00M - R0006 - External Movement (14.31 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Technological & Applied Studies - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Metal Technology Bay (81.99 m2)

No Asbestos

B00N - R0002 - Covered Outdoor Space (34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Technological & Applied Studies - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B000 - R0001 - External Movement (14.06 m2)

No Asbestos

B000 - R0002 - Covered Outdoor Space (57.35 m2)

No Asbestos

B000 - R0003 - Plant (1.32 m2)

No Asbestos

B000 - R0004 - Toilets-Disabled (6.05 m2)

No Asbestos

B000 - R0005 - Movement (10.42 m2)

No Asbestos

B000 - R0006 - Student Kitchen (6.71 m2)

No Asbestos

B000 - R0007 - General Learning Space - Type 6 (43.51 m2)

No Asbestos

B000 - R0008 - General Learning Space - Type 6 (136.34 m2)

No Asbestos

B000 - R0009 - Welding Area (14.46 m2)

No Asbestos

B000 - R0010 - Project Store - Type 1 (5.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017