


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Billabong High School (8503)  
**Region :** Riverina  
**State Electorate :** Albury  
**Local Government Area :** Greater Hume

**Initial Survey :** Noel Arnold & Associates : 23 - Feb - 2008  
**Reviewed By :** Parsons Brinckerhoff : 07 - Feb - 2017

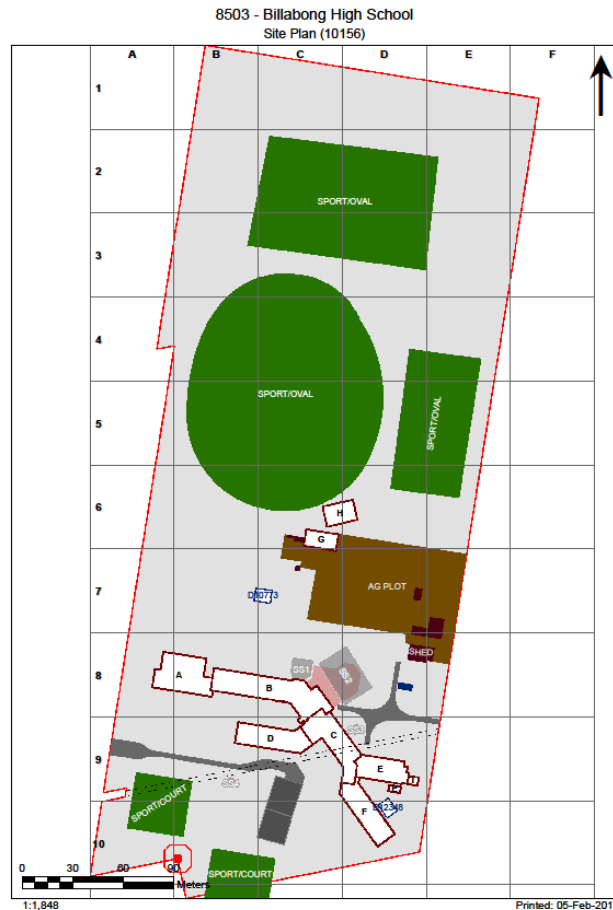

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Physical Education - 1978 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 8503/B00E/Eaves Linings/S9	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Expansion joint	Mastic 8503/B00A/Expansion joint/S10	3m	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Toilets-Girls (8.03 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 8503/B00D/R0010/Partition Walls (Cubicles)/S3	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

**B00A - R0002 - Student Canteen (8.89 m2)**

No Asbestos

**B00A - R0003 - Shower/Change (11.72 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 8503/B00D/R0010/Partition Walls (Cubicles)/S3	18m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

**B00A - R0004 - Shower/Change (22.94 m2)**

No Asbestos

**B00A - R0005 - Pupil Entry (2.74 m2)**

No Asbestos

**B00A - R0006 - Stage (67.25 m2)**

No Asbestos

**B00A - R0007 - Gymnasium (305.15 m2)**

No Asbestos

**B00A - R0008 - Pupil Entry (2.76 m2)**

No Asbestos

**B00A - R0009 - Shower/Change (22.79 m2)**

No Asbestos

**B00A - R0010 - Shower/Change (9.89 m2)**

No Asbestos

**B00A - R0011 - Toilets-Boys (1.78 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 8503/B00D/R0010/Partition Walls (Cubicles)/S3	4m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

**B00A - R0012 - Staff Change (12.16 m2)**

No Asbestos

**B00A - R0013 - Staff Shower (1.77 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 8503/B00D/R0010/Partition Walls (Cubicles)/S3	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

**B00A - R0014 - Pupil Entry (3.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8503/B00B/R1016/Ceiling Structures/Linings/S7	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

**B00A - R0015 - Staff Shower (1.79 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
<b>B00A - R0016 - Staff Change (10.76 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Chair Store (11.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0018 - Movement (9.97 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0019 - Sport Equipment Store (34.56 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0020 - Movement (10 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0021 - Chair Store (11.42 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0022 - Toilets-Boys (6.16 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
<b>B00A - R0023 - Movement (31.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8503/B00B/R0012/Floor Coverings Res/Textile/S2					No Asbestos Detected	
<b>B00A - R0024 - Movement (3.65 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0025 - Movement (1.56 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00B/R1016/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
<b>B00A - R0026 - Movement (2.16 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B00A - R0027 - Distribution Board Cupboard (1.23 m2)</b>						
Note: No inspection of live electrical installation.						
Door lining	Flat AC Sheeting	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0019/Door lining/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00A/R0027/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1978 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00E/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - Toilets-Girls (10.21 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0002 - Staff - Toilet (1.57 m2)**

No Asbestos

**B00B - R0003 - Office/Store (6.32 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0004 - Student Canteen (56.18 m2)**

No Asbestos

**B00B - R0005 - Office/Store (11.94 m2)**

No Asbestos

**B00B - R0006 - Staff Study (32.69 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0008 - Main Switchroom (15.21 m2)**

Switchboard panel	Resinous Board	1Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00B/R0008/Switchboard panel/S12					<b>Chrysotile (white asbestos)</b>
Door lining	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0019/Door lining/S4					<b>Chrysotile (white asbestos)</b>

**B00B - R0009 - Laboratory L.S. (99.34 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0010 - Laboratory L.S. (95.16 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0011 - Preparation (47.93 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0012 - Laboratory L.S. (89.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0013 - Staff Study (16.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0014 - General Storeroom (38.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0015 - Toilets-Boys (11.73 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0016 - Movement (111.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	112m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B00B - R0017 - Pupil Entry (131.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					No Asbestos Detected
<b>B00B - R0018 - Movement (53.4 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B00B - R0019 - Movement (119.85 m2)</b>						
Infill panels above servery	Flat AC Sheeting	4m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00B/R0019/Infill panels above servery/S8					Chrysotile (white asbestos)
<b>B00B - R0020 - Distribution Board Cupboard (0.73 m2)</b>						
Note: No inspection of live electrical installation.						
Switchboard panel	Resinous Board	2Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00B/R0020/Switchboard panel/S13					Chrysotile (white asbestos)
Door lining	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0019/Door lining/S4					Chrysotile (white asbestos)
<b>B00B - R0021 - Chemical Store (7.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8503/B00B/R0021/Floor Coverings Res/Textile/S14					No Asbestos Detected
<b>B00B - R0022 - Apparatus Store (13.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0023 - Lift (2.24 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Movement (101.42 m2)</b>						
No Asbestos						
<b>B00B - R1002 - Pupil Entry (130.92 m2)</b>						
No Asbestos						
<b>B00B - R1003 - Cleaning Supplies Store (1.1 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00B/R1003/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1004 - Movement (57.23 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1010 - Design L.S. (62.33 m2)</b>						
No Asbestos						
<b>B00B - R1011 - Resource/Project Store (7.64 m2)</b>						
No Asbestos						
<b>B00B - R1012 - Materials Store (5.24 m2)</b>						
No Asbestos						
<b>B00B - R1013 - Resource/Project Store (25.02 m2)</b>						
No Asbestos						
<b>B00B - R1014 - General Learning Space (51.12 m2)</b>						
No Asbestos						
<b>B00B - R1015 - General Learning Space (53.43 m2)</b>						
No Asbestos						
<b>B00B - R1016 - Music Store (4.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00B/R1016/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1017 - Tiered Learning Area (94.63 m2)</b>						
No Asbestos						
<b>B00B - R1018 - Distribution Board Cupboard (0.79 m2)</b>						
					Note: No inspection of live electrical installation.	
Switchboard panel	Resinous Board	8503/B00B/R1018/Switchboard panel/S16		<b>No Asbestos Detected</b>		
Door lining	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0019/Door lining/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1019 - Food Technology L.S. (105.74 m2)</b>						
No Asbestos						
<b>B00B - R1020 - Food/Research Space (14.92 m2)</b>						
No Asbestos						
<b>B00B - R1021 - Pantry (11.55 m2)</b>						
No Asbestos						
<b>B00B - R1022 - Movement (3.38 m2)</b>						
No Asbestos						
<b>B00B - R1023 - Student Change - Type 2 (2.31 m2)</b>						
No Asbestos						
<b>B00B - R1024 - Laundry (1.74 m2)</b>						
No Asbestos						
<b>B00B - R1025 - Food/Research Space (13.31 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1978 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00E/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids						

**Interior****B00C - R0001 - Toilets-Boys (5.83 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0002 - Toilets-Girls (6.97 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0003 - Cleaning Supplies Store (2.1 m2)**

No Asbestos

**B00C - R0004 - General Learning Space (67.21 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0005 - Music Learning Space (91.25 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0006 - Kiln Space (6.99 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					

**B00C - R0007 - Resources Store (22.81 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					

**B00C - R0008 - Art Learning Space (65.38 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					

**B00C - R0009 - Cleaning Supplies Store (2.03 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00C - R0010 - Movement (87.82 m2)</b>						
No Asbestos						
<b>B00C - R0011 - Distribution Board Cupboard (1.97 m2)</b>					Note: No inspection of live electrical installation.	
Door lining	Flat AC Sheeting	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0019/Door lining/S4					<b>Chrysotile (white asbestos)</b>
Switchboard panel	Resinous Board	3Unit(s)	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R0011/Switchboard panel/S17					<b>Chrysotile (white asbestos)</b>
<b>B00C - R0014 - Toilets-Boys (7.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00C - R0015 - Public Entry (13.17 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Public Entry (148.26 m2)</b>						
No Asbestos						
<b>B00C - R0017 - Distribution Board Cupboard (37.05 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R1007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
<b>B00C - R0018 - Stairs (9.59 m2)</b>						
No Asbestos						
<b>B00C - R0019 - Toilets-Disabled (11.2 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Toilets-Boys (6.72 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00C - R1002 - Distribution Board Cupboard (0.92 m2)</b>					Note: No inspection of live electrical installation.	
Switchboard panel	Resinous Board	4Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R1002/Switchboard panel/S19					<b>Chrysotile (white asbestos)</b>
Door lining	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0019/Door lining/S4					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	8503/B00C/R1002/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00C - R1003 - General Learning Space (54.29 m2)</b>						
No Asbestos						
<b>B00C - R1004 - General Learning Space (54.75 m2)</b>						
No Asbestos						
<b>B00C - R1005 - Computer Learning Space (54.68 m2)</b>						
No Asbestos						
<b>B00C - R1006 - General Storeroom (40.13 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R1008 - Distribution Board Cupboard (1.62 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00C - R1009 - Cleaning Supplies Store (3.39 m2)</b>						
No Asbestos						
<b>B00C - R1010 - Toilets-Girls (7.51 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1011 - Toilets-Boys (6.46 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1012 - Movement (67.94 m2)</b>						
No Asbestos						
<b>B00C - R1013 - Toilets-Girls (6.53 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1016 - G.L.S. Store (14.17 m2)</b>						
Non Accessible						
<b>B00C - R1017 - Movement (68.71 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1017/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1018 - Stairs (21.67 m2)</b>						
No Asbestos						
<b>B00C - R1019 - Stairs (14.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1017/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration - 1978 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	65m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00E/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - M1001 - Seminar (36.14 m2)**

No Asbestos

**B00D - M1002 - Stairs (5.13 m2)**

No Asbestos

**B00D - R0001 - Movement (87.63 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00D - R0002 - Administration - Clerical (38.52 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00D - R0003 - Clinic - Boys (12.02 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					

**B00D - R0004 - Clinic-Toilets (2.09 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>

**B00D - R0005 - Clinic-Toilets (2.06 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00D - R0006 - Clinic - Girls (11.69 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					

**B00D - R0007 - Interview/Office - Type 1 (12.15 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00D - R0008 - Plant (11.36 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R0009 - Staff - Toilet (6.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00D - R0010 - Staff - Toilet (6.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00D - R0011 - Staff Study (23.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0012 - Commonroom (78.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0013 - Staff Study (17.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0014 - Interview/Office - Type 1 (13.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0015 - Careers Advisers Office (13.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0016 - Deputy Principal Office (17.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0017 - Principal Office (18.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R0018 - Duplicating Workroom (25.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					
<b>B00D - R0019 - Distribution Board Cupboard (0.77 m2)</b>						
					Note: No inspection of live electrical installation.	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Switchboard panel	Resinous Board	1Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0019/Switchboard panel/S21					<b>Chrysotile (white asbestos)</b>
Door lining	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0019/Door lining/S4					<b>Chrysotile (white asbestos)</b>
<b>B00D - R0020 - Staff Change (9.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles					
	8503/B00B/R0012/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
<b>B00D - R0021 - Movement (86.85 m2)</b>						
No Asbestos						
<b>B00D - R1001 - General Learning Space (54.82 m2)</b>						
No Asbestos						
<b>B00D - R1002 - Commonroom (10.85 m2)</b>						
No Asbestos						
<b>B00D - R1003 - Senior Seminar (42.72 m2)</b>						
No Asbestos						
<b>B00D - R1004 - Distribution Board Cupboard (0.98 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00D - R1005 - Toilets-Girls (7.15 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00D - R1006 - Toilets-Boys (7.22 m2)</b>						
No Asbestos						
<b>B00D - R1007 - Audio Visual Workroom (16.26 m2)</b>						
No Asbestos						
<b>B00D - R1008 - Main Area (215.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00D - R1009 - Seminar (13.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00D - R1010 - Seminar (13.55 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00D - R1011 - Librarian (12.21 m2)</b>						
No Asbestos						
<b>B00D - R1012 - Workroom (20.8 m2)</b>						
No Asbestos						
<b>B00D - R1013 - Entry (44.2 m2)</b>						
No Asbestos						
<b>B00D - R1014 - Cleaning Supplies Store (2.22 m2)</b>						
No Asbestos						
<b>B00D - R1015 - Movement (39.19 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00D - R1016 - Stairs (1.17 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Technological & Applied Studies - 1978 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00E/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00E - R0001 - Movement (30.36 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R1007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00E - R0002 - Dust Extraction Space (5.39 m2)**

No Asbestos

**B00E - R0005 - Movement (52.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R1007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00E - R0006 - Staff Study (36.8 m2)**

No Asbestos

**B00E - R0007 - Materials Store (31.53 m2)**

No Asbestos

**B00E - R0010 - Resource/Project Store (10.12 m2)**

No Asbestos

**B00E - R0013 - Materials Store (24.19 m2)**

No Asbestos

**B00E - R0014 - Movement (23.01 m2)**

No Asbestos

**B00E - R0015 - Materials Technology L.S. (112.29 m2)**

No Asbestos

**B00E - R0016 - Materials Technology L.S. (80.51 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - General Learning - 1981 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Eaves Linings	Flat AC Sheeting	85m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00E/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00F - R0001 - Movement (103.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	104m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00C/R1007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
<b>B00F - R0002 - Cleaning Supplies Store (6.35 m2)</b>						
No Asbestos						
<b>B00F - R0003 - General Learning Space (52.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0004 - Movement (99.78 m2)</b>						
Expansion joint	Mastic					<b>No Asbestos Detected</b>
	8503/B00F/Expansion joint/S6					
<b>B00F - R0005 - General Learning Space (51.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0006 - Computer Learning Space (51.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0007 - General Storeroom (18.61 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0008 - General Storeroom (5.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0009 - Staff Study (25.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0010 - Staff - Toilet (7.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00F - R0011 - Staff - Toilet (8.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0012 - Distribution Board Cupboard (2.05 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00F - R0013 - Toilets-Boys (17.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0014 - Toilets-Girls (8.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8503/B00B/R0014/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0015 - Stairs (7.62 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00F/R0015/Ceiling Structures/Linings/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1001 - General Learning Space (52.57 m2)</b>						
No Asbestos						
<b>B00F - R1002 - General Learning Space (51.26 m2)</b>						
No Asbestos						
<b>B00F - R1003 - General Learning Space (51.27 m2)</b>						
No Asbestos						
<b>B00F - R1004 - General Learning Space (51.12 m2)</b>						
No Asbestos						
<b>B00F - R1005 - General Storeroom (16.32 m2)</b>						
No Asbestos						
<b>B00F - R1006 - General Storeroom (1.89 m2)</b>						
No Asbestos						
<b>B00F - R1007 - Toilets-Boys (12.89 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00D/R0010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1008 - Toilets-Girls (8.52 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					
8503/B00F/R1008/Partition Walls (Cubicles)/S23					<b>No Asbestos Detected</b>	
<b>B00F - R1009 - Movement (91.07 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00C/R1007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
Expansion joint	Mastic					
8503/B00F/Expansion joint/S6					<b>No Asbestos Detected</b>	
<b>B00F - R1016 - Stairs (12.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8503/B00F/R0015/Ceiling Structures/Linings/S22					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Agricultural Science - 2007 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Agriculture Covered Area (31.29 m2)**

No Asbestos

**B00G - R0002 - Agriculture Covered Area (51.39 m2)**

No Asbestos

**B00G - R0003 - Agriculture Covered Area (42.93 m2)**

No Asbestos

**B00G - R0004 - Agriculture Covered Area (67.6 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Agricultural Science - 2007 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00H - M0001 - Sports Store (68.04 m2)**

No Asbestos

**B00H - R0001 - General Storeroom (68.1 m2)**

No Asbestos

**B00H - R0002 - General Storeroom (69.68 m2)**

No Asbestos

**B00H - R0003 - Movement Studio (70.74 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - General Learning - 2012 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B001 - R0001 - Materials Store (25.67 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D10773 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 602 - D11995 - Learning Unit - Standard With P.A.A. : Placement Date - 17/01/2017**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 603 - D12348 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 13/12/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017