

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Brisbane Water Secondary College Umina Campus (8513)
Region : Hunter/Central Coast
State Electorate : Gosford
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : Greencap-NAA : 20 - Mar - 2015



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found 8513/B00L/Ceiling Voids/S90				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Downpipes	Fibre Cement Pipe 8513/B00L/Ceiling Space - above wall lining/S91				No Asbestos Detected	

Interior

B00L - R0001 - Main Area (193.12 m2)

Ceiling Structures/Linings	Vermiculite 8513/B00L/R0010/Ceiling Structures/Linings/S54					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Air Conditioning Unit	Mastic	5m	Ductwork joints	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8513/B00L/R0010/Air Conditioning Unit/S55					

B00L - R0002 - Cleaning Store - Distributed (1.65 m2)

No Asbestos

B00L - R0003 - General Storeroom (5.79 m2)

No Asbestos

B00L - R0004 - Staff - Toilet (3.94 m2)

No Asbestos

B00L - R0005 - Library Administration (47.1 m2)

Ceiling Structures/Linings	Vermiculite 8513/B00L/R0010/Ceiling Structures/Linings/S54					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B00L - R0006 - Main Entry (14.09 m2)

Ceiling Structures/Linings	Vermiculite 8513/B00L/R0010/Ceiling Structures/Linings/S54					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B00L - R0007 - Librarian (15.18 m2)

Ceiling Structures/Linings	Vermiculite 8513/B00L/R0010/Ceiling Structures/Linings/S54					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B00L - R0008 - Staff - Toilet (4.1 m2)

Riser	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8513/B00L/R0008/Riser/S56					

B00L - R0009 - Movement (27.34 m2)

Ceiling Structures/Linings	Vermiculite 8513/B00L/R0010/Ceiling Structures/Linings/S54					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B00L - R0010 - System Administrators Office (46.51 m2)

Ceiling Structures/Linings	Vermiculite 8513/B00L/R0010/Ceiling Structures/Linings/S54					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Air Conditioning Unit	Mastic	5m2	Ductwork joints	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8513/B00L/R0010/Air Conditioning Unit/S55					

B00L - R0011 - Computer Resource (7.61 m2)

Safe Door	Encapsulated Insulation material within unit	1Unit	Egress	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Inaccessible Item
-----------	--	-------	--------	----------------------	---------	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00L - R0012 - External Movement (57.29 m2)						
No Asbestos						
B00L - R0013 - Tiered Learning Area (13.44 m2)						
Recently Modified Space Requires Inspection						
B00L - R0014 - Stairs (8.87 m2)						
Recently Modified Space Requires Inspection						
B00L - R0015 - Stairs (4.16 m2)						
Recently Modified Space Requires Inspection						
B00L - R0016 - Stairs (0.97 m2)						
Recently Modified Space Requires Inspection						
B00L - R0017 - Stairs (0.97 m2)						
Recently Modified Space Requires Inspection						
B00L - R0018 - Movement (2.85 m2)						
Recently Modified Space Requires Inspection						
B00L - R0019 - Movement (4.46 m2)						
Recently Modified Space Requires Inspection						
B00L - R0020 - Lift (2.1 m2)						
Recently Modified Space Requires Inspection						
B00L - R0021 - External Movement (28.12 m2)						
Recently Modified Space Requires Inspection						
B00L - R1001 - Seminar/Study (15.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1002 - Study Space (15.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1003 - Study Space (15.49 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1004 - Seminar/Study (15.34 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1005 - Seminar/Study (15.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1007 - Distribution Board Cupboard (0.91 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)
B00L - R1009 - Cleaning Store - Distributed (0.95 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B00L/R1008/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1010 - Stairs (2.8 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Recently Modified Space	Requires Inspection					
B00L - R1011 - Stairs (4.06 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1012 - Stairs (2.68 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1013 - Stairs (3.92 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1014 - Main Area (111.81 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1015 - Shared Study Space (102.58 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1016 - Movement (4.47 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1017 - Movement (7.37 m2)						
Recently Modified Space	Requires Inspection					
B00L - R1018 - External Movement (57.71 m2)						
Recently Modified Space	Requires Inspection					
B00L - Room+1 - Lift						
No Asbestos						
B00L - Room+2 - A/C Plant Room						
Non Accessible						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Administration - 2006 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00M - R0001 - Clinic (13.02 m2)**

No Asbestos

B00M - R0002 - Toilets-Disabled (5.8 m2)

No Asbestos

B00M - R0003 - Distribution Board Cupboard (0.88 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0004 - Staff Kitchen (13.07 m2)

No Asbestos

B00M - R0005 - Deputy Principal Office (13.01 m2)

No Asbestos

B00M - R0006 - Interview/Office - Type 1 (13.01 m2)

No Asbestos

B00M - R0007 - Interview/Office - Type 1 (13.01 m2)

No Asbestos

B00M - R0008 - Leading Teacher (13.01 m2)

No Asbestos

B00M - R0010 - External Movement (18.58 m2)

No Asbestos

B00M - R0011 - Deputy Principal Office (13.25 m2)

No Asbestos

B00M - R0012 - Principal Office (23.53 m2)

No Asbestos

B00M - R0013 - Administration - Executive (20.46 m2)

No Asbestos

B00M - R0014 - Secure Storeroom (13.23 m2)

No Asbestos

B00M - R0015 - Staff - Toilet (4.95 m2)

No Asbestos

B00M - R0016 - Staff - Toilet (4.98 m2)

No Asbestos

B00M - R0017 - Uniform Shop (12.68 m2)

No Asbestos

B00M - R0018 - Uniform Shop (12.8 m2)

No Asbestos

B00M - R0019 - Office/Store (13.05 m2)

No Asbestos

B00M - R0022 - Cleaning Store - Distributed (3.28 m2)

No Asbestos

B00M - R0023 - Ancillary Staff (5.18 m2)

No Asbestos

B00M - R0024 - Public Entry (19.78 m2)

No Asbestos

B00M - R0027 - Movement (5.53 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00M - R0028 - Movement (9.82 m2)

No Asbestos

B00M - R0029 - Administration - Clerical (82.42 m2)

No Asbestos

B00M - R0030 - Pupil Entry (27.91 m2)

No Asbestos

B00M - R0031 - Movement (13.5 m2)

No Asbestos

B00M - R0032 - External Movement (13.08 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Storage - 2013 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00N - R0001 - General Storeroom (84.45 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - Agricultural Science - 1976 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Stored Panels (loose)	Compressed AC Sheet	3m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8513/B0A1/Stored Panels (loose)/S80				Chrysotile (white asbestos)	

Interior

B0A1 - R0001 - Animal Space (32.68 m2)

Wall Linings Internal No Asbestos Found

B0A1 - R0002 - Animal Space (15.65 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A2 - Agricultural Science - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Switchbox	Resinous Board	1Unit(s)	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Electric	Assumed Asbestos - Electrical Hazard					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					

Interior

B0A2 - R0001 - Toilets-Unisex (3.73 m2)

Wall Linings Internal	Flat AC Sheeting 8513/B0A2/R0001/Wall Linings Internal/S79					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B0A2 - R0002 - Resources Store (5.32 m2)

Wall Linings Internal	Flat AC Sheeting 8513/B0A2/R0001/Wall Linings Internal/S79					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B0A2 - R0003 - Staff Study (11.52 m2)

Wall Linings Internal	Flat AC Sheeting 8513/B0A2/R0004/Wall linings behind plaster render/S44					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B0A2 - R0004 - General Learning Space (48.26 m2)

Wall linings behind plaster render	Compressed AC Sheet 8513/B0A2/R0004/Wall linings behind plaster render/S44					No Asbestos Detected
------------------------------------	---	--	--	--	--	----------------------

B0A2 - R0005 - General Learning Space (34.58 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B0A2 - R0006 - Staff Study (9.68 m2)


Wall Linings Internal	Flat AC Sheeting 8513/B0A2/R0004/Wall linings behind plaster render/S44					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B0A2 - R0007 - External Movement (29.29 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B0A2 - Room+1 - Bathroom

Wall Linings Internal	Compressed AC Sheet 8513/B0A2/Room+1/Wall Linings Internal/S43					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

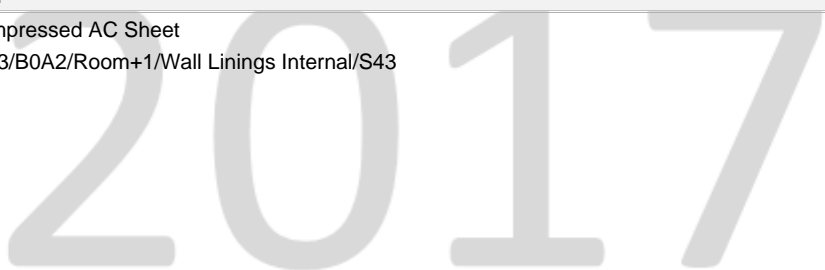

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A3 - Agricultural Science - 1976 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B0A3 - R0001 - Garden Store Room (17.06 m2)

No Asbestos

B0A3 - R0002 - Growing/Breeding (46.84 m2)

No Asbestos

B0A3 - R0006 - Machine Storage (84.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A4 - Agricultural Science - 2009 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0A4 - R0001 - Agriculture Covered Area (50.26 m2)

No Asbestos

B0A4 - R0002 - Machine Storage (49.53 m2)

No Asbestos

B0A4 - R0003 - Animal Space (101.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A5 - Agricultural Science - 2009 - Greenhouse (Greenhouse)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0A5 - R0001 - Plant Growing Space (45.09 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A6 - Agricultural Science - 2009 - Greenhouse (Greenhouse)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0A6 - R0001 - Plant Growing Space (34.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A7 - Agricultural Science - 2014 - Greenhouse (Greenhouse)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0A7 - R0001 - Plant Growing Space (72.27 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0AM - Staff/General Learning - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Wall Cladding	Compressed AC Sheet	100m2	South facing, West facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Wall Cladding/S10					Chrysotile (white asbestos)
Cement debris to ground	Compressed AC Sheet 8513/B0AM/Cement debris to ground/S11					
						No Asbestos Detected
Infill panels above windows	Compressed AC Sheet 8513/B0AM/Infill panels above windows/S12					
						No Asbestos Detected
Downpipes	Fibre Cement Pipe	30m	North facing, South facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					

Interior**B0AM - R0004 - Distribution Board Cupboard (1.37 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 8513/B0AM/R0019/Ceiling Structures/Linings/S1					
						Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)

B0AM - R0008 - Toilets-Disabled (5.42 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0AM/R0019/Ceiling Structures/Linings/S1					
						Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0AM - R0009 - Toilet - Lobby (3.43 m2)

No Asbestos

B0AM - R0010 - Staff - Toilet (16.36 m2)

No Asbestos

B0AM - R0017 - General Storeroom (9.86 m2)

No Asbestos

B0AM - R0021 - Leading Teacher (11.09 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0AM/R0019/Ceiling Structures/Linings/S1					
						Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0AM - R0022 - Staff - Toilet (6.42 m2)

Toilet partition	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S1/R0002/Partition Walls (Cubicles)/S74					Chrysotile (white asbestos)

B0AM - R0023 - Staff - Toilet (6.04 m2)

No Asbestos

B0AM - R0032 - Interview/Meeting (13.55 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0AM/R0019/Ceiling Structures/Linings/S1					
						Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0AM - R0033 - Communication Space (7.62 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R0019/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0AM - R0036 - External Movement (9.14 m2)						
Down pipe through concrete slab	Fibre Cement Pipe	2Unit(s)	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78					Chrysotile (white asbestos) , Amosite (brown asbestos)
B0AM - R0037 - External Movement (9.01 m2)						
Down pipe through concrete slab	Fibre Cement Pipe	2Unit(s)	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78					Chrysotile (white asbestos) , Amosite (brown asbestos)
B0AM - R0039 - Administration - Clerical (10.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R0019/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0AM - R0040 - Interview/Meeting (17.73 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R0019/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0AM - R0041 - Interview/Meeting (12.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R0019/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0AM - R0044 - Staff Study (188.84 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0045 - Printing/Photocopying (32.48 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0046 - Movement (10.5 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0047 - Commonroom (91.13 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0048 - Tea Room (11.41 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0049 - Tea Room (9.98 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0050 - Movement (48.93 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0051 - Interview/Meeting (13.48 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0052 - Staff Study (195.56 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0053 - External Movement (7.95 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0054 - External Stairs (15.54 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0055 - External Movement (9.54 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R0056 - External Movement (87.23 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B0AM - R0057 - External Stairs (13.02 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R1001 - Aboriginal Resource Centre (16.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1003/Ceiling Structures/Linings/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	8m2	north, east , south	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/Room+1/Wall Linings Internal/S9			Chrysotile (white asbestos)		
B0AM - R1002 - Staff Study (30.62 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/R1023/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
B0AM - R1003 - General Learning Space (52.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/R1023/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
B0AM - R1005 - General Learning Space (53.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/R1023/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
B0AM - R1006 - General Learning Space (53.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/R1023/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
B0AM - R1007 - General Learning Space (64.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/R1023/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
B0AM - R1008 - General Learning Space (64.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0AM/R1023/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
B0AM - R1009 - General Learning Space (53.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0AM/R1019/Ceiling Structures/Linings/S75			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B0AM - R1010 - Resources Store (39.75 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1011 - Cleaning Store - Distributed (1.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0AM/R1014/Ceiling Structures/Linings/S7	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1012 - Staff - Toilet (17.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0AM/R1014/Ceiling Structures/Linings/S7	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 8513/B0AM/R1014/Toilet partition/S6	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1013 - Distribution Board Cupboard (0.78 m2) Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board 8513/B00L/R1007/Electrical Mounting Board/S63	3Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0AM/R1014/Ceiling Structures/Linings/S7	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1015 - Independent Learning Space (12.61 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1016 - Leading Teacher (16.66 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1017 - Sport Equipment Store (5.82 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1018 - Leading Teacher (16.65 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Flat AC Sheeting 8513/B0AM/R1018/Wall Linings Internal/S8					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1019 - Leading Teacher (12.68 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1021 - Movement (74.24 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1022 - External Movement (59.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0AM/R1022/Ceiling Structures/Linings/S4				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0S3/R1006/Ceiling Structures/Linings/S15	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1023 - Movement (20.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0AM/R1023/Floor Coverings Res/Textile/S5	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8513/B0AM/R1019/Ceiling Structures/Linings/S75				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B0AM - R1024 - External Movement (48.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0S3/R1006/Ceiling Structures/Linings/S15	46m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0AM - R1025 - Staff - Toilet (17.97 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R1026 - General Learning Space (52.54 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R1027 - External Stairs (19.95 m2)						
Recently Modified Space	Requires Inspection					
B0AM - R1028 - External Stairs (21.16 m2)						
Recently Modified Space	Requires Inspection					
B0AM - Room+1 - Room adjacent to AMR1001						
Wall Linings Internal	Flat AC Sheeting 8513/B0AM/Room+1/Wall Linings Internal/S9	20m2	External cladding	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0AM/Room+1/Wall Linings Internal/S9	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - Art/Technological & Applied Studies - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Sunhood (Louvers)	Compressed AC Sheet	5m2	East	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0S2/Wall Cladding/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B0C1 - R0001 - Distribution Board Cupboard (0.62 m2) Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63			Chrysotile (white asbestos)		

B0C1 - R0002 - Visual Arts Store (11.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35			Chrysotile (white asbestos)		

Ceiling Structures/Linings	Vermiculite 8513/B0C1/R0008/Ceiling Structures/Linings/S66				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0C1 - R0003 - Visual Arts Workshop (23.64 m2)

No Asbestos

B0C1 - R0004 - Resources Store (4.18 m2)

No Asbestos

B0C1 - R0008 - Art Learning Space (61.83 m2)

Floor Coverings Res/Textile	Vinyl Tiles	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35			Chrysotile (white asbestos)		

Ceiling Structures/Linings	Vermiculite 8513/B0C1/R0008/Ceiling Structures/Linings/S66				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0C1 - R0011 - Art Learning Space (62.13 m2)

Recently Modified Space Requires Inspection

B0C1 - R0012 - Dark Room (32.36 m2)

Recently Modified Space Requires Inspection

B0C1 - R0013 - External Movement (45.44 m2)

Recently Modified Space Requires Inspection

B0C1 - R0014 - External Movement (1.26 m2)

Recently Modified Space Requires Inspection

B0C1 - R1001 - Distribution Board Cupboard (0.6 m2) Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Compressed AC Sheet	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0C1/R1001/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B0C1 - R1002 - Resources Store (13.51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0C1 - R1003 - Careers Advisers Office (19.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0C1 - R1004 - Fitness Laboratory (69.68 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C1 - R1005 - Movement (5.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C1 - R1006 - Materials Store (5.14 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0C1 - R1007 - Craft Store (6.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0C1 - R1008 - Materials Learning Space - Type 1 (69.83 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R1008/Ceiling Structures/Linings/S67					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	71m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0C1 - R1009 - Movement (2.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C1/R0008/Ceiling Structures/Linings/S66					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C1 - R1010 - External Movement (33.38 m2)						
Ceiling Structures/Linings	Compressed AC Sheet	31m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0C1/R1010/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C2 - Technological & Applied Studies - 1977 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Eaves to Dust Extraction Room C2R0008	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0C2/R1010/Ceiling Structures/Linings/S40					Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
8513/B0AM/Downpipes/S78					Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B0C2 - R0001 - Art Learning Space (67.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles	69m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite 8513/B0C2/R0001/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0002 - Distribution Board Cupboard (0.59 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)	

B0C2 - R0003 - Materials Store (31.68 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0C1/R0008/Ceiling Structures/Linings/S66					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0004 - Materials Learning Space - Type 1 (76.35 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0C2/R0001/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0005 - Wood Technology Bay (32.34 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0C2/R0001/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0006 - Materials Learning Space - Type 1 (77.79 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0C2/R0001/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0008 - Dust Extraction Space (7.46 m2)

Ceiling Structures/Linings	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						

B0C2 - R0010 - External Movement (55.77 m2)

Recently Modified Space Requires Inspection

B0C2 - R0011 - General Storeroom (6.41 m2)

Recently Modified Space Requires Inspection

B0C2 - R0012 - Cleaning Store - Distributed (2.95 m2)

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0C2 - R1001 - Distribution Board Cupboard (0.62 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8513/B0HC/R1008/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)
B0C2 - R1002 - Pantry (11.5 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R1009/Ceiling Structures/Linings/S65					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0C2 - R1004 - Movement (4.03 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R0001/Ceiling Structures/Linings/S34					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C2 - R1005 - Food Technology L.S. (95.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R1009/Ceiling Structures/Linings/S65					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C2 - R1006 - Laundry (14.62 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R1009/Ceiling Structures/Linings/S65					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C2 - R1007 - Preparation (16.6 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R1009/Ceiling Structures/Linings/S65					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C2 - R1008 - Office/Store (15.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R1009/Ceiling Structures/Linings/S65					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C2 - R1009 - Food Technology L.S. (94.78 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0C2/R1009/Ceiling Structures/Linings/S65					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0C2 - R1010 - External Movement (58.37 m2)						
Ceiling Structures/Linings	Compressed AC Sheet	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R1010/Ceiling Structures/Linings/S40					Chrysotile (white asbestos)
B0C2 - R1011 - Darkroom Space (1.57 m2)						
Recently Modified Space	Requires Inspection					
B0C2 - R1012 - Darkroom Space (2.13 m2)						
Recently Modified Space	Requires Inspection					
B0C2 - R1013 - Dark Room (27.43 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C3 - Materials Learning/Art/Computer Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Sunhood (Louvers)	Compressed AC Sheet	5m2	North	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0S2/Wall Cladding/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B0C3 - R0001 - General Storeroom (18.81 m2)**

Cupboard	Flat AC Sheeting	2m2	Top covering	Poor Condition - Extensive Damage (4)	Medium (2)	Medium Priority (4-5)
	8513/B0C3/R0001/Cupboard/S57			Chrysotile (white asbestos)		
Pottery Kiln\Oven	Millboard	8513/B0C3/R0001/Pottery Kiln\Oven/S58				No Asbestos Detected

B0C3 - R0002 - Resources Store (21.03 m2)

No Asbestos

B0C3 - R0003 - Distribution Board Cupboard (0.66 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63			Chrysotile (white asbestos)		

B0C3 - R0009 - Art Learning Space (65.53 m2)

Ceiling Structures/Linings	Vermiculite	8513/B0C3/R0009/Ceiling Structures/Linings/S59				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0C3 - R0010 - Staff - Toilet (4.38 m2)

Ceiling Structures/Linings	Vermiculite	8513/B0C2/R0001/Ceiling Structures/Linings/S34				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0C3 - R0011 - Garden Store Room (13.12 m2)

Ceiling Structures/Linings	Vermiculite	8513/B0C2/R0001/Ceiling Structures/Linings/S34				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0C3 - R0012 - External Movement (31.75 m2)

No Asbestos

B0C3 - R0013 - Materials Learning Space - Type 1 (114.6 m2)

Recently Modified Space Requires Inspection

B0C3 - R0014 - Welding Area (6.6 m2)

Recently Modified Space Requires Inspection

B0C3 - R1001 - Computer Learning Space (55.96 m2)

Ceiling Structures/Linings	Vermiculite	8513/B0C3/R1001/Ceiling Structures/Linings/S37				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0C3 - R1002 - Staff - Toilet (10.45 m2)

Register Issue Date : Monday, 10 Jul 2017

8513 - Brisbane Water Secondary College Umina Campus

Page 24 of 53

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C3/R1004/Toilet partition/S38				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C3/R1009/Ceiling Structures/Linings/S39				Chrysotile (white asbestos)	
B0C3 - R1003 - Distribution Board Cupboard (0.62 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63				Chrysotile (white asbestos)	
Redundant panel	Flat AC Sheeting	1m2	Lower portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8513/B0C3/R1003/Redundant panel/S36				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B0C3 - R1004 - Staff - Toilet (9.9 m2)						
Toilet partition	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C3/R1004/Toilet partition/S38				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Compressed AC Sheet	10m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0C3/R1009/Ceiling Structures/Linings/S39				Chrysotile (white asbestos)	
B0C3 - R1005 - Materials Learning Space - Type 1 (66.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0C3/R1001/Ceiling Structures/Linings/S37				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B0C3 - R1006 - Independent Learning Space (23.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C3/R1006/Floor Coverings Res/Textile/S64				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	23m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	8513/B0C1/R1001/Ceiling Structures/Linings/S32				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B0C3 - R1008 - Movement (7.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0C3/R1001/Ceiling Structures/Linings/S37				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B0C3 - R1009 - External Movement (33.51 m2)						
Ceiling Structures/Linings	Compressed AC Sheet	32m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0C3/R1009/Ceiling Structures/Linings/S39				Chrysotile (white asbestos)	
B0C3 - R1010 - Materials Learning Space - Type 1 (65.17 m2)						
Recently Modified Space	Requires Inspection					
B0C3 - R1011 - Handwashing Facilities (1.03 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C4 - Performance Learning/Pupil Facilities - 2005 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0C4 - R0001 - Toilets-Girls (24.32 m2)

No Asbestos

B0C4 - R0003 - Change (21 m2)

No Asbestos

B0C4 - R0004 - Change (20.98 m2)

No Asbestos

B0C4 - R0008 - External Movement (122.68 m2)

No Asbestos

B0C4 - R0009 - External Stairs (11.5 m2)

No Asbestos

B0C4 - R0010 - External Movement (4.85 m2)

No Asbestos

B0C4 - R0011 - Change (19.62 m2)

No Asbestos

B0C4 - R0012 - Shower (15.77 m2)

No Asbestos

B0C4 - R0013 - Change (20.56 m2)

No Asbestos

B0C4 - R0014 - Shower (15.85 m2)

No Asbestos

B0C4 - R1001 - External Stairs (15.04 m2)

No Asbestos

B0C4 - R1003 - Music Learning Space (19.47 m2)

No Asbestos

B0C4 - R1004 - Music Learning Space (19.76 m2)

No Asbestos

B0C4 - R1005 - Performance Workshop (103.75 m2)

No Asbestos

B0C4 - R1006 - Music Store (19.8 m2)

No Asbestos

B0C4 - R1008 - Distribution Board Cupboard (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0C4 - R1009 - External Movement (6.44 m2)

No Asbestos

B0C4 - R1010 - External Movement (11.88 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0EL - General Learning/Support Unit - 1985 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Wall Cladding	Compressed AC Sheet	30m2	South facing, West facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0HC/Wall Cladding/S24 Chrysotile (white asbestos) , Amosite (brown asbestos)					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids - Slab on Ground	No Asbestos Found					
window frame	Mastic	5m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0HC/R1013/Window Frame/S53 Chrysotile (white asbestos)					
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78 Chrysotile (white asbestos) , Amosite (brown asbestos)					

Interior

B0EL - R0002 - General Learning Space (66.53 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0EL/R0011/Ceiling Structures/Linings/S26 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0EL/R0005/Floor Coverings Res/Textile/S25 Chrysotile (white asbestos)					

B0EL - R0003 - General Learning Space (65.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0EL/R0011/Ceiling Structures/Linings/S26 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0EL/R0005/Floor Coverings Res/Textile/S25 Chrysotile (white asbestos)					

B0EL - R0004 - General Learning Space (51.65 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0EL/R0011/Ceiling Structures/Linings/S26 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0EL/R0005/Floor Coverings Res/Textile/S25 Chrysotile (white asbestos)					

B0EL - R0005 - Staff Study (25.4 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0EL/R0011/Ceiling Structures/Linings/S26 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0EL/R0005/Floor Coverings Res/Textile/S25 Chrysotile (white asbestos)					

B0EL - R0006 - Cleaning Store - Distributed (0.51 m2)

No Asbestos

B0EL - R0007 - Seminar/Study (41.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8513/B0EL/R0011/Ceiling Structures/Linings/S26 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B0EL - R0008 - Resources Store (4.3 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B0EL - R0009 - Distribution Board Cupboard (1 m2)					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board 8513/B0HC/R0008/Electrical Mounting Board/S62					No Asbestos Detected
B0EL - R0010 - General Learning Space (51.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B0EL - R0011 - Special Learning Space (51.8 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B0EL - R0012 - General Storeroom (2.26 m2)						
No Asbestos						
B0EL - R0013 - General Storeroom (23.67 m2)						
Toilet partition	Compressed AC Sheet 8513/B0EL/R1012/Toilet partition/S27	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B0EL - R0016 - External Movement (116.16 m2)						
Recently Modified Space	Requires Inspection					
B0EL - R0017 - Student Drinking Facilities (5.36 m2)						
Recently Modified Space	Requires Inspection					
B0EL - R0018 - External Stairs (6.03 m2)						
Recently Modified Space	Requires Inspection					
B0EL - R0019 - General Storeroom (12.31 m2)						
Recently Modified Space	Requires Inspection					
B0EL - R0020 - Chair Store (18.82 m2)						
Recently Modified Space	Requires Inspection					
B0EL - R1001 - General Learning Space (65.33 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B0EL - R1002 - General Learning Space (64.58 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0EL - R1003 - General Learning Space (51.87 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0EL - R1005 - Cleaning Store - Distributed (0.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0S3/R1003/Ceiling Structures/Linings/S20	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B0EL - R1006 - Resources Store (19.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0EL - R1007 - General Storeroom (5.47 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0EL - R1008 - Distribution Board Cupboard (0.95 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 8513/B0S3/R1003/Ceiling Structures/Linings/S20	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Mounting Board	Resinous Board 8513/B0HC/R0008/Electrical Mounting Board/S62					No Asbestos Detected
B0EL - R1009 - Computer Learning Space (72.25 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0EL - R1010 - General Learning Space (51.65 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8513/B0EL/R0005/Floor Coverings Res/Textile/S25	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B0EL - R1011 - Cleaning Store - Distributed (2.28 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R1017/Ceiling Structures/Linings/S77					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B0EL - R1015 - General Storeroom (22.29 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0EL - R1016 - Tea Room (5.02 m2)						
Recently Modified Space Requires Inspection						
B0EL - R1017 - Seminar/Study (20.15 m2)						
Recently Modified Space Requires Inspection						
B0EL - R1018 - External Movement (120.78 m2)						
Recently Modified Space Requires Inspection						
B0EL - R1019 - External Stairs (24.82 m2)						
Recently Modified Space Requires Inspection						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0HC - General Learning/Pupil Facilities - 1976 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Compressed AC Sheet 8513/B0HC/Wall Cladding/S24	30m2	South facing, West facing	Some Damage - Unsealed (3) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Downpipes	Fibre Cement Pipe 8513/B0AM/Downpipes/S78	10m2	Variable positions	Some Damage - Unsealed (3) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)

Interior**B0HC - R0001 - General Learning Space (53.09 m2)**

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0002 - General Learning Space (48.63 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0003 - Garden Store Room (6.57 m2)

No Asbestos

B0HC - R0004 - General Learning Space (53.95 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0005 - General Learning Space (51.87 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0006 - Seminar/Study (46.5 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0007 - General Storeroom (4.35 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0008 - Distribution Board Cupboard (0.86 m2)

Electrical Mounting Board	Resinous Board 8513/B0HC/R0008/Electrical Mounting Board/S62				Note: No inspection of live electrical installation.	No Asbestos Detected
---------------------------	---	--	--	--	--	----------------------

B0HC - R0009 - General Storeroom (0.49 m2)

No Asbestos

B0HC - R0010 - Resource/Project Store (30.02 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0011 - General Learning Space (51.94 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B0HC - R0012 - General Learning Space (53.24 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R0013 - Toilets-Boys (24.05 m2)						
Toilet partition	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8513/B0EL/R1012/Toilet partition/S27 Chrysotile (white asbestos)
B0HC - R0014 - Cleaning Store - Distributed (3.49 m2)						
No Asbestos						
B0HC - R0015 - Toilets-Girls (23.96 m2)						
Toilet partition	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8513/B0EL/R1012/Toilet partition/S27 Chrysotile (white asbestos)
B0HC - R0016 - General Learning Space (53.02 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0EL/R0011/Ceiling Structures/Linings/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R0020 - External Movement (225.34 m2)						
Recently Modified Space	Requires Inspection					
B0HC - R0021 - External Stairs (2.49 m2)						
Recently Modified Space	Requires Inspection					
B0HC - R0022 - General Storeroom (15.42 m2)						
Recently Modified Space	Requires Inspection					
B0HC - R1001 - General Learning Space (52.37 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R1002 - General Learning Space (48.26 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R1003 - Sport Equipment Store (6.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8513/B0HC/R1007/Ceiling Structures/Linings/S52 Chrysotile (white asbestos)
B0HC - R1004 - General Learning Space (52.73 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R1005 - General Learning Space (51.94 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R1006 - Seminar/Study (45.86 m2)						
Ceiling Structures/Linings	Vermiculite 8513/B0HC/R1006/Ceiling Structures/Linings/S51					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B0HC - R1007 - General Storeroom (4.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8513/B0HC/R1007/Ceiling Structures/Linings/S52 Chrysotile (white asbestos)
B0HC - R1008 - Distribution Board Cupboard (0.86 m2)						
Electrical Mounting Board	Resinous Board 8513/B0HC/R0008/Electrical Mounting Board/S62					Note: No inspection of live electrical installation. No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Compressed AC Sheet	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8513/B0HC/R1008/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B0HC - R1009 - Cleaning Store - Distributed (0.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0HC/R1007/Ceiling Structures/Linings/S52					Chrysotile (white asbestos)	
B0HC - R1010 - Leading Teacher (29.78 m2)						
Ceiling Structures/Linings	Vermiculite					
8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0HC - R1011 - General Learning Space (51.65 m2)						
Ceiling Structures/Linings	Vermiculite					
8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0HC - R1012 - General Learning Space (51.22 m2)						
Ceiling Structures/Linings	Vermiculite					
8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0HC - R1014 - General Learning Space (52.23 m2)						
Ceiling Structures/Linings	Vermiculite					
8513/B0HC/R1013/Ceiling Structures/Linings/S50					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0HC - R1017 - General Learning Space (51.76 m2)						
Recently Modified Space	Requires Inspection					
B0HC - R1018 - External Movement (192.22 m2)						
Recently Modified Space	Requires Inspection					
B0HC - R1019 - External Stairs (24.37 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0PM - Performance Learning - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B0PM - R0001 - General Storeroom (32.59 m2)**

No Asbestos

B0PM - R0002 - Distribution Board Cupboard (1.03 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0PM - R0003 - Cleaning Store - Distributed (2.02 m2)

No Asbestos

B0PM - R0004 - Movement Studio (156.87 m2)

No Asbestos

B0PM - R0007 - Performance Store (16.5 m2)

No Asbestos

B0PM - R0008 - Control Room (9.91 m2)

No Asbestos

B0PM - R0009 - External Movement (23.24 m2)

No Asbestos

B0PM - R0010 - Toilets-Disabled (8.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0S1 - Science Learning/Pupil Facilities - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B0S1 - R0002 - Toilets-Girls (20.41 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S1/R0002/Partition Walls (Cubicles)/S74			Chrysotile (white asbestos)		

B0S1 - R0003 - Toilets-Boys (17.36 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S1/R0002/Partition Walls (Cubicles)/S74			Chrysotile (white asbestos)		

B0S1 - R0004 - Cleaning Store - Distributed (1.67 m2)

No Asbestos

B0S1 - R0005 - Interview/Office - Type 1 (26.07 m2)

Ceiling Structures/Linings	Compressed AC Sheet	26m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1006/Ceiling Structures/Linings/S15			Chrysotile (white asbestos)		

B0S1 - R0006 - Resources Store (38.55 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8513/B0S3/R1002/Ceiling Structures/Linings/S22			No Asbestos Detected		

B0S1 - R0007 - External Movement (19.67 m2)

Recently Modified Space Requires Inspection

B0S1 - R0008 - External Stairs (11.81 m2)

Recently Modified Space Requires Inspection

B0S1 - R0009 - General Storeroom (11.83 m2)

Recently Modified Space Requires Inspection

B0S1 - R1001 - General Storeroom (19.73 m2)

Ceiling Structures/Linings	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1006/Ceiling Structures/Linings/S15			Chrysotile (white asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S1/R0002/Partition Walls (Cubicles)/S74			Chrysotile (white asbestos)		

B0S1 - R1002 - General Storeroom (17.32 m2)

Toilet partition	Flat AC Sheeting					
	8513/B0S1/R1002/Toilet partition/S23			No Asbestos Detected		

Ceiling Structures/Linings	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1006/Ceiling Structures/Linings/S15			Chrysotile (white asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S1/R0002/Partition Walls (Cubicles)/S74			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B0S1 - R1003 - Cleaning Store - Distributed (1.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8513/B0S3/R1006/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)		
B0S1 - R1004 - Resources Store (8.24 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S3/R1003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S2/R1001/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B0S1 - R1005 - Resources Store (12.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S3/R1003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S2/R1001/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B0S1 - R1006 - Movement (4.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S3/R1003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S2/R1001/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B0S1 - R1007 - Apparatus Store (37.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S2/R1001/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S3/R1003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B0S1 - R1008 - External Stairs (22.66 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0S2 - Science Learning/Computer Learning - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Wall Cladding	Compressed AC Sheet	50m2	West facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0S2/Wall Cladding/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B0S2 - R0001 - General Storeroom (18.33 m2)**

No Asbestos

B0S2 - R0002 - Computer Learning Space (94 m2)

Ceiling Structures/Linings	Vinyl Sheet	8513/B0S2/R0004/Ceiling Structures/Linings/S72					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8513/B0S2/R1001/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)			

B0S2 - R0003 - Distribution Board Cupboard (0.58 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63			Chrysotile (white asbestos)		

B0S2 - R0004 - Computer Resource (50.08 m2)

Ceiling Structures/Linings	Vermiculite	8513/B0S2/R0004/Ceiling Structures/Linings/S72					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8513/B0S2/R1001/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)			
Expansion Joint	Mastic	10m	between ceiling & walls	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8513/B0S2/R0004/Expansion Joint/S73			Chrysotile (white asbestos)			

B0S2 - R0005 - Computer Learning Space (93.99 m2)

Ceiling Structures/Linings	Vermiculite	8513/B0S2/R0004/Ceiling Structures/Linings/S72					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8513/B0S2/R1001/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)			

B0S2 - R0007 - External Movement (54.5 m2)

Recently Modified Space Requires Inspection

B0S2 - R0008 - Student Drinking Facilities (6.71 m2)

Recently Modified Space Requires Inspection

B0S2 - R0009 - External Stairs (4.88 m2)

Recently Modified Space Requires Inspection

B0S2 - R1001 - Laboratory L.S. (92.9 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	94m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S2/R1001/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8513/B0S2/R1001/Ceiling Structures/Linings/S18					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B0S2 - R1002 - Distribution Board Cupboard (0.57 m2)						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Compressed AC Sheet	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8513/B0S2/R1002/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B0S2 - R1003 - Preparation - Science (50.11 m2)						
Ceiling Structures/Linings	Vermiculite					
8513/B0S2/R1001/Ceiling Structures/Linings/S18					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S2/R1001/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B0S2 - R1004 - Laboratory L.S. (92.89 m2)						
Ceiling Structures/Linings	Vermiculite					
8513/B0S2/R1001/Ceiling Structures/Linings/S18					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B0S2 - R1006 - External Stairs (23.47 m2)						
Recently Modified Space	Requires Inspection					
B0S2 - R1007 - External Movement (37 m2)						
Recently Modified Space	Requires Inspection					
B0S2 - R1008 - External Movement (19.18 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B0S3 - Science Learning - 1986 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Downpipes	Fibre Cement Pipe	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0AM/Downpipes/S78			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B0S3 - R0001 - Laboratory L.S. (94.11 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	96m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1002/Floor Coverings Res/Textile/S21			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite 8513/B0S3/R0005/Ceiling Structures/Linings/S69				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0S3 - R0002 - Preparation - Science (54.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles	544m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1002/Floor Coverings Res/Textile/S21			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite 8513/B0S3/R0005/Ceiling Structures/Linings/S69				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0S3 - R0003 - Lift (0.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1002/Floor Coverings Res/Textile/S21			Chrysotile (white asbestos)		

B0S3 - R0004 - Distribution Board Cupboard (0.66 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	on floor (loose)	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63			Chrysotile (white asbestos)		

B0S3 - R0005 - Laboratory L.S. (94.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles	95m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1002/Floor Coverings Res/Textile/S21			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite 8513/B0S3/R0005/Ceiling Structures/Linings/S69				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R0005/Floor Coverings Res/Textile/S70			Chrysotile (white asbestos)		
Vinyl Floor Tile Backing	Adhesive (bituminous Material)	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0S3/R0005/Vinyl Floor Tile Backing/S71			Chrysotile (white asbestos)		

B0S3 - R0006 - External Movement (74.24 m2)

No Asbestos

B0S3 - R1001 - Laboratory L.S. (92.9 m2)

Ceiling Structures/Linings	Vermiculite 8513/B0S3/R1002/Ceiling Structures/Linings/S22				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0S3 - R1002 - Preparation - Science (53.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0S3/R1002/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B0S3 - R1004 - Distribution Board Cupboard (0.6 m2)						
						Note: No inspection of live electrical installation.
Electrical Mounting Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1004/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
B0S3 - R1005 - Laboratory L.S. (90.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	8513/B0S3/R1002/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B0S3 - R1006 - External Movement (74.24 m2)						
Ceiling Structures/Linings	Compressed AC Sheet	69m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8513/B0S3/R1006/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)
B0S3 - R1007 - Plant (0.74 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0SC - Multi Purpose Facilities/Pupil Facilities/Music - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior**B0SC - R0002 - Sport Equipment Store (62.22 m2)**

No Asbestos

B0SC - R0003 - Sport Equipment Store (8.32 m2)

No Asbestos

B0SC - R0004 - Main Switchroom (9.69 m2)

Electrical Mounting Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	2Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8513/B00L/R1007/Electrical Mounting Board/S63					Chrysotile (white asbestos)	

B0SC - R0005 - Cleaning Store - Distributed (2.3 m2)

No Asbestos

B0SC - R0006 - Sport Equipment Store (8.75 m2)

No Asbestos

B0SC - R0008 - Performance Store (14.01 m2)

No Asbestos

B0SC - R0009 - Movement (2.62 m2)

No Asbestos

B0SC - R0011 - Toilets-Boys (5.78 m2)

Toilet partition	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0SC/R0010/Toilet partition/S45					Chrysotile (white asbestos)	

B0SC - R0012 - Plant (3.34 m2)

No Asbestos

B0SC - R0013 - Toilets-Girls (5.86 m2)

Toilet partition	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0SC/R0010/Toilet partition/S45					Chrysotile (white asbestos)	

B0SC - R0015 - Sport Equipment Store (11.43 m2)

No Asbestos

B0SC - R0016 - Staff - Toilet (11.12 m2)

No Asbestos

B0SC - R0018 - Bulk Store (11.62 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0S3/R1002/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)	

B0SC - R0019 - Multi-Purpose Space (456.94 m2)

No Asbestos

B0SC - R0021 - External Movement (4.86 m2)

No Asbestos

B0SC - R0024 - External Movement (4.87 m2)

No Asbestos

B0SC - R0027 - Student Canteen (58.62 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Recently Modified Space	Requires Inspection					
B0SC - R0028 - Change (25.85 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0029 - Toilet - Lobby (8.81 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0030 - Shower (44.3 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0031 - Change (25.84 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0032 - Toilet - Lobby (8.81 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0033 - Chair Store (16.73 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0034 - Performance Workshop (97.51 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0035 - Movement (5.96 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0036 - External Movement (29.47 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0037 - Cleaning Store - Distributed (8.94 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0038 - External Movement (57.39 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0039 - External Stairs (3.7 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0040 - External Movement (47.9 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0041 - External Movement (263.83 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0042 - General Storeroom (8.94 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R0043 - External Stairs (3.66 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1002 - General Storeroom (12.24 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0SC/R1002/Ceiling Structures/Linings/S68					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
B0SC - R1006 - Cleaning Store - Distributed (3.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0SC/R1002/Ceiling Structures/Linings/S68					Chrysotile (white asbestos)
B0SC - R1007 - Toilets-Boys (7.02 m2)						
Ceiling Structures/Linings	Compressed AC Sheet	8m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8513/B0SC/R0010/Toilet partition/S45					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/B0SC/R1002/Ceiling Structures/Linings/S68					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0SC - R1008 - Shower (44.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8513/B0SC/R1002/Ceiling Structures/Linings/S68					Chrysotile (white asbestos)	
B0SC - R1014 - General Assistants (13.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0SC/R1002/Ceiling Structures/Linings/S68					Chrysotile (white asbestos)	
B0SC - R1015 - Music Learning Space (82.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0C2/R0001/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)	
B0SC - R1017 - Music Learning Space (79.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8513/B0SC/R1012/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
B0SC - R1019 - Change (33.99 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1020 - Toilets-Boys (6.1 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1021 - Resources Store (2.7 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1022 - General Assistants (11.31 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1023 - General Storeroom (10.7 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1024 - Control Room (14.68 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1025 - Movement (24.35 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1026 - Music Learning Space (43.04 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1027 - Change (33.92 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1028 - General Storeroom (12.67 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1029 - External Stairs (21.17 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1030 - External Stairs (21.11 m2)						
Recently Modified Space	Requires Inspection					
B0SC - R1031 - External Movement (293.58 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

BARC - General Learning/Art - 2009 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

BARC - R0002 - External Movement (17.31 m2)

No Asbestos

BARC - R0003 - General Storeroom (9.33 m2)

No Asbestos

BARC - R0004 - Art Learning Space (39.78 m2)

No Asbestos

BARC - R0005 - General Storeroom (8.19 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Demountable

Exterior

Eaves Linings	Flat AC Sheeting 8513/Build+1/Eaves Linings/S81					No Asbestos Detected
Underfloor Void - Packer in Brick Supports	Compressed AC Sheet 8513/Build+1/Underfloor Void - Packer in Brick Supports/S82					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction - Height Restriction					

Interior

Build+1 - R0001 - Movement

Steps & Floor Panel	Compressed AC Sheet 8513/Build+1/R0001/Steps & Floor Panel/S83	3m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos)
---------------------	---	-----	------------	----------------------------	------------	---

Build+1 - R0002 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

Build+1 - R0003 - Store Room

Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

Build+1 - R0004 - General Learning Space

Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	45m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

Wall Linings Internal	Flat AC Sheeting 8513/Build+1/R0004/Wall Linings Internal/S85	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	--	-----	------	--------------------	---------	---

Build+1 - R0005 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

Build+2 - Farm Building (sport/oval)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction					
Debris to Ground	AC Fragments/Debris	0.5m2	Northwest	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8513/Build+2/Debris to Ground/S87			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**Build+2 - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		

Build+2 - R0002 - Store Room

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		

Build+2 - R0003 - Animal Store Space

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		

Build+2 - R0004 - Animal Space

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+2/R0004/Wall Linings Internal/S86			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+3 - The Croft - Amenities**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Restricted Access - Flat Roof					
Underfloor Void - Packer in Brick Supports	Compressed AC Sheet 8513/Build+1/Underfloor Void - Packer in Brick Supports/S82					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**Build+3 - R0001 - Movement**

Steps	Compressed AC Sheet	2m2	North	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	8513/Build+1/R0001/Steps & Floor Panel/S83					Chrysotile (white asbestos)

Build+3 - R0002 - Boys Toilet

Partition Walls (Cubicles)	Compressed AC Sheet 8513/Build+3/R0003/Partition Walls (Cubicles)/S88					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Ceiling Structures/Linings/S84					Chrysotile (white asbestos)

Build+3 - R0003 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet 8513/Build+3/R0003/Partition Walls (Cubicles)/S88					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Ceiling Structures/Linings/S84					Chrysotile (white asbestos)

Build+3 - R0004 - Girls Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Ceiling Structures/Linings/S84					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 8513/Build+3/R0003/Partition Walls (Cubicles)/S88					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+4 - The Croft - General Learning**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Restricted Access - Flat Roof					
Eaves Linings	Flat AC Sheeting 8513/Build+1/Eaves Linings/S81					No Asbestos Detected
Underfloor Void - Packer in Brick Supports	Compressed AC Sheet 8513/Build+1/Underfloor Void - Packer in Brick Supports/S82					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**Build+4 - R0001 - Movement**

Steps & Floor Panel	Compressed AC Sheet 8513/Build+1/R0001/Steps & Floor Panel/S83	3m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos)

Build+4 - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Build+4 - R0003 - General Store Space

Floor Coverings Res/Textile	Vinyl Tiles 8513/Build+4/R0003/Floor Coverings Res/Textile/S89	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Build+4 - R0004 - General Learning Space

Ceiling Structures/Linings	Flat AC Sheeting 8513/Build+1/R0004/Ceiling Structures/Linings/S84	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 8513/Build+1/R0004/Wall Linings Internal/S85	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+5 - The Croft - General Learning**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Restricted Access - Flat Roof					
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Void - Packer in Brick Supports	Compressed AC Sheet 8513/Build+1/Underfloor Void - Packer in Brick Supports/S82					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 8513/Build+1/Eaves Linings/S81					No Asbestos Detected

Interior**Build+5 - R0001 - Movement**

Steps & Floor Panel	Compressed AC Sheet	4m2	East	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	8513/Build+1/R0001/Steps & Floor Panel/S83					Chrysotile (white asbestos)

Build+5 - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Ceiling Structures/Linings/S84					Chrysotile (white asbestos)

Build+5 - R0003 - General Learning Space

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Ceiling Structures/Linings/S84					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Wall Linings Internal/S85					Chrysotile (white asbestos) , Amosite (brown asbestos)

Build+5 - R0004 - General Store Space

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8513/Build+1/R0004/Ceiling Structures/Linings/S84					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+6 - The Croft - General Learning (2010)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

Build+6 - R0001 - Movement

No Asbestos

Build+6 - R0002 - General Learning Space

No Asbestos

Build+6 - R0003 - General Learning Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 710 - D10815 - Home Science/Pantry/Laundry : Placement Date - 12/05/1998

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R2 - Food Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	73 m2

R3 - Laundry

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

OS 601 - D12576 - Learning Unit - Standard/Withdrawal : Placement Date - 10/04/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 532 - D12804 - Library : Placement Date - 9/04/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Reading Area

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	90 m2

R2 - Library Office/Workroom

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R3 - Communications Room

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

OS 842 - D14081 - Country Toilet - Relta - Boys/Girls : Placement Date - 15/03/2002

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
Interior						
R1 - Toilets-Girls						
No Asbestos Found.						
R2 - Staff Toilet						
No Asbestos Found.						
R3 - Toilets-Boys						
No Asbestos Found.						
R4 - Staff Toilet						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8513_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017