


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blaxland High School (8522)
Region : Western Sydney
State Electorate : Blue Mountains
Local Government Area : Blue Mountains

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 07 - Oct - 2015

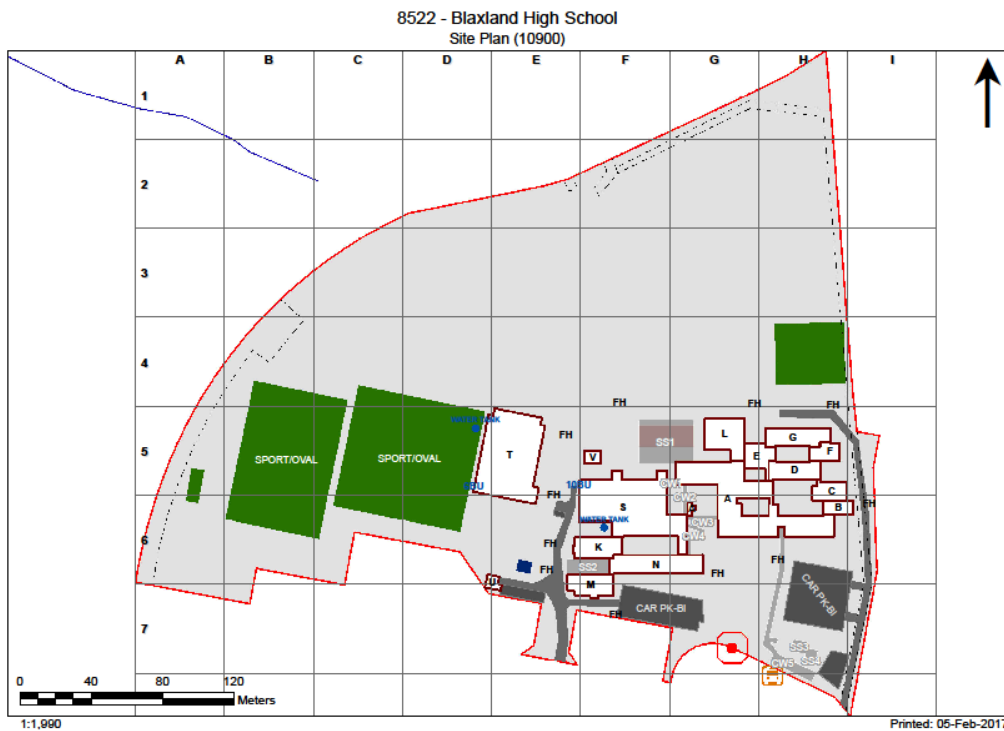

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	120m	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/Gable Verge Lining/S100				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor voids	No Asbestos Found					
Ceiling voids	No Asbestos Found					

Interior**B00A - R0001 - Public Entry (32.78 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0001/Ceiling Structures/Linings/S36					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Toilets-Disabled (5.37 m2)

No Asbestos

B00A - R0003 - Staff - Toilet (2.99 m2)

No Asbestos

B00A - R0004 - Utility Space (22.09 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0004/Ceiling Structures/Linings/S37					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00A - R0005 - Administration - Clerical (25.44 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0005/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Ancillary Staff (26.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0006/Ceiling Structures/Linings/S39					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Leading Teacher (14.33 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0007/Ceiling Structures/Linings/S40					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Principal Office (25.41 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0008/Ceiling Structures/Linings/S41					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Administration - Clerical (13.13 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0009/Ceiling Structures/Linings/S42					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Clinic - Boys (15.12 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0010/Ceiling Structures/Linings/S43					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - Clinic-Toilets (2.76 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00A/R0011/Ceiling Structures/Linings/S44					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0012 - Clinic-Toilets (2.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0012/Ceiling Structures/Linings/S45					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0013 - Clinic - Girls (15.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0013/Ceiling Structures/Linings/S46					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R0014 - Interview/Office - Type 1 (12.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0014/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Interview/Office - Type 1 (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0015/Ceiling Structures/Linings/S48					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0016 - General Storeroom (7.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0016/Ceiling Structures/Linings/S50					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R0017 - Movement (42.87 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0017/Ceiling Structures/Linings/S51					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0018 - Deputy Principal Office (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0018/Ceiling Structures/Linings/S52					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Movement (20.93 m2)						
No Asbestos						
B00A - R0021 - Cleaning Store - Distributed (2.78 m2)						
No Asbestos						
B00A - R0023 - Main Switchroom (12.96 m2)						
Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R0023/Electrical Mounting Board/S4					Chrysotile (white asbestos)
B00A - R0024 - Staff - Toilet (7.98 m2)						
No Asbestos						
B00A - R0025 - Movement (2.57 m2)						
No Asbestos						
B00A - R0026 - Staff - Toilet (7.98 m2)						
No Asbestos						
B00A - R0028 - General Storeroom (7.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00A/R0028/Ceiling Structures/Linings/S53					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0029 - General Storeroom (3.9 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0031 - Shared Study Space (88.56 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0031/Ceiling Structures/Linings/S55			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0033 - Movement (149.4 m2)						
No Asbestos						
B00A - R0034 - Laboratory L.S. (93.32 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0034/Ceiling Structures/Linings/S57			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0035 - Lift (0.27 m2)						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0036 - Preparation (47.83 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0036/Ceiling Structures/Linings/S58			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0037 - Laboratory L.S. (93.33 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0037/Ceiling Structures/Linings/S59			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0039 - Distribution Board Cupboard (0.56 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0040 - Apparatus Store (33.57 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0040/Ceiling Structures/Linings/S61			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0041 - Laboratory L.S. (97.91 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0041/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0042 - Preparation (48.49 m2)						
Ceiling Structures/Linings	Vermiculite		8522/B00A/R0042/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8522/B00A/R0042/Floor Coverings Res/Textile/S1			No Asbestos Detected
B00A - R0043 - Laboratory L.S. (97.91 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8522/B00A/R0043/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R0044 - Lift (21.29 m2)						
No Asbestos						
B00A - R0046 - Commonroom (120.67 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R0046/Ceiling Structures/Linings/S9					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0047 - Movement (24.36 m2)						
No Asbestos						
B00A - R0048 - Cleaning Store - Distributed (4.63 m2)						
No Asbestos						
B00A - R0050 - Student Drinking Facilities (0.85 m2)						
No Asbestos						
B00A - R0051 - Movement (3.9 m2)						
No Asbestos						
B00A - R0052 - Lift (1.67 m2)						
No Asbestos						
B00A - R0053 - Movement (6.21 m2)						
No Asbestos						
B00A - R0054 - No Access (4.93 m2)						
No Asbestos						
B00A - R0055 - Movement (46.17 m2)						
No Asbestos						
B00A - R0056 - Movement (74.78 m2)						
No Asbestos						
B00A - R0057 - Staff Study (26.14 m2)						
No Asbestos						
B00A - R0058 - Movement (7.39 m2)						
No Asbestos						
B00A - R0059 - Stairs (16.94 m2)						
No Asbestos						
B00A - R0060 - Stairs (6.84 m2)						
No Asbestos						
B00A - R0061 - Preparation - Science (15.09 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00E/R1007/Ceiling Structures/Linings/S164					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0062 - Chemical Store (15.37 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00E/R1007/Ceiling Structures/Linings/S164					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0063 - Movement (13.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8522/B00A/R1040/Ceiling Structures/Linings/S154	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0064 - Stairs (8.19 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00A/R1040/Ceiling Structures/Linings/S154					Chrysotile (white asbestos)	
B00A - R1001 - General Learning Space (52.57 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1001/Ceiling Structures/Linings/S10						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1002/Ceiling Structures/Linings/S11						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - General Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1003/Ceiling Structures/Linings/S12						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - General Learning Space (52.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1004/Ceiling Structures/Linings/S13						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1005 - Staff Study (40.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1005/Ceiling Structures/Linings/S14						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Interview/Office - Type 1 (17.65 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1006/Ceiling Structures/Linings/S15						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - General Learning Space (48.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1008/Ceiling Structures/Linings/S16						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - General Learning Space (51.83 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1009/Ceiling Structures/Linings/S17						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - Staff Study (24.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1010/Ceiling Structures/Linings/S18						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - Distribution Board Cupboard (0.7 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00A - R1012 - Computer Learning Space (51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1012/Ceiling Structures/Linings/S19						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1013 - Computer Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1013/Ceiling Structures/Linings/S20						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1014 - Staff - Toilet (4.8 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8522/B00A/R1014/Ceiling Structures/Linings/S21						
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1015 - Staff - Toilet (4.35 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1015/Ceiling Structures/Linings/S22					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1016 - Cleaning Store - Distributed (2.72 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1017 - Movement (54.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1018 - Laboratory L.S. (93.32 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1018/Ceiling Structures/Linings/S24					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R1019 - Lift (0.27 m2)						
No Asbestos						
B00A - R1020 - Preparation (46.89 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1020/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R1021 - Laboratory L.S. (93.32 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1021/Ceiling Structures/Linings/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R1023 - Distribution Board Cupboard (0.56 m2)						
Electrical Mounting Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1025 - Movement (123.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	124m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1026 - Chemical Store (13.32 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1026/Ceiling Structures/Linings/S28					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1027 - General Learning Space (65.5 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1027/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1028 - General Learning Space (56.58 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1028/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1029 - General Learning Space (56.58 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1029/Ceiling Structures/Linings/S31					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1030 - General Learning Space (65.79 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1030/Ceiling Structures/Linings/S32					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1031 - Movement (22.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1007/Ceiling Structures/Linings/S2 Chrysotile (white asbestos)
B00A - R1033 - Staff Study (55.01 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1033/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1034 - General Storeroom (9.58 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00A/R1034/Ceiling Structures/Linings/S62					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R1035 - Movement (3.9 m2)						
No Asbestos						
B00A - R1037 - Movement (6.4 m2)						
No Asbestos						
B00A - R1038 - Stairs (7.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
B00A - R1039 - Movement (20.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
B00A - R1040 - Plant (0.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	South, East & West	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
B00A - R1041 - Stairs (7.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
B00A - R1042 - Stairs (11.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
B00A - R1043 - General Storeroom (12.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8522/B00A/R1040/Ceiling Structures/Linings/S154 Chrysotile (white asbestos)
B00A - R1044 - Movement (110.89 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	111m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00A/R1040/Ceiling Structures/Linings/S154					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00B/Gable Verge Lining/S101					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00B - R0001 - General Learning Space (50.82 m2)**

Ceiling Structures/Linings	Vermiculite					
	8522/B00B/R0001/Ceiling Structures/Linings/S63					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0002 - General Learning Space (51.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00B/R0002/Ceiling Structures/Linings/S65					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Distribution Board Cupboard (0.64 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0004 - Movement (13.83 m2)

No Asbestos

B00B - R1001 - Movement (13.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R1002 - Cleaning Store - Distributed (1.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R1003 - General Storeroom (5.4 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R1004 - Staff - Toilet (4.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R1005 - Resources (51.48 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00B/R1005/Ceiling Structures/Linings/S66					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R1006 - Staff Study (38.42 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00B/R1006/Ceiling Structures/Linings/S67					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00B - R1007 - Distribution Board Cupboard (1.02 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1985 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/Gable Verge Lining/S102					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior

B00C - R0001 - General Learning Space (51.26 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00C/R0001/Ceiling Structures/Linings/S69					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R0002 - General Learning Space (51.26 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00C/R0002/Ceiling Structures/Linings/S70					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R0003 - Movement (49.23 m2)

No Asbestos

B00C - R0005 - Student Drinking Facilities (1.1 m2)

No Asbestos

B00C - R0006 - Garden Store Room (4.22 m2)

No Asbestos

B00C - R0007 - Movement (17.96 m2)

No Asbestos

B00C - R0008 - Stairs (5.1 m2)

No Asbestos

B00C - R1001 - General Learning Space (51.12 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00C/R1001/Ceiling Structures/Linings/S71					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R1002 - General Learning Space (51.11 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00C/R1002/Ceiling Structures/Linings/S72					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R1003 - Movement (49.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R1005 - Movement (23.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/R1005/Ceiling Structures/Linings/S155					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1040/Ceiling Structures/Linings/S154					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/R1005/Ceiling Structures/Linings/S155					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00C/R1005/Ceiling Structures/Linings/S157				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1006 - Stairs (6.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00C/R1005/Ceiling Structures/Linings/S155				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00C/R1005/Ceiling Structures/Linings/S155				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00C/R1005/Ceiling Structures/Linings/S155				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00C/R1005/Ceiling Structures/Linings/S155				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00D/Gable Verge Lining/S103					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00D - R0001 - Interview/Office - Type 1 (14.55 m2)**

Ceiling Structures/Linings	Vermiculite					
	8522/B00D/R0001/Ceiling Structures/Linings/S73					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0002 - Toilets-Girls (19.05 m2)

No Asbestos

B00D - R0003 - Distribution Board Cupboard (0.64 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0004 - General Learning Space (51.12 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00D/R0004/Ceiling Structures/Linings/S74					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0005 - General Learning Space (51.12 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00D/R0005/Ceiling Structures/Linings/S76					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0006 - Toilets-Boys (19.98 m2)

No Asbestos

B00D - R0007 - General Assistants (14.55 m2)

No Asbestos

B00D - R0009 - Movement (92.35 m2)

No Asbestos

B00D - R1001 - Interview/Office - Type 1 (14.55 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R1002 - Toilets-Boys (16.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R1003 - Cleaning Store - Distributed (2.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R1004 - Distribution Board Cupboard (0.64 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R1005 - General Learning Space (51.47 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00D/R1005/Ceiling Structures/Linings/S77					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R1006 - General Learning Space (51.12 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8522/B00D/R1006/Ceiling Structures/Linings/S78					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1007 - Toilets-Girls (19.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00D - R1008 - Interview/Office - Type 1 (14.4 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00D/R1008/Ceiling Structures/Linings/S79					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1010 - Movement (87.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	88m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00E/Gable Verge Lining/S104					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00E - R0001 - Movement (114.84 m2)**

No Asbestos

B00E - R0002 - Performing Arts Store (15.92 m2)

No Asbestos

B00E - R0003 - General Storeroom (2.51 m2)

No Asbestos

B00E - R0005 - Movement (30.58 m2)

No Asbestos

B00E - R0006 - Student Drinking Facilities (3.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R0007 - Movement (13.67 m2)

No Asbestos

B00E - R0008 - Stairs (3.13 m2)

No Asbestos

B00E - R0009 - Movement (32.14 m2)

No Asbestos

B00E - R1001 - General Learning Space (53.29 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00E/R1001/Ceiling Structures/Linings/S81					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1002 - Movement (20.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R1003 - General Storeroom (5.1 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R1005 - Movement (13.67 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R1006 - General Storeroom (7.06 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite					
	8522/B00E/R1007/Ceiling Structures/Linings/S164					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1007 - Staff Study (17.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00E/R1007/Ceiling Structures/Linings/S164					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1008 - Stairs (26.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/R1005/Ceiling Structures/Linings/S155					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/R1005/Ceiling Structures/Linings/S155					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/R1005/Ceiling Structures/Linings/S155					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00C/R1005/Ceiling Structures/Linings/S155					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00F/Gable Verge Lining/S105					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00F - R0001 - Disabled Toilet (5.07 m2)**

No Asbestos

B00F - R0002 - General Storeroom (6.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00F - R0003 - Distribution Board Cupboard (0.88 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0004 - Staff Study (36.39 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00F/R0004/Ceiling Structures/Linings/S83					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0005 - Staff Study (26.83 m2)

Ceiling Structures/Linings	Vermiculite					
	8522/B00F/R0005/Ceiling Structures/Linings/S85					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0006 - Movement (23.76 m2)

No Asbestos

B00F - R0007 - Cleaning Store - Distributed (7.7 m2)

No Asbestos

B00F - R0008 - Movement (13.99 m2)

No Asbestos

B00F - R0009 - Student Drinking Facilities (3.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00F - R0010 - Stairs (14.23 m2)

No Asbestos

B00F - R1001 - Staff - Toilet (4.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00F - R1002 - Cleaning Store - Distributed (1.83 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00F - R1003 - General Storeroom (3.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00F - R1004 - Distribution Board Cupboard (0.72 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R1005 - Staff Study (31.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00F/R1005/Ceiling Structures/Linings/S86					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1006 - Staff Study (32.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00F/R1006/Ceiling Structures/Linings/S87					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1007 - Movement (23.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	24m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00F - R1008 - Movement (14.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00F - R1009 - Stairs (26.24 m2)						
Wall Linings Internal	Flat AC Sheeting	10m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00F/R1009/Wall Linings Internal/S162					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00G/Gable Verge Lining/S106				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00G - R0001 - Duplicating Workroom (51.84 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R0001/Ceiling Structures/Linings/S88					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R0002 - General Learning Space (51.84 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R0002/Ceiling Structures/Linings/S89					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R0003 - General Learning Space (51.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R0003/Ceiling Structures/Linings/S90					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R0004 - General Learning Space (51.84 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R0004/Ceiling Structures/Linings/S91					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R0005 - General Learning Space (51.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R0005/Ceiling Structures/Linings/S92					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R0006 - Movement (61.79 m2)

No Asbestos

B00G - R1001 - General Learning Space (51.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R1001/Ceiling Structures/Linings/S93					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R1002 - General Learning Space (51.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R1002/Ceiling Structures/Linings/S94					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R1003 - General Learning Space (51.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R1003/Ceiling Structures/Linings/S95					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R1004 - General Learning Space (51.48 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R1004/Ceiling Structures/Linings/S96					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R1005 - General Learning Space (51.47 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00G/R1005/Ceiling Structures/Linings/S98					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00G - R1006 - Movement (59.84 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Technological & Applied Studies - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00K/Gable Verge Lining/S34					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00K - R0006 - Distribution Board Cupboard (0.59 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00K - R0008 - External Movement (7.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)

B00K - R0009 - Materials Store (27.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)

B00K - R0010 - External Movement (7 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)

B00K - R0011 - General Storeroom (3.95 m2)

No Asbestos

B00K - R0012 - General Learning Space - Type 6 (30 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00K/R0012/Ceiling Structures/Linings/S163					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00K - R0013 - Metal Technology Bay (158.24 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00K/R0012/Ceiling Structures/Linings/S163					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00K - R0014 - Welding Area (3.82 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00K/R0012/Ceiling Structures/Linings/S163					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00K - R0015 - Welding Area (3.82 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00K/R0012/Ceiling Structures/Linings/S163					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00K - R0016 - Movement (38.74 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R0017 - Stairs (6.52 m2)						
No Asbestos						
B00K - R1001 - Movement (24.19 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	
B00K - R1002 - Stairs (6.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00L/Gable Verge Lining/S107				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00L - R0001 - Staff - Toilet (5.89 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0001/Ceiling Structures/Linings/S105					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0002 - Staff - Toilet (5.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0002/Ceiling Structures/Linings/S106					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0005 - Distribution Board Cupboard (0.9 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00L/R0005/Electrical Mounting Board/S105					Chrysotile (white asbestos)

B00L - R0006 - Workroom (22.58 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0006/Ceiling Structures/Linings/S108					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0007 - Workroom (24.48 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0007/Ceiling Structures/Linings/S109					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0009 - Seminar (9.05 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0009/Ceiling Structures/Linings/S110					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0010 - Seminar (12 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0010/Ceiling Structures/Linings/S111					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0011 - Workroom (11.73 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0011/Ceiling Structures/Linings/S112					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0012 - Seminar (9.18 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0012/Ceiling Structures/Linings/S113					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0013 - General Storeroom (9.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00L - R0015 - Main Area (235.99 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00L/R0015/Ceiling Structures/Linings/S114					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0016 - General Storeroom (5.77 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00L - R0017 - Workroom (17.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00L/R0017/Ceiling Structures/Linings/S115					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0018 - Movement (7.02 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00L/R0018/Ceiling Structures/Linings/S116					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0019 - Entry (21.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00L/R0019/Ceiling Structures/Linings/S117					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0020 - Stairs (1.45 m2)						
No Asbestos						
B00L - R0021 - Stairs (1.43 m2)						
No Asbestos						
B00L - R1002 - Main Area (244.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00L/R1002/Ceiling Structures/Linings/S118					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1003 - General Storeroom (16.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00L/R1003/Ceiling Structures/Linings/S120					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1004 - Stairs (5.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00E/R1007/Ceiling Structures/Linings/S164					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1005 - Stairs (5.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00E/R1007/Ceiling Structures/Linings/S164					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Technological & Applied Studies - 1985 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00M/Gable Verge Lining/S35					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00M - R0001 - Distribution Board Cupboard (0.64 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00M - R0002 - Materials Technology L.S. (81.66 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00M/R0002/Ceiling Structures/Linings/S121					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00M - R0003 - Dust Extraction Space (6.6 m2)

No Asbestos

B00M - R0004 - No Access (19.07 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00M/R0004/Ceiling Structures/Linings/S123					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00M - R0005 - Wood Technology Bay (13.51 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00M/R0005/Ceiling Structures/Linings/S124					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00M - R0006 - Materials Technology L.S. (82.34 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00M/R0006/Ceiling Structures/Linings/S125					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00M - R0007 - Resource/Project Store (26.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00M - R0008 - Movement (50.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Art/Technological & Applied Studies - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00N/Gable Verge Lining/S108					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00N - R0001 - Staff Study (34.96 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00N/R0001/Ceiling Structures/Linings/S126					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00N - R0002 - General Storeroom (3.96 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00N/R0002/Ceiling Structures/Linings/S127					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00N - R0003 - Staff - Toilet (2.21 m2)

No Asbestos

B00N - R0004 - Staff - Toilet (10.73 m2)

No Asbestos

B00N - R0005 - Staff - Toilet (10.61 m2)

No Asbestos

B00N - R0006 - Movement (4.79 m2)

No Asbestos

B00N - R0007 - Cleaning Store - Distributed (2.38 m2)

No Asbestos

B00N - R0008 - Distribution Board Cupboard (0.85 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00N/R0008/Electrical Mounting Board/S128					Chrysotile (white asbestos)

B00N - R0009 - Toilets-Boys (25.98 m2)

No Asbestos

B00N - R0010 - Toilets-Girls (25.03 m2)

No Asbestos

B00N - R0011 - Art Learning Space (52.72 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00N/R0011/Ceiling Structures/Linings/S129					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00N - R0012 - Art Learning Space (52.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00N/R0012/Ceiling Structures/Linings/S130					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00N - R0015 - Art Learning Space (52.7 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8522/B00N/R0015/Ceiling Structures/Linings/S133					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R0016 - Workshop (17.42 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00N/R0016/Ceiling Structures/Linings/S135					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R0017 - Movement (122.15 m2)						
No Asbestos						
B00N - R0018 - External Movement (19.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8522/B00S/R1023/Ceiling Structures/Linings/S158					
B00N - R0019 - General Learning Space - Type 12 (60.91 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00K/R0012/Ceiling Structures/Linings/S163					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00N - R1003 - Distribution Board Cupboard (0.8 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00N - R1004 - Design L.S. (52.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00N - R1005 - Staff Study (35.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00N - R1006 - Cleaning Store - Distributed (3.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00N - R1007 - Staff Study (26.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00N - R1008 - Design L.S. (65.71 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00N/R1008/Ceiling Structures/Linings/S136					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R1009 - General Storeroom (6.81 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00N/R1009/Ceiling Structures/Linings/S137					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R1010 - Preparation (7.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00N/R1010/Ceiling Structures/Linings/S138					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R1011 - Movement (2.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00N - R1012 - General Learning Space (65.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00N/R1012/Ceiling Structures/Linings/S139					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R1013 - Staff Study (17.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00N/R1013/Ceiling Structures/Linings/S140					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00N - R1014 - Movement (119.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00A/R1007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00N - R1015 - Design L.S. (73.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8522/B00N/R1015/Ceiling Structures/Linings/S141					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Physical Education - 1985 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	60m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/Gable Verge Lining/S109					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling voids	No Asbestos Found					
Underfloor voids	No Asbestos Found					

Interior**B00S - R0001 - Sport Equipment Store (19.34 m2)**

No Asbestos

B00S - R0003 - Cleaning Store - Distributed (6.06 m2)

No Asbestos

B00S - R0006 - Staff Change (11.08 m2)

No Asbestos

B00S - R0007 - Staff Change (11.08 m2)

No Asbestos

B00S - R0009 - Gymnasium (453.17 m2)

No Asbestos

B00S - R0010 - Sport Equipment Store (49.31 m2)

No Asbestos

B00S - R0011 - Distribution Board Cupboard (0.57 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00S - R0012 - Materials Store (38.45 m2)

No Asbestos

B00S - R0016 - Student Canteen (61.57 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8522/B00S/R0016/Ceiling Structures/Linings/S143					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00S - R0017 - General Storeroom (8.23 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00S - R0018 - Movement (3.42 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00S - R0019 - Distribution Board Cupboard (0.82 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8522/B00S/R0019/Electrical Mounting Board/S144					Chrysotile (white asbestos)

B00S - R0020 - General Storeroom (5.82 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8522/B00A/R0042/Floor Coverings Res/Textile/S1					

B00S - R0021 - Staff - Toilet (3.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00S - R0022 - Toilets-Disabled (10.51 m2)						
No Asbestos						
B00S - R0023 - Cleaning Store - Distributed (5.5 m2)						
No Asbestos						
B00S - R0024 - Movement (26.86 m2)						
No Asbestos						
B00S - R0026 - General Storeroom (1.89 m2)						
No Asbestos						
B00S - R0027 - General Storeroom (1.89 m2)						
No Asbestos						
B00S - R0028 - Movement (98.63 m2)						
No Asbestos						
B00S - R0029 - Covered Area (257.73 m2)						
No Asbestos						
B00S - R0030 - Senior Study (33.23 m2)						
No Asbestos						
B00S - R0031 - Movement (185.85 m2)						
No Asbestos						
B00S - R0032 - Stairs (17.4 m2)						
No Asbestos						
B00S - R0033 - Stairs (17.21 m2)						
No Asbestos						
B00S - R0034 - Cleaning Store - Distributed (8.7 m2)						
No Asbestos						
B00S - R0035 - Stairs (14.34 m2)						
No Asbestos						
B00S - R0036 - Change (13.29 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0037 - Movement (10.47 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0038 - Change (10.36 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0039 - Change (15.89 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0040 - Movement (3.52 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0041 - Toilets - Boys/Girls (6.39 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0042 - Movement (4.86 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8522/B00S/R0036/Wall Linings Internal/S161				
B00S - R0043 - General Storeroom (14.18 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting 8522/B00S/R0036/Wall Linings Internal/S161					No Asbestos Detected
B00S - R0044 - Dark Room (44.71 m2)						
Wall Linings Internal	Flat AC Sheeting 8522/B00S/R0044/Wall Linings Internal/S160					No Asbestos Detected
B00S - R0045 - General Storeroom (2.92 m2)						
No Asbestos						
B00S - R0046 - Dark Room (10.73 m2)						
No Asbestos						
B00S - R0047 - General Storeroom (6.56 m2)						
No Asbestos						
B00S - R0048 - Stairs (29.64 m2)						
No Asbestos						
B00S - R0049 - Movement (11.39 m2)						
No Asbestos						
B00S - R1001 - Toilets-Boys (38.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8522/B00A/R1007/Ceiling Structures/Linings/S2	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00S - R1002 - Distribution Board Cupboard (0.61 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 8522/B00A/R1007/Ceiling Structures/Linings/S2	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00S - R1003 - General Storeroom (4.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8522/B00A/R1007/Ceiling Structures/Linings/S2	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00S - R1004 - Toilets-Girls (34.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8522/B00A/R1007/Ceiling Structures/Linings/S2	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00S - R1005 - Food Technology L.S. (102.11 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1005/Ceiling Structures/Linings/S145					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00S - R1006 - Laundry (15.84 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1006/Ceiling Structures/Linings/S146					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00S - R1007 - Preparation (10.45 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1007/Ceiling Structures/Linings/S147					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00S - R1008 - Pantry (5.03 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1008/Ceiling Structures/Linings/S148					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00S - R1009 - Food/Research Space (15.84 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1009/Ceiling Structures/Linings/S149					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00S - R1010 - Food Technology L.S. (100.28 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1010/Ceiling Structures/Linings/S150					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8522/B00A/R0042/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00S - R1011 - Chair Store (24.31 m2)						
No Asbestos						
B00S - R1012 - Chair Store (9.9 m2)						
No Asbestos						
B00S - R1013 - Chair Store (9.9 m2)						
No Asbestos						
B00S - R1014 - Movement (124.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	125m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00S - R1016 - Music Learning Space (71.55 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1016/Ceiling Structures/Linings/S151					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00S - R1017 - Music Learning Space (91.79 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1017/Ceiling Structures/Linings/S152					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00S - R1018 - Music Store (8.44 m2)						
Ceiling Structures/Linings	Vermiculite 8522/B00S/R1018/Ceiling Structures/Linings/S153					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00S - R1019 - Movement (127.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	128m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00S - R1020 - Movement (27.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
	8522/B00A/R1007/Ceiling Structures/Linings/S2					
B00S - R1021 - Stairs (24.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
	8522/B00S/R1023/Ceiling Structures/Linings/S158					
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
	8522/B00S/R1023/Ceiling Structures/Linings/S158					
B00S - R1022 - Control Room (10.51 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00S - R1023 - Stairs (24.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S156					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	

B00S - R1024 - Movement (25.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	

B00S - R1025 - Stairs (14.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00S/R1023/Ceiling Structures/Linings/S158					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00T - Physical Education - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00T - M0002 - Stairs (4.8 m2)**

No Asbestos

B00T - M0003 - Stairs (2.87 m2)

No Asbestos

B00T - M0004 - Other-Not Used (26.03 m2)

No Asbestos

B00T - M0005 - Other-Not Used (17.45 m2)

No Asbestos

B00T - M0006 - Other-Not Used (2.16 m2)

No Asbestos

B00T - M0007 - Other-Not Used (124.69 m2)

No Asbestos

B00T - R0001 - Public Entry (15.34 m2)

No Asbestos

B00T - R0002 - Administration - Clerical (13.94 m2)

No Asbestos

B00T - R0003 - Communications Cupboard (0.31 m2)

No Asbestos

B00T - R0004 - Distribution Board Cupboard (0.3 m2)

No Asbestos

Note: No inspection of live electrical installation.

B00T - R0005 - Disabled Toilet (5.75 m2)

No Asbestos

B00T - R0006 - Shower/Change (14.75 m2)

No Asbestos

B00T - R0007 - Toilets - Girls (8.2 m2)

No Asbestos

B00T - R0008 - Movement (7.4 m2)

No Asbestos

B00T - R0009 - Toilets - Girls (8.09 m2)

No Asbestos

B00T - R0010 - Shower/Change (14.62 m2)

No Asbestos

B00T - R0011 - Cleaning Store - Distributed (6.4 m2)

No Asbestos

B00T - R0012 - Stairs (2.81 m2)

No Asbestos

B00T - R0013 - Shower/Change (14.82 m2)

No Asbestos

B00T - R0014 - Toilets - Boys (8.13 m2)

No Asbestos

B00T - R0015 - Movement (9.59 m2)

No Asbestos

B00T - R0016 - Toilets - Boys (7.68 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00T - R0017 - Shower/Change (14.74 m2)

No Asbestos

B00T - R0018 - Sport Equipment Store (12.23 m2)

No Asbestos

B00T - R0019 - Staff Study (26.24 m2)

No Asbestos

B00T - R0020 - Movement (7.48 m2)

No Asbestos

B00T - R0021 - Multi-Purpose Space (1210.33 m2)

No Asbestos

B00T - R0022 - Stairs (1.66 m2)

No Asbestos

B00T - R0023 - Performance Store (64.96 m2)

No Asbestos

B00T - R0024 - Sport Equipment Store (44.44 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Building Services - 1985 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00U - R0001 - General Assistants (16.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00U/R0001/Ceiling Structures/Linings/S159					Chrysotile (white asbestos)	

B00U - R0002 - General Assistants (11.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8522/B00U/R0001/Ceiling Structures/Linings/S159					Chrysotile (white asbestos)	

B00U - R0003 - General Assistants (13.16 m2)

No Asbestos

B00U - R0004 - General Assistants (12.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - Building Services - 2009 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00V - R0001 - Chair Store (63.16 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017