


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Belmore Boys High School (8804)
Region : South Western Sydney
State Electorate : Canterbury
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

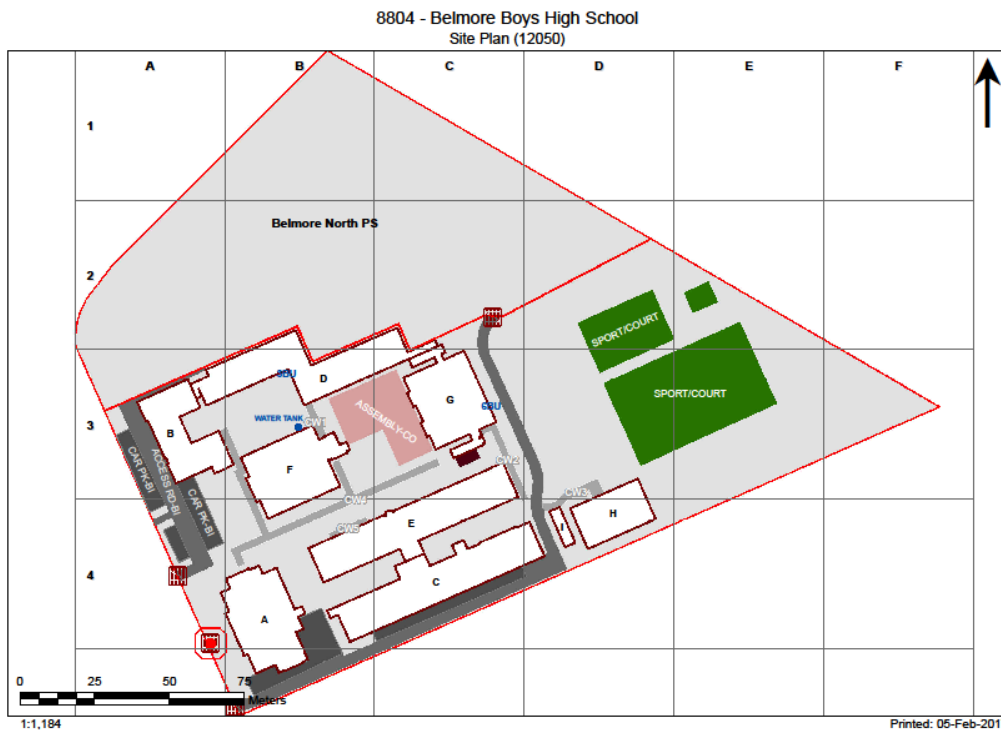

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1927 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Height						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	AC Pipe	10m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00A/Ceiling Voids/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Flat AC Sheeting Debris	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00A/Ceiling Voids/S23			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00A - R0001 - General Storeroom (8.68 m2)**

No Asbestos

B00A - R0002 - General Learning Space (54.36 m2)

No Asbestos

B00A - R0007 - Clinic - Girls (7.8 m2)

No Asbestos

B00A - R0010 - Cleaning Store - Distributed (9.36 m2)

No Asbestos

B00A - R0011 - External Movement (4.78 m2)

No Asbestos

B00A - R0012 - Commonroom (54.49 m2)

No Asbestos

B00A - R0013 - Administration - Clerical (35.12 m2)

No Asbestos

B00A - R0014 - Pupil Entry (19.87 m2)

No Asbestos

B00A - R0015 - External Movement (44.76 m2)

No Asbestos

B00A - R0016 - Principal Office (22.52 m2)

No Asbestos

B00A - R0017 - General Storeroom (2.78 m2)

No Asbestos

B00A - R0018 - Security Store (8.1 m2)

Floor Coverings Res/Textile	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00A/R0018/Floor Coverings Res/Textile/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0019 - General Learning Space (54.42 m2)

No Asbestos

B00A - R0020 - Secure Storeroom (9 m2)

No Asbestos

B00A - R0021 - Movement (25.32 m2)

No Asbestos

B00A - R0024 - External Movement (4.8 m2)

No Asbestos

B00A - R0025 - Stairs (5.51 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0026 - Stairs (7.88 m2)						
No Asbestos						
B00A - R0027 - External Movement (7.03 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0028 - Administration - Clerical (39.47 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0029 - Clinic (8.61 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0030 - Staff Kitchen (1.33 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0031 - Store (2.49 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0032 - Movement (44.64 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0033 - Printing/Photocopying (6.75 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0034 - Deputy Principal Office (21.19 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0035 - Toilet - Lobby (2.07 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0036 - Staff - Toilet (1.76 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0037 - Movement (17.51 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0038 - Movement (20.7 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0039 - Distribution Board Cupboard (0.53 m2)						Note: No inspection of live electrical installation.
Recently Modified Space	Requires Inspection					
B00A - R0040 - Student Reception (11.31 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0041 - Toilet - Lobby (2.07 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0042 - Staff - Toilet (1.76 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0043 - Administration - Executive (19.75 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1001 - General Learning Space (57.58 m2)						
No Asbestos						
B00A - R1002 - Study Space (21.76 m2)						
No Asbestos						
B00A - R1003 - Staff Study (57.09 m2)						
No Asbestos						
B00A - R1004 - General Learning Space (48.92 m2)						
No Asbestos						
B00A - R1005 - General Learning Space (48.92 m2)						
No Asbestos						
B00A - R1006 - General Learning Space (57 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R1007 - Movement (88.93 m2)

No Asbestos

B00A - R1008 - Stairs (8.3 m2)

No Asbestos

B00A - R1009 - Stairs (15.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1903 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Computer Learning Space (47.63 m2)

No Asbestos

B00B - R0002 - General Storeroom (12.05 m2)

No Asbestos

B00B - R0003 - Computer Learning Space (47.91 m2)

Wall Linings Internal	Flat AC Sheeting					
	8804/B00B/R0003/Wall Linings Internal/S10					No Asbestos Detected

B00B - R0004 - External Movement (5.7 m2)

No Asbestos

B00B - R0005 - General Learning Space (40.48 m2)

No Asbestos

B00B - R0006 - General Learning Space (42.58 m2)

No Asbestos

B00B - R0007 - Movement (13.64 m2)

No Asbestos

B00B - R0008 - General Learning Space (35.16 m2)

No Asbestos

B00B - R0009 - General Learning Space (45.5 m2)

No Asbestos

B00B - R0010 - General Learning Space (55.51 m2)

No Asbestos

B00B - R0011 - External Movement (106.3 m2)

In-fill-panel	Flat AC Sheeting	5m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00B/R0011/In-fill-panel/S24					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - Science/General Learning - 1981 - Brick/Block (Brick/Block)						
Exterior						
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/Gable Verge Lining/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00C - R0001 - General Storeroom (22.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0002/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
B00C - R0002 - Gymnasium (200.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	201m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0002/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
B00C - R0003 - Multi Media Studio (67.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
B00C - R0004 - General Assistants (15.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					
B00C - R0005 - Secure Storeroom (10.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
B00C - R0006 - Laboratory L.S. (104.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	105m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					
Fume Cupboard	Flat AC Sheeting	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0006/Fume Cupboard/S4				Chrysotile (white asbestos)	
B00C - R0007 - Preparation (10.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
B00C - R0011 - Staff - Toilet (11.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0011/Wall Linings Internal/S5				Chrysotile (white asbestos)	
B00C - R0012 - Staff - Toilet (11.29 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0011/Wall Linings Internal/S5					Chrysotile (white asbestos)
B00C - R0013 - Staff Study (17.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00C - R0014 - External Movement (132.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	134m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00C - R0015 - Movement (10.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00C - R0016 - General Storeroom (15.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00C - R0017 - Staff Study (15.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00C - R0018 - Performance Workspace (67.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0018/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
B00C - R0019 - Performing Arts Store (6.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0018/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
B00C - R0020 - Stage (16.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0018/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
B00C - R0021 - Performing Arts Changeroom (6.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0018/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
B00C - R0022 - Staff Kitchen (13.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0018/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0022/Floor Coverings Res/Textile/S27					Chrysotile (white asbestos)
B00C - R0023 - Food Technology L.S. (87.12 m2)						
No Asbestos						
B00C - R0024 - Food/Research Space (24.61 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0025 - Laundry (5.71 m2)						
No Asbestos						
B00C - R0026 - Laundry (4.84 m2)						
No Asbestos						
B00C - R0027 - Main Switch Board Cupboard (0.2 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1927 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00D/Eaves Linings/S28					Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	50m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00D/Wall Cladding/S29					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Distribution Board Cupboard (0.31 m2) Note: No inspection of live electrical installation.

In-fill-panel	Flat AC Sheeting	4m	Back of door	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00D/R0001/In-fill-panel/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Flat AC Sheeting Debris	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00D/R0001/Floor Coverings Res/Textile/S30					Chrysotile (white asbestos)

B00D - R0002 - Toilets-Boys (21.63 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00D/R0018/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)

B00D - R0003 - General Learning Space (45.93 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0004 - General Learning Space (47.08 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0005 - General Learning Space (46.84 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0006 - General Learning Space (48.74 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0007 - Staff Study (29.06 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0008 - Staff Study (28.98 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0009 - Staff Room Annexe (11.63 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0010 - Staff Room Annexe (11.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8804/B00D/R0016/Ceiling Structures/Linings/S11					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0011 - General Learning Space (58.7 m2)						
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0012 - Art Learning Space (58.87 m2)						
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0013 - Kiln Space (7.22 m2)						
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0014 - Art Learning Space (60.62 m2)						
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0015 - Art Learning Space (58.71 m2)						
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0016 - Resources Store (18.94 m2)						
Ceiling Structures/Linings	Vermiculite 8804/B00D/R0016/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0017 - Distribution Board Cupboard (0.6 m2)						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
		8804/B00D/R0017/Electrical Backing Board/S31				
In-fill-panel	Flat AC Sheeting	4m	Back of door	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
		8804/B00D/R0001/In-fill-panel/S14				
B00D - R0018 - Toilets-Boys (11.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
		8804/B00D/R0018/Ceiling Structures/Linings/S12				
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
		8804/B00D/R0018/Partition Walls (Cubicles)/S13				
B00D - R0019 - Cleaning Store - Distributed (3.9 m2)						
No Asbestos						
B00D - R0020 - External Movement (190.48 m2)						
No Asbestos						
B00D - R0021 - External Stairs (16.08 m2)						
No Asbestos						
B00D - R0022 - External Stairs (15.32 m2)						
No Asbestos						
B00D - R1001 - Music Learning Space (68.2 m2)						
No Asbestos						
B00D - R1002 - Music Store (26.15 m2)						
No Asbestos						
B00D - R1003 - Music Learning Space (75.8 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R1004 - General Learning Space (45.91 m2)						
No Asbestos						
B00D - R1005 - General Learning Space (46.32 m2)						
No Asbestos						
B00D - R1006 - Staff Study (28.97 m2)						
No Asbestos						
B00D - R1007 - Staff Study (96.22 m2)						
No Asbestos						
B00D - R1008 - Study Space (9.39 m2)						
No Asbestos						
B00D - R1009 - Interview/Office - Type 1 (11.14 m2)						
No Asbestos						
B00D - R1010 - Staff Study (28.99 m2)						
No Asbestos						
B00D - R1011 - Distribution Board Cupboard (0.55 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8804/B00D/R1011/Electrical Backing Board/S32					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	4m	Back of door	Good Condition (1)	Low (1)	Low Priority (2-3)
8804/B00D/R0001/In-fill-panel/S14					Chrysotile (white asbestos)	
B00D - R1012 - Staff - Toilet (6.52 m2)						
No Asbestos						
B00D - R1013 - Staff - Toilet (4.85 m2)						
No Asbestos						
B00D - R1014 - Movement (40.78 m2)						
No Asbestos						
B00D - R1015 - Movement (75.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8804/B00D/R1015/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	
B00D - R1016 - Distribution Board Cupboard (0.31 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8804/B00D/R1011/Electrical Backing Board/S32					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	4m	Back of door	Good Condition (1)	Low (1)	Low Priority (2-3)
8804/B00D/R0001/In-fill-panel/S14					Chrysotile (white asbestos)	
B00D - R1017 - External Movement (183.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	184m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8804/B00D/R1015/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	
B00D - R1018 - External Stairs (21.14 m2)						
No Asbestos						
B00D - R1019 - Ramp (22.3 m2)						
No Asbestos						
B00D - R1020 - External Stairs (16.93 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Technological & Applied Studies - 1927 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/Gable Verge Lining/S33					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Flat AC Sheeting Debris	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/Ceiling Voids/S34					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - General Storeroom (10.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0002 - Design L.S. (46.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0003 - Materials Store (9.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0004 - Metal Technology L.S. (125.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	126m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0005 - Resource/Project Store (10.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0006 - Resource/Project Store (11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0007 - Metal Technology L.S. (66.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0008 - Class Tools Storage (9.91 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0009 - Wood Technology L.S. (95.94 m2)

Ceiling Structures/Linings	Flat AC Sheeting	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0010 - Materials Store (8.32 m2)

In-fill-panel	Flat AC Sheeting	1m	Inside Cupboard	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8804/B00E/R0010/In-fill-panel/S6					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0011 - T.A.S. Entry/Display (9.25 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					
B00E - R0012 - Movement (25.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00C/R0017/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					
B00E - R0013 - Maintenance Bulk Store (17.9 m2)						
No Asbestos						
B00E - R0014 - Staff Study (25.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00E - R0015 - Staff Study (16.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					
B00E - R0022 - Seminar/Technology Space (36.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00E - R0023 - Seminar/Technology Space (10.78 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00E - R0024 - External Movement (109.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	109m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00E/R0019/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00E - R0025 - Workshop Area (156.1 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0026 - Dust Extraction Space (11.46 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0027 - Materials Store (16.58 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0028 - Project Store - Type 1 (13.71 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0029 - Store (8.27 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Science/Library - 1981 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - M1001 - Seminar (38.25 m2)**

No Asbestos

B00F - M1002 - Plant (5.98 m2)

Non Accessible

B00F - M1003 - Main Area (67.74 m2)

No Asbestos

B00F - M1004 - Seminar (15.39 m2)

No Asbestos

B00F - M1005 - Plant (9.92 m2)

No Asbestos

B00F - M1006 - Plant (9.93 m2)

No Asbestos

B00F - M1007 - Stairs (3.1 m2)

No Asbestos

B00F - M1008 - Stairs (3.23 m2)

No Asbestos

B00F - R0001 - Cleaning Store - Distributed (7.87 m2)

No Asbestos

B00F - R0002 - Laboratory L.S. (91.14 m2)

Ceiling Structures/Linings	Vermiculite		
	8804/B00F/R0003/Ceiling Structures/Linings/S8		Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works			

B00F - R0005 - Laboratory L.S. (91.06 m2)

Ceiling Structures/Linings	Vermiculite		
	8804/B00F/R0003/Ceiling Structures/Linings/S8		Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works			

B00F - R0006 - Chemical Store (16.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles		
	8804/B00C/R0015/Floor Coverings Res/Textile/S2		No Asbestos Detected

B00F - R0007 - Cleaning Store - Distributed (0.53 m2)

Floor Coverings Res/Textile	Vinyl Tiles		
	8804/B00C/R0015/Floor Coverings Res/Textile/S2		No Asbestos Detected

B00F - R0008 - Laboratory L.S. (91.25 m2)

Ceiling Structures/Linings	Vermiculite		
	8804/B00F/R0003/Ceiling Structures/Linings/S8		Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works			

B00F - R0010 - Apparatus Store (3.34 m2)

Ceiling Structures/Linings	Vermiculite		
	8804/B00F/R0003/Ceiling Structures/Linings/S8		Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works			
Floor Coverings Res/Textile	Vinyl Tiles		
	8804/B00C/R0015/Floor Coverings Res/Textile/S2		No Asbestos Detected

B00F - R0011 - Laboratory L.S. (91.15 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8804/B00F/R0003/Ceiling Structures/Linings/S8 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0012 - Movement (40.84 m2)

No Asbestos

B00F - R0013 - Distribution Board Cupboard (3.26 m2) Note: No inspection of live electrical installation.

No Asbestos

B00F - R0014 - Plant (8.69 m2)

No Asbestos

B00F - R0015 - Stairs (7.97 m2)

No Asbestos

B00F - R0016 - External Movement (22.68 m2)

No Asbestos

B00F - R0017 - Ramp (8.14 m2)

No Asbestos

B00F - R0018 - Preparation (48.55 m2)

No Asbestos

B00F - R0019 - Staff Kitchen (3.3 m2)

No Asbestos

B00F - R0020 - Staff Study (41.26 m2)

No Asbestos

B00F - R1001 - Multi Media Studio (72.39 m2)

Ceiling Structures/Linings Vermiculite
 8804/B00F/R0003/Ceiling Structures/Linings/S8 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R1002 - Staff - Toilet (3.04 m2)

No Asbestos

B00F - R1003 - Staff - Toilet (3.01 m2)

No Asbestos

B00F - R1004 - Workroom (12.58 m2)

No Asbestos

B00F - R1005 - General Storeroom (12.71 m2)

No Asbestos

B00F - R1006 - Audio Visual Workroom (28.71 m2)

No Asbestos

B00F - R1007 - Librarian (16.24 m2)

No Asbestos

B00F - R1008 - Main Area (327.4 m2)

Ceiling Structures/Linings Vermiculite
 8804/B00F/R0003/Ceiling Structures/Linings/S8 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R1009 - Seminar (13.42 m2)

No Asbestos

B00F - R1010 - Seminar (11.75 m2)

No Asbestos

B00F - R1011 - Movement (4.8 m2)

No Asbestos

B00F - R1012 - Distribution Board Cupboard (0.32 m2) Note: No inspection of live electrical installation.

No Asbestos

B00F - R1013 - Cleaning Store - Distributed (0.41 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00F - R1014 - Plant (4.32 m2)

No Asbestos

B00F - R1015 - Plant (6.31 m2)

No Asbestos

B00F - R1016 - Seminar (25.32 m2)

No Asbestos

B00F - R1017 - Stairs (0.16 m2)

No Asbestos

B00F - R1018 - Stairs (0.16 m2)

No Asbestos

B00F - R1019 - Stairs (15.77 m2)

No Asbestos

B00F - R1020 - External Stairs (3.41 m2)

No Asbestos

B00F - R1021 - External Movement (28.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Physical Education/Pupil Facilities - 1971 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Cleaning Store - Distributed (4.86 m2)

No Asbestos

B00G - R0002 - Music Store (14.16 m2)

No Asbestos

B00G - R0003 - Cleaning Store - Distributed (1.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
		8804/B00C/R0015/Floor Coverings Res/Textile/S2				No Asbestos Detected

B00G - R0004 - Performing Arts Store (21.83 m2)

No Asbestos

B00G - R0005 - Distribution Board Cupboard (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0006 - Pantry (8.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
		8804/B00C/R0015/Floor Coverings Res/Textile/S2				No Asbestos Detected

B00G - R0007 - Student Canteen (53.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
		8804/B00C/R0015/Floor Coverings Res/Textile/S2				No Asbestos Detected

B00G - R0008 - Staff - Toilet (4.8 m2)

No Asbestos

B00G - R0009 - Performing Arts Store (14.08 m2)

No Asbestos

B00G - R0010 - Toilets-Boys (32.6 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
		8804/B00G/R0010/Partition Walls (Cubicles)/S16				
In-fill-panel	Flat AC Sheeting	20m	Behind toilets	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
		8804/B00G/R0010/In-fill-panel/S17				

B00G - R0011 - Movement (78.13 m2)

Ceiling Structures/Linings	Vermiculite					
		8804/B00G/R0011/Ceiling Structures/Linings/S18				Limited Samples Taken
		Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				

Floor Coverings Res/Textile	Vinyl Tiles					
		8804/B00C/R0015/Floor Coverings Res/Textile/S2				No Asbestos Detected

B00G - R0012 - Gymnasium (318.14 m2)

No Asbestos

B00G - R0013 - Stairs (10.14 m2)

No Asbestos

B00G - R0014 - Cleaning Store - Distributed (7.59 m2)

No Asbestos

B00G - R0015 - Student Drinking Facilities (2.29 m2)

No Asbestos

B00G - R0016 - External Movement (12.45 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00G - R0017 - Stairs (9.1 m2)						
No Asbestos						
B00G - R0018 - Store (8.51 m2)						
No Asbestos						
B00G - R0019 - External Movement (17.59 m2)						
No Asbestos						
B00G - R1001 - Cleaning Store - Distributed (3.4 m2)						
No Asbestos						
B00G - R1002 - General Storeroom (9.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00G - R1003 - General Storeroom (7.76 m2)						
No Asbestos						
B00G - R1004 - Toilets-Boys (14.69 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00G/R0010/Partition Walls (Cubicles)/S16					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	10m	Behind toilets	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00G/R0010/In-fill-panel/S17					Chrysotile (white asbestos)
B00G - R1005 - Shower/Change (46.2 m2)						
No Asbestos						
B00G - R1006 - Shower/Change (46.16 m2)						
No Asbestos						
B00G - R1007 - Toilets-Boys (14.5 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00G/R0010/Partition Walls (Cubicles)/S16					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	10m	Behind toilets	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00G/R0010/In-fill-panel/S17					Chrysotile (white asbestos)
B00G - R1008 - Staff - Toilet (8.38 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8804/B00G/R0010/Partition Walls (Cubicles)/S16					Chrysotile (white asbestos)
B00G - R1009 - Staff Study (9.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8804/B00C/R0015/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00G - R1010 - Cleaning Store - Distributed (3.38 m2)						
No Asbestos						
B00G - R1011 - Movement (66.65 m2)						
No Asbestos						
B00G - R1012 - Stairs (17.47 m2)						
No Asbestos						
B00G - R1013 - External Movement (14.76 m2)						
No Asbestos						
B00G - R1014 - Stairs (17.47 m2)						
No Asbestos						
B00G - R1015 - External Movement (17.59 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Technological & Applied Studies - 1991 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting 8804/B00H/Wall Cladding/S36					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 8804/B00H/Eaves Linings/S35					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - General Learning Space (48.61 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0002 - General Learning Space (48.01 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0003 - General Learning Space (48.01 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0004 - Design L.S. (56.82 m2)

No Asbestos

B00H - R0005 - Resource/Project Store (26.29 m2)

No Asbestos

B00H - R0006 - Materials Store (17.9 m2)

No Asbestos

B00H - R0007 - Staff - Toilet (5.73 m2)

No Asbestos

B00H - R0008 - Distribution Board Cupboard (0.61 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0009 - General Storeroom (0.67 m2)

No Asbestos

B00H - R0010 - Staff Study (29.68 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0011 - Movement (52.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Music - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B001 - R0001 - Music Store (37.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017