


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bulli High School (8878)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Grencap-NAA : 26 - Aug - 2014

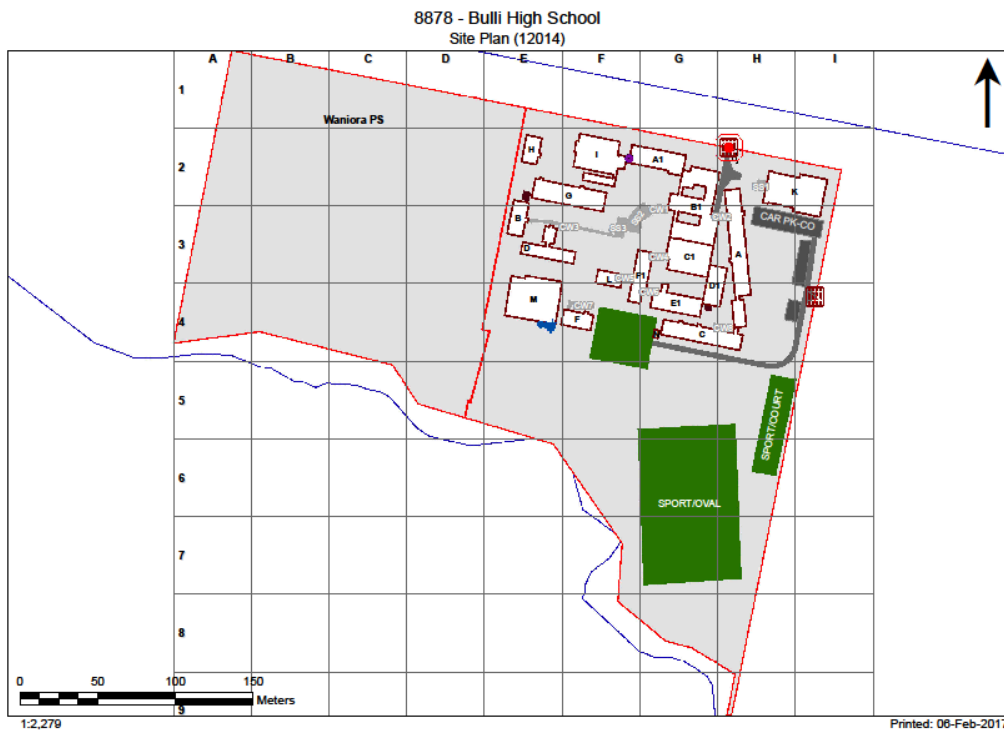

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1956 - Steel (Steel)**Exterior**

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	No Asbestos Found
Gable Ends	No Asbestos Found

Interior**B00A - R0001 - Staff Study (38.04 m2)**

No Asbestos

B00A - R0002 - Leading Teacher (12.96 m2)

No Asbestos

B00A - R0003 - Staff - Toilet (9.15 m2)

No Asbestos

B00A - R0004 - Staff Study (33.07 m2)

No Asbestos

B00A - R0005 - Cleaning Store - Distributed (6.43 m2)

No Asbestos

B00A - R0006 - Distribution Board Cupboard (1.94 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0007 - Staff Study (18.28 m2)

No Asbestos

B00A - R0008 - Staff - Toilet (3.47 m2)

No Asbestos

B00A - R0009 - Study Space (23.43 m2)

No Asbestos

B00A - R0010 - General Storeroom (11.55 m2)

No Asbestos

B00A - R0011 - General Learning Space (53.44 m2)

No Asbestos

B00A - R0012 - General Learning Space (53.43 m2)

No Asbestos

B00A - R0013 - General Learning Space (53.29 m2)

No Asbestos

B00A - R0014 - General Learning Space (53.23 m2)

No Asbestos

B00A - R0015 - General Learning Space (53.21 m2)

No Asbestos

B00A - R0016 - General Learning Space (53.21 m2)

No Asbestos

B00A - R0017 - General Storeroom (5.86 m2)

No Asbestos

B00A - R0018 - General Storeroom (8.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B00A/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00A - R0019 - Staff Study (46.42 m2)

No Asbestos

B00A - R0020 - Staff Study (47.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R0021 - Staff - Toilet (8.75 m2)

No Asbestos

B00A - R0022 - Movement (187.69 m2)

No Asbestos

B00A - R0023 - Movement (3.18 m2)

No Asbestos

B00A - R0024 - Movement (3.19 m2)

No Asbestos

B00A - R0025 - Movement (3.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1956 - Steel (Steel)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	No Asbestos Found					
Ceiling Voids - Flat Roof	Flat AC Sheeting 8878/B00B/Ceiling Voids - Flat Roof/S54				No Asbestos Detected	
Gable Ends	Flat AC Sheeting	6m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00B/Gable Ends/S55			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00B - R0001 - General Learning Space (71.54 m2)

No Asbestos

B00B - R0002 - General Storeroom (5.76 m2)

No Asbestos

B00B - R0003 - Staff Study (29.18 m2)

No Asbestos

B00B - R0004 - Staff Study (8.78 m2)

No Asbestos

B00B - R0005 - Cleaning Store - Distributed (8.66 m2)

No Asbestos

B00B - R0006 - General Learning Space (71.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00B/R0006/Floor Coverings Res/Textile/S15			Chrysotile (white asbestos)		

B00B - R0007 - Movement (17.59 m2)

No Asbestos

B00B - R0008 - Movement (3.09 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1956 - Steel (Steel)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00C/Eaves Linings/S48				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Roof	Flat AC Sheeting	10m2	North, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00C/Roof/S2				Chrysotile (white asbestos)	
Ceiling Voids - Flat Roof	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00C/Ceiling Voids - Flat Roof/S49				Chrysotile (white asbestos)	
Telecommunication Pit	Moulded Cement Sheeting	1Unit	Northeast corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00C/Telecommunication Pit/S50				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00C - R0005 - General Learning Space (95.15 m2)**

No Asbestos

B00C - R0006 - General Learning Space (65.12 m2)

No Asbestos

B00C - R0007 - General Learning Space (65.38 m2)

No Asbestos

B00C - R0008 - General Learning Space (71.39 m2)

No Asbestos

B00C - R0009 - Movement (9.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00C/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

B00C - R0010 - Movement (25.96 m2)

No Asbestos

B00C - R0011 - General Storeroom (17.32 m2)

No Asbestos

B00C - R0012 - Movement (15.84 m2)

No Asbestos

B00C - R0013 - Movement (3.09 m2)

No Asbestos

B00C - R0014 - Movement (3.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8878/B00C/R0014/Ceiling Structures/Linings/S4				No Asbestos Detected	

B00C - R0015 - General Learning Space (69.31 m2)

No Asbestos

B00C - R0016 - General Learning Space (72.75 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1956 - Steel (Steel)**Exterior**

Ceiling Voids - Flat Roof	Flat AC Sheeting 8878/B00D/Ceiling Voids - Flat Roof/S52					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	No Asbestos Found					

Interior**B00D - R0001 - Staff - Toilet (5.09 m2)**

No Asbestos

B00D - R0002 - Staff Study (11.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B00D/R0002/Floor Coverings Res/Textile/S67					Chrysotile (white asbestos)	

B00D - R0003 - General Storeroom (5.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B00D/R0003/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00D - R0004 - General Learning Space (71.73 m2)

No Asbestos

B00D - R0005 - General Storeroom (8.62 m2)

No Asbestos

B00D - R0006 - General Storeroom (8.62 m2)

No Asbestos

B00D - R0007 - General Learning Space (110.12 m2)

No Asbestos

B00D - R0008 - General Storeroom (8.77 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B00D/R0003/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00D - R0009 - General Storeroom (17.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B00D/R0003/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00D - R0010 - General Storeroom (17.71 m2)

No Asbestos

B00D - R0011 - Distribution Board Cupboard (8.71 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0012 - Movement (50.8 m2)

No Asbestos

B00D - R0013 - Cleaning Store - Distributed (0.43 m2)

No Asbestos

B00D - R0014 - Movement (3.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8878/B00D/R0014/Ceiling Structures/Linings/S13					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Science Learning - 1961 - Steel (Steel)**Exterior**

Eaves Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00F/Eaves Linings/S51					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Ends	No Asbestos Found					

Interior**B00F - R0001 - General Storeroom (12.42 m2)**

No Asbestos

B00F - R0002 - Preparation (21.63 m2)

Fume Cupboard	Compressed AC Sheet	1Unit	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00F/R0002/Fume Cupboard/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0003 - Laboratory L.S. (106.06 m2)

No Asbestos

B00F - R0004 - Movement (2.78 m2)

No Asbestos

B00F - R0005 - Darkroom Space (22.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00F/R0005/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00F - R0006 - General Storeroom (5.43 m2)

No Asbestos

B00F - R0007 - Movement (9.75 m2)

No Asbestos

B00F - R0008 - Movement (3.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00F/R0008/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1956 - Steel (Steel)**Exterior**

Gable Verge Lining	No Asbestos Found					
Eaves Linings	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Awnings	Flat AC Sheeting 8878/B00G/Awnings/S60					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00G - R0001 - Staff Study (17.59 m2)**

No Asbestos

B00G - R0002 - General Storeroom (4.14 m2)

No Asbestos

B00G - R0003 - Art Learning Space (115.5 m2)

No Asbestos

B00G - R0004 - General Learning Space (95.16 m2)

No Asbestos

B00G - R0005 - General Storeroom (6.92 m2)

No Asbestos

B00G - R0006 - General Storeroom (15.21 m2)

No Asbestos

B00G - R0007 - General Learning Space (95.36 m2)

No Asbestos

B00G - R0008 - General Learning Space (71.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8878/B00G/R0011/Floor Coverings Res/Textile/S17	75m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor tile adhesive	Floor covering 8878/B00G/R0008/Thermacon Heater/S59	71.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Invalid Sample
Floor tile adhesive	Floor covering 8878/B00G/R0008/Floor tile adhesive/S68	71.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00G - R0009 - Staff Study (32.7 m2)

No Asbestos

B00G - R0010 - General Storeroom (7.18 m2)

No Asbestos

B00G - R0011 - Cleaning Store - Distributed (5.83 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00G/R0011/Floor Coverings Res/Textile/S17	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	--	-----	------------	--------------------	---------	--------------------	------------------------------------

B00G - R0014 - Movement (3.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8878/B00G/R0014/Ceiling Structures/Linings/S16						No Asbestos Detected
----------------------------	--	--	--	--	--	--	-----------------------------

B00G - R0015 - Movement (3.13 m2)

No Asbestos

B00G - R0016 - Distribution Board Cupboard (0.49 m2)

Note: No inspection of live electrical installation.

In-fill-panel	Flat AC Sheeting 8878/B00G/R0016/In-fill-panel/S18						No Asbestos Detected
---------------	---	--	--	--	--	--	-----------------------------

B00G - R0017 - Bulk Store (24.01 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00G - R0018 - Movement (33.85 m2)

No Asbestos

B00G - R0019 - Movement (36.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1956 - Steel (Steel)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Flat AC Sheeting					
	8878/B00H/Ceiling Voids - Raked Ceiling/S58					No Asbestos Detected

Interior**B00H - R0001 - General Learning Space (71.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8878/B00H/R0001/Floor Coverings Res/Textile/S57					No Asbestos Detected

B00H - R0002 - Staff Study (17.62 m2)

No Asbestos

B00H - R0003 - General Learning Space (53.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B00H/R0003/Floor Coverings Res/Textile/S56					Chrysotile (white asbestos)

B00H - R0004 - General Storeroom (5.83 m2)

No Asbestos

B00H - R0005 - Movement (17.67 m2)

No Asbestos

B00H - R0006 - Movement (3.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8878/B00H/R0006/Ceiling Structures/Linings/S19					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Science/Library - 1973 - Brick/Block (Brick/Block)**Exterior**

gutter lining	Compressed AC Sheet	100m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	---------------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - box guttering lining

Ceiling Voids	Non Accessible Area - Area inaccessible
---------------	--

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
-----------------------------------	--

Interior**B00I - M1001 - Seminar (50.21 m2)**

Ceiling Structures/Linings	Vermiculite 8878/B00I/R1004/Ceiling Structures/Linings/S26	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00I - M1002 - Study Space (86.27 m2)

No Asbestos

B00I - M1003 - Seminar (18.32 m2)

Ceiling Structures/Linings	Vermiculite 8878/B00I/R1004/Ceiling Structures/Linings/S26	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00I - M1004 - Seminar (18.62 m2)

Ceiling Structures/Linings	Vermiculite 8878/B00I/R1004/Ceiling Structures/Linings/S26	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00I - R0004 - Cleaning Store - Distributed (0.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00I/R1004/Ceiling Structures/Linings/S26	No Asbestos Detected
-----------------------------	---	----------------------

B00I - R0005 - Distribution Board Cupboard (0.98 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0006 - General Storeroom (10.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00I/R1004/Ceiling Structures/Linings/S26	No Asbestos Detected
-----------------------------	---	----------------------

B00I - R0007 - Plant Space (15.76 m2)

No Asbestos

B00I - R0011 - Movement (40.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00I/R1004/Ceiling Structures/Linings/S26	No Asbestos Detected
-----------------------------	---	----------------------

B00I - R0012 - General Storeroom (7.68 m2)

No Asbestos

B00I - R0013 - Movement (3.42 m2)

No Asbestos

B00I - R0014 - Ramp (56.1 m2)

No Asbestos

B00I - R0015 - Movement (38.63 m2)

No Asbestos

B00I - R0016 - Stairs (7.68 m2)

No Asbestos

B00I - R0017 - Laboratory L.S. (85.88 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00I - R0018 - Preparation (45.57 m2)						
No Asbestos						
B00I - R0019 - Laboratory L.S. (86.98 m2)						
No Asbestos						
B00I - R0020 - Laboratory L.S. (85.98 m2)						
No Asbestos						
B00I - R0021 - Laboratory L.S. (84.75 m2)						
No Asbestos						
B00I - R0022 - Preparation (46.97 m2)						
No Asbestos						
B00I - R1001 - General Storeroom (7.74 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		8878/B00I/R1004/Ceiling Structures/Linings/S26			No Asbestos Detected
B00I - R1002 - Workroom (19.25 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1003 - Audio Visual Workroom (29.83 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1004 - Librarian (9.98 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1005 - Staff - Toilet (3.23 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1006 - Staff - Toilet (3.28 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1007 - Main Area (389.95 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1008 - Seminar (10.83 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1009 - Seminar (12.06 m2)						
Ceiling Structures/Linings	Vermiculite		8878/B00I/R1004/Ceiling Structures/Linings/S26			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00I - R1010 - Distribution Board Cupboard (0.52 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00I - R1011 - Cleaning Store - Distributed (1.92 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - R1012 - Distribution Board Cupboard (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B001 - R1013 - Seminar (11.51 m2)

Ceiling Structures/Linings Vermiculite

8878/B001/R1004/Ceiling Structures/Linings/S26

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B001 - R1014 - Seminar (9.42 m2)

Ceiling Structures/Linings Vermiculite

8878/B001/R1004/Ceiling Structures/Linings/S26

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B001 - R1015 - Seminar (14.09 m2)

Ceiling Structures/Linings Vermiculite

8878/B001/R1004/Ceiling Structures/Linings/S26

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B001 - R1016 - Movement (2.35 m2)

No Asbestos

B001 - R1017 - Movement (16.51 m2)

No Asbestos

B001 - R1018 - Movement (24.78 m2)

No Asbestos

B001 - R1019 - Stairs (17.4 m2)

No Asbestos

B001 - R1020 - Ramp (52.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Multi Purpose Facilities - 1961 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 8878/B00K/Eaves Linings/S46	160m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 8878/B00K/In-fill-panel/S22					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible					

Interior**B00K - M0001 - Performing Arts Store (13.28 m2)**

No Asbestos

B00K - M0002 - Movement (9.02 m2)

No Asbestos

B00K - M0003 - Control Room (18.61 m2)

No Asbestos

B00K - R0001 - Shower/Change (6.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00K/R0001/Floor Coverings Res/Textile/S47	10m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos)
--------------------------------	--	------	------------	-------------------------------	------------	--

B00K - R0002 - Shower/Change (41.96 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8878/B00K/R0002/Partition Walls (Cubicles)/S24	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00K - R0003 - General Storeroom (10.54 m2)

No Asbestos

B00K - R0004 - Shower/Change (42.06 m2)

No Asbestos

B00K - R0005 - Shower/Change (6.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00K/R0005/Floor Coverings Res/Textile/S21	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------------	--	-----	------------	--------------------	---------	--

B00K - R0006 - Stage (119.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B00K/R0006/Floor Coverings Res/Textile/S23	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------------	--	-------	------------	--------------------	---------	--

B00K - R0007 - General Storeroom (12.66 m2)

No Asbestos

B00K - R0008 - Multi-Purpose Space (395.47 m2)

No Asbestos

B00K - R0009 - General Storeroom (8.37 m2)

No Asbestos

B00K - R0010 - Toilets-Boys (7.62 m2)

No Asbestos

B00K - R0011 - Toilets-Girls (12.03 m2)

No Asbestos

B00K - R0012 - General Storeroom (5.35 m2)

No Asbestos

B00K - R0013 - Movement (21.25 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting 8878/B00K/R0016/Ceiling Structures/Linings/S20					No Asbestos Detected
B00K - R0014 - Movement (25.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8878/B00K/R0016/Ceiling Structures/Linings/S20					No Asbestos Detected
B00K - R0015 - Chair Store (26.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8878/B00K/R0016/Ceiling Structures/Linings/S20					No Asbestos Detected
B00K - R0016 - Movement (3.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8878/B00K/R0016/Ceiling Structures/Linings/S20					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 8878/B00K/R0016/In-fill-panel/S25	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00K - R0017 - Movement (3.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8878/B00K/R0016/Ceiling Structures/Linings/S20					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Tiered Learning/Art - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Awnings	Flat AC Sheeting 8878/B00L/Awnings/S66					No Asbestos Detected

Interior

B00L - R0001 - Tiered Learning Area (69.27 m2)

No Asbestos

B00L - R0002 - Tiered Learning Store (3.74 m2)

No Asbestos

B00L - R0003 - Movement (9.85 m2)

No Asbestos

B00L - R0004 - Darkroom Space (30.91 m2)

No Asbestos

B00L - R0005 - Plant (6.75 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Physical Education - 2009 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior**B00M - R0001 - Gymnasium (623.93 m2)**

No Asbestos

B00M - R0002 - Large Equipment Store (25.33 m2)

No Asbestos

B00M - R0003 - Staff Study (24.69 m2)

No Asbestos

B00M - R0004 - Staff Kitchen (8.96 m2)

No Asbestos

B00M - R0005 - Change (27.77 m2)

No Asbestos

B00M - R0006 - Change (27.48 m2)

No Asbestos

B00M - R0007 - Distribution Board Cupboard (0.76 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0008 - Cleaning Store - Distributed (3.3 m2)

No Asbestos

B00M - R0009 - Plant (0.72 m2)

No Asbestos

B00M - R0010 - Access Staff Shower/Toilet (9.04 m2)

No Asbestos

B00M - R0011 - First Aid (12.31 m2)

No Asbestos

B00M - R0012 - External Movement (84.38 m2)

No Asbestos

B00M - R0013 - Plant (0.6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other-Community Use - 2009 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00N - R0001 - Other-Community Use (14.52 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - Science/General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior**B0A1 - R0004 - Distribution Board Cupboard (0.67 m2)**

Note: No inspection of live electrical installation.

No Asbestos

B0A1 - R0005 - Apparatus Store (44.59 m2)

No Asbestos

B0A1 - R0006 - Chemical Store (21.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B0A1/R0006/Floor Coverings Res/Textile/S28				Chrysotile (white asbestos)	

Shelves	Flat AC Sheeting					
	8878/B0A1/R0006/Shelves/S29				No Asbestos Detected	

B0A1 - R0007 - Cleaning Store - Distributed (2.41 m2)

No Asbestos

B0A1 - R0008 - Movement (81.29 m2)

No Asbestos

B0A1 - R0009 - Movement (14.61 m2)

No Asbestos

B0A1 - R0010 - Laboratory L.S. (87.94 m2)

Wall Linings Internal	Flat AC Sheeting					
	8878/B0A1/R0010/Wall Linings Internal/S61				No Asbestos Detected	

Ceiling Structures/Linings	Vermiculite					
	8878/B0A1/R0010/Ceiling Structures/Linings/S62				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0A1 - R0011 - Laboratory L.S. (87.98 m2)

Ceiling Structures/Linings	Vermiculite					
	8878/B0A1/R0010/Ceiling Structures/Linings/S62				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Wall Linings Internal	Flat AC Sheeting					
	8878/B0A1/R0010/Wall Linings Internal/S61				No Asbestos Detected	

B0A1 - R0012 - Preparation (45.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8878/B0A1/R0012/Floor Coverings Res/Textile/S63				Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					
	8878/B0A1/R0010/Ceiling Structures/Linings/S62				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B0A1 - R1001 - General Learning Space (64.34 m2)

No Asbestos

B0A1 - R1002 - General Learning Space (63.89 m2)

No Asbestos

B0A1 - R1003 - General Learning Space (63.89 m2)

No Asbestos

B0A1 - R1004 - Distribution Board Cupboard (0.55 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0A1 - R1007 - Movement (74.17 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

8878/B0A1/R1007/Ceiling Structures/Linings/S31

Chrysotile (white asbestos)

B0A1 - R1008 - Movement (14.61 m2)

No Asbestos

B0A1 - R1009 - Computer Learning Space (64.4 m2)

No Asbestos

B0A1 - R1010 - General Learning Space (51.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0B1 - Administration/Pupil Facilities - 1977 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior**B0B1 - R0001 - Administration - Clerical (28.14 m2)**

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0002 - Duplicating Workroom (23.45 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0003 - Deputy Principal Office (15.75 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0004 - Principal Office (23.37 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0005 - Staff - Toilet (4.49 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0006 - Staff - Toilet (5.66 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0007 - Duplicating Workroom (12.32 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0008 - Staff Study (12.74 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0009 - Staff Study (12.77 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0010 - Staff Study (12.81 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0B1/R0023/Ceiling Structures/Linings/S8	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0B1 - R0011 - General Assistants (7.46 m2)

No Asbestos

B0B1 - R0012 - Sport Equipment Store (22.84 m2)

No Asbestos

B0B1 - R0013 - Sport Equipment Store (38.22 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B0B1 - R0014 - Cleaning Store - Distributed (10.17 m2)						
No Asbestos						
B0B1 - R0015 - General Storeroom (9.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B0B1 - R0016 - Student Canteen (73.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B0B1 - R0017 - Staff - Toilet (6.32 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B0B1 - R0020 - Toilets-Girls (3.04 m2)						
No Asbestos						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B0B1 - R0021 - Clinic - Girls (10.29 m2)						
No Asbestos						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B0B1 - R0022 - Toilets-Girls (19.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0023/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	
B0B1 - R0023 - Toilets-Boys (19.53 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0023/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	
B0B1 - R0024 - Cleaning Store - Distributed (10.14 m2)						
No Asbestos						
B0B1 - R0025 - Main Switchroom (11.32 m2)						
Electrical Mounting Board	No Asbestos Found					
B0B1 - R0026 - Cleaning Store - Distributed (7.36 m2)						
No Asbestos						
B0B1 - R0027 - General Storeroom (8.93 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0027/Floor Coverings Res/Textile/S32					Chrysotile (white asbestos)	
B0B1 - R0028 - Movement (57.1 m2)						
Ceiling Structures/Linings	Vermiculite					
8878/B0B1/R0023/Ceiling Structures/Linings/S8					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0B1 - R0029 - Movement (211.25 m2)						
No Asbestos						
B0B1 - R0030 - Movement (96.33 m2)						
No Asbestos						
B0B1 - R0031 - Movement (33.48 m2)						
No Asbestos						
B0B1 - R0032 - Movement (63.48 m2)						
No Asbestos						
B0B1 - R0033 - Toilets-Disabled (14.24 m2)						
No Asbestos						
B0B1 - R0034 - Stairs (10.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)	
B0B1 - R0035 - Stairs (10.14 m2)						
No Asbestos						
B0B1 - R0036 - Stairs (8.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)	
B0B1 - R1001 - Staff Study (30.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B0B1 - R1002 - Commonroom (135.41 m2)						
No Asbestos						
B0B1 - R1003 - Staff - Toilet (4.48 m2)						
No Asbestos						
B0B1 - R1004 - Staff - Toilet (5.63 m2)						
No Asbestos						
B0B1 - R1005 - Staff Study (24.39 m2)						
No Asbestos						
B0B1 - R1006 - Staff Study (12.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B0B1 - R1007 - Staff Study (20.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B0B1 - R1008 - Music Learning Space (75.25 m2)						
No Asbestos						
B0B1 - R1009 - Music Learning Space (91.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B0B1 - R1010 - Music Store (17.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B0B1 - R1011 - General Storeroom (22.82 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B0B1 - R1012 - General Learning Space (48.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B0B1 - R1013 - General Learning Space (51.11 m2)						
No Asbestos						
B0B1 - R1014 - General Learning Space (50.6 m2)						
No Asbestos						
B0B1 - R1015 - Distribution Board Cupboard (0.56 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1015/Ceiling Structures/Linings/S64				Chrysotile (white asbestos)		
B0B1 - R1016 - Cleaning Supplies Store (11.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R0021/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B0B1 - R1017 - Cleaning Store - Distributed (9.11 m2)						
No Asbestos						
B0B1 - R1018 - Movement (227.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	228m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)		
B0B1 - R1019 - Movement (31.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)		
B0B1 - R1020 - Stairs (22.83 m2)						
No Asbestos						
B0B1 - R1021 - Stairs (21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)		
B0B1 - R1022 - Stairs (14.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - Multi Purpose Facilities - 1977 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior**B0C1 - R0001 - Gymnasium (303.26 m2)**

No Asbestos

B0C1 - R0002 - Movement (54.53 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0C1/R0009/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8878/B0C1/R0002/Floor Coverings Res/Textile/S37	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0C1 - R0003 - Sport Equipment Store (9.49 m2)

No Asbestos

B0C1 - R0004 - Distribution Board Cupboard (1.09 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0C1 - R0005 - Cleaning Store - Distributed (6.1 m2)

Flue	Fibre Cement Pipe 8878/B0C1/R0005/Flu/S36	8m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
------	--	----	--------------------	--------------------	---------	---

B0C1 - R0006 - Staff Study (10.66 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0C1/R0009/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8878/B0C1/R0009/Partition Walls (Cubicles)/S35	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0C1 - R0007 - Shower/Change (27.65 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0C1/R0009/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B0C1 - R0008 - Shower/Change (27.65 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0C1/R0009/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B0C1 - R0009 - Toilets-Boys (23.45 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0C1/R0009/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8878/B0C1/R0009/Partition Walls (Cubicles)/S35	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0C1 - R0010 - Movement (33.71 m2)

No Asbestos

B0C1 - R0011 - Stairs (8.66 m2)

No Asbestos

B0C1 - R1001 - Movement (49.61 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0002/Floor Coverings Res/Textile/S37				Chrysotile (white asbestos)		
B0C1 - R1002 - Cleaning Store - Distributed (6.45 m2)						
Flue	Fibre Cement Pipe	10m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0005/Flu/S36				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B0C1 - R1003 - Cleaning Store - Distributed (10.92 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0009/Partition Walls (Cubicles)/S35				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0002/Floor Coverings Res/Textile/S37				Chrysotile (white asbestos)		
B0C1 - R1004 - Shower/Change (28.55 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0009/Partition Walls (Cubicles)/S35				Chrysotile (white asbestos)		
B0C1 - R1005 - Shower/Change (29.16 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0009/Partition Walls (Cubicles)/S35				Chrysotile (white asbestos)		
B0C1 - R1006 - Staff Study (23.7 m2)						
No Asbestos						
B0C1 - R1007 - Sport Equipment Store (5.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0C1/R0002/Floor Coverings Res/Textile/S37				Chrysotile (white asbestos)		
B0C1 - R1008 - Movement (30.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)		
B0C1 - R1009 - Stairs (20.45 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B0D1 - Technological & Applied Studies - 1977 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B0D1 - R0001 - Materials Technology L.S. (64.03 m2)**

Ceiling Structures/Linings	Vermiculite	65m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8878/B0D1/R0001/Ceiling Structures/Linings/S43				Chrysotile (white asbestos)		

B0D1 - R0004 - Welding Area (3.87 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0E1/R0006/Ceiling Structures/Linings/S42		Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B0D1 - R0005 - Materials Technology L.S. (70.29 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0E1/R0006/Ceiling Structures/Linings/S42		Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B0D1 - R0006 - Materials Store (32.66 m2)

No Asbestos

B0D1 - R0007 - Movement (0.75 m2)

No Asbestos

B0D1 - R0008 - Distribution Board Cupboard (44.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0D1 - R0009 - Movement (3.99 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0C1/R0009/Ceiling Structures/Linings/S34		Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B0D1 - R0010 - Welding/Hot Metals Area (16.72 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0E1/R0006/Ceiling Structures/Linings/S42		Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B0D1 - R0011 - Metal Technology Bay (32.22 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0E1/R0006/Ceiling Structures/Linings/S42		Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B0D1 - R1001 - Design L.S. (63.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0D1/R1001/Floor Coverings Res/Textile/S44				Chrysotile (white asbestos)		

B0D1 - R1002 - Seminar/Technology Space (21.55 m2)

Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0D1/R1001/Floor Coverings Res/Textile/S44				Chrysotile (white asbestos)		

B0D1 - R1003 - Design L.S. (71.01 m2)

Floor Coverings Res/Textile	Vinyl Tiles	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0D1/R1001/Floor Coverings Res/Textile/S44				Chrysotile (white asbestos)		

B0D1 - R1004 - Staff Study (41.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0D1/R1001/Floor Coverings Res/Textile/S44				Chrysotile (white asbestos)		

B0D1 - R1005 - Cleaning Store - Distributed (4.25 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0D1/R1001/Floor Coverings Res/Textile/S44					Chrysotile (white asbestos)	
B0D1 - R1006 - Staff - Toilet (10.38 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1001/Partition Walls (Cubicles)/S39					Chrysotile (white asbestos)	
B0D1 - R1007 - Distribution Board Cupboard (0.75 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	No Asbestos Found					
B0D1 - R1008 - Movement (45.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8878/B0D1/R1008/Ceiling Structures/Linings/S45					No Asbestos Detected	
B0D1 - R1009 - Movement (4.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8878/B0D1/R1008/Ceiling Structures/Linings/S45					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0E1 - Technological & Applied Studies - 1977 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B0E1 - R0001 - Materials Technology L.S. (80.35 m2)**

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0006/Ceiling Structures/Linings/S42	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0E1 - R0002 - Wood Technology Bay (13.5 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0006/Ceiling Structures/Linings/S42	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0E1 - R0003 - Resource/Project Store (13.93 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0006/Ceiling Structures/Linings/S42	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0E1 - R0004 - Dust Extraction Space (5.36 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0006/Ceiling Structures/Linings/S42	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0E1 - R0005 - Materials Technology L.S. (81.26 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0006/Ceiling Structures/Linings/S42	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0E1 - R0006 - General Learning Space (58.59 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0006/Ceiling Structures/Linings/S42	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles 8878/B0E1/R1002/Floor Coverings Res/Textile/S41	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B0E1 - R0007 - Toilets-Boys (29.45 m2)

Ceiling Structures/Linings	Vermiculite 8878/B0E1/R0007/Ceiling Structures/Linings/S5	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Partition Walls (Cubicles)	Compressed AC Sheet 8878/B0E1/R0007/Ceiling Structures/Linings/S5	No Asbestos Detected
----------------------------	--	----------------------

B0E1 - R0008 - Distribution Board Cupboard (0.9 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0E1 - R0009 - Cleaning Store - Distributed (3.9 m2)

No Asbestos

B0E1 - R0010 - Movement (61.66 m2)

No Asbestos

B0E1 - R1001 - Food Technology L.S. (101.34 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8878/B0E1/R1002/Floor Coverings Res/Textile/S41	102m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B0E1 - R1006 - Food Technology L.S. (102.41 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	103m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0E1/R1002/Floor Coverings Res/Textile/S41					Chrysotile (white asbestos)	
B0E1 - R1007 - Toilets-Girls (29.16 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
8878/B0E1/R0007/Ceiling Structures/Linings/S5					No Asbestos Detected	
B0E1 - R1008 - Distribution Board Cupboard (0.74 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B0E1 - R1009 - Movement (57.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)	
B0E1 - R1010 - Computer Room (19.89 m2)						
No Asbestos						
B0E1 - R1011 - Store (6.37 m2)						
No Asbestos						
B0E1 - R1012 - Laundry (1.3 m2)						
No Asbestos						
B0E1 - R1013 - Preparation - Materials (19.92 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0F1 - Art/Technological & Applied Studies - 1977 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B0F1 - R0001 - Cleaning Store - Distributed (9.01 m2)**

No Asbestos

B0F1 - R0007 - Movement (62.51 m2)

No Asbestos

B0F1 - R0011 - Stairs (9.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)		

B0F1 - R0012 - Music Store (9.55 m2)

No Asbestos

B0F1 - R0013 - Music Learning Space (79.92 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0F1/R0002/Ceiling Structures/Linings/S38		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0F1 - R0014 - Music Entry/Display (41.94 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0F1/R0002/Ceiling Structures/Linings/S38		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0F1 - R0015 - Music Learning Space (61.07 m2)

Ceiling Structures/Linings	Vermiculite	8878/B0F1/R0002/Ceiling Structures/Linings/S38		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B0F1 - R1001 - Staff - Toilet (10.2 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1001/Partition Walls (Cubicles)/S39				Chrysotile (white asbestos)		

B0F1 - R1002 - General Storeroom (14.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1002/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		

B0F1 - R1003 - Staff Study (30.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1002/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		

B0F1 - R1004 - Design L.S. (64.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1002/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		

B0F1 - R1005 - Seminar/Technology Space (6.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1002/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		

B0F1 - R1006 - Seminar/Technology Space (7.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1002/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		

B0F1 - R1007 - General Storeroom (61.56 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0F1/R1002/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)	
B0F1 - R1008 - Movement (60.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)	
B0F1 - R1009 - Stairs (19.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8878/B0B1/R1018/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Shed next to Building C

Exterior

Eaves Linings	Flat AC Sheeting					No Asbestos Detected
	8878/Build+1/Eaves Linings/S65					

Interior

Build+1 - Room+1 - RO01

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017