


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Greenacre Public School (1123)
Region : South Western Sydney
State Electorate : Lakemba
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 18 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

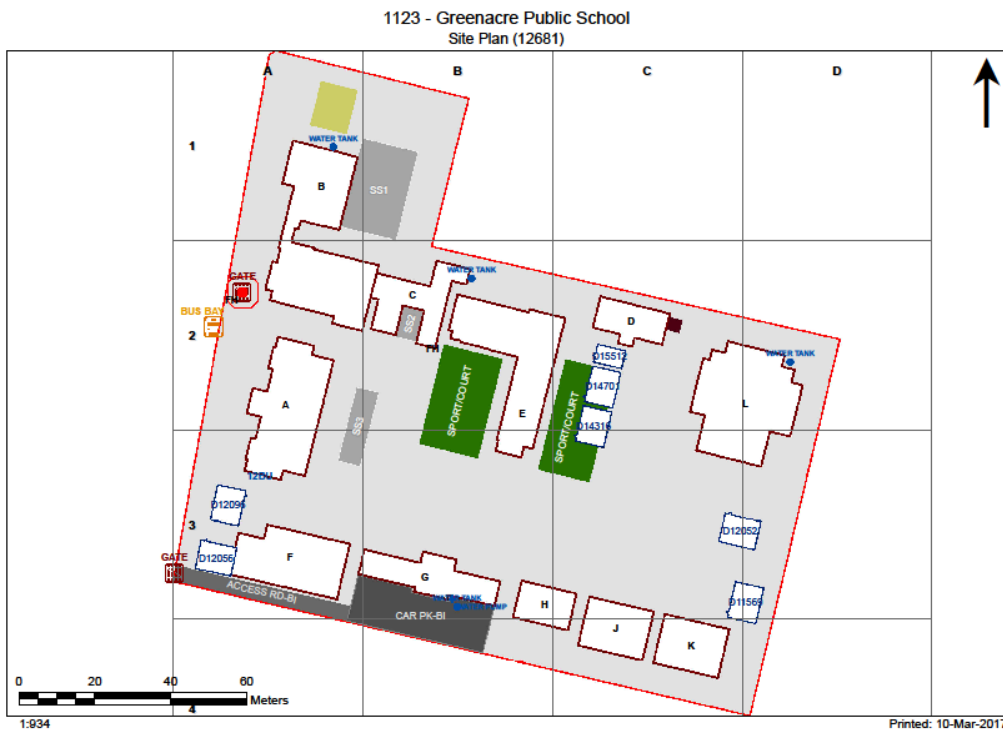

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1927 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 1123/B00A/Underfloor Voids/S8					No Asbestos Detected

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00A/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - Security Store

No Asbestos

B00A - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00A/R1001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0007 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Tiles					
	1123/B00A/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0008 - Sick Bay

No Asbestos

B00A - R0009 - Deputy Principal

No Asbestos

B00A - R0010 - Duplicating Workroom

No Asbestos

B00A - R0011 - Cleaning Distributed Store

No Asbestos

B00A - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00A/R0012/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00A/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00A - R0014 - Home Base

No Asbestos

B00A - R0016 - Home Base

No Asbestos

B00A - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00A/R0019/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0020 - Stairs

No Asbestos

B00A - R0021 - Stairs

No Asbestos

B00A - R0025 - Clerical Office

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R0026 - Staff Kitchen						
Recently Modified Space	Requires Inspection					
B00A - R0027 - Staff Room						
Recently Modified Space	Requires Inspection					
B00A - R0028 - Movement						
Recently Modified Space	Requires Inspection					
B00A - R0029 - Movement						
Recently Modified Space	Requires Inspection					
B00A - R0030 - Personal Effects Storage						
Recently Modified Space	Requires Inspection					
B00A - R0031 - Sick Bay						
Recently Modified Space	Requires Inspection					
B00A - R0032 - Principal						
Recently Modified Space	Requires Inspection					
B00A - R1001 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00A/R1001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1002 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
1123/B00A/R0007/Floor Coverings Res/Textile/S1						No Asbestos Detected
B00A - R1004 - Special Programs Room						
No Asbestos						
B00A - R1005 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00A/R1001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1006 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
1123/B00A/R0007/Floor Coverings Res/Textile/S1						No Asbestos Detected
B00A - R1007 - General Storeroom						
No Asbestos						
B00A - R1008 - Home Base						
No Asbestos						
B00A - R1009 - Home Base						
No Asbestos						
B00A - R1010 - Home Base						
No Asbestos						
B00A - R1011 - Home Base						
No Asbestos						
B00A - R1012 - Movement						
No Asbestos						
B00A - R1013 - Stairs						
No Asbestos						
B00A - R1014 - Stairs						
No Asbestos						
B00A - R1015 - Home Base/Practical Activities						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R1016 - Staff Kitchen

Recently Modified Space Requires Inspection

B00A - R1017 - Clerical Office

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible Less than 300mm					

Interior

B00B - R0001 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00B/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0002 - Interview

No Asbestos

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base - M

No Asbestos

B00B - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00B/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0010 - Security Store

No Asbestos

B00B - R0011 - Movement

Floor Coverings Res/Textile	Vinyl Tiles				
1123/B00B/R0021/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00B - R0012 - Cleaning Distributed Store

No Asbestos

B00B - R0013 - Home Base

No Asbestos

B00B - R0014 - Home Base

No Asbestos

B00B - R0015 - Disabled Shower/Toilet

No Asbestos

B00B - R0016 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00B/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0017 - Movement

No Asbestos

B00B - R0018 - General Storeroom

No Asbestos

B00B - R0019 - Movement

No Asbestos

B00B - R0020 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0021 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
	1123/B00B/R0021/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R0022 - Stairs						
No Asbestos						
B00B - R0023 - Stairs						
No Asbestos						
B00B - R0024 - Movement						
No Asbestos						
B00B - R0026 - External Movement						
No Asbestos						
B00B - R0031 - Practical Activities						
Recently Modified Space	Requires Inspection					
B00B - R0032 - Practical Activities - 1hb						
Recently Modified Space	Requires Inspection					
B00B - R0033 - Movement						
Recently Modified Space	Requires Inspection					
B00B - R0034 - Practical Activities						
Recently Modified Space	Requires Inspection					
B00B - R1001 - Seminar/Study						
Floor Coverings Res/Textile	Vinyl Tiles					
	1123/B00B/R0021/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1002 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1003 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1004 - Home Base						
No Asbestos						
B00B - R1005 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
	1123/B00B/R0021/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1006 - Cleaning Distributed Store						
No Asbestos						
B00B - R1007 - Movement						
No Asbestos						
B00B - R1008 - General Storeroom						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00B/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1009 - Special Programs Room						
No Asbestos						
B00B - R1010 - Home Base						
No Asbestos						
B00B - R1011 - Home Base						
No Asbestos						
B00B - R1012 - Personal Effects Storage						
No Asbestos						
B00B - R1013 - Movement						
No Asbestos						
B00B - R1014 - Toilets - Boys/Girls						
No Asbestos						
B00B - R1015 - Staff Toilet						
No Asbestos						
B00B - R1016 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
1123/B00B/R0021/Floor Coverings Res/Textile/S3				No Asbestos Detected		
Ceiling Structures/Linings	Flat AC Sheeting	116m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00B/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1017 - Stairs						
No Asbestos						
B00B - R1018 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - Pupil Facilities - 1951 - Brick/Block (Brick/Block)						
Exterior						
No Asbestos						
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Interior						
B00C - R0001 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0003 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0004 - Canteen Office/Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0005 - Canteen						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0006 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0007 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	75m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0008 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0010 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0011 - Handwashing Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0012 - Handwashing Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0013 - Toilets - Boys						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00C/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0014 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00C/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0015 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00C/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0016 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	22.73m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00C/R0016/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0017 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	12.8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1123/B00C/R0017/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1123/B00D/Eaves Linings/S15					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 1123/B00D/Gable verge lining/S16	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris 1123/B00D/Underfloor Voids/S17	1m2	South East	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00D - R0001 - Home Base**

Panel behind heater	Flat AC Sheeting 1123/B00D/R0001/Panel behind heater/S6	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------------	--	-----	-------------	--------------------	---------	--

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - Personal Effects Storage

No Asbestos

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1123/B00D/R0001/Panel behind heater/S6	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00D - R0006 - Personal Effects Storage

No Asbestos

B00D - R0007 - Home Base Store

No Asbestos

B00D - R0008 - Home Base

Panel behind heater	Flat AC Sheeting 1123/B00D/R0001/Panel behind heater/S6	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------------	--	-----	-------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Communal Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Compressed AC Sheet	1m2	Under R0029	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00E/Underfloor Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Under R0029	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1123/B00E/Underfloor Voids/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Under R0018	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1123/B00E/Underfloor Voids/S20			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1123/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1123/B00B/R0021/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00E - R0007 - Movement

No Asbestos

B00E - R0008 - Toilets - Boys/Girls

No Asbestos

B00E - R0009 - Movement

No Asbestos

B00E - R0010 - Interview

Floor Coverings Res/Textile	Vinyl Tiles					
	1123/B00B/R0021/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00E - R0011 - Movement

No Asbestos

B00E - R0012 - Movement

No Asbestos

B00E - R0013 - Movement

No Asbestos

B00E - R0014 - General Storeroom

No Asbestos

B00E - R0015 - Security Store

No Asbestos

B00E - R0016 - Home Base

No Asbestos

B00E - R0017 - Home Base

No Asbestos

B00E - R0018 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00E - R0019 - General Storeroom						
No Asbestos						
B00E - R0020 - Movement						
No Asbestos						
B00E - R0021 - Movement						
No Asbestos						
B00E - R0022 - Stairs						
No Asbestos						
B00E - R0023 - Stairs						
No Asbestos						
B00E - R0024 - Home Base						
No Asbestos						
B00E - R0025 - Practical Activities						
No Asbestos						
B00E - R0026 - Home Base Store						
No Asbestos						
B00E - R0027 - Home Base Store						
No Asbestos						
B00E - R0028 - Practical Activities						
No Asbestos						
B00E - R0029 - Home Base						
No Asbestos						
B00E - R0030 - External Movement						
No Asbestos						
B00E - R1001 - Sports Store						
Floor Coverings Res/Textile	Vinyl Tiles					
1123/B00B/R0021/Floor Coverings Res/Textile/S3					No Asbestos Detected	
B00E - R1002 - Staff Toilet						
No Asbestos						
B00E - R1003 - Cleaning Distributed Store						
No Asbestos						
B00E - R1004 - Special Programs Room						
No Asbestos						
B00E - R1005 - General Storeroom						
No Asbestos						
B00E - R1009 - Movement						
No Asbestos						
B00E - R1010 - Stairs						
No Asbestos						
B00E - R1011 - Stairs						
No Asbestos						
B00E - R1012 - Home Base						
No Asbestos						
B00E - R1013 - Special Programs Room						
No Asbestos						
B00E - R1014 - Home Base						
No Asbestos						
B00E - R1015 - Home Base Store						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - Movement

No Asbestos

B00F - R0002 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0003 - Plant

No Asbestos

B00F - R0004 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0007 - Toilet - P

No Asbestos

B00F - R0008 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0009 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0010 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0011 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1123/B00G/Eaves Linings/S21	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Cover Strips 1123/B00G/Eaves Linings/S22	80m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00G - R0001 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 1123/B00G/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0008 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 1123/B00G/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0009 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting 1123/B00G/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0010 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 1123/B00G/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0011 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 1123/B00G/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0012 - Sports Store

No Asbestos

B00G - R0013 - Toilets - Boys

No Asbestos

B00G - R0014 - Toilets - Girls

No Asbestos

B00G - R0015 - Sports Store

No Asbestos

B00G - R0016 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1950 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Home Base Store

No Asbestos

B00H - R0002 - Movement

No Asbestos

B00H - R0003 - Home Base Store

No Asbestos

B00H - R0004 - Home Base

No Asbestos

B00H - R0005 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Movement

No Asbestos

B00J - R0002 - Practical Activities - 1hb

No Asbestos

B00J - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Movement

No Asbestos

B00K - R0002 - Practical Activities - 1hb

No Asbestos

B00K - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Communal Space

No Asbestos

B00L - R0002 - Raised Platform

No Asbestos

B00L - R0003 - Movement

No Asbestos

B00L - R0004 - Toilets - Boys

No Asbestos

B00L - R0005 - P.E. Store

No Asbestos

B00L - R0006 - Movement

No Asbestos

B00L - R0007 - Communal/Performance Store

No Asbestos

B00L - R0008 - Chair Storeroom

No Asbestos

B00L - R0009 - Movement

No Asbestos

B00L - R0010 - Plant

No Asbestos

B00L - R0011 - Cleaning Distributed Store

No Asbestos

B00L - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0013 - Movement

No Asbestos

B00L - R0014 - Toilets - Girls

No Asbestos

B00L - R0015 - Sound Cupboard

No Asbestos

B00L - R0016 - Access Shower/Toilet

No Asbestos

B00L - R0017 - External Movement

No Asbestos

B00L - R0018 - Movement

No Asbestos

B00L - R0019 - Ramp

No Asbestos

B00L - R0020 - External Movement

No Asbestos

B00L - R0021 - Covered Outdoor Learning Area

No Asbestos

B00L - R0022 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11569 - Learning Unit - Standard With P.A.A. : Placement Date - 27/04/2012

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12052 - Learning Unit - Standard/Withdrawal : Placement Date - 6/01/2000

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D12056 - Learning Unit - Standard/Withdrawal : Placement Date - 14/01/1999

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D12096 - Learning Unit - Standard With P.A.A. : Placement Date - 21/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D14316 - Learning Unit - Standard/Withdrawal : Placement Date - 23/07/1998						
Exterior						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D14701 - Learning Unit - Standard/Withdrawal : Placement Date - 11/02/2003						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 750 - D15512 - Learning Unit - ESL : Placement Date - 10/02/2003						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				5.76 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - EsI						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1123_ASB_281112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017