


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Galston Public School (1952)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Jul - 2016

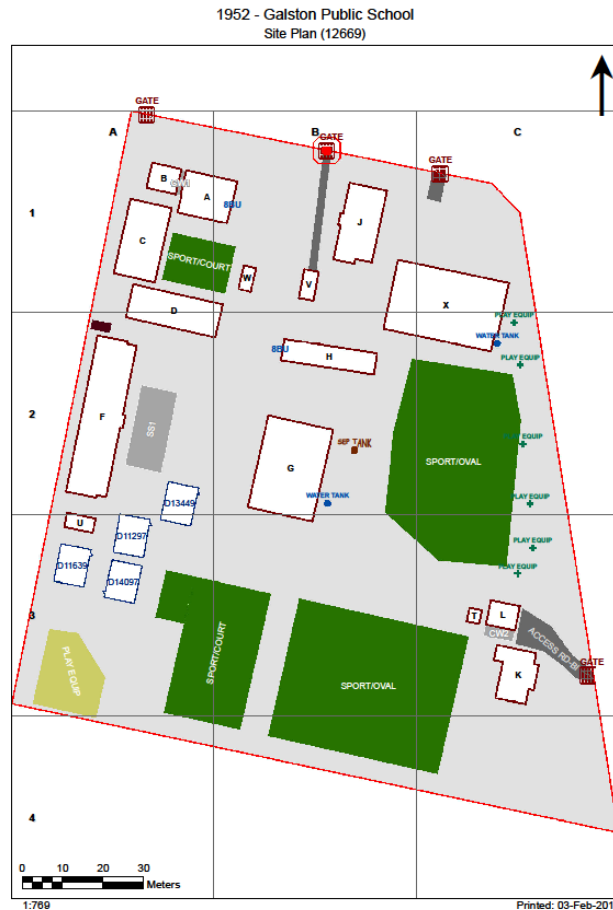

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Pupil Facilities/Special Purpose - 1891 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Height Restriction

Underfloor Voids - Slab on Ground
 No Asbestos Found

Interior

B00A - R0001 - Canteen

No Asbestos

B00A - R0002 - Canteen

No Asbestos

B00A - R0003 - Entry Vestibule

No Asbestos

B00A - R0004 - General Storeroom

No Asbestos

B00A - R0005 - Withdrawal Space - 1hb

No Asbestos

B00A - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Special Purpose - 1913 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00B/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Height Restriction					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Area inaccessible, height of void less than 200mm.					

Interior

B00B - R0001 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1950 - Brick/Block (Brick/Block)**Exterior**

Gable verge lining	Flat AC Sheeting	16m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/Gable verge lining/S26				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	30m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction, low clearance on underfloor void.					

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Panels below windows	Flat AC Sheeting	16m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/R0001/Panels below windows/S19				Chrysotile (white asbestos)	

B00C - R0002 - Personal Effects Storage

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Home Base Store

No Asbestos

B00C - R0005 - Home Base

Panels below windows	Flat AC Sheeting	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/R0001/Panels below windows/S19				Chrysotile (white asbestos)	

B00C - R0006 - Home Base

Panels below windows	Flat AC Sheeting	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/R0001/Panels below windows/S19				Chrysotile (white asbestos)	

B00C - R0007 - Home Base Store

No Asbestos

B00C - R0008 - Main Switch Board

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1952/B00C/R0008/Wall Linings Internal/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00C/R0008/Wall Linings Internal/S1				Chrysotile (white asbestos)	

B00C - R0009 - Personal Effects Storage

No Asbestos

B00C - R0010 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction > 3m.					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction < 0.25m					
Wall Cladding	Flat AC Sheeting 1952/B00D/Wall Cladding/S20	0.5m2	East facing, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00D - R0001 - Personal Effects Storage

No Asbestos

B00D - R0002 - Movement

Wall Linings Internal	Flat AC Sheeting 1952/B00D/Wall Cladding/S20	1m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	---	-----	-------------------------------	--------------------	---------	---

B00D - R0003 - General Storeroom

No Asbestos

B00D - R0004 - Cleaning Supplies

Sink panel	Flat AC Sheeting 1952/B00D/R0004/Wall Linings Internal/S2	1.5m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
------------	--	-------	------------------------------	--------------------	---------	--

B00D - R0005 - Home Base

Sink panel	Flat AC Sheeting 1952/B00D/R0004/Wall Linings Internal/S2	1m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
------------	--	-----	------------------------------	--------------------	---------	--

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1950 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - Cordoned Off					
Eaves Linings	Flat AC Sheeting 1952/B00F/Eaves Linings/S16				No Asbestos Detected	
Wall Cladding	Flat AC Sheeting 1952/B00F/Wall Cladding/S18	8m2	South west corner	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction > 3m.					

Interior

B00F - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting 1952/B00F/R0001/Wall Linings Internal/S21	4m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	---	-----	-----------------------------	--------------------	---------	--

B00F - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1952/B00F/R0002/Ceiling Structures/Linings/S12	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0003 - Movement

Wall Linings Internal	Flat AC Sheeting 1952/B00F/R0003/Wall Linings Internal/S22	3m2	North facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	---	-----	-----------------------------	--------------------	---------	---

B00F - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 1952/B00F/R0004/Floor Coverings Res/Textile/S23					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00F - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1952/B00F/R0005/Wall Linings Internal/S15					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00F - R0006 - Home Base

No Asbestos

B00F - R0007 - Home Base

No Asbestos

B00F - R0008 - Withdrawal Space - 1hb

No Asbestos

B00F - R0009 - Withdrawal Space - 1hb

No Asbestos

B00F - R0010 - Home Base

No Asbestos

B00F - R0011 - Home Base

No Asbestos

B00F - R0012 - Practical Activities - 1hb

No Asbestos

B00F - R0013 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 1952/B00F/R0013/Wall Linings Internal/S11	7m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	---	-----	--	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1988 - Brick/Veneer (Brick/Veneer)

Exterior

Wall Cladding	Flat AC Sheeting 1952/B00G/R0001/Wall Linings Internal/S9					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00G - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting 1952/B00G/R0001/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00G - R0002 - Movement

Wall Linings Internal	Flat AC Sheeting 1952/B00G/R0001/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00G - R0003 - Reading Area

Door panel	Flat AC Sheeting 1952/B00G/R0005/Door panel/S7	2m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
------------	---	-----	-------------------------------	--------------------	---------	--

B00G - R0004 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00G - R0005 - Library Office/Workroom

Door panel	Flat AC Sheeting 1952/B00G/R0005/Door panel/S7	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
------------	---	-----	--------------	--------------------	---------	--

Floor Coverings Res/Textile	Vinyl Sheet 1952/B00G/R0004/Floor Coverings Res/Textile/S8					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00G - R0006 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00G - R0007 - Movement

Wall Linings Internal	Flat AC Sheeting 1952/B00G/R0001/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00G - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 1952/B00G/R0009/Wall Linings Internal/S10					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

Ceiling Structures/Linings	Flat AC Sheeting 1952/B00G/R0009/Wall Linings Internal/S10					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00G - R0009 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting 1952/B00G/R0009/Wall Linings Internal/S10					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

Ceiling Structures/Linings	Flat AC Sheeting 1952/B00G/R0009/Wall Linings Internal/S10					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00G - R0010 - Security Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/Eaves Linings/S28					Chrysotile (white asbestos)

Interior**B00H - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0003 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0004 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0005 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0006 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0007 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Administration - 1913 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction > 3 and storage.

Interior**B00J - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1952/B00J/R0001/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0002 - Staff Room Annexe

No Asbestos

B00J - R0003 - General Storeroom

No Asbestos

B00J - R0004 - Staff Kitchen

No Asbestos

B00J - R0005 - Duplicating Workroom

No Asbestos

B00J - R0006 - Clerical Office/Workroom

No Asbestos

B00J - R0007 - Principal

No Asbestos

B00J - R0008 - Movement

No Asbestos

B00J - R0009 - Movement

Electrical Mounting Board	Resinous Membrane	0.5Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	-------------------	---------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00J - R0010 - Clerical Office/Workroom**

No Asbestos

B00J - R0011 - Staff Room

No Asbestos

B00J - R0012 - General Storeroom

No Asbestos

B00J - R0013 - Staff Shower/Change

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1952/B00J/R0014/Wall Linings Internal/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1952/B00J/R0014/Wall Linings Internal/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0014 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1952/B00J/R0014/Wall Linings Internal/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1952/B00J/R0014/Wall Linings Internal/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0015 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00J/R0014/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1952/B00J/R0014/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other-After School Care - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - access blocked off due to storage.					
Eaves Linings	Flat AC Sheeting 1952/B00K/Eaves Linings/S6	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor	AC Fragments/Debris 1952/B00K/Underfloor/S29	4m2	Entrance	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos)

Interior**B00K - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 1952/B00K/R0001/Ceiling Structures/Linings/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0002 - Out Of School Hours Care Centre

No Asbestos

B00K - R0003 - Out Of School Hours Care Centre

No Asbestos

B00K - R0004 - Movement

No Asbestos

B00K - R0005 - Out Of School Hours Care Centre

Wall Linings Internal	Flat AC Sheeting 1952/B00K/R0005/Wall Linings Internal/S17					No Asbestos Detected
Partition Walls (Cubicles)	Flat AC Sheeting 1952/B00K/R0005/Wall Linings Internal/S17					No Asbestos Detected

B00K - R0006 - Out Of School Hours Care Centre

No Asbestos

B00K - R0007 - Out Of School Hours Care Centre

Wall Linings Internal	Flat AC Sheeting 1952/B00K/R0007/Wall Linings Internal/S3	6m2	North facing, East facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0008 - Library Office/Workroom

No Asbestos

B00K - R0009 - Entry Vestibule

No Asbestos

B00K - R0010 - Sports Store

Wall Linings Internal	Flat AC Sheeting 1952/B00K/R0011/Ceiling Structures/Linings/S4	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 1952/B00K/R0011/Ceiling Structures/Linings/S4	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1952/B00K/R0011/Ceiling Structures/Linings/S4	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Shed - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00L - R0001 - P.E. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Mechanical Services - 1975 - Concrete (Concrete)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00T - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Shed - 1988 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00U - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - Shed - 1950 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	80m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1952/B00V/Wall Cladding/S30				Chrysotile (white asbestos)	

Interior

B00V - R0001 - Uniform Shop

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00W - Pupil Facilities - 1913 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00W - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00X - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00X - R0001 - Covered Outdoor Learning Area

No Asbestos

B00X - R0002 - Communal Space

No Asbestos

B00X - R0003 - Raised Platform

No Asbestos

B00X - R0004 - Chair Storeroom

No Asbestos

B00X - R0005 - Communal/Performance Store

No Asbestos

B00X - R0006 - P.E. Store

No Asbestos

B00X - R0007 - Toilet - Lobby

No Asbestos

B00X - R0008 - Toilets - Girls

No Asbestos

B00X - R0009 - Sound Cupboard

No Asbestos

B00X - R0010 - Toilets - Boys

No Asbestos

B00X - R0011 - Toilet - Lobby

No Asbestos

B00X - R0012 - Cleaning Distributed Store

No Asbestos

B00X - R0013 - Main Switch Board

No Asbestos

B00X - R0014 - Toilet - P

No Asbestos

B00X - R0015 - Plant

No Asbestos

B00X - R0016 - Movement

No Asbestos

B00X - R0017 - Movement

No Asbestos

B00X - R0018 - Ramp

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11297 - Learning Unit - Standard With P.A.A. : Placement Date - 2/02/2010

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11639 - Learning Unit - Standard With P.A.A. : Placement Date - 1/08/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D13449 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 29/04/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14097 - Learning Unit - Standard With P.A.A. : Placement Date - 18/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017