


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ganmain Public School (1954)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Coolamon

Initial Survey : Noel Arnold & Associates : 01 - May - 2008
Register Issue Date : 22 - Mar - 2017

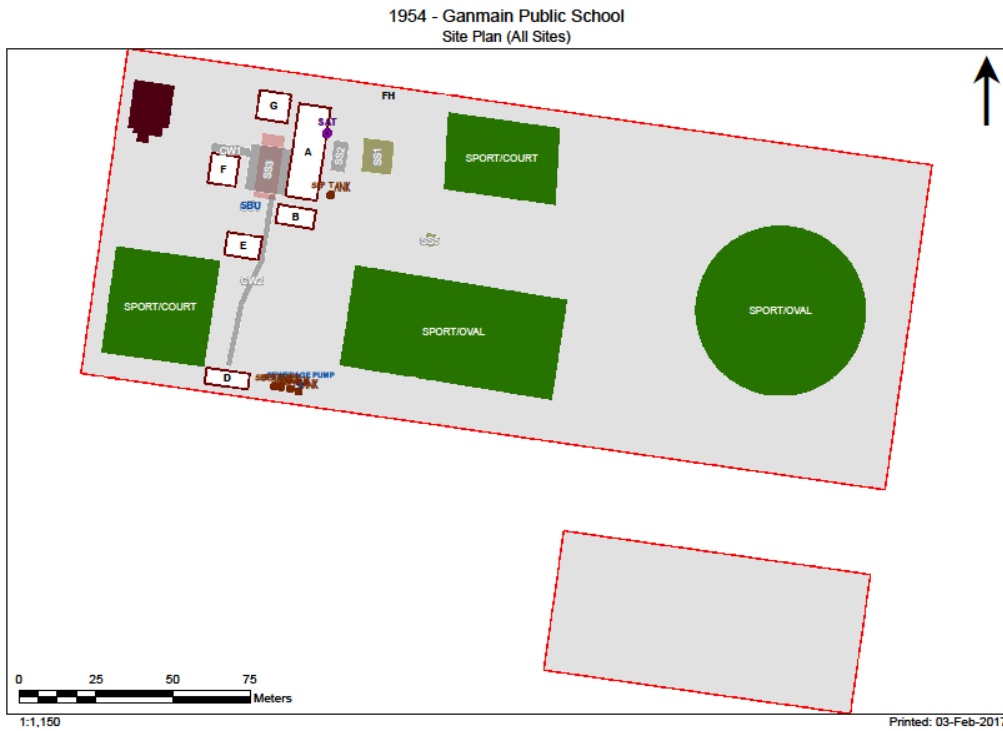

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1912 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00A - R0001 - Reading Area

No Asbestos

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Home Base - M

No Asbestos

B00A - R0004 - Shower/Change

Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1954/B00C/R0001/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B00A - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1954/B00C/R0001/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B00A - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
1954/B00B/R0002/Ceiling Structures/Linings/S7						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
1954/B00B/R0002/Ceiling Structures/Linings/S7						

B00A - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1954/B00C/R0001/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
1954/B00B/R0002/Ceiling Structures/Linings/S7						

B00A - R0008 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles	3m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1954/B00C/R0001/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B00A - R0009 - Clerical Office

No Asbestos

B00A - R0012 - Principal

No Asbestos

B00A - R0013 - Clerical Office/Workroom

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Shed - 1935 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1954/B00B/R0002/Ceiling Structures/Linings/S7					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00B - R0001 - General Storeroom

No Asbestos

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1954/B00B/R0002/Ceiling Structures/Linings/S7					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1954/B00B/R0002/Ceiling Structures/Linings/S7					No Asbestos Detected

B00B - R0003 - Canteen Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1965 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior

B00D - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	------------	--------------------	---------	--------------------

1954/B00D/R0001/Partition Walls (Cubicles)/S4

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0002 - Toilets - Girls

No Asbestos

B00D - R0003 - Staff Toilet

No Asbestos

B00D - R0004 - Cleaning Supplies

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Special Purpose - 1896 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Sheet
1954/B00E/R0002/Floor Coverings Res/Textile/S6	

No Asbestos Detected

B00E - R0003 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1920 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - Withdrawal Space - 1hb

No Asbestos

B00F - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	2m2	SW Corner	Good Condition (1)	Low (1)	Low Priority (2-3)
1954/B00F/R0002/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Heater Surround	Flat AC Sheeting	1Unit(s)	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1954/B00F/R0002/Backing behind heater/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0003 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet					
1954/B00F/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Home Base

No Asbestos

B00G - R0002 - Home Base Store

No Asbestos

B00G - R0003 - Practical Activities - 1hb

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017