


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Gerogery Public School (1969)
Region : Riverina
State Electorate : Albury
Local Government Area : Greater Hume

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

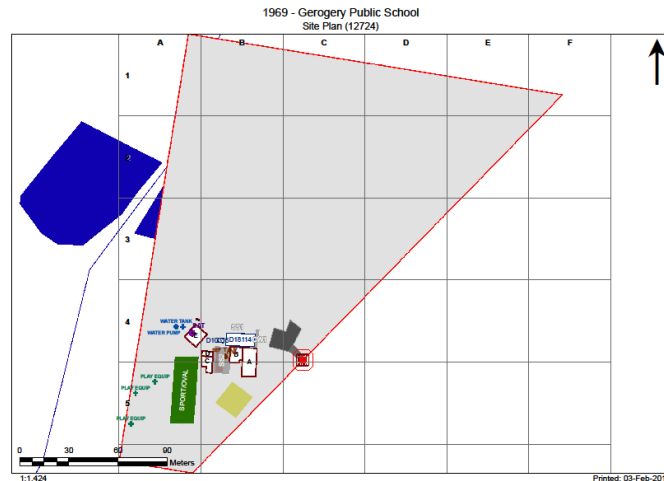

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1955 - Timber (Timber)

Exterior

Electrical backing board	Resinous Board	1Unit(s)	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	----------	-------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Practical Activities - 1hb

Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00A - R0003 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1969/B00A/R0003/Floor Coverings Res/Textile/S4	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive 1969/B00A/R0003/Floor Coverings Res/Textile/S5					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00A - R0004 - Withdrawal Space - 1hb

No Asbestos

B00A - R0005 - Home Base Store

No Asbestos

B00A - R0006 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1969/B00B/R0003/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00B - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1969/B00B/R0003/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00B - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1969/B00B/R0003/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00B - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1969/B00B/R0003/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00B - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Building Services - 1920 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1969/B00C/R0002/Wall Linings Internal/S2					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 1969/B00C/Wall Cladding/S3					No Asbestos Detected

Interior

B00C - R0001 - Reading Area

No Asbestos

B00C - R0002 - Cleaning Supplies

Wall Linings Internal	Flat AC Sheeting 1969/B00C/R0002/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1969/B00C/R0002/Wall Linings Internal/S2					No Asbestos Detected

B00C - R0003 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities/Building Services - 2009 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00D - R0001 - Sports Store

No Asbestos

B00D - R0002 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Practical Activities

No Asbestos

B00E - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 837 - D10315 - Hcap Shower/Change/Toilet : Placement Date - 23/11/2011

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

OS 500 - D18114 - Admin - Library : Placement Date - 29/08/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	20.16 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	13 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2
---------	---------------	------------------	-------

R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos	19 m2
---------	---------------	------------------	-------

R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2
---------	---------------	------------------	-------

R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos	0 m2
---------	---------------	------------------	------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2

R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos	0 m2
---------	---------------	------------------	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017