


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Geurie Public School (1972)  
**Region :** Western NSW  
**State Electorate :** Dubbo  
**Local Government Area :** Wellington

**Initial Survey :** Noel Arnold & Associates : 19 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

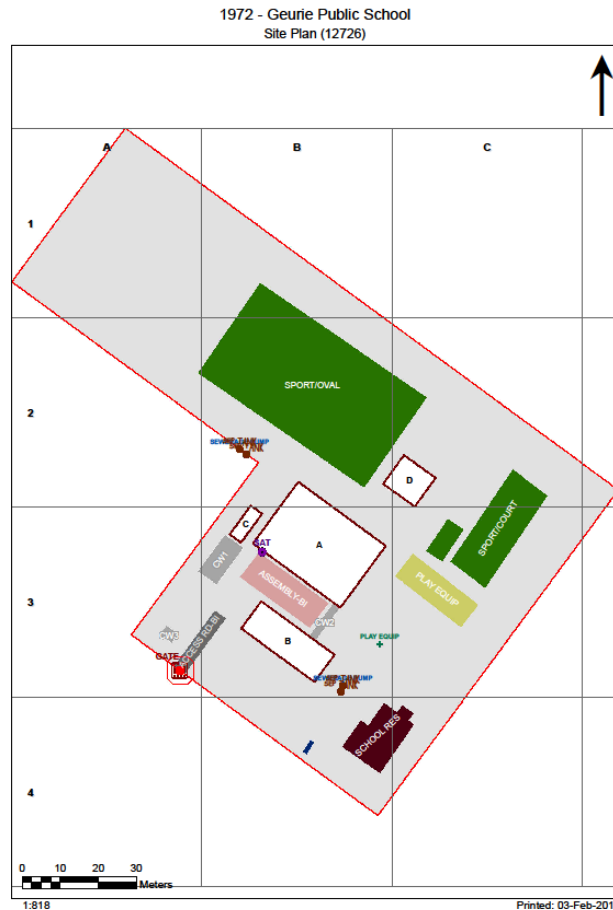

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - General Learning/Pupil Facilities - 1982 - Brick/Veneer (Brick/Veneer)</b>						
<b>Exterior</b>						
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Northeast & Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Ramp	Compressed AC Sheet					<b>No Asbestos Detected</b>
	1972/B00A/Ramp/S5					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
<b>Interior</b>						
<b>B00A - R0001 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0002 - Home Base</b>						
No Asbestos						
<b>B00A - R0003 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0004 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0004/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0005 - Distribution Board</b>						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	1Unit	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					
Ceiling Structures/Linings	Flat AC Sheeting	1.26m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1972/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0006 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0007 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	1972/B00A/R0007/Floor Coverings Res/Textile/S6					
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	1972/B00A/R0007/Floor Coverings Res/Textile/S7					
<b>B00A - R0008 - Canteen</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	1972/B00A/R0007/Floor Coverings Res/Textile/S6					
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	1972/B00A/R0007/Floor Coverings Res/Textile/S7					
<b>B00A - R0009 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	1972/B00A/R0007/Floor Coverings Res/Textile/S6					
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	1972/B00A/R0007/Floor Coverings Res/Textile/S7					
<b>B00A - R0010 - Staff Room Annexe</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Red vinyl sheet under carpet					
	1972/B00A/R0007/Floor Coverings Res/Textile/S6				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive under red vinyl sheet under carpet					
	1972/B00A/R0007/Floor Coverings Res/Textile/S7				<b>No Asbestos Detected</b>	
<b>B00A - R0011 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Red vinyl sheet					
	1972/B00A/R0007/Floor Coverings Res/Textile/S6				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive under red vinyl sheet					
	1972/B00A/R0007/Floor Coverings Res/Textile/S7				<b>No Asbestos Detected</b>	
<b>B00A - R0012 - Cleaning Supplies</b>						
Wall Linings Internal	Flat AC Sheeting	45m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1972/B00A/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0013 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0004/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0014 - General Storeroom</b>						
Floor Coverings Res/Textile	Red vinyl sheet					
	1972/B00A/R0007/Floor Coverings Res/Textile/S6				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive under red vinyl sheet					
	1972/B00A/R0007/Floor Coverings Res/Textile/S7				<b>No Asbestos Detected</b>	
<b>B00A - R0015 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0016 - Home Base</b>						
No Asbestos						
<b>B00A - R0017 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0018 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00A - R0019 - Home Base</b>						
No Asbestos						
<b>B00A - R0020 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0021 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0022 - Home Base</b>						
No Asbestos						
<b>B00A - R0023 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00A/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0024 - Withdrawal Space - 1hb</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/Library - 1895 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	7m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	-------------------------------	--------------------	---------	--------------------

**Assumed Asbestos - Cannot sample - height restricted**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - No sub-floor opening
---	---

Pitched roof -Flat ceiling	Non Accessible Area - Height restricted approx 6m
----------------------------	--

**Interior****B00B - R0001 - Clerical Office**

No Asbestos

**B00B - R0002 - Duplicating Workroom**

Floor Coverings Res/Textile	Red vinyl sheeting 1972/B00A/R0007/Floor Coverings Res/Textile/S6	<b>No Asbestos Detected</b>
--------------------------------	--	-----------------------------

Floor Coverings Res/Textile	Adhesive under red vinyl sheet 1972/B00A/R0007/Floor Coverings Res/Textile/S7	<b>No Asbestos Detected</b>
--------------------------------	--	-----------------------------

**B00B - R0003 - Principal**

No Asbestos

**B00B - R0004 - Staff Room**

No Asbestos

**B00B - R0005 - Movement**

No Asbestos

**B00B - R0006 - Reading Area**

No Asbestos

**B00B - R0007 - Library Office/Workroom**

Floor Coverings Res/Textile	Red vinyl sheet 1972/B00A/R0007/Floor Coverings Res/Textile/S6	<b>No Asbestos Detected</b>
--------------------------------	---	-----------------------------

Floor Coverings Res/Textile	Adhesive under red vinyl sheet 1972/B00A/R0007/Floor Coverings Res/Textile/S7	<b>No Asbestos Detected</b>
--------------------------------	--	-----------------------------

**B00B - R0008 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet 1972/B00A/R0007/Floor Coverings Res/Textile/S6	<b>No Asbestos Detected</b>
--------------------------------	---	-----------------------------

Floor Coverings Res/Textile	Adhesive 1972/B00A/R0007/Floor Coverings Res/Textile/S7	<b>No Asbestos Detected</b>
--------------------------------	--	-----------------------------

**B00B - R0009 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet 1972/B00A/R0007/Floor Coverings Res/Textile/S6	<b>No Asbestos Detected</b>
--------------------------------	---	-----------------------------

Floor Coverings Res/Textile	Adhesive 1972/B00A/R0007/Floor Coverings Res/Textile/S7	<b>No Asbestos Detected</b>
--------------------------------	--	-----------------------------

**B00B - R0010 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet 1972/B00A/R0007/Floor Coverings Res/Textile/S6	<b>No Asbestos Detected</b>
--------------------------------	---	-----------------------------

Floor Coverings Res/Textile	Adhesive 1972/B00A/R0007/Floor Coverings Res/Textile/S7	<b>No Asbestos Detected</b>
--------------------------------	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - R0011 - Staff Toilet**

No Asbestos

**B00B - R0012 - Entry Vestibule**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Building Services - 1939 - Brick/Veneer (Brick/Veneer)****Exterior**

Wall Cladding	Flat AC Sheeting	12m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00C/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Electrical Backing Board	Resinous Board	1Unit	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Cannot sample - Live</b>					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

**Interior****B00C - R0001 - No Access**

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00C/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00C/R0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - Garden Store**

Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00C/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1972/B00C/R0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Tan coloured vinyl sheet					
	1972/B00C/R0002/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive under tan vinyl sheet					
	1972/B00C/R0002/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B00C - R0003 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00D - R0001 - Reading Area**

No Asbestos

**B00D - R0002 - K.L.A. Store**

No Asbestos

**B00D - R0003 - Practical Activities**

No Asbestos

**B00D - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017