


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Glenfield Public School (2001)  
**Region :** South Western Sydney  
**State Electorate :** Macquarie Fields  
**Local Government Area :** Campbelltown

**Initial Survey :** Noel Arnold & Associates : 30 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 25 - Nov - 2016

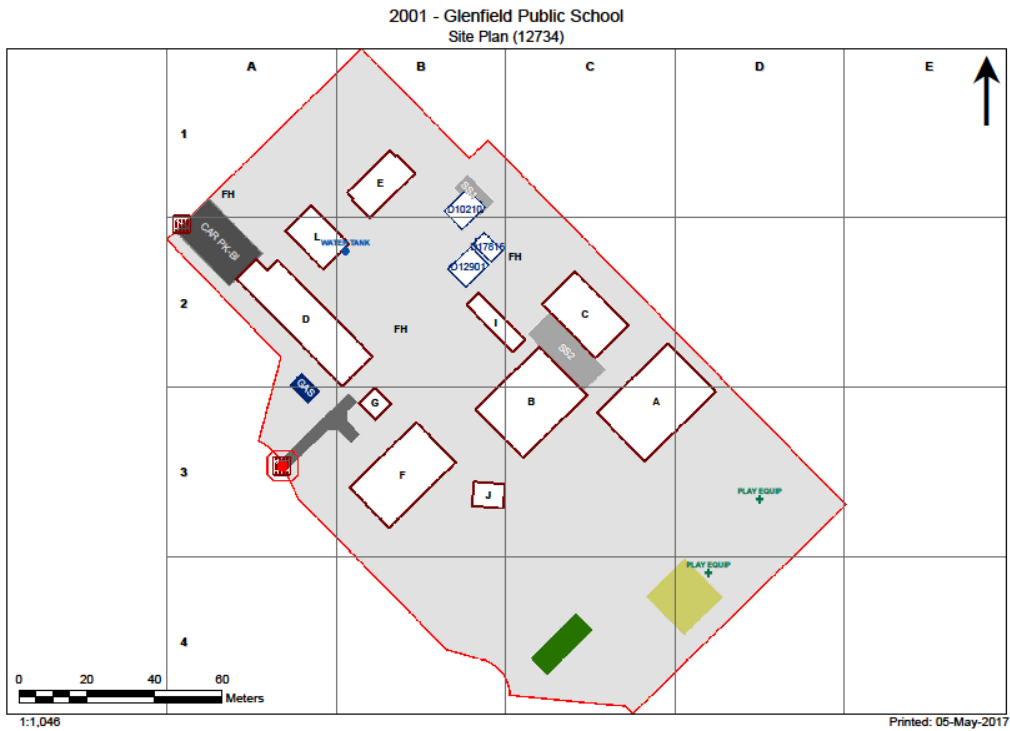

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1975 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area  
- Area inaccessible No voids

Ceiling Voids No Asbestos Found

**Interior****B00A - R0001 - Home Base (69.38 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles  
2001/B00A/R0001/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

**B00A - R0002 - Uniform Shop (4 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0003 - Toilets - Girls (22.56 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Partition Walls (Cubicles) Compressed AC Sheet 13m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
2001/B00A/R0011/Partition Walls (Cubicles)/S6 **Chrysotile (white asbestos)**

**B00A - R0004 - Distribution Board (0.74 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0005 - Home Base (78.16 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0006 - Practical Activities - 1hb (10.3 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0007 - Toilets - Boys/Girls (2.75 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0008 - Toilets - Boys/Girls (2.77 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0009 - Practical Activities - 1hb (10.3 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0010 - Home Base (78.16 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00A/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R0011 - Toilets - Boys (20.96 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 2001/B00A/R0011/Partition Walls (Cubicles)/S6	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0012 - Cleaning Distributed Store (5.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0013 - Home Base (50.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0014 - Practical Activities - 1hb (17.25 m2)</b>						
Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00A/R0001/Floor Coverings Res/Textile/S2					No Asbestos Detected
<b>B00A - R0015 - External Movement (30.24 m2)</b>						
No Asbestos						
<b>B00A - R0016 - External Movement (39.37 m2)</b>						
No Asbestos						
<b>B00A - R0017 - External Movement (30.24 m2)</b>						
No Asbestos						
<b>B00A - R0018 - External Movement (39.37 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Administration - 1975 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area  
- Area inaccessible No Voids

Ceiling Voids No Asbestos Found

**Interior****B00B - R0001 - Practical Activities - 1hb (17.33 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Tiles 18m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
2001/B00B/R0006/Floor Coverings Res/Textile/S8 **Chrysotile (white asbestos)**

**B00B - R0002 - Home Base (50.97 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00B - R0003 - General Storeroom (8.1 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Tiles 9m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
2001/B00B/R0006/Floor Coverings Res/Textile/S8 **Chrysotile (white asbestos)**

**B00B - R0004 - Distribution Board (7.16 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Electrical Backing Board Resinous Board 1m2 West Good Condition (1) Low (1) Low Priority (2-3)  
2001/B00B/R0004/Electrical Backing Board/S15 **Chrysotile (white asbestos)**

**B00B - R0005 - Home Base (50.83 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00B - R0006 - Practical Activities - 1hb (17.25 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Tiles 18m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
2001/B00B/R0006/Floor Coverings Res/Textile/S8 **Chrysotile (white asbestos)**

**B00B - R0007 - Clerical Office (39.22 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00B - R0009 - Staff Room Annexe (10.76 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00B - R0010 - Staff Room (32.1 m2)**

Ceiling Structures/Linings Vermiculite  
2001/B00B/R0023/Ceiling Structures/Linings/S7 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0011 - Cleaning Distributed Store (2.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00B/R0006/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
<b>B00B - R0012 - General Storeroom (9.54 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0013 - Special Programs Room (17.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0014 - Duplicating Workroom (14.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0015 - Staff Toilet (3.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0016 - General Storeroom (0.48 m2)</b>						
No Asbestos						
<b>B00B - R0017 - Staff Toilet (3.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0018 - Movement (11.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0019 - External Movement (40.15 m2)</b>						
No Asbestos						
<b>B00B - R0020 - External Movement (25.76 m2)</b>						
No Asbestos						
<b>B00B - R0021 - External Movement (40.68 m2)</b>						
No Asbestos						
<b>B00B - R0022 - External Movement (25.76 m2)</b>						
No Asbestos						
<b>B00B - R0023 - Principal (22.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00B - R0024 - Sick Bay (6.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2001/B00B/R0023/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1985 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable Ends	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00C/Gable Ends/S16				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					
	2001/B00C/Eaves Linings/S17					<b>No Asbestos Detected</b>

**Interior**

**B00C - R0001 - Movement (3.28 m2)**

Infill Panel	Flat AC Sheeting					
	2001/B00C/R0001/Infill Panel/S18					<b>No Asbestos Detected</b>

**B00C - R0005 - Home Base Store (2.85 m2)**

No Asbestos

**B00C - R0006 - General Storeroom (7.43 m2)**

No Asbestos

**B00C - R0007 - Personal Effects Storage (3.33 m2)**

No Asbestos

**B00C - R0008 - Movement (4.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	2001/B00C/R0008/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>
Infill Panel	Flat AC Sheeting					
	2001/B00C/R0001/Infill Panel/S18					<b>No Asbestos Detected</b>

**B00C - R0009 - Movement (4.89 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	2001/B00C/R0008/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>

**B00C - R0010 - Handwashing Facilities (1.7 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2001/B00C/R0010/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0011 - Toilets - Boys/Girls (1.94 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2001/B00C/R0010/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0012 - External Movement (104.43 m2)**

Ceiling Structures/Linings No Asbestos Found

**B00C - R0013 - Home Base Store (3.21 m2)**

Ceiling Structures/Linings No Asbestos Found

**B00C - R0014 - Practical Activities - 1hb (7.16 m2)**

Ceiling Structures/Linings No Asbestos Found

**B00C - R0015 - Home Base (71.25 m2)**

Ceiling Structures/Linings No Asbestos Found

**B00C - R0016 - Reading Area (70.79 m2)**

Ceiling Structures/Linings No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1963 - Brick/Veneer (Brick/Veneer)****Exterior**

Wall Cladding	Flat AC Sheeting 2001/B00D/Wall Cladding/S5					<b>No Asbestos Detected</b>
Gable Verge Lining	Flat AC Sheeting 2001/B00D/Gable Verge Lining/S19	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2001/B00D/Eaves Linings/S20					<b>No Asbestos Detected</b>
Underfloor Voids	AC Fragments/Debris 2001/B00D/Underfloor Voids/S22					<b>No Asbestos Detected</b>

**Interior****B00D - R0001 - Home Base Store (6.3 m2)**

No Asbestos

**B00D - R0002 - Home Base (57.51 m2)**

No Asbestos

**B00D - R0006 - Home Base Store (6.27 m2)**

No Asbestos

**B00D - R0007 - Home Base (57.51 m2)**

No Asbestos

**B00D - R0008 - Home Base Store (6.79 m2)**

No Asbestos

**B00D - R0009 - Home Base (57.59 m2)**

No Asbestos

**B00D - R0012 - Home Base Store (6.75 m2)**

No Asbestos

**B00D - R0013 - Home Base (57.19 m2)**

No Asbestos

**B00D - R0014 - Staff Room Annexe (13 m2)**

No Asbestos

**B00D - R0015 - General Storeroom (1.08 m2)**

No Asbestos

**B00D - R0016 - General Storeroom (1.22 m2)**

No Asbestos

**B00D - R0017 - K.L.A. Store (2.92 m2)**

No Asbestos

**B00D - R0018 - Movement (8.95 m2)**

No Asbestos

**B00D - R0022 - External Movement (4.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00D/R0024/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00D - R0023 - External Movement (7.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00D/R0024/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00D - R0024 - External Movement (4.2 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00D/R0024/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00D - R0025 - External Movement (153.21 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R0026 - Special Programs Room (28.87 m2)**

No Asbestos

**B00D - R0027 - Practical Activities/Movement - 2hb (13.96 m2)**

Ceiling Hatch

Flat AC Sheeting

2001/B00D/R0027/Ceiling Hatch/S21

**No Asbestos Detected**

**B00D - R0028 - Practical Activities/Movement - 2hb (15.68 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - General Learning - 1912 - Timber (Timber)</b>						
<b>Exterior</b>						
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/Eaves Linings/S23					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00E - R0001 - Withdrawal Space - 1hb (16.81 m2)</b>						
No Asbestos						
<b>B00E - R0002 - Home Base Store (9.54 m2)</b>						
No Asbestos						
<b>B00E - R0003 - Home Base (53.58 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0004/Wall Linings Internal/S12					<b>Chrysotile (white asbestos)</b>
<b>B00E - R0004 - Home Base (53.51 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0004/Wall Linings Internal/S12					<b>Chrysotile (white asbestos)</b>
<b>B00E - R0005 - Home Base Store (5.2 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0005/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Infill Panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2001/B00E/R0005/Infill Panel/S25					
<b>B00E - R0006 - External Movement (34.36 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0006/Ceiling Structures/Linings/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Communal Facilities - 1985 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no voids
Ceiling Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Communal Space (135.14 m2)**

No Asbestos

**B00F - R0002 - Raised Platform (52.62 m2)**

No Asbestos

**B00F - R0003 - Toilets - Girls (10.62 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6					<b>Chrysotile (white asbestos)</b>	

**B00F - R0004 - Shower/Change (2.21 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6					<b>Chrysotile (white asbestos)</b>	

**B00F - R0005 - Plant (0.83 m2)**

No Asbestos

**B00F - R0006 - Cleaning Distributed Store (0.93 m2)**

No Asbestos

**B00F - R0007 - Movement (6.58 m2)**

No Asbestos

**B00F - R0008 - Movement (6.56 m2)**

No Asbestos

**B00F - R0009 - Shower/Change (2.71 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6					<b>Chrysotile (white asbestos)</b>	

**B00F - R0010 - Toilets - Boys (10.85 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6					<b>Chrysotile (white asbestos)</b>	

**B00F - R0011 - Hall Chair Store (2.87 m2)**

No Asbestos

**B00F - R0012 - Hall Chair Store (2.7 m2)**

No Asbestos

**B00F - R0013 - Garden Store (10.55 m2)**

No Asbestos

**B00F - R0014 - Disabled Toilet (3.36 m2)**

No Asbestos

**B00F - R0015 - Distribution Board (1.56 m2)**

No Asbestos

Note: No inspection of live electrical installation.

**B00F - R0016 - Sports Store (13.13 m2)**

No Asbestos

**B00F - R0017 - Canteen Office/Store (4.81 m2)**

No Asbestos

**B00F - R0018 - Canteen Office/Store (3.95 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0019 - Canteen (27.47 m2)</b>						
No Asbestos						
<b>B00F - R0020 - External Movement (18.85 m2)</b>						
No Asbestos						
<b>B00F - R0021 - External Movement (28.5 m2)</b>						
No Asbestos						
<b>B00F - R0022 - External Movement (29.82 m2)</b>						
No Asbestos						
<b>B00F - R0023 - External Movement (22.33 m2)</b>						
No Asbestos						
<b>B00F - R0024 - External Movement (15.84 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 1985 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no voids					
Eaves Linings	Flat AC Sheeting 2001/B00G/Eaves Linings/S27					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					

**Interior**

**B00G - R0001 - General Storeroom (13.38 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00G - R0002 - General Storeroom (18.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00G/R0002/Floor Coverings Res/Textile/S14	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00G - R0003 - General Storeroom (2.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00G/R0002/Floor Coverings Res/Textile/S14	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00G - R0004 - General Storeroom (3.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00G/R0002/Floor Coverings Res/Textile/S14	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1985 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no voids					
Eaves Linings	Flat AC Sheeting 2001/B001/Eaves Linings/S29	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					

**Interior**

<b>B001 - R0001 - General Storeroom (6.69 m2)</b>	No Asbestos
<b>B001 - R0002 - General Storeroom (4.23 m2)</b>	No Asbestos
<b>B001 - R0003 - Toilets - Boys (24.78 m2)</b>	No Asbestos
<b>B001 - R0004 - Drinking Facilities (13 m2)</b>	No Asbestos
<b>B001 - R0005 - Drinking Facilities (13.18 m2)</b>	No Asbestos
<b>B001 - R0006 - Toilets - Girls (20.39 m2)</b>	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Building Services - 1985 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible Less than 300mm

**Interior**

**B00J - R0001 - Garden Store (33.38 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

**B00J - R0002 - Cleaning Supplies (15.32 m2)**

No Asbestos

**B00J - R0003 - External Movement (12.28 m2)**

Floor Coverings Res/Textile	Vinyl Sheet				
2001/B00J/R0003/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - External Movement (31.19 m2)**

No Asbestos

**B00L - R0002 - Reading Area (91.47 m2)**

No Asbestos

**B00L - R0003 - Library Office/Workroom (20.47 m2)**

No Asbestos

**B00L - R0004 - Communications Room (8.4 m2)**

No Asbestos

**B00L - R0005 - K.L.A. Store (9.89 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10210 - Learning Unit - Standard With P.A.A. : Placement Date - 1/04/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D10681 - Learning Unit - Standard With P.A.A. : Placement Date - 1/07/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12901 - Learning Unit - Standard With P.A.A. : Placement Date - 9/06/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 750 - D17816 - Learning Unit - ESL : Placement Date - 7/11/2014**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	5.76 m2

**Interior**

**R1 - Esl**

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017