


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Glenhaven Public School (2003)
Region : Northern Sydney
State Electorate : Castle Hill
Local Government Area : The Hills

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Sep - 2016

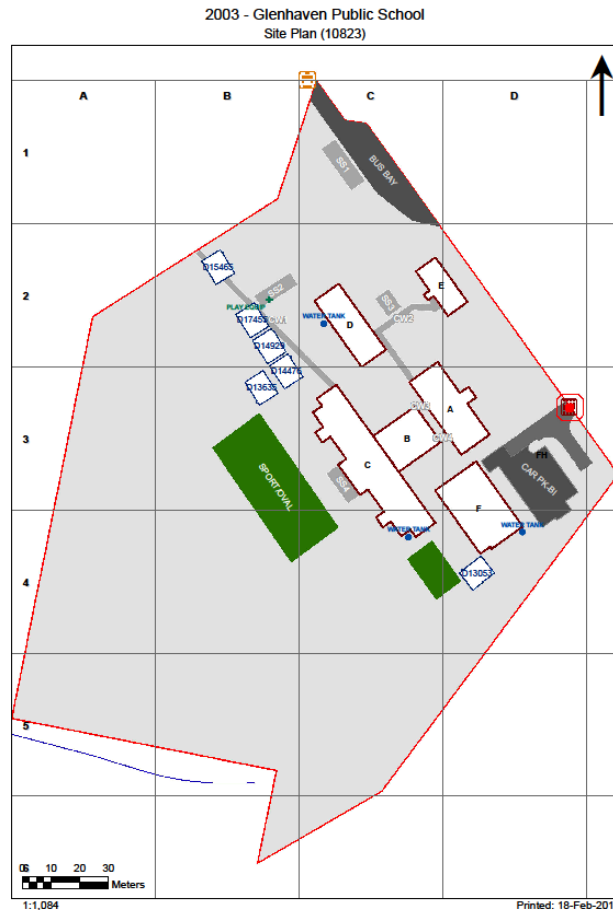

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1993 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00A - R0001 - Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0002 - Staff Toilet

No Asbestos

B00A - R0003 - Sick Bay

No Asbestos

B00A - R0004 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0007 - Interview

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0008 - Clerical Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0009 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Staff Toilet

No Asbestos

B00A - R0012 - Staff Toilet

No Asbestos

B00A - R0013 - Staff Toilet

No Asbestos

B00A - R0014 - General Storeroom

No Asbestos

B00A - R0015 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0016 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0017 - Duplicating Workroom

No Asbestos

B00A - R0018 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0019 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0020 - Cleaning Distributed Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0021 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Tiered Learning - 1993 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00B - R0001 - Disabled Toilet

No Asbestos

B00B - R0002 - General Storeroom

No Asbestos

B00B - R0003 - Plant

No Asbestos

B00B - R0004 - General Assistant/Bulk Store

No Asbestos

B00B - R0005 - Cleaning Supplies

No Asbestos

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - Cleaning Distributed Store

No Asbestos

B00B - R0008 - Canteen Office/Store

No Asbestos

B00B - R0009 - Canteen

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0013 - Cleaning Distributed Store

No Asbestos

B00B - R0014 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0015 - Movement

No Asbestos

B00B - R0016 - Movement

No Asbestos

B00B - R0017 - Main Switch Board

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Library - 1993 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Practical Activities - 1hb

No Asbestos

B00C - R0003 - Home Base Store

No Asbestos

B00C - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0007 - Practical Activities - 1hb

No Asbestos

B00C - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0009 - Kiln Room

No Asbestos

B00C - R0010 - Cleaning Distributed Store

No Asbestos

B00C - R0011 - Toilets - Girls

No Asbestos

B00C - R0012 - Movement

No Asbestos

B00C - R0013 - Toilets - Boys

No Asbestos

B00C - R0014 - P.E. Store

No Asbestos

B00C - R0015 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0016 - Home Base Store

No Asbestos

B00C - R0017 - Practical Activities - 1hb

No Asbestos

B00C - R0018 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0019 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0020 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0021 - Practical Activities - 1hb						
No Asbestos						
B00C - R0022 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1001 - Movement						
No Asbestos						
B00C - R1002 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1003 - Practical Activities - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1004 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1005 - Withdrawal Space - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1006 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1007 - Practical Activities - 1hb						
No Asbestos						
B00C - R1008 - Home Base Store						
No Asbestos						
B00C - R1009 - Cleaning Distributed Store						
No Asbestos						
B00C - R1010 - Communications Room						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1011 - Reading Area						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1012 - Library Office/Workroom						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1013 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R1014 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1015 - Practical Activities - 1hb						
No Asbestos						
B00C - R1016 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1017 - Withdrawal Space - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1018 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00C - R1019 - Practical Activities - 1hb						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - R1020 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Pupil Facilities - 1971 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 2003/B00D/Wall Cladding/S1				No Asbestos Detected	
Underfloor Voids	AC Fragments/Debris 2003/B00D/Underfloor Voids/S8	NA	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos)

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Home Base Store

No Asbestos

B00D - R0004 - Personal Effects Storage

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - Toilets - Boys

No Asbestos

B00D - R0008 - Cleaning Distributed Store

No Asbestos

B00D - R0009 - Cleaning Distributed Store

No Asbestos

B00D - R0010 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other-Community Use/Pupil Facilities - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction < 0.3m.
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Uniform Shop

Floor Coverings Res/Textile	Vinyl Sheet					
	2003/B00E/R0003/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00E - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2003/B00E/R0008/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00E - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	2003/B00E/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected

B00E - R0011 - Personal Effects Storage

Wall Linings Internal	Flat AC Sheeting	1m2	South facing, under sink	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2003/B00E/R0011/Wall Linings Internal/S2					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Flat AC Sheeting	4m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2003/B00E/R0011/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0012 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2003/B00E/R0013/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

B00E - R0013 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2003/B00E/R0013/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - Covered Outdoor Learning Area

No Asbestos

B00F - R0002 - Communal Space

No Asbestos

B00F - R0003 - Raised Platform

No Asbestos

B00F - R0004 - Movement

No Asbestos

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - Movement

No Asbestos

B00F - R0007 - Chair Storeroom

No Asbestos

B00F - R0008 - Communal/Performance Store

No Asbestos

B00F - R0009 - P.E. Store

No Asbestos

B00F - R0010 - Toilet - Lobby

No Asbestos

B00F - R0011 - Toilets - Girls

No Asbestos

B00F - R0012 - Sound Cupboard

No Asbestos

B00F - R0013 - Toilet - Lobby

No Asbestos

B00F - R0014 - Toilets - Boys

No Asbestos

B00F - R0015 - Cleaning Distributed Store

No Asbestos

B00F - R0016 - Plant

No Asbestos

B00F - R0017 - Shower/Change

No Asbestos

B00F - R0018 - Main Switch Board Cupboard

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D13053 - Learning Unit - Standard/Withdrawal : Placement Date - 30/01/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D13635 - Learning Unit - Standard With P.A.A. : Placement Date - 20/01/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14476 - Learning Unit - Standard With P.A.A. : Placement Date - 7/02/2006

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 603 - D14929 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 3/02/2003

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
OS 602 - D15465 - Learning Unit - Standard With P.A.A. : Placement Date - 17/11/2008						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 603 - D17455 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 15/02/2007						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017