


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Glen Innes Public School (2005)  
**Region :** New England  
**State Electorate :** Northern Tablelands  
**Local Government Area :** Glen Innes Severn

**Initial Survey :** Noel Arnold & Associates : 20 - May - 2008  
**Reviewed By :** Greencap-NAA : 01 - Apr - 2015

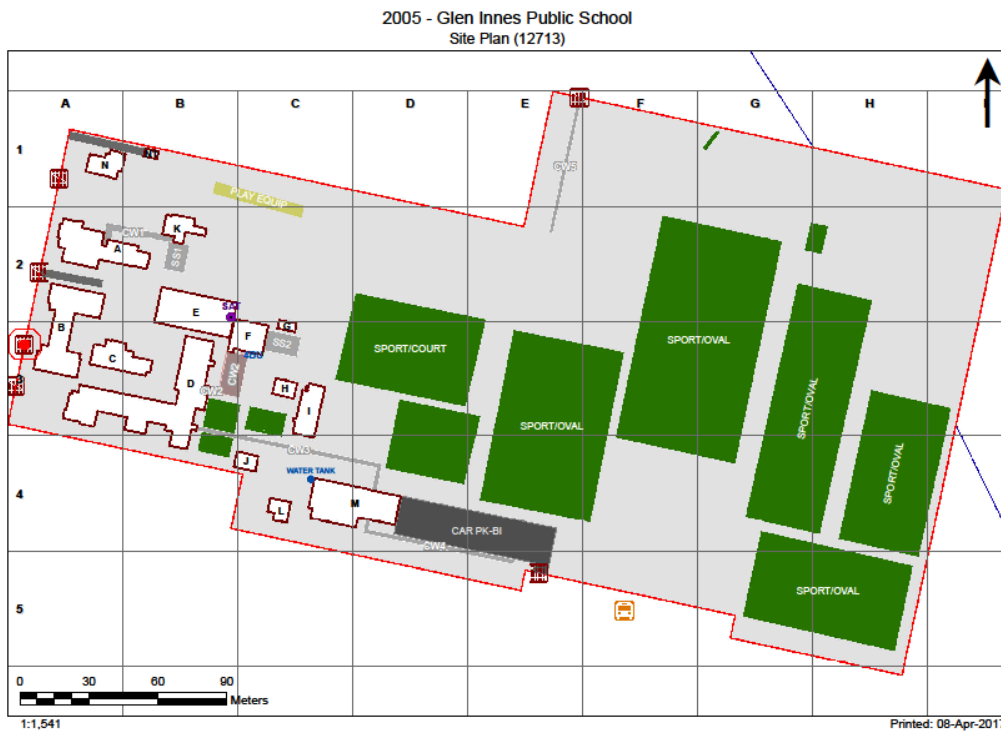

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Staff Facilities - 1929 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/Eaves Linings/S31					<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00A - R0001 - Staff Room Annexe (15.25 m2)**

No Asbestos

**B00A - R0002 - Movement (7.48 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R0002/Wall Linings Internal/S9					<b>Chrysotile (white asbestos)</b>	

**B00A - R0003 - External Movement (11 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
2005/B00A/R0003/Ceiling Structures/Linings/S8						

**B00A - R0004 - Home Base (101.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	102m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)

**B00A - R0005 - External Movement (1.89 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
2005/B00A/R0005/Ceiling Structures/Linings/S8						

**B00A - R0006 - Movement (11.34 m2)**

No Asbestos

**B00A - R0007 - Home Base (46.82 m2)**

No Asbestos

**B00A - R0008 - Home Base (46.91 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
2005/B00A/R0008/Floor Coverings Res/Textile/S18						
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
2005/B00A/R0008/Floor Coverings Res/Textile/S19						

**B00A - R0009 - Duplicating Workroom (10.17 m2)**

No Asbestos

**B00A - R0010 - Special Programs Room (16.98 m2)**

No Asbestos

**B00A - R0011 - Movement (6.75 m2)**

No Asbestos

**B00A - R0013 - Cleaning Distributed Store (2.91 m2)**

No Asbestos

**B00A - R0014 - Personal Effects Storage (13.12 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0018 - Movement (34.61 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Home Base (51.65 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R0019/Ceiling Structures/Linings/S28					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0020 - Stairs (0.79 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Stairs (8.03 m2)</b>						
No Asbestos						
<b>B00A - R0022 - External Movement (14.74 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Staff Toilet (3.33 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Movement (3.75 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Home Base (48.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1003 - Home Base (48.06 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1005 - Staff Room Annexe (20.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
2005/B00A/R0008/Floor Coverings Res/Textile/S18					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive					
2005/B00A/R0008/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>	
<b>B00A - R1006 - Movement (6.07 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1010 - Stairs (6.98 m2)</b>						
No Asbestos						
<b>B00A - R1011 - Movement (22.74 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1012 - Practical Activities - 1hb (13.6 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1013 - Stairs (10.89 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1014 - Movement (5.37 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1015 - Toilet - Lobby (1.12 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
2005/B00A/R1016/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
2005/B00A/R1016/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>	
Wall Linings Internal	Flat AC Sheeting					
2005/B00A/R1017/Wall Linings Internal/S20					<b>No Asbestos Detected</b>	
<b>B00A - R1016 - Staff Toilet (1.71 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
2005/B00A/R1016/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
2005/B00A/R1016/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>	
Wall Linings Internal	Flat AC Sheeting					
2005/B00A/R1017/Wall Linings Internal/S20					<b>No Asbestos Detected</b>	
<b>B00A - R1017 - General Storeroom (5.81 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
2005/B00A/R1017/Wall Linings Internal/S20					<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00A/R1011/Ceiling Structures/Linings/S29					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/General Learning - 1891 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00B - R0001 - Home Base (71.26 m2)**

No Asbestos

**B00B - R0002 - External Movement (88.68 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00B/R0002/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>	

**B00B - R0004 - Cleaning Distributed Store (4.54 m2)**

No Asbestos

**B00B - R0005 - General Storeroom (10.82 m2)**

No Asbestos

**B00B - R0006 - Interview (5.65 m2)**

Floor Coverings Res/Textile	Vinyl Sheet under carpet					
2005/B00B/R0006/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive					
2005/B00B/R0006/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>	

**B00B - R0009 - Staff Room (80.76 m2)**

Floor Coverings Res/Textile	Adhesive					
2005/B00B/R0006/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
2005/B00B/R0006/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>	

**B00B - R0010 - Entry Vestibule (10.67 m2)**

No Asbestos

**B00B - R0011 - Deputy Principal (14.22 m2)**

No Asbestos

**B00B - R0012 - Principal (20.54 m2)**

No Asbestos

**B00B - R0013 - Movement (27.14 m2)**

No Asbestos

**B00B - R0014 - Clerical Office (31.04 m2)**

No Asbestos

**B00B - R0015 - Duplicating Workroom (35.55 m2)**

Floor Coverings Res/Textile	Adhesive					
2005/B00B/R0006/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
2005/B00B/R0006/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>	

**B00B - R0016 - Clerical Office (8.6 m2)**

Floor Coverings Res/Textile	Adhesive					
2005/B00B/R0006/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
	2005/B00B/R0006/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	
<b>B00B - R0017 - Movement (4.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2005/B00C/R0002/Floor Coverings Res/Textile/S6				<b>No Asbestos Detected</b>	
<b>B00B - R0018 - Home Base (57.95 m2)</b>						
No Asbestos						
<b>B00B - R0019 - Withdrawal Space - 2hb (14.37 m2)</b>						
No Asbestos						
<b>B00B - R0020 - Practical Activities - 2hb (21.65 m2)</b>						
No Asbestos						
<b>B00B - R0021 - Home Base Store (4.66 m2)</b>						
No Asbestos						
<b>B00B - R0022 - Home Base Store (4.7 m2)</b>						
No Asbestos						
<b>B00B - R0023 - Toilet - Lobby (2.3 m2)</b>						
No Asbestos						
<b>B00B - R0024 - Staff Toilet (2.36 m2)</b>						
No Asbestos						
<b>B00B - R0025 - Staff Toilet (2.8 m2)</b>						
No Asbestos						
<b>B00B - R0026 - Toilet - Lobby (2.94 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/General Learning - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Drinking Facilities (7.92 m2)**

No Asbestos

**B00C - R0002 - Home Base (59.74 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
2005/B00C/R0002/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	

**B00C - R0003 - External Movement (18.91 m2)**

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

**Assumed Asbestos - Electrical Hazard**

**B00C - R0004 - Canteen (45.9 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
2005/B00C/R0002/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	

**B00C - R0005 - Canteen Office/Store (18.34 m2)**

No Asbestos

**B00C - R0006 - External Movement (19.95 m2)**

No Asbestos

**B00C - R0007 - Home Base (46.77 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Communal Facilities - 1947 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 2005/B00D/Eaves Linings/S32					<b>No Asbestos Detected</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction</b>					
Roof Sealant	Resinous Membrane	34m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction over plant room</b>					

**Interior**

**B00D - R0001 - Raised Platform (53.8 m2)**

No Asbestos

**B00D - R0002 - Communal Space (224.55 m2)**

Decorative Coating To Wall	Vermiculite 2005/B00D/R0002/Decorative Coating/S12					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

Ceiling Structures/Linings	Vermiculite 2005/B00D/R0002/Decorative Coating/S12					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

**B00D - R0003 - External Movement (4.17 m2)**

No Asbestos

**B00D - R0004 - Staff Kitchen (11.24 m2)**

No Asbestos

**B00D - R0005 - Movement (28.18 m2)**

No Asbestos

**B00D - R0007 - Movement (5.1 m2)**

No Asbestos

**B00D - R0008 - Cleaning Distributed Store (3.26 m2)**

No Asbestos

**B00D - R0009 - External Movement (14.16 m2)**

No Asbestos

**B00D - R0010 - Movement (13.27 m2)**

No Asbestos

**B00D - R0011 - External Movement (4.83 m2)**

No Asbestos

**B00D - R0012 - Hall Chair Store (11.37 m2)**

No Asbestos

**B00D - R0013 - Staff Toilet (3.5 m2)**

No Asbestos

**B00D - R0014 - Staff Room Annexe (14.38 m2)**

No Asbestos

**B00D - R0015 - Uniform Shop (11.03 m2)**

No Asbestos

**B00D - R0016 - Movement (13.07 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0017 - External Movement (5.18 m2)</b>						
No Asbestos						
<b>B00D - R0018 - Plant (11.17 m2)</b>						
No Asbestos						
<b>B00D - R0019 - Plant (24.66 m2)</b>						
Electrical Backing Board	Resinous Board	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00D - R0020 - Plant (5.97 m2)</b>						
No Asbestos						
<b>B00D - R0021 - Interview (14.73 m2)</b>						
No Asbestos						
<b>B00D - R0022 - Staff Toilet (3.17 m2)</b>						
No Asbestos						
<b>B00D - R0023 - General Storeroom (13.13 m2)</b>						
No Asbestos						
<b>B00D - R0024 - General Storeroom (7.45 m2)</b>						
No Asbestos						
<b>B00D - R0025 - Movement (20.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2005/B00D/R0025/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>	
<b>B00D - R0026 - Distribution Board (0.66 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00D - R0027 - External Movement (1.65 m2)</b>						
No Asbestos						
<b>B00D - R0028 - External Movement (1.65 m2)</b>						
No Asbestos						
<b>B00D - R0029 - External Movement (1.65 m2)</b>						
No Asbestos						
<b>B00D - R0030 - Movement (8.93 m2)</b>						
No Asbestos						
<b>B00D - R0031 - Home Base (47.68 m2)</b>						
No Asbestos						
<b>B00D - R0033 - Home Base (47.55 m2)</b>						
No Asbestos						
<b>B00D - R0034 - Home Base (47.47 m2)</b>						
No Asbestos						
<b>B00D - R0036 - Home Base (47.54 m2)</b>						
No Asbestos						
<b>B00D - R0037 - Movement (109.02 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	110m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00D/R0037/Floor Coverings Res/Textile/S26					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
2005/B00D/R0037/Floor Coverings Res/Textile/S27					<b>No Asbestos Detected</b>	
<b>B00D - R0038 - Practical Activities - 1hb (12.88 m2)</b>						
No Asbestos						
<b>B00D - R0039 - Home Base Store (4.85 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R0040 - Withdrawal Space - 2hb (9.85 m2)</b>						
No Asbestos						
<b>B00D - R0041 - Home Base Store (4.82 m2)</b>						
No Asbestos						
<b>B00D - R0042 - Practical Activities - 1hb (12.8 m2)</b>						
No Asbestos						
<b>B00D - R0043 - Practical Activities - 1hb (12.6 m2)</b>						
No Asbestos						
<b>B00D - R0044 - Home Base Store (4.84 m2)</b>						
No Asbestos						
<b>B00D - R0045 - Withdrawal Space - 2hb (9.88 m2)</b>						
No Asbestos						
<b>B00D - R0046 - Home Base Store (4.9 m2)</b>						
No Asbestos						
<b>B00D - R0047 - Practical Activities - 1hb (13.06 m2)</b>						
No Asbestos						
<b>B00D - R0048 - Stairs (7.76 m2)</b>						
No Asbestos						
<b>B00D - R0049 - Stairs (9.77 m2)</b>						
No Asbestos						
<b>B00D - R0050 - External Movement (30.78 m2)</b>						
No Asbestos						
<b>B00D - R1001 - Practical Activities - 1hb (2.1 m2)</b>						
No Asbestos						
<b>B00D - R1002 - Personal Effects Storage (11.74 m2)</b>						
No Asbestos						
<b>B00D - R1003 - Staff Room Annexe (5.32 m2)</b>						
No Asbestos						
<b>B00D - R1004 - General Storeroom (13.96 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2005/B00D/R0025/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>
<b>B00D - R1005 - Home Base (48.34 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
	2005/B00D/R0037/Floor Coverings Res/Textile/S27					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00D/R0037/Floor Coverings Res/Textile/S26					<b>Chrysotile (white asbestos)</b>
<b>B00D - R1007 - Home Base (48.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00D/R0037/Floor Coverings Res/Textile/S26					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	2005/B00D/R0037/Floor Coverings Res/Textile/S27					<b>No Asbestos Detected</b>
<b>B00D - R1008 - Home Base (48.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00D/R0037/Floor Coverings Res/Textile/S26					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Adhesive					
	2005/B00D/R0037/Floor Coverings Res/Textile/S27					No Asbestos Detected
<b>B00D - R1010 - Home Base (49.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00D/R0037/Floor Coverings Res/Textile/S26					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	2005/B00D/R0037/Floor Coverings Res/Textile/S27					No Asbestos Detected
<b>B00D - R1011 - Sick Bay (12.25 m2)</b>						
No Asbestos						
<b>B00D - R1012 - Staff Toilet (2.33 m2)</b>						
No Asbestos						
<b>B00D - R1013 - Staff Toilet (3.37 m2)</b>						
Partition Walls (Cubicles)	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00D/R1013/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)
<b>B00D - R1014 - Movement (15.04 m2)</b>						
No Asbestos						
<b>B00D - R1015 - Home Base - M (35.87 m2)</b>						
No Asbestos						
<b>B00D - R1016 - Practical Activities - M - 1hb (2.76 m2)</b>						
No Asbestos						
<b>B00D - R1017 - Movement (110 m2)</b>						
No Asbestos						
<b>B00D - R1018 - Stairs (14.35 m2)</b>						
No Asbestos						
<b>B00D - R1019 - Practical Activities - 1hb (12.88 m2)</b>						
No Asbestos						
<b>B00D - R1020 - Home Base Store (4.77 m2)</b>						
No Asbestos						
<b>B00D - R1021 - Withdrawal Space - 2hb (10.09 m2)</b>						
No Asbestos						
<b>B00D - R1022 - Practical Activities - 1hb (4.87 m2)</b>						
No Asbestos						
<b>B00D - R1023 - Home Base Store (13.2 m2)</b>						
No Asbestos						
<b>B00D - R1024 - Practical Activities - 1hb (13.02 m2)</b>						
No Asbestos						
<b>B00D - R1025 - Home Base Store (4.79 m2)</b>						
No Asbestos						
<b>B00D - R1026 - Withdrawal Space - 2hb (10.1 m2)</b>						
No Asbestos						
<b>B00D - R1027 - Home Base Store (4.85 m2)</b>						
No Asbestos						
<b>B00D - R1028 - Practical Activities - 1hb (13.36 m2)</b>						
No Asbestos						
<b>B00D - R1029 - Stairs (14.56 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00D - R9001 - General Assistant/Bulk Store (49.7 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/Tiered Learning - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B00E - R0001 - Plant (1.74 m2)**

No Asbestos

**B00E - R0002 - Special Programs Store (5.04 m2)**

No Asbestos

**B00E - R0006 - Distribution Board (1.85 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00E/R0006/Electrical Mounting Board/S15					<b>Chrysotile (white asbestos)</b>	

**B00E - R0007 - Reading Area (237.15 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
2005/B00D/R0025/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>	

**B00E - R0008 - Seminar/Study (14.29 m2)**

No Asbestos

**B00E - R0009 - Communications Room (13.15 m2)**

No Asbestos

**B00E - R0010 - External Movement (160.44 m2)**

No Asbestos

**B00E - R0011 - Toilets-Disabled (13.75 m2)**

No Asbestos

**B00E - R0012 - Home Base (39.84 m2)**

No Asbestos

**B00E - R0013 - Laundry (3.83 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1930 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00F/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

**Interior**

**B00F - R0001 - Plant (4.95 m2)**

No Asbestos

**B00F - R0002 - Toilets - Boys (48.4 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00F/R0006/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>

**B00F - R0003 - Drinking Facilities (9.06 m2)**

No Asbestos

**B00F - R0004 - Plant (10.34 m2)**

No Asbestos

**B00F - R0005 - Drinking Facilities (8.91 m2)**

No Asbestos

**B00F - R0006 - Toilets - Girls (51.59 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00F/R0006/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>

**B00F - R0007 - Cleaning Distributed Store (1.46 m2)**

No Asbestos

**B00F - R0008 - Movement (4.5 m2)**

No Asbestos

**B00F - R0009 - External Movement (35.43 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 1935 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00G - R0001 - General Assistant/Bulk Store (21.71 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00G/R0001/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00G - R0002 - General Assistant/Bulk Store (1.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2005/B00G/R0001/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 1935 - Timber (Timber)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Wall Cladding	Flat AC Sheeting 2005/B00H/Wall Cladding/S3	30m2	North, South, East	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00H - R0001 - P.E. Store (13.73 m2)**

Wall Linings Internal	Flat AC Sheeting 2005/B00H/Wall Cladding/S3	30m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	--	------	--------------------	--------------------	---------	--

**B00H - R0002 - P.E. Store (27.41 m2)**

No Asbestos

**B00H - R0003 - Sports Store (18.72 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Special Purpose/General Learning - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	No Asbestos Found

**Interior**

**B001 - R0002 - Craft Store (7.66 m2)**

No Asbestos

**B001 - R0006 - Practical Activities - 1hb (18.09 m2)**

No Asbestos

**B001 - R0007 - Home Base (54.34 m2)**

No Asbestos

**B001 - R0008 - Home Base (75.34 m2)**

No Asbestos

**B001 - R0009 - Home Base Store (5.89 m2)**

No Asbestos

**B001 - R0010 - Practical Activities - 2hb (16.98 m2)**

No Asbestos

**B001 - R0011 - Withdrawal Space - 2hb (11.52 m2)**

No Asbestos

**B001 - R0012 - External Movement (1.36 m2)**

No Asbestos

**B001 - R0013 - External Movement (1.38 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Administration/Building Services - 1935 - Timber (Timber)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00J - R0001 - Cleaning Supplies (2.34 m2)**

No Asbestos

**B00J - R0002 - Garden Store (12.31 m2)**

Wall Linings Internal	Flat AC Sheeting 2005/B00J/R0002/Wall Linings Internal/S25					<b>No Asbestos Detected</b>
-----------------------	---	--	--	--	--	-----------------------------

**B00J - R0003 - General Storeroom (45.38 m2)**

In-fill-panel	Flat AC Sheeting 2005/B00J/R0002/Wall Linings Internal/S25					<b>No Asbestos Detected</b>
---------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities/Staff Facilities - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/Eaves Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

**Interior**

**B00K - R0002 - Drinking Facilities (13.35 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0002/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	

**B00K - R0003 - Staff Toilet (5.68 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0002/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	

**B00K - R0004 - Toilets - Girls (31.08 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0002/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0004/Partition Walls (Cubicles)/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00K - R0005 - External Movement (50.49 m2)**

No Asbestos


**B00K - R0006 - Toilets - Boys (21.38 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0002/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0004/Partition Walls (Cubicles)/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00K - R0007 - Toilet - Lobby (3.08 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2005/B00K/R0002/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	

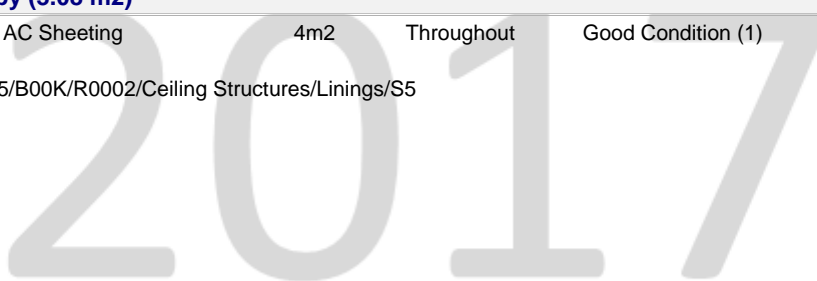

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Building Services - 2011 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B00L - R0001 - Garage/Carport (18.14 m2)**

No Asbestos

**B00L - R0002 - General Assistant/Bulk Store (53.82 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified
Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B00M - R0001 - Communal Space (202.54 m2)**

No Asbestos

**B00M - R0002 - Raised Platform (60.54 m2)**

No Asbestos

**B00M - R0003 - Communal/Performance Store (12.72 m2)**

No Asbestos

**B00M - R0004 - P.E. Store (10.31 m2)**

No Asbestos

**B00M - R0005 - Hall Chair Store (16.36 m2)**

No Asbestos

**B00M - R0006 - Toilet - Lobby (2.44 m2)**

No Asbestos

**B00M - R0007 - Toilets - Girls (6.85 m2)**

No Asbestos

**B00M - R0008 - Sound Cupboard (2.01 m2)**

No Asbestos

**B00M - R0009 - Toilet - Lobby (3.5 m2)**

No Asbestos

**B00M - R0010 - Toilets - Boys (5.53 m2)**

No Asbestos

**B00M - R0011 - Cleaning Distributed Store (3.55 m2)**

No Asbestos

**B00M - R0012 - Plant (1.56 m2)**

No Asbestos

**B00M - R0013 - Distribution Board (3.29 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00M - R0014 - Access Shower/Toilet/Change (6.74 m2)**

No Asbestos

**B00M - R0015 - Covered Outdoor Learning Area (181.73 m2)**

No Asbestos

**B00M - R0016 - Movement (5.08 m2)**

No Asbestos

**B00M - R0017 - Ramp (11.15 m2)**

No Asbestos

**B00M - R0018 - Movement (12.91 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017