


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Glenquarry Public School (2015)
Region : Illawarra and South East
State Electorate : Wollondilly
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Parsons Brinckerhoff : 12 - Jul - 2016

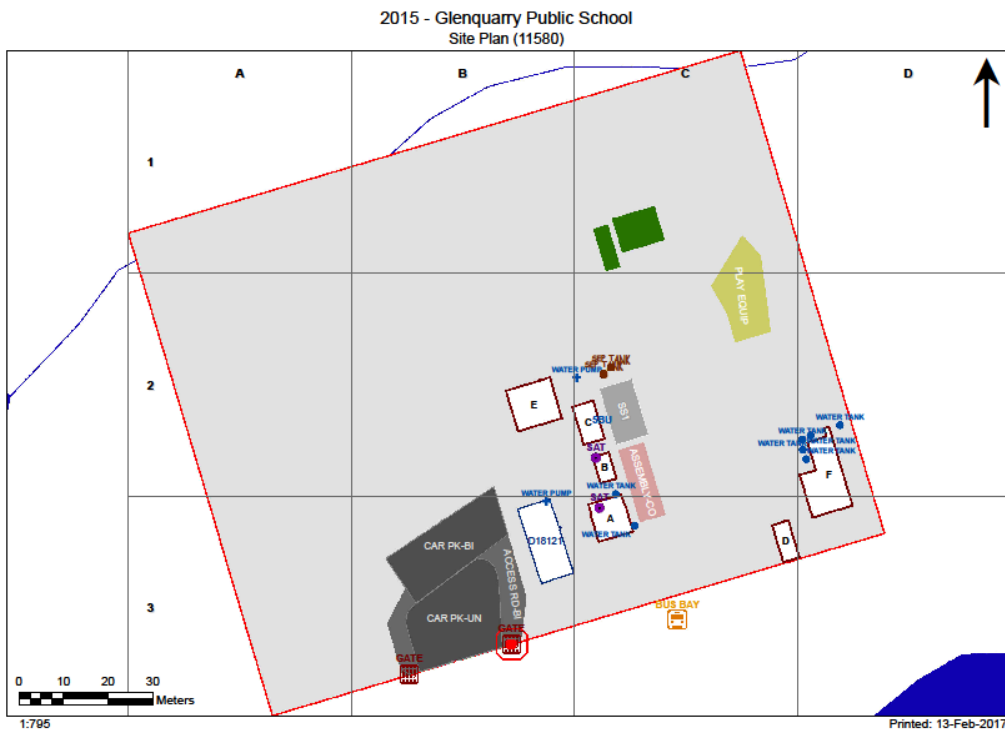

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1892 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00A/Eaves Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					

Interior

B00A - R0001 - Reading Area

No Asbestos

B00A - R0002 - Clerical Office/Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2015/B00B/Eaves Linings/S4					No Asbestos Detected

Interior

B00B - R0001 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2015/B00B/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00B - R0003 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting 2015/B00B/R0003/Ceiling Structures/Linings/S6					
						No Asbestos Detected

B00B - R0004 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 2015/B00B/R0004/Wall Linings Internal/S8					
						No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Staff Facilities - 1969 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - No manhole to access ceiling void					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00C/Eaves Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00C - R0001 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00C/R0002/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00C - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00C/R0002/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00C - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00C/R0002/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00C - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00C/R0002/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00C - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2015/B00C/R0002/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 1976 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00D - R0001 - Garden Store

No Asbestos

B00D - R0002 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting	4m2	South	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
2015/B00D/R0002/Wall Linings Internal/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 2010 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Practical Activities/Movement - 1hb

No Asbestos

B00E - R0003 - Home Base Store

No Asbestos

B00E - R0004 - Personal Effects Storage

No Asbestos

B00E - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 500 - D18121 - Admin - Library : Placement Date - 8/05/2002

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				20.16 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				13 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
---------	---------------	------------------	--	--	--	-------

R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos				19 m2
---------	---------------	------------------	--	--	--	-------

R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
---------	---------------	------------------	--	--	--	-------

R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos				54 m2
---------	---------------	------------------	--	--	--	-------

R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos				0 m2
---------	---------------	------------------	--	--	--	------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2

R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos				0 m2
---------	---------------	------------------	--	--	--	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017