


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Goolgowi Public School (2035)  
**Region :** Riverina  
**State Electorate :** Murray  
**Local Government Area :** Carrathool

**Initial Survey :** Noel Arnold & Associates : 07 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

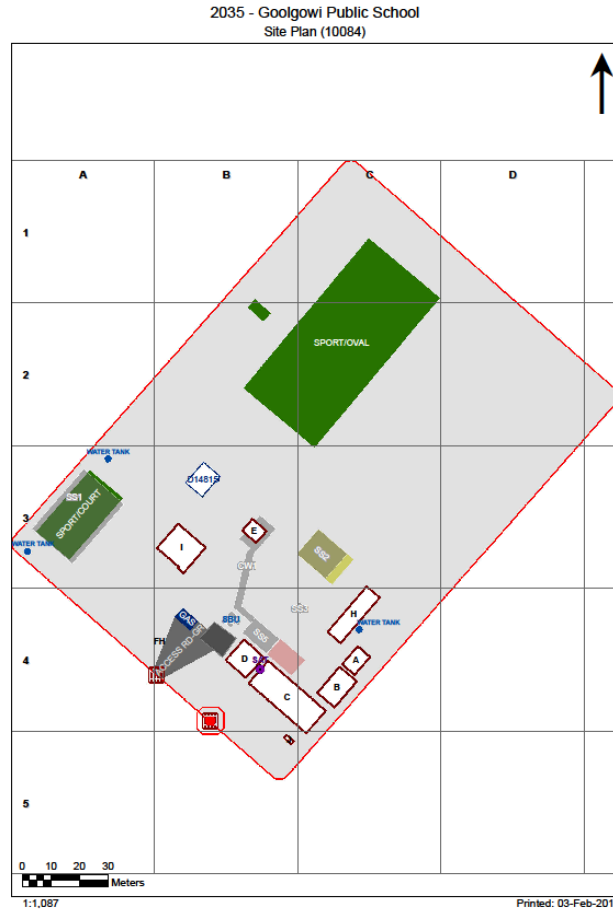

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1930 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting 2035/B00A/Eaves Linings/S2					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0001 - Clerical Office**

No Asbestos

**B00A - R0002 - Principal**

No Asbestos

**B00A - R0004 - External Movement**

Flooring	Compressed AC Sheet 2035/B00B/R0008/Flooring/S6					No Asbestos Detected
----------	--	--	--	--	--	----------------------

**B00A - R0005 - Toilet - Lobby**

Wall Linings Internal	Flat AC Sheeting 2035/B00A/R0005/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00A - R0006 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting 2035/B00A/R0005/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00A - R0007 - Toilet - Lobby**

Wall Linings Internal	Flat AC Sheeting 2035/B00A/R0005/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00A - R0008 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting 2035/B00A/R0005/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration - 1928 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00B/Eaves Linings/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0002 - General Storeroom**

No Asbestos

**B00B - R0004 - Movement**

No Asbestos

**B00B - R0005 - Principal**

Floor Coverings Res/Textile	Adhesive	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00B/R0006/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	2035/B00B/R0006/Floor Coverings Res/Textile/S4					

**B00B - R0006 - Clerical Office**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	2035/B00B/R0006/Floor Coverings Res/Textile/S4					
Floor Coverings Res/Textile	Adhesive	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00B/R0006/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0007 - Cleaning Distributed Store**

Flooring	Compressed AC Sheet					<b>No Asbestos Detected</b>
	2035/B00B/R0008/Flooring/S6					

**B00B - R0008 - External Movement**

Flooring	Compressed AC Sheet					<b>No Asbestos Detected</b>
	2035/B00B/R0008/Flooring/S6					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00C/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Window In-fill-panel	Flat AC Sheeting	14m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00C/Window In-fill-panel/S10				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible no access point					
Gable Verge Lining	Flat AC Sheeting	24m	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00C/Gable Verge Lining/S9				Chrysotile (white asbestos)	

**Interior**

**B00C - R0001 - External Movement**

Window In-fill-panel	Flat AC Sheeting	11m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00C/Window In-fill-panel/S10				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00C/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	

**B00C - R0002 - Personal Effects Storage**

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

**B00C - R0003 - General Storeroom**

No Asbestos

**B00C - R0004 - Toilets - Boys/Girls**

No Asbestos

**B00C - R0005 - Home Base**

No Asbestos

**B00C - R0006 - Home Base**

No Asbestos

**B00C - R0007 - Home Base Store**

No Asbestos

**B00C - R0008 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2035/B00C/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

**B00C - R0009 - Staff Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 1930 - Timber (Timber)**

**Exterior**

Wall Cladding	Flat AC Sheeting 2035/B00D/Wall Cladding/S11	4m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Reading Area**

Wall Linings Internal	Flat AC Sheeting 2035/B00D/R0001/Wall Linings Internal/S12	1m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	---	-----	---------------	--------------------	---------	--

**B00D - R0002 - General Storeroom**

No Asbestos

**B00D - R0003 - Seminar/Study**

No Asbestos

**B00D - R0004 - Library Office/Workroom**

Wall Linings Internal	Flat AC Sheeting 2035/B00D/R0004/Wall Linings Internal/S13	4m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
-----------------------	---	-----	------------------------------	--------------------	---------	---

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1940 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00E/R0001/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00E - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00E/R0001/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2035/B00E/R0001/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Other - 2009 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00H - R0001 - Garden Store**

No Asbestos

**B00H - R0002 - Sports Store**

No Asbestos

**B00H - R0003 - General Storeroom**

No Asbestos

**B00H - R0004 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00I - R0001 - Library Office/Workroom**

No Asbestos

**B00I - R0002 - K.L.A. Store**

No Asbestos

**B00I - R0003 - Communications Room**

No Asbestos

**B00I - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00I - R0005 - Reading Area**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Electrical Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D14815 - Learning Unit - Standard With P.A.A. : Placement Date - 24/02/2009**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017