


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Goolma Public School (2036)  
**Region :** Western NSW  
**State Electorate :** Dubbo  
**Local Government Area :** Mid-Western

**Initial Survey :** Noel Arnold & Associates : 16 - May - 2008  
**Reviewed By :** Grencap-NAA : 15 - Jun - 2016

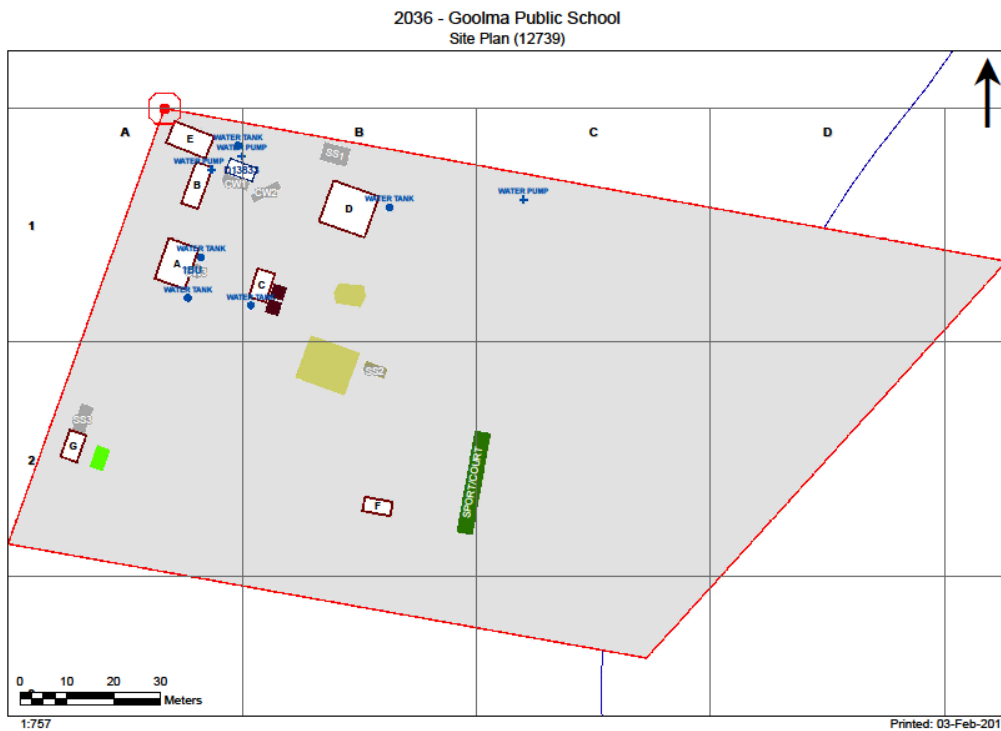

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Library - 1909 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2036/B00B/Eaves Linings/S2					<b>Chrysotile (white asbestos)</b>
Pitched Roof flat ceiling	Non Accessible Area - No manhole					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Window beading	Caulking material 2036/B00A/Window beading/S5					<b>No Asbestos Detected</b>

**Interior**

**B00A - R0001 - Practical Activities - 1hb**

No Asbestos

**B00A - R0002 - Reading Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Staff Facilities/Building Services - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2036/B00B/Eaves Linings/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior**

**B00B - R0004 - Clerical Office**

Floor Coverings Res/Textile	Green vinyl sheet under carpet					
	2036/B00B/R0004/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive under green vinyl sheet under carpet					
	2036/B00B/R0004/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>

**B00B - R0005 - Staff Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof    Non Accessible Area  
 - No manhole

Underfloor Voids -        No Asbestos Found  
 Packing to Floor Joists

**Interior**

**B00C - R0001 - Sports Store**

No Asbestos

**B00C - R0002 - General Storeroom**

No Asbestos

**B00C - R0003 - Office**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00D - R0001 - Home Base**

No Asbestos

**B00D - R0002 - K.L.A. Store**

No Asbestos

**B00D - R0003 - Practical Activities**

No Asbestos

**B00D - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Building Services - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00E - R0001 - Garage/Carport**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00G - R0001 - Garden Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 844 - D13833 - Country Toilet - Reltc - Boys/Girls : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

### Interior

#### R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

#### R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

**OS 844 - D17814 - Country Toilet - Reltc - Boys/Girls : Placement Date - 1/03/2002**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

### Interior

#### R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

#### R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017