


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gooloogong Public School (2038)
Region : Western NSW
State Electorate : Cootamundra
Local Government Area : Cowra

Initial Survey : Noel Arnold & Associates : 23 - Apr - 2008
Reviewed By : Grencap-NAA : 01 - Mar - 2017

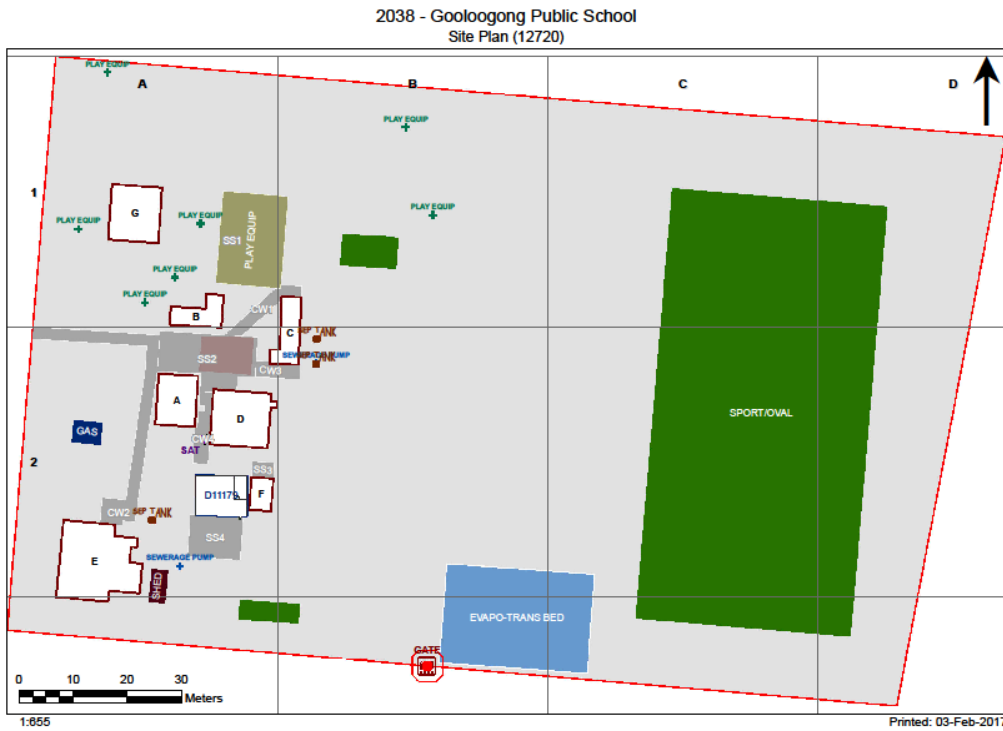

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1913 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - No sub-floor opening.					
Pitched Roof - Flat Ceiling	No Asbestos Found					

Interior

B00A - R0001 - Home Base Store

Floor Coverings Res/Textile	Brown vinyl sheet 2038/B00A/R0001/Floor Coverings Res/Textile/S5					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under brown vinyl sheet 2038/B00A/R0001/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00A - R0002 - Home Base

Floor Coverings Res/Textile	Brown vinyl sheet 2038/B00A/R0001/Floor Coverings Res/Textile/S5					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under brown vinyl sheet 2038/B00A/R0001/Floor Coverings Res/Textile/S6					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Building Services - 1913 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00B - R0001 - General Storeroom

No Asbestos

B00B - R0002 - Garden Store

No Asbestos

B00B - R0003 - Canteen Covered Area

No Asbestos

B00B - R0004 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Pupil Facilities/Staff Facilities - 1913 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00C/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole ceiling height 2.5m					

Interior**B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00C/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00C/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00C/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Incinerette	Encapsulated Insulation material within unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Material encased.					

B00C - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00C/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot samp'e material encased					

B00C - R0005 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00C/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Staff Facilities - 1913 - Timber (Timber)

Exterior

Pitched Roof - Flat Ceiling Non Accessible Area

- No manhole 4m high ceiling

Underfloor Voids - Packing to Floor Joists Non Accessible Area

- No entry very low headspace.

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2038/B00C/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - Withdrawal Space - 1hb

No Asbestos

B00D - R0004 - Home Base Store

Floor Coverings Res/Textile	Brown vinyl sheet					
2038/B00A/R0001/Floor Coverings Res/Textile/S5						No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under brown vinyl sheet					
2038/B00A/R0001/Floor Coverings Res/Textile/S6						No Asbestos Detected

B00D - R0006 - Home Base

No Asbestos

B00D - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Brown vinyl sheet					
2038/B00A/R0001/Floor Coverings Res/Textile/S5						No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under brown vinyl sheet					
2038/B00A/R0001/Floor Coverings Res/Textile/S6						No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration/Library - 1997 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00E/R0012/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - No sub-floor opening low head space.					
Window Beading	Caulking Material					
	2038/B00A/R0001/Window Beading/S4				No Asbestos Detected	

Interior**B00E - R0001 - Principal**

No Asbestos

B00E - R0002 - Movement

No Asbestos

B00E - R0003 - Clerical Office

No Asbestos

B00E - R0004 - Reading Area

No Asbestos

B00E - R0005 - Special Programs Room

No Asbestos

B00E - R0006 - Staff Kitchen

No Asbestos

B00E - R0007 - Withdrawal Space - 1hb

No Asbestos

B00E - R0008 - Shower/Change

Wall Linings Internal	Flat AC Sheeting					
	2038/B00E/R0008/Wall Linings Internal/S3				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00E/R0012/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00E - R0009 - General Storeroom

No Asbestos

B00E - R0010 - Movement

No Asbestos

B00E - R0011 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	1.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00E/R0012/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00E/R0012/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00E - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00E/R0012/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00FURN - Former Furnace

Exterior

Debris Pile	Flat AC Debris	10m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2038/B00FURN/Exterior/Debris Pile/S8					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00G - R0001 - Communal Space

No Asbestos

B00G - R0002 - General Storeroom

No Asbestos

B00G - R0003 - Practical Activities

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00GA1 - Shed

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
	2038/B00GA1/Exterior/Wall Cladding/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
	2038/B00GA1/Exterior/Wall Cladding/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00GA1 - R0001 - Shed

Wall Linings Internal	Corrugated AC Sheeting	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2038/B00GA1/Exterior/Wall Cladding/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 531 - D11179 - Library : Placement Date - 4/12/2002

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry/classroom

No Asbestos Found.

R2 - Reading Area/workroom

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017