


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Goulburn Public School (2053)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Goulburn Mulwaree

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Jul - 2015

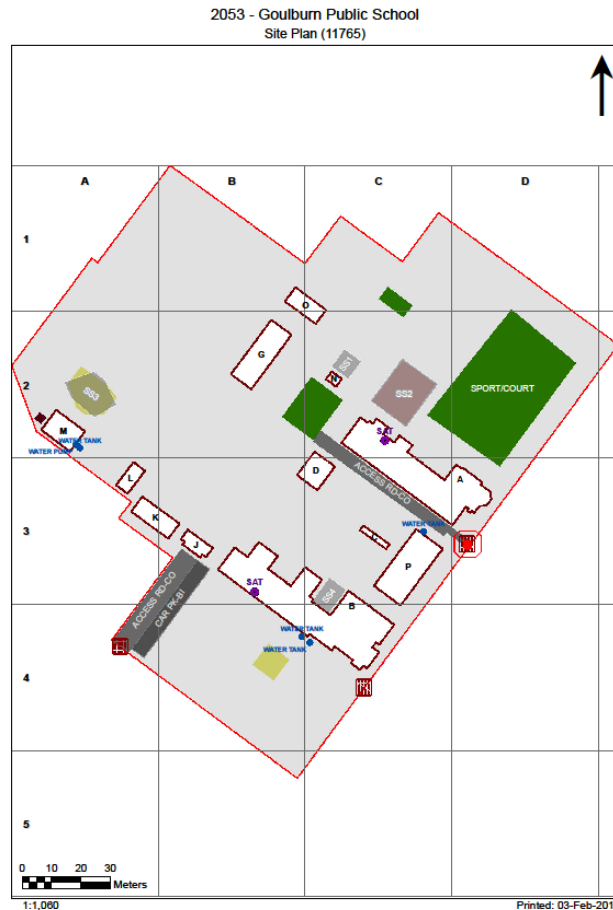

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1897 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Unable to sample due to height						

Interior

B00A - R0004 - Entry Vestibule

No Asbestos

B00A - R0005 - Movement

Wall Linings Internal	Flat AC Sheeting	2m2	East, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0005/Wall Linings Internal/S1					Chrysotile (white asbestos)	

B00A - R0008 - Sick Bay

No Asbestos

B00A - R0009 - Movement

No Asbestos

B00A - R0011 - Sports Store

No Asbestos

B00A - R0012 - Staff Room Annexe

No Asbestos

B00A - R0013 - Cleaning Supplies

No Asbestos

B00A - R0016 - Home Base

No Asbestos

B00A - R0017 - Home Base

No Asbestos

B00A - R0018 - Staff Room

No Asbestos

B00A - R0021 - Movement

No Asbestos

B00A - R0022 - Sports Store

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0022/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00A - R0023 - Museum

No Asbestos

B00A - R0024 - Practical Activities - 1hb

No Asbestos

B00A - R0025 - Movement

No Asbestos

B00A - R0026 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet				
2053/B00A/R0026/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0027 - Principal

No Asbestos

B00A - R0028 - Library Office/Workroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - R0029 - Movement

No Asbestos

B00A - R0031 - Clerical Office/Workroom

No Asbestos

B00A - R0032 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0033/Ceiling Structures/Linings/S7	Chrysotile (white asbestos) , Amosite (brown asbestos)
---	---

Wall Linings Internal	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0035/Wall Linings Internal/S8	Chrysotile (white asbestos) , Amosite (brown asbestos)
--	---

B00A - R0033 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0033/Ceiling Structures/Linings/S7	Chrysotile (white asbestos) , Amosite (brown asbestos)
---	---

Wall Linings Internal	Flat AC Sheeting	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	------	--------------------	---------	--------------------

2053/B00A/R0035/Wall Linings Internal/S8	Chrysotile (white asbestos) , Amosite (brown asbestos)
--	---

Incinerator	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	High Priority (6-8)
-------------	--	-------	-------	----------------------	---------	---------------------

Assumed Asbestos - Redundant. Remove as soon as

B00A - R0034 - Toilet - Lobby

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0033/Ceiling Structures/Linings/S7	Chrysotile (white asbestos) , Amosite (brown asbestos)
---	---

Wall Linings Internal	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0035/Wall Linings Internal/S8	Chrysotile (white asbestos) , Amosite (brown asbestos)
--	---

B00A - R0035 - Toilet - Lobby

Wall Linings Internal	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0035/Wall Linings Internal/S8	Chrysotile (white asbestos) , Amosite (brown asbestos)
--	---

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

2053/B00A/R0033/Ceiling Structures/Linings/S7	Chrysotile (white asbestos) , Amosite (brown asbestos)
---	---

B00A - R0036 - Reading Area

No Asbestos

B00A - R0037 - Reading Area

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1888 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00B - R0001 - Home Base**

No Asbestos

B00B - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0022/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Shower/Change

Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0019/Wall Linings Internal/S3					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0019/Wall Linings Internal/S3					Chrysotile (white asbestos)	

B00B - R0005 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0019/Wall Linings Internal/S3					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0019/Wall Linings Internal/S3					Chrysotile (white asbestos)	

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Music Store

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Movement

Wall Linings Internal	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0019/Wall Linings Internal/S3					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2053/B00A/R0019/Wall Linings Internal/S3					Chrysotile (white asbestos)	

B00B - R0012 - Home Base

No Asbestos

B00B - R0013 - Movement

No Asbestos

B00B - R0014 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0022/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0015 - Staff Room Annexe

No Asbestos

B00B - R0016 - Special Programs Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R0017 - Home Base

No Asbestos

B00B - R0018 - Home Base

No Asbestos

B00B - R0019 - Home Base

No Asbestos

B00B - R0020 - Home Base

No Asbestos

B00B - R0021 - Home Base

No Asbestos

B00B - R0022 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2053/B00A/R0022/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0023 - Home Base

No Asbestos

B00B - R0024 - Special Programs Room

No Asbestos

B00B - R0025 - Home Base

No Asbestos

B00B - R0026 - Staff Room Annexe

No Asbestos

B00B - R0027 - Staff Toilet

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Unable to sample as material is within						

B00B - R0028 - General Storeroom

No Asbestos

B00B - R0029 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1940 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00C - R0001 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1920 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00D - R0001 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet					
	2053/B00A/R0026/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00D - R0002 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1920 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Ceiling void is above 4 metres.					
Underfloor Voids - Slab on Ground	No Asbestos Found					
South-west grounds	AC Fragments/Debris 2053/B00G/South-west grounds/S9					No Asbestos Detected

Interior

B00G - R0001 - Raised Platform

No Asbestos

B00G - R0002 - Communal Space

No Asbestos

B00G - R0003 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1920 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0005/Wall Linings Internal/S1				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - No ceiling void access point.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00J - R0001 - Movement**

No Asbestos

B00J - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0019/Wall Linings Internal/S3				Chrysotile (white asbestos)	

B00J - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0019/Wall Linings Internal/S3				Chrysotile (white asbestos)	

B00J - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0019/Wall Linings Internal/S3				Chrysotile (white asbestos)	

B00J - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1920 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0005/Wall Linings Internal/S1				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - No ceiling void access point.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00K - R0001 - Toilets - Girls

No Asbestos

B00K - R0002 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 1940 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Administration - 1920 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00M/R0001/Wall Linings Internal/S5				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - No ceiling void access point.					
Underfloor Voids	No Asbestos Found					

Interior**B00M - R0001 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	60m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00M/R0001/Wall Linings Internal/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0019/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00M/R0001/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00M - R0002 - Other-After School Care

Ceiling Structures/Linings	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00M/R0001/Wall Linings Internal/S5				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Pupil Facilities - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2053/B00A/R0005/Wall Linings Internal/S1				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00N - R0001 - Drinking Facilities

No Asbestos

B00N - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Other-After School Care - 2009 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B000 - R0001 - Other-After School Care

No Asbestos

B000 - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - External Movement

No Asbestos

B00P - R0002 - Reading Area

No Asbestos

B00P - R0003 - Library Office/Workroom

No Asbestos

B00P - R0004 - Communications Room

No Asbestos

B00P - R0005 - K.L.A. Store

No Asbestos

B00P - R0006 - Staff Toilet

No Asbestos

B00P - R0007 - Movement

No Asbestos

B00P - R0008 - Cleaning Distributed Store

No Asbestos

B00P - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017